YASKAWA

Σ -7-Series AC Servo Drive Σ -7S SERVOPACK with Analog Voltage/Pulse Train References **Product Manual**

Model: SGD7S-DDDD00ADDDDDD

Σ7	

Basic	Information on	
	SFRVOPACKs	

Selecting a	a SERVOPACK
-------------	-------------

SERVOPACK	Inetalletien
SERVUPAUN	mstallation

Wiring	and Connect	ing
Ū	SERVOPAC	

Basic Functions That Require
Setting before Operation

Application	Functions
ADDIICATIOL	LEURGHORS

Trial Operation and	
Actual Operation	

- 11		n	1	n	-
- 11	u	n	1	ш	IU.
	٠.	٠.	٠	•	

lor		

=i ills	/-Closed	Loon	Control
-uii\	/-CIUSEU	LUUU	COLLIO

Safety Functions

	_		
Ma	inter	าลทั้	2

	Panel	Disp	lays	and
Panel	Operato	or Pro	ced	ures

Parameter Lists

Appendices

Copyright © 2014 YASKAWA ELECTRIC CORPORATION
All rights reserved. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form, or by any means, mechanical, electronic, photocopying, recording, or otherwise, without the prior written permission of Yaskawa. No patent liability is assumed with respect to the use of the information contained herein. Moreover, because Yaskawa is constantly striving to improve its high-quality products, the information contained in this manual is subject to change without notice. Every precaution has been taken in the preparation of this manual. Nevertheless, Yaskawa assumes no responsibility for errors or omissions. Neither is any liability assumed for damages resulting from the use of the information contained in this publication.

About this Manual

This manual provides information required to select Σ -7S SERVOPACKs with Analog Voltage/Pulse Train References for Σ -7-Series AC Servo Drives, and to design, perform trial operation of, tune, operate, and maintain the Servo Drives.

Read and understand this manual to ensure correct usage of the Σ -7-Series AC Servo Drives.

Keep this manual in a safe place so that it can be referred to whenever necessary.


Outline of Manual

The contents of the chapters of this manual are described in the following table. Refer to these chapters as required.

Chapter	Chapter Title	Contents
1	Basic Information on SERVOPACKs	Provides information required to select SERVOPACKs, such as SERVOPACK models and combinations with Servomotors.
2	Selecting a SERVOPACK	Provides information required to select SERVOPACKs, such as specifications, block diagrams, dimensional drawings, and connection examples.
3	SERVOPACK Installation	Provides information on installing SERVOPACKs in the required locations.
4	Wiring and Connecting SERVOPACKs	Provides information on wiring and connecting SERVOPACKs to power supplies and peripheral devices.
5	Basic Functions That Require Setting before Operation	Describes the basic functions that must be set before you start servo system operation. It also describes the setting methods.
6	Application Functions	Describes the application functions that you can set before you start servo system operation. It also describes the setting methods.
7	Trial Operation and Actual Operation	Provides information on the flow and procedures for trial operation and convenient functions to use during trial operation.
8	Tuning	Provides information on the flow of tuning, details on tuning functions, and related operating procedures.
9	Monitoring	Provides information on monitoring SERVOPACK product information and SERVOPACK status.
10	Fully-Closed Loop Control	Provides detailed information on performing fully-closed loop control with the SERVOPACK.
11	Safety Functions	Provides detailed information on the safety functions of the SERVO-PACK.
12	Maintenance	Provides information on the meaning of, causes of, and corrections for alarms and warnings.
13	Panel Displays and Panel Operator Procedures	Describes how to interpret panel displays and the operation of the Panel Operator.
14	Parameter Lists	Provides information on the parameters.
15	Appendices	Provides host controller connection examples and tables of corresponding SERVOPACK and SigmaWin+ function names.

Related Documents

The relationships between the documents that are related to the Servo Drives are shown in the following figure. The numbers in the figure correspond to the numbers in the table on the following pages. Refer to these documents as required.

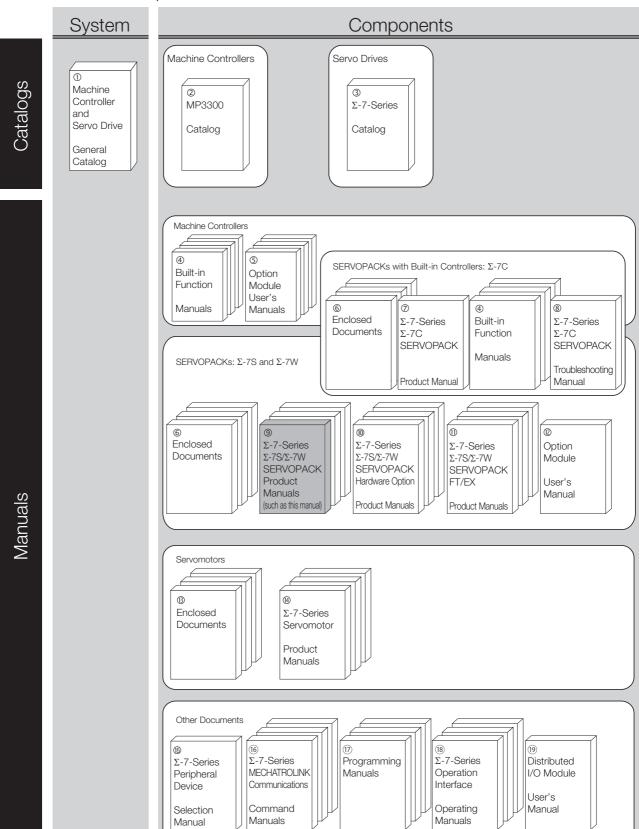

Classification	Document Name	Document No.	Description
Machine Controller and Servo Drive General Catalog	Machine Controller and AC Servo Drive Solutions Catalog	KAEP S800001 22	Describes the features and application examples for combinations of MP3000-Series Machine Controllers and Σ-7-Series AC Servo Drives.
② MP3300 Catalog	Machine Controller MP3300	KAEP C880725 03	Provides detailed information on MP3300 Machine Controllers, including features and specifications.
③ Σ-7-Series Catalog	AC Servo Drives Σ-7 Series	KAEP S800001 23	Provides detailed information on Σ -7-Series AC Servo Drives, including features and specifications.
④ Built-in Function Manuals	Σ-7-Series AC Servo Drive Σ-7C SERVOPACK Motion Control User's Manual	SIEP S800002 03	Provides detailed information on the specifications, system configuration, and application methods of the Motion Control Function Modules (SVD, SVC4, and SVR4) for Σ -7-Series Σ -7C SERVOPACKs.
	Machine Controller MP3000 Series Communications User's Manual	SIEP C880725 12	Provides detailed information on the specifications, system configuration, and communications connection methods for the Ethernet communications that are used with MP3000-Series Machine Controllers and Σ -7-Series Σ -7C SERVO-PACKs.
© Option Module User's Manuals	Machine Controller MP2000 Series Communication Module User's Manual	SIEP C880700 04	Provide detailed information on the specifications and communications methods for the Communications Modules that can be mounted to MP3000-Series Machine Controllers and Σ-7-
	Machine Controller MP2000 Series 262IF-01 FL-net Communication Module User's Manual	SIEP C880700 36	
	Machine Controller MP2000 Series 263IF-01 EtherNet/IP Communication Module User's Manual	SIEP C880700 39	Series Σ-7C SERVOPACKs.
	Machine Controller MP2000 Series I/O Module User's Manual	SIEP C880700 34	
	Machine Controller MP2000 Series Analog Input/Analog Output Module Al-01/AO-01 User's Manual	SIEP C880700 26	Provide detailed information on the specifications and communications methods for the I/O Modules that can be mounted to MP3000-Series Machine Controllers and Σ-7-Series Σ-7C SERVOPACKs.
	Machine Controller MP2000 Series Counter Module CNTR-01 User's Manual	SIEP C880700 27	7-Series 2-70 SERVUPACKS.

Continued from previous page.

Classification	Document Name	Document No.	Description
Ciassification		Document No.	Description
© Enclosed Documents	Σ-7-Series AC Servo Drive Σ-7S, Σ-7W, and Σ-7C SERVO- PACK Safety Precautions	TOMP C710828 00	Provides detailed information for the safe usage of Σ -7-Series SERVOPACKs.
	Σ-V-Series/Σ-V-Series for Large-Capacity Models/ Σ-7-Series Safety Precautions Option Module	TOBP C720829 00	Provides detailed information for the safe usage of Option Modules.
	Σ-V-Series/Σ-V-Series for Large-Capacity Models/ Σ-7-Series Installation Guide Command Option Module	TOBP C720829 01	Provides detailed procedures for installing the Command Option Module in a SERVOPACK.
	Σ-V-Series/Σ-V-Series for Large-Capacity Models/ Σ-7-Series Installation Guide Fully-closed Module	TOBP C720829 03	Provides detailed procedures for installing the Fully-closed Module in a SERVOPACK.
	Σ-V-Series/Σ-V-Series for Large-Capacity Models/ Σ-7-Series Installation Guide Safety Module	TOBP C720829 06	Provides detailed procedures for installing the Safety Module in a SERVOPACK.
	Σ-V-Series/Σ-V-Series for Large-Capacity Models/ Σ-7-Series Installation Guide INDEXER Module	TOBP C720829 02	Provides detailed procedures for installing the INDEXER Module in a SERVOPACK.
	Σ-V-Series/Σ-V-Series for Large-Capacity Models/ Σ-7-Series Installation Guide DeviceNet Module	TOBP C720829 07	Provides detailed procedures for installing the DeviceNet Module in a SERVOPACK.
⑦ Σ-7-Series Σ-7C SERVOPACK Product Manual	Σ-7-Series AC Servo Drive Σ-7C SERVOPACK Product Manual	SIEP S800002 04	Provides detailed information on selecting Σ -7-Series Σ -7C SERVO-PACKs; installing, connecting, setting, testing in trial operation, and tuning Servo Drives; writing, monitoring, and maintaining programs; and other information.
8Σ-7-SeriesΣ-7C SERVOPACKTroubleshootingManual	Σ-7-Series AC Servo Drive Σ-7C SERVOPACK Troubleshooting Manual	SIEP S800002 07	Provides detailed troubleshooting information for Σ -7-Series Σ -7C SERVOPACKs.

Continued from previous page.

Classification	Document Name	Document No.	Description
Σ-7-Series Σ-7S/Σ-7W SERVOPACK Product Manuals	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with MECHATROLINK-4 Communications References Product Manual	SIEP S800002 31	
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with MECHATROLINK-III Communications References Product Manual	SIEP S800001 28	
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with MECHATROLINK-II Communications References Product Manual	SIEP S800001 27	Provide detailed information on selecting Σ -7-Series Σ -7S and Σ -7W SERVOPACKs; installing, connecting, setting, testing in trial operation, tuning, monitoring, and maintaining Servo Drives; and other information.
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with Analog Voltage/Pulse Train References Product Manual	This manual (SIEP S800001 26)	
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK Command Option Attachable Type with INDEXER Module Product Manual	SIEP S800001 64	
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK Command Option Attachable Type with DeviceNet Module Product Manual	SIEP S800001 70	
	Σ-7-Series AC Servo Drive Σ-7W SERVOPACK with MECHATROLINK-III Communications References Product Manual	SIEP S800001 29	
 Φ Σ-7-Series Σ-7S/Σ-7W SERVOPACK with Hardware Option Specifications Product Manuals 	Σ-7-Series AC Servo Drive Σ-7S/Σ-7W SERVOPACK with Hardware Option Specifica- tions Dynamic Brake Product Manual	SIEP S800001 73	Provide detailed information on
	Σ-7-Series AC Servo Drive Σ-7W/Σ-7C SERVOPACK with Hardware Option Specifica- tions HWBB Function Product Manual	SIEP S800001 72	Hardware Options for Σ -7-Series SERVOPACKs.

Continued from previous page

			Continued from previous page.
Classification	Document Name	Document No.	Description
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with FT/EX Specification for Index- ing Application Product Manual	SIEP S800001 84	
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with FT/EX Specification for Track- ing Application Product Manual	SIEP S800001 89	
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with FT/EX Specification for Application with Special Motor, SGM7D Motor Product Manual	SIEP S800001 91	
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with FT/EX Specification for Press and Injection Molding Application Product Manual	SIEP S800001 94	
[®] Σ-7-Series Σ-7S/Σ-7W SERVOPACK FT/EX Product Manuals	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with FT/EX Specification for Transfer and Alignment Application Product Manual	SIEP S800001 95	Provide detailed information on the FT/EX Option for Σ-7-Series SERVOPACKs.
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with FT/EX Specification for Torque/Force Assistance for Conveyance Application Product Manual	SIEP S800002 09	
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with FT/EX Specification for Cutting Application Feed Shaft Motor Product Manual	SIEP S800002 10	
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with FT/EX Specification for Three-Point Latching for Conveyance Application Product Manual	SIEP S800002 17	
	Σ-7-Series AC Servo Drive Σ-7S SERVOPACK with FT/EX Specification for Semi-/Fully-Closed Loop Control Online Switching for Conveyance Application Product Manual	SIEP S800002 27	
	Σ-7-Series AC Servo Drive Σ-7W SERVOPACK with FT/EX Specification for Gantry Applications Product Manual	SIEP S800002 29	Continued on next page

Continued from previous page.

Classification	Document Name	Document No.	Description
Classification	AC Servo Drives	Doddinon: No.	Beschption
® Option Module User's Manual	Σ-V Series/Σ-V Series for Large-Capacity Models/ Σ-7 Series User's Manual Safety Module	SIEP C720829 06	Provides detailed information required for the design and maintenance of a Safety Module.
(3)	AC Servo Drive Rotary Servomotor Safety Precautions	TOBP C230260 00	Provides detailed information for the safe usage of Rotary Servomotors and Direct Drive Servomotors.
Enclosed Documents	AC Servomotor Linear Σ Series Safety Precautions	TOBP C230800 00	Provides detailed information for the safe usage of Linear Servomotors.
	Σ-7-Series AC Servo Drive Rotary Servomotor Product Manual	SIEP S800001 36	
® Σ-7-Series Servomotor Product Manuals	Σ-7-Series AC Servo Drive Linear Servomotor Product Manual	SIEP S800001 37	Provide detailed information on selecting, installing, and connecting the Σ -7-Series Servomotors.
Floudet Manuals	Σ-7-Series AC Servo Drive Direct Drive Servomotor Product Manual	SIEP S800001 38	
® Σ-7-Series Peripheral Device Selection Manual	Σ-7-Series AC Servo Drive Peripheral Device Selection Manual	SIEP S800001 32	 Provides the following information in detail for Σ-7-Series Servo Systems. Cables: Models, dimensions, wiring materials, connector models, and connection specifications Peripheral devices: Models, specifications, diagrams, and selection (calculation) methods
® Σ-7-Series MECHATROLINK Communications Command Manuals	Σ-7-Series AC Servo Drive MECHATROLINK-II Communications Command Manual	SIEP S800001 30	Provides detailed information on the MECHATROLINK-II communications commands that are used for a Σ -7-Series Servo System.
	Σ-7-Series AC Servo Drive MECHATROLINK-III Communications Standard Servo Profile Command Manual	SIEP S800001 31	Provides detailed information on the MECHATROLINK-III communications standard servo profile commands that are used for a Σ-7-Series Servo System.
	Σ-7-Series AC Servo Drive MECHATROLINK-4 Communications Standard Servo Profile Command Manual	SIEP S800002 32	Provides detailed information on the MECHATROLINK-4 communications standard servo profile commands that are used for a Σ -7- Series Servo System.
ரி Programming Manuals	Machine Controller MP3000 Series Ladder Programming Manual	SIEP C880725 13	Provides detailed information on the ladder programming specifications and instructions for MP3000-Series Machine Controllers and Σ -7-Series Σ -7C SERVOPACKs.
	Machine Controller MP3000 Series Motion Programming Manual	SIEP C880725 14	Provides detailed information on the motion programming and sequence programming specifications and instructions for MP3000-Series Machine Controllers and Σ-7-Series Σ-7C SERVOPACKs.

Continued from previous page.

Classification	Document Name	Document No.	Description
[®] Σ-7-Series Operation Interface Operating Manuals	System Integrated Engineering Tool MPE720 Version 7 USER'S MANUAL	SIEP C880761 03	Describes in detail how to operate MPE720 version 7.
	Σ-7-Series AC Servo Drive Digital Operator Operating Manual	SIEP S800001 33	Describes the operating procedures for a Digital Operator for a Σ-7-Series Servo System.
	AC Servo Drive Engineering Tool SigmaWin+ Operation Manual	SIET S800001 34	Provides detailed operating procedures for the SigmaWin+ Engineering Tool for a Σ-7-Series Servo System.
① Distributed I/O Module User's Manual	MECHATROLINK-III Compatible I/O Module User's Manual	SIEP C880781 04	Describes the functions, specifications, operating methods, and MECHATROLINK-III communications for the Remote I/O Modules for MP2000/MP3000-Series Machine Controllers.
	MECHATROLINK-4 Compatible I/O Module User's Manual	SIEP C880782 01	Describes the functions, specifications, operating methods, and MECHATROLINK-4 communications for the Remote I/O Modules for MP3000-Series Machine Controllers.

Using This Manual

◆ Technical Terms Used in This Manual

The following terms are used in this manual.

Term	Meaning	
Servomotor	A Σ-7-Series Rotary Servomotor, Direct Drive Servomotor, or Linear Servomotor.	
Rotary Servomotor	A generic term used for a Σ -7-Series Rotary Servomotor (SGM7M, SGM7J, SGM7A, SGM7P, SGM7G, or SGMMV) or a Direct Drive Servomotor (SGM7E, SGM7F, SGMCV, or SGMCS). The descriptions will specify when Direct Drive Servomotors are excluded.	
Linear Servomotor	A generic term used for a Σ -7-Series Linear Servomotor (SGLG, SGLF, or SGLT).	
SERVOPACK	A Σ -7-Series Σ -7S Servo Amplifier with Analog Voltage/Pulse Train References.	
Servo Drive	The combination of a Servomotor and SERVOPACK.	
Servo System	A servo control system that includes the combination of a Servo Drive with a host controller and peripheral devices.	
servo ON	Supplying power to the motor.	
servo OFF	Not supplying power to the motor.	
base block (BB)	Shutting OFF the power supply to the motor by shutting OFF the base current to the power transistor in the SERVOPACK.	
servo lock	A state in which the motor is stopped and is in a position loop with a position reference of 0.	
Main Circuit Cable	One of the cables that connect to the main circuit terminals, including the Main Circuit Power Supply Cable, Control Power Supply Cable, and Servomotor Main Circuit Cable.	
SigmaWin+	The Engineering Tool for setting up and tuning Servo Drives or a computer in which the Engineering Tool is installed.	

◆ Differences in Terms for Rotary Servomotors and Linear Servomotors

There are differences in the terms that are used for Rotary Servomotors and Linear Servomotors. This manual primarily describes Rotary Servomotors. If you are using a Linear Servomotor, you need to interpret the terms as given in the following table.

Rotary Servomotors	Linear Servomotors
torque	force
moment of inertia	mass
rotation	movement
forward rotation and reverse rotation	forward movement and reverse movement
CW and CCW pulse trains	forward and reverse pulse trains
rotary encoder	linear encoder
absolute rotary encoder	absolute linear encoder
incremental rotary encoder	incremental linear encoder
unit: min ⁻¹	unit: mm/s
unit: N·m	unit: N

Notation Used in this Manual

■ Notation for Reverse Signals

The names of reverse signals (i.e., ones that are valid when low) are written with a forward slash (/) before the signal abbreviation.


Notation Example

BK is written as /BK.

■ Notation for Parameters


The notation depends on whether the parameter requires a numeric setting (parameter for numeric setting) or requires the selection of a function (parameter for selecting functions).

· Parameters for Numeric Settings

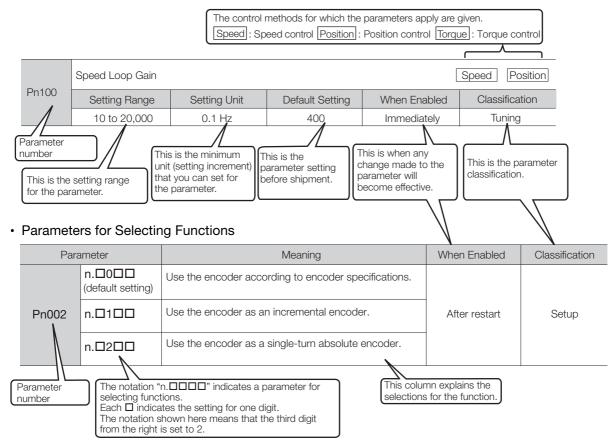

Notation Example

Notation Examples for Pn002

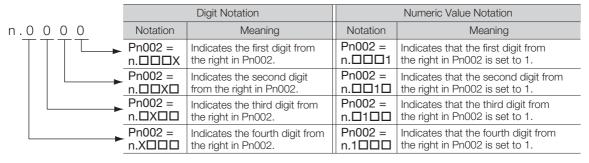

◆ Engineering Tools Used in This Manual

This manual uses the interfaces of the SigmaWin+ for descriptions.

♦ Trademarks

- QR code is a trademark of Denso Wave Inc.
- Other product names and company names are the trademarks or registered trademarks of the respective company. "TM" and the ® mark do not appear with product or company names in this manual.

◆ Visual Aids

The following aids are used to indicate certain types of information for easier reference.



Indicates precautions or restrictions that must be observed.

Also indicates alarm displays and other precautions that will not result in machine damage.



Indicates definitions of difficult terms or terms that have not been previously explained in this manual.

Example Indicates operating or setting examples.

Information Indicates supplemental information to deepen understanding or useful information.

Safety Precautions

Safety Information

To prevent personal injury and equipment damage in advance, the following signal words are used to indicate safety precautions in this document. The signal words are used to classify the hazards and the degree of damage or injury that may occur if a product is used incorrectly. Information marked as shown below is important for safety. Always read this information and heed the precautions that are provided.

DANGER

• Indicates precautions that, if not heeded, are likely to result in loss of life, serious injury, or fire.

WARNING

• Indicates precautions that, if not heeded, could result in loss of life, serious injury, or fire.

M CAUTION

 Indicates precautions that, if not heeded, could result in relatively serious or minor injury, or in fire.

NOTICE

• Indicates precautions that, if not heeded, could result in property damage.

Safety Precautions That Must Always Be Observed

General Precautions

DANGER

- Read and understand this manual to ensure the safe usage of the product.
- Keep this manual in a safe, convenient place so that it can be referred to whenever necessary.
 Make sure that it is delivered to the final user of the product.
- Do not remove covers, cables, connectors, or optional devices while power is being supplied to the SERVOPACK.

There is a risk of electric shock, operational failure of the product, or burning.

MARNING

- Use a power supply with specifications (number of phases, voltage, frequency, and AC/DC type) that are appropriate for the product.
 There is a risk of burning, electric shock, or fire.
- Connect the ground terminals on the SERVOPACK and Servomotor to ground poles according to local electrical codes (100 Ω or less for a SERVOPACK with a 100-VAC or 200-VAC power supply, and 10 Ω or less for a SERVOPACK with a 400-VAC power supply). There is a risk of electric shock or fire.
- Do not attempt to disassemble, repair, or modify the product.
 There is a risk of fire or failure.
 The warranty is void for the product if you disassemble, repair, or modify it.

CAUTION

- The SERVOPACK heat sinks, regenerative resistors, External Dynamic Brake Resistors, Servomotors, and other components can be very hot while power is ON or soon after the power is turned OFF. Implement safety measures, such as installing covers, so that hands and parts such as cables do not come into contact with hot components.
 There is a risk of burn injury.
- For a 24-VDC power supply, use a power supply device with double insulation or reinforced insulation.

There is a risk of electric shock.

- Do not damage, pull on, apply excessive force to, place heavy objects on, or pinch cables. There is a risk of failure, damage, or electric shock.
- The person who designs the system that uses the hard wire base block safety function must have a complete knowledge of the related safety standards and a complete understanding of the instructions in this document.

There is a risk of injury, product damage, or machine damage.

 Do not use the product in an environment that is subject to water, corrosive gases, or flammable gases, or near flammable materials.

There is a risk of electric shock or fire.

- Do not attempt to use a SERVOPACK or Servomotor that is damaged or that has missing parts.
- Install external emergency stop circuits that shut OFF the power supply and stops operation immediately when an error occurs.
- In locations with poor power supply conditions, install the necessary protective devices (such as AC reactors) to ensure that the input power is supplied within the specified voltage range.
 There is a risk of damage to the SERVOPACK.
- Use a Noise Filter to minimize the effects of electromagnetic interference.

 Electronic devices used near the SERVOPACK may be affected by electromagnetic interference.
- Always use a Servomotor and SERVOPACK in one of the specified combinations.
- Do not touch a SERVOPACK or Servomotor with wet hands.
 There is a risk of product failure.

■ Storage Precautions

⚠ CAUTION

 Do not place an excessive load on the product during storage. (Follow all instructions on the packages.)

There is a risk of injury or damage.

NOTICE

- Do not install or store the product in any of the following locations.
 - Locations that are subject to direct sunlight
 - Locations that are subject to ambient temperatures that exceed product specifications
 - Locations that are subject to relative humidities that exceed product specifications
 - · Locations that are subject to condensation as the result of extreme changes in temperature
 - Locations that are subject to corrosive or flammable gases
 - · Locations that are near flammable materials
 - · Locations that are subject to dust, salts, or iron powder
 - Locations that are subject to water, oil, or chemicals
 - · Locations that are subject to vibration or shock that exceeds product specifications
 - · Locations that are subject to radiation

If you store or install the product in any of the above locations, the product may fail or be damaged.

■ Transportation Precautions

A CAUTION

- Transport the product in a way that is suitable to the mass of the product.
- Do not use the eyebolts on a SERVOPACK or Servomotor to move the machine. There is a risk of damage or injury.
- When you handle a SERVOPACK or Servomotor, be careful of sharp parts, such as the corners. There is a risk of injury.
- Do not place an excessive load on the product during transportation. (Follow all instructions on the packages.)

There is a risk of injury or damage.

- Do not hold onto the front cover or connectors when you move a SERVOPACK.
 There is a risk of the SERVOPACK falling.
- A SERVOPACK or Servomotor is a precision device. Do not drop it or subject it to strong shock. There is a risk of failure or damage.
- Do not subject connectors to shock.

 There is a risk of faulty connections or damage.
- If disinfectants or insecticides must be used to treat packing materials such as wooden frames, plywood, or pallets, the packing materials must be treated before the product is packaged, and methods other than fumigation must be used.

Example: Heat treatment, where materials are kiln-dried to a core temperature of 56°C for 30 minutes or more.

If the electronic products, which include stand-alone products and products installed in machines, are packed with fumigated wooden materials, the electrical components may be greatly damaged by the gases or fumes resulting from the fumigation process. In particular, disinfectants containing halogen, which includes chlorine, fluorine, bromine, or iodine can contribute to the erosion of the capacitors.

Do not overtighten the eyebolts on a SERVOPACK or Servomotor.
 If you use a tool to overtighten the eyebolts, the tapped holes may be damaged.

■ Installation Precautions

CAUTION

- Install the Servomotor or SERVOPACK in a way that will support the mass given in technical documents.
- Install SERVOPACKs, Servomotors, regenerative resistors, and External Dynamic Brake Resistors on nonflammable materials.

Installation directly onto or near flammable materials may result in fire.

 Provide the specified clearances between the SERVOPACK and the control panel as well as with other devices.

There is a risk of fire or failure.

- Install the SERVOPACK in the specified orientation. There is a risk of fire or failure.
- Do not step on or place a heavy object on the product. There is a risk of failure, damage, or injury.
- Do not allow any foreign matter to enter the SERVOPACK or Servomotor.
 There is a risk of failure or fire.

- Do not install or store the product in any of the following locations.
 - · Locations that are subject to direct sunlight
 - · Locations that are subject to ambient temperatures that exceed product specifications
 - · Locations that are subject to relative humidities that exceed product specifications
 - · Locations that are subject to condensation as the result of extreme changes in temperature
 - Locations that are subject to corrosive or flammable gases
 - · Locations that are near flammable materials
 - · Locations that are subject to dust, salts, or iron powder
 - · Locations that are subject to water, oil, or chemicals
 - · Locations that are subject to vibration or shock that exceeds product specifications
 - · Locations that are subject to radiation

If you store or install the product in any of the above locations, the product may fail or be damaged.

- Use the product in an environment that is appropriate for the product specifications. If you use the product in an environment that exceeds product specifications, the product may fail or be damaged.
- A SERVOPACK or Servomotor is a precision device. Do not drop it or subject it to strong shock.
 There is a risk of failure or damage.
- Always install a SERVOPACK in a control panel.
- Do not allow any foreign matter to enter a SERVOPACK or a Servomotor with a Cooling Fan and do not cover the outlet from the Servomotor's cooling fan.
 There is a risk of failure.

Wiring Precautions

A DANGER

• Do not change any wiring while power is being supplied. There is a risk of electric shock or injury.

WARNING

- Wiring and inspections must be performed only by qualified engineers. There is a risk of electric shock or product failure.
- Check all wiring and power supplies carefully.

 Incorrect wiring or incorrect voltage application to the output circuits may cause short-circuit failures. If a short-circuit failure occurs as a result of any of these causes, the holding brake will not work. This could damage the machine or cause an accident that may result in death or injury.
- Connect the AC and DC power supplies to the specified SERVOPACK terminals.
 - Connect an AC power supply to the L1, L2, and L3 terminals and the L1C and L2C terminals on the SERVOPACK.
 - Connect a DC power supply to the B1/⊕ and ⊕2 terminals and the L1C and L2C terminals on the SERVOPACK.

There is a risk of failure or fire.

 If you use a SERVOPACK with the Dynamic Brake Hardware Option, connect an External Dynamic Brake Resistor that is suitable for the machine and equipment specifications to the specified terminals.

There is a risk of unexpected operation, machine damage, burning, or injury when an emergency stop is performed.

CAUTION

Wait for at least six minutes after turning OFF the power supply (with a SERVOPACK for a 100-VAC power supply input, wait for at least nine minutes) and then make sure that the CHARGE indicator is not lit before starting wiring or inspection work. Do not touch the power supply terminals while the CHARGE lamp is lit because high voltage may still remain in the SERVOPACK even after turning OFF the power supply.

There is a risk of electric shock.

 Observe the precautions and instructions for wiring and trial operation precisely as described in this document.

Failures caused by incorrect wiring or incorrect voltage application in the brake circuit may cause the SERVOPACK to fail, damage the equipment, or cause an accident resulting in death or injury.

- Check the wiring to be sure it has been performed correctly.
 Connectors and pin layouts are sometimes different for different models. Always confirm the pin layouts in technical documents for your model before operation.
 There is a risk of failure or malfunction.
- Connect wires to power supply terminals and motor connection terminals securely with the specified methods and tightening torque.
 Insufficient tightening may cause wires and terminal blocks to generate heat due to faulty contact, possibly resulting in fire.
- Use shielded twisted-pair cables or screened unshielded multi-twisted-pair cables for I/O Signal Cables and Encoder Cables.
- The maximum wiring length is 3 m for I/O Signal Cables, and 50 m for Encoder Cables or Servomotor Main Circuit Cables.
- Observe the following precautions when wiring the SERVOPACK's main circuit terminals.
 - Turn ON the power supply to the SERVOPACK only after all wiring, including the main circuit terminals, has been completed.
 - If a connector is used for the main circuit terminals, remove the main circuit connector from the SERVOPACK before you wire it.
 - Insert only one wire per insertion hole in the main circuit terminals.
 - When you insert a wire, make sure that the conductor wire (e.g., whiskers) does not come into contact with adjacent wires and cause a short-circuit.
- Install molded-case circuit breakers and other safety measures to provide protection against short circuits in external wiring.

There is a risk of fire or failure.

NOTICE

- Whenever possible, use the Cables specified by Yaskawa. If you use any other cables, confirm the rated current and application environment of your model and use the wiring materials specified by Yaskawa or equivalent materials.
- Securely tighten connector screws and lock mechanisms.
 Insufficient tightening may result in connectors falling off during operation.
- Do not bundle power lines (e.g., the Main Circuit Cable) and low-current lines (e.g., the I/O Signal Cables or Encoder Cables) together or run them through the same duct. If you do not place power lines and low-current lines in separate ducts, separate them by at least 30 cm.
 If the cables are too close to each other, malfunctions may occur due to noise affecting the low-current lines.
- Install a battery at either the host controller or on the Encoder Cable.

 If you install batteries both at the host controller and on the Encoder Cable at the same time, you will create a loop circuit between the batteries, resulting in a risk of damage or burning.
- When connecting a battery, connect the polarity correctly. There is a risk of battery rupture or encoder failure.

Operation Precautions

WARNING

- Before starting operation with a machine connected, change the settings of the switches and parameters to match the machine.
 - Unexpected machine operation, failure, or personal injury may occur if operation is started before appropriate settings are made.
- Do not radically change the settings of the parameters.

 There is a risk of unstable operation, machine damage, or injury.
- Install limit switches or stoppers at the ends of the moving parts of the machine to prevent unexpected accidents.

There is a risk of machine damage or injury.

- For trial operation, securely mount the Servomotor and disconnect it from the machine. There is a risk of injury.
- Forcing the motor to stop for overtravel is disabled when the Jog, Origin Search, or Easy FFT utility function is executed. Take necessary precautions.

 There is a risk of machine damage or injury.
- When an alarm occurs, the Servomotor will coast to a stop or stop with the dynamic brake
 according to the SERVOPACK Option and settings. The coasting distance will change with the
 moment of inertia of the load and the resistance of the External Dynamic Brake Resistor. Check
 the coasting distance during trial operation and implement suitable safety measures on the
 machine.
- Do not enter the machine's range of motion during operation. There is a risk of injury.
- Do not touch the moving parts of the Servomotor or machine during operation.
 There is a risk of injury.

CAUTION

- Design the system to ensure safety even when problems, such as broken signal lines, occur.
 For example, the P-OT and N-OT signals are set in the default settings to operate on the safe side if a signal line breaks. Do not change the polarity of this type of signal.
- When overtravel occurs, the power supply to the motor is turned OFF and the brake is released.
 If you use the Servomotor to drive a vertical load, set the Servomotor to enter a zero-clamped state after the Servomotor stops. Also, install safety devices (such as an external brake or counterweight) to prevent the moving parts of the machine from falling.
- Always turn OFF the servo before you turn OFF the power supply. If you turn OFF the main circuit power supply or control power supply during operation before you turn OFF the servo, the Servomotor will stop as follows:
 - If you turn OFF the main circuit power supply during operation without turning OFF the servo, the Servomotor will stop abruptly with the dynamic brake.
 - If you turn OFF the control power supply without turning OFF the servo, the stopping method that is used by the Servomotor depends on the model of the SERVOPACK. For details, refer to the manual for the SERVOPACK.
 - If you use a SERVOPACK with the Dynamic Brake Hardware Option, the Servomotor stopping methods will be different from the stopping methods used without the Option or with other Hardware Options. For details, refer to the following manual.
 - Σ -7-Series Σ -7S/ Σ -7W SERVOPACK with Dynamic Brake Hardware Option Specifications Product Manual (Manual No.: SIEP S800001 73)
- Do not use the dynamic brake for any application other than an emergency stop. There is a risk of failure due to rapid deterioration of elements in the SERVOPACK and the risk of unexpected operation, machine damage, burning, or injury.

- When you adjust the gain during system commissioning, use a measuring instrument to monitor the torque waveform and speed waveform and confirm that there is no vibration.
 If a high gain causes vibration, the Servomotor will be damaged quickly.
- Do not frequently turn the power supply ON and OFF. After you have started actual operation, allow at least one hour between turning the power supply ON and OFF (as a guideline).
 Do not use the product in applications that require the power supply to be turned ON and OFF frequently.

The elements in the SERVOPACK will deteriorate quickly.

- An alarm or warning may occur if communications are performed with the host controller while the SigmaWin+ or Digital Operator is operating.
 - If an alarm or warning occurs, it may interrupt the current process and stop the system.
- After you complete trial operation of the machine and facilities, use the SigmaWin+ to back up
 the settings of the SERVOPACK parameters. You can use them to reset the parameters after
 SERVOPACK replacement.

If you do not copy backed up parameter settings, normal operation may not be possible after a faulty SERVOPACK is replaced, possibly resulting in machine or equipment damage.

■ Maintenance and Inspection Precautions

A DANGER

Do not change any wiring while power is being supplied.
 There is a risk of electric shock or injury.

MARNING

• Wiring and inspections must be performed only by qualified engineers. There is a risk of electric shock or product failure.

M CAUTION

- Wait for at least six minutes after turning OFF the power supply (with a SERVOPACK for a 100-VAC power supply input, wait for at least nine minutes) and then make sure that the CHARGE indicator is not lit before starting wiring or inspection work. Do not touch the power supply terminals while the CHARGE lamp is lit because high voltage may still remain in the SERVOPACK even after turning OFF the power supply.
 There is a risk of electric shock.
- Before you replace a SERVOPACK, back up the settings of the SERVOPACK parameters. Copy
 the backed up parameter settings to the new SERVOPACK and confirm that they were copied
 correctly.

If you do not copy backed up parameter settings or if the copy operation is not completed correctly, normal operation may not be possible, possibly resulting in machine or equipment damage.

NOTICE

 Discharge all static electricity from your body before you operate any of the buttons or switches inside the front cover of the SERVOPACK.
 There is a risk of equipment damage.

■ Troubleshooting Precautions

A DANGER

If the safety device (molded-case circuit breaker or fuse) installed in the power supply line operates, remove the cause before you supply power to the SERVOPACK again. If necessary, repair or replace the SERVOPACK, check the wiring, and remove the factor that caused the safety device to operate.

There is a risk of fire, electric shock, or injury.

MARNING

The product may suddenly start to operate when the power supply is recovered after a momentary power interruption. Design the machine to ensure human safety when operation restarts.
 There is a risk of injury.

CAUTION

- When an alarm occurs, remove the cause of the alarm and ensure safety. Then reset the alarm or turn the power supply OFF and ON again to restart operation.
 There is a risk of injury or machine damage.
- If the Servo ON signal is input to the SERVOPACK and an alarm is reset, the Servomotor may suddenly restart operation. Confirm that the servo is OFF and ensure safety before you reset an alarm

There is a risk of injury or machine damage.

- Always insert a magnetic contactor in the line between the main circuit power supply and the
 main circuit power supply terminals on the SERVOPACK so that the power supply can be shut
 OFF at the main circuit power supply.
 - If a magnetic contactor is not connected when the SERVOPACK fails, a large current may flow continuously, possibly resulting in fire.
- If an alarm occurs, shut OFF the main circuit power supply.
 There is a risk of fire due to a regenerative resistor overheating as the result of regenerative transistor failure.
- Install a ground fault detector against overloads and short-circuiting or install a molded-case circuit breaker combined with a ground fault detector.
 There is a risk of SERVOPACK failure or fire if a ground fault occurs.
- The holding brake on a Servomotor will not ensure safety if there is the possibility that an external force (including gravity) may move the current position and create a hazardous situation when power is interrupted or an error occurs. If an external force may cause movement, install an external braking mechanism that ensures safety.

■ Disposal Precautions

 Correctly discard the product as stipulated by regional, local, and municipal laws and regulations. Be sure to include these contents in all labelling and warning notifications on the final product as necessary.



■ General Precautions

- Figures provided in this manual are typical examples or conceptual representations. There may be differences between them and actual wiring, circuits, and products.
- The products shown in illustrations in this manual are sometimes shown with their covers or
 protective guards removed to illustrate detail. Always replace all covers and protective guards
 before you use the product.
- If you need a new copy of this manual because it has been lost or damaged, contact your nearest Yaskawa representative or one of the offices listed on the back of this manual.
- This manual is subject to change without notice for product improvements, specifications changes, and improvements to the manual itself.
 We will update the manual number of the manual and issue revisions when changes are made.
- Any and all quality guarantees provided by Yaskawa are null and void if the customer modifies
 the product in any way. Yaskawa disavows any responsibility for damages or losses that are
 caused by modified products.

Warranty

Details of Warranty

■ Warranty Period

The warranty period for a product that was purchased (hereinafter called the "delivered product") is one year from the time of delivery to the location specified by the customer or 18 months from the time of shipment from the Yaskawa factory, whichever is sooner.

■ Warranty Scope

Yaskawa shall replace or repair a defective product free of charge if a defect attributable to Yaskawa occurs during the above warranty period.

This warranty does not cover defects caused by the delivered product reaching the end of its service life and replacement of parts that require replacement or that have a limited service life.

This warranty does not cover failures that result from any of the following causes.

- Improper handling, abuse, or use in unsuitable conditions or in environments not described in product catalogs or manuals, or in any separately agreed-upon specifications
- · Causes not attributable to the delivered product itself
- Modifications or repairs not performed by Yaskawa
- Use of the delivered product in a manner in which it was not originally intended
- Causes that were not foreseeable with the scientific and technological understanding at the time of shipment from Yaskawa
- · Events for which Yaskawa is not responsible, such as natural or human-made disasters

Limitations of Liability

- Yaskawa shall in no event be responsible for any damage or loss of opportunity to the customer that arises due to failure of the delivered product.
- Yaskawa shall not be responsible for any programs (including parameter settings) or the results of program execution of the programs provided by the user or by a third party for use with programmable Yaskawa products.
- The information described in product catalogs or manuals is provided for the purpose of the customer purchasing the appropriate product for the intended application. The use thereof does not guarantee that there are no infringements of intellectual property rights or other proprietary rights of Yaskawa or third parties, nor does it construe a license.
- Yaskawa shall not be responsible for any damage arising from infringements of intellectual property rights or other proprietary rights of third parties as a result of using the information described in catalogs or manuals.

Suitability for Use

- It is the customer's responsibility to confirm conformity with any standards, codes, or regulations that apply if the Yaskawa product is used in combination with any other products.
- The customer must confirm that the Yaskawa product is suitable for the systems, machines, and equipment used by the customer.
- Consult with Yaskawa to determine whether use in the following applications is acceptable. If use in the application is acceptable, use the product with extra allowance in ratings and specifications, and provide safety measures to minimize hazards in the event of failure.
 - Outdoor use, use involving potential chemical contamination or electrical interference, or use in conditions or environments not described in product catalogs or manuals
 - Nuclear energy control systems, combustion systems, railroad systems, aviation systems, vehicle systems, medical equipment, amusement machines, and installations subject to separate industry or government regulations
 - Systems, machines, and equipment that may present a risk to life or property
 - Systems that require a high degree of reliability, such as systems that supply gas, water, or electricity, or systems that operate continuously 24 hours a day
 - · Other systems that require a similar high degree of safety
- Never use the product for an application involving serious risk to life or property without first ensuring that the system is designed to secure the required level of safety with risk warnings and redundancy, and that the Yaskawa product is properly rated and installed.
- The circuit examples and other application examples described in product catalogs and manuals are for reference. Check the functionality and safety of the actual devices and equipment to be used before using the product.
- Read and understand all use prohibitions and precautions, and operate the Yaskawa product correctly to prevent accidental harm to third parties.

Specifications Change

The names, specifications, appearance, and accessories of products in product catalogs and manuals may be changed at any time based on improvements and other reasons. The next editions of the revised catalogs or manuals will be published with updated code numbers. Consult with your Yaskawa representative to confirm the actual specifications before purchasing a product.

Compliance with UL Standards, EU Directives, UK Regulations, and Other Safety Standards

Certification marks for the standards for which the product has been certified by certification bodies are shown on nameplate. Products that do not have the marks are not certified for the standards. Refer to the Servomotor manual for compliant standards of Servomotors.

North American Safety Standards (UL)



Product	Model	North American Safety Standards (UL File No.)
SERVOPACKs	SGD7S	UL 61800-5-1 (E147823) CSA C22.2 No.274

◆ EU Directives



Product	Model	EU Directives	Harmonized Standards
SERVOPACKs		Machinery Directive 2006/42/EC	EN ISO13849-1: 2015 EN 62061 EN 61800-5-2
	SGD7S	EMC Directive 2014/30/EU	EN 55011 group 1, class A EN 61000-6-2 EN 61000-6-4 EN 61800-3 (Category C2, Second environment)
		Low Voltage Directive 2014/35/EU	EN 61800-5-1
			RoHS Directive 2011/65/EU (EU)2015/863

Note: 1. We declared the CE Marking based on the harmonized standards in the above table.

^{2.} These products are for industrial use. In home environments, these products may cause electromagnetic interference and additional noise reduction measures may be necessary.

◆ UK Conformity Assessed (UKCA)



Product	Model	UK Regulations	Designated Standards
SERVOPACKs		Supply of Machinery (Safety) Regulations S.I. 2008/1597	EN ISO13849-1: 2015 EN 62061 EN 61800-5-2
	SGD7S	Electromagnetic Compatibility Regulations S.I. 2016/1091	EN 55011 group 1, class A EN 61000-6-2 EN 61000-6-4 EN 61800-3 (Category C2, Second environment)
		Electrical Equipment (Safety) Regulations S.I. 2016/1101	EN 61800-5-1
		Restriction of the Use of Certain Hazardous Sub- stances in Electrical and Electronic Equipment Reg- ulations S.I. 2012/3032	EN IEC 63000

Note: We declared the UKCA marking based on the designated standards in the above table.

◆ Safety Standards

Product	Model	Safety Standards	Standards
SERVOPACKs		Safety of Machinery	EN ISO13849-1: 2015 EN 60204-1
	SGD7S	Functional Safety	EN 61508 series EN 62061 EN 61800-5-2
		Functional Safety EMC	EN 61326-3-1 EN 61000-6-7

■ Safety Parameters

Item	Standards	Performa	nce Level
Safaty Integrity Layel	IEC 61508	SIL3	
Safety Integrity Level	IEC 62061	SILCL3	
Mission Time	IEC 61508	10 years	20 years
Probability of Dangerous Failure per Hour	IEC 61508 IEC 62061	PFH = 4.04×10 ⁻⁹ [1/h] (4.04% of SIL3)	PFH = 4.05×10 ⁻⁹ [1/h] (4.05% of SIL3)
Performance Level	EN ISO 13849-1	PLe (Category 3)	
Mean Time to Dangerous Failure of Each Channel	EN ISO 13849-1	MTTFd: High	
Average Diagnostic Coverage	EN ISO 13849-1	DCavg: Medium	
Stop Category	IEC 60204-1	Stop category 0	
Safety Function	IEC 61800-5-2	STO	
Hardware Fault Tolerance	IEC 61508	HFT = 1	
Subsystem	IEC 61508	В	

Contents

		Outline Relate Using Safety Warrar Compl and Ot	this Manual	iii iv xi kiv kiv
1			nformation on SERVOPACKs	-
	1.1		-7 Series	
	1.2	Interp	preting the Nameplate1	-3
	1.3	Part I	Names1	-4
	1.4	Mode	el Designations	-6
		1.4.1 1.4.2	Interpreting SERVOPACK Model Numbers	
	1.5	Comb	pinations of SERVOPACKs and Servomotors1	-9
		1.5.1 1.5.2 1.5.3	Combinations of Rotary Servomotors and SERVOPACKS	10
	1.6	Funct	tions	13
2	S		ng a SERVOPACK	-
2	S. 2.1	electii	ng a SERVOPACK gs and Specifications 2-	-
2		Ratin	gs and Specifications	- 2
2		electii Ratin	gs and Specifications	- 2 2-2 2-6
2		Ratin 2.1.1 2.1.2 2.1.3	gs and Specifications	-2 2-2 2-6 2-7
2	2.1	Ratin 2.1.1 2.1.2 2.1.3 Block 2.2.1	gs and Specifications 2- Ratings .2 SERVOPACK Overload Protection Characteristics .2 Specifications .2 C Diagrams 2-1 SGD7S-R70A, -R90A, and -1R6A .2-	-2 2-2 2-6 2-7 12
2	2.1	Ratin 2.1.1 2.1.2 2.1.3 Block 2.2.1 2.2.2 2.2.3	gs and Specifications 2- Ratings .2 SERVOPACK Overload Protection Characteristics .2 Specifications .2 4 Diagrams 2-1 SGD7S-R70A, -R90A, and -1R6A .2- SGD7S-2R8A .2- SGD7S-3R8A, -5R5A, and -7R6A .2-	-2 2-2 2-6 2-7 12 12 13
2	2.1	Ratin 2.1.1 2.1.2 2.1.3 Block 2.2.1 2.2.2	gs and Specifications 2- Ratings .2 SERVOPACK Overload Protection Characteristics .2 Specifications .2 C Diagrams 2-1 SGD7S-R70A, -R90A, and -1R6A .2- SGD7S-2R8A .2-	-2 2-2 2-6 2-7 12 12 13 14
2	2.1	Ratin 2.1.1 2.1.2 2.1.3 Block 2.2.1 2.2.2 2.2.3 2.2.4 2.2.5 2.2.6	gs and Specifications 2- Ratings. .2 SERVOPACK Overload Protection Characteristics .2 Specifications. .2 Comparison .2 SGD7S-R70A, -R90A, and -1R6A .2- SGD7S-2R8A .2- SGD7S-3R8A, -5R5A, and -7R6A .2- SGD7S-120A .2- SGD7S-180A and -200A .2- SGD7S-330A .2-	-2 2-2 1-6 1-7 12 13 14 15 16
2	2.1	Patin 2.1.1 2.1.2 2.1.3 Block 2.2.1 2.2.2 2.2.3 2.2.4 2.2.5 2.2.6 2.2.7 2.2.8	gs and Specifications 2- Ratings .2 SERVOPACK Overload Protection Characteristics .2 Specifications .2 Compared Services .2 SGD7S-R70A, -R90A, and -1R6A .2- SGD7S-2R8A .2- SGD7S-3R8A, -5R5A, and -7R6A .2- SGD7S-120A .2- SGD7S-180A and -200A .2- SGD7S-330A .2- SGD7S-470A and -550A .2- SGD7S-590A and -780A .2-	-2 2-2 2-6 2-7 12 13 14 15 16 17 18
2	2.1	Ratin 2.1.1 2.1.2 2.1.3 Block 2.2.1 2.2.2 2.2.3 2.2.4 2.2.5 2.2.6 2.2.7	gs and Specifications 2- Ratings .2 SERVOPACK Overload Protection Characteristics .2 Specifications .2 Comparison .2 SGD7S-R70A, -R90A, and -1R6A .2- SGD7S-2R8A .2- SGD7S-3R8A, -5R5A, and -7R6A .2- SGD7S-120A .2- SGD7S-180A and -200A .2- SGD7S-330A .2- SGD7S-470A and -550A .2-	-2 2-2 1-6 1-7 12 13 14 15 16 17 18 18
2	2.1	Ratin 2.1.1 2.1.2 2.1.3 Block 2.2.1 2.2.2 2.2.3 2.2.4 2.2.5 2.2.6 2.2.7 2.2.8 2.2.9 2.2.10	gs and Specifications 2- Ratings .2 SERVOPACK Overload Protection Characteristics .2 Specifications .2 Specifications .2 SGD7S-R70A, -R90A, and -1R6A .2- SGD7S-2R8A .2- SGD7S-3R8A, -5R5A, and -7R6A .2- SGD7S-120A .2- SGD7S-180A and -200A .2- SGD7S-330A .2- SGD7S-470A and -550A .2- SGD7S-590A and -780A .2- SGD7S-R70F, -R90F, and -2R1F .2-	-2 2-6 1-7 12 13 14 15 16 17 18 18 19

	2.4	Examp	les of Standard Connections between SERVOPACKs and Peripheral Devices 2-27
3	S	ERVO	PACK Installation
	3.1	Insta	llation Precautions
	3.2	Mour	nting Types and Orientation 3-3
	3.3	Mour	nting Hole Dimensions 3-4
	3.4	Mour	nting Interval
		3.4.1 3.4.2	Installing One SERVOPACK in a Control Panel
	3.5	Moni	toring the Installation Environment 3-7
	3.6	Dera	ting Specifications 3-8
	3.7	EMC	Installation Conditions
4	W	/iring	and Connecting SERVOPACKs
4			
	4.1	Wirin	g and Connecting SERVOPACKs4-3
		4.1.1 4.1.2 4.1.3	General Precautions4-3Countermeasures against Noise4-5Grounding4-8
	4.2	Basic	Wiring Diagrams
	12		
	4.3		g the Power Supply to the SERVOPACK
		4.3.2	Wiring Procedure for Main Circuit Connector
		4.3.3 4.3.4	Power ON Sequence
		4.3.5 4.3.6	Wiring Regenerative Resistors
	4.4		g Servomotors
		4.4.1	Terminal Symbols and Terminal Names
		4.4.2 4.4.3	Pin Arrangement of Encoder Connector (CN2)
		4.4.4	Wiring the SERVOPACK to the Holding Brake
	4.5	I/O S	ignal Connections 4-35
		4.5.1 4.5.2	I/O Signal Connector (CN1) Names and Functions
		4.5.3	I/O Signal Wiring Examples
		4.5.4	I/O Circuits
	4.6	Conn 4.6.1	Pin Arrangement of Safety Function Signals
		4.6.1	I/O Circuits

	4.7	Conn	ecting the Other Connectors	4-52
		4.7.1 4.7.2	Serial Communications Connector (CN3)	4-52
		4.7.3	Analog Monitor Connector (CN5)	4-52
5	Ва	asic F	unctions That Require Setting before Operation	
J				
	5.1	Manip	oulating Parameters (Pn□□□)	. 5-4
		5.1.1 5.1.2 5.1.3 5.1.4 5.1.5	Parameter Classification. Notation for Parameters. Parameter Setting Methods. Write Prohibition Setting for Parameters. Initializing Parameter Settings.	5-5 5-6 5-8
	5.2	Contr	ol Method Selection	5-13
	5.3	Power	Supply Type Settings for the Main Circuit and Control Circuit	5-14
		5.3.1 5.3.2	AC Power Supply Input/DC Power Supply Input Setting Single-phase AC Power Supply Input/ Three-phase AC Power Supply Input Setting	5-14
	5.4	Auton	natic Detection of Connected Motor	5-16
	5.5	Funct	tions and Settings for the /S-ON (Servo ON) Signal	5-17
		5.5.1 5.5.2	Function of the /S-ON (Servo ON) Signal	
	5.6	Motor	r Direction Setting	5-18
	5.7	Settin	ng the Linear Encoder Pitch	5-19
	5.8		g Linear Servomotor Parameters	
	=			
	5.9	Selec	ting the Phase Sequence for a Linear Servomotor	5-24
	5.10	Polari	ity Sensor Setting	5-26
	5.11	Polari	ity Detection	5-27
			Restrictions	
			Using the /S-ON (Servo ON) Signal to Perform Polarity Detection Using the /P-DET (Polarity Detection) Signal to Perform Polarity Detection	
		5.11.4	Using a Tool Function to Perform Polarity Detection	
	5.12	Overt	ravel and Related Settings	5-31
		5.12.3	Overtravel Signals	5-32 5-33

	Holding Brake 5-36	
		5.13.1Brake Operating Sequence5-365.13.2/BK (Brake) Signal5-375.13.3Output Timing of /BK (Brake) Signal When the Servomotor Is Stopped5-385.13.4Output Timing of /BK (Brake) Signal When the Servomotor Is Operating5-39
	5.14	Motor Stopping Methods for Servo OFF and Alarms 5-41
		5.14.1 Stopping Method for Servo OFF 5-42 5.14.2 Servomotor Stopping Method for Alarms 5-42
	5.15	Motor Overload Detection Level 5-44
		5.15.1 Detection Timing for Overload Warnings (A.910)
	5.16	Electronic Gear Settings 5-46
		5.16.1 Electronic Gear Ratio Settings 5-47 5.16.2 Electronic Gear Ratio Setting Examples 5-51
	5.17	Resetting the Absolute Encoder 5-52
		5.17.1 Precautions on Resetting. 5-52 5.17.2 Preparations 5-52 5.17.3 Applicable Tools 5-53 5.17.4 Operating Procedure 5-53
	5.18	Setting the Origin of the Absolute Encoder 5-55
		5.18.1 Setting the Origin of the Absolute Linear Encoder 5-55
	5.19	Setting the Regenerative Resistor Capacity 5-58
6	A	pplication Functions
	6.1	I/O Signal Allocations
		6.1.1 Input Signal Allocations 6-5 6.1.2 Output Signal Allocations 6-8 6.1.3 ALM (Servo Alarm) Signal 6-9 6.1.4 ALO1 to ALO3 (Alarm Code) Signals 6-10 6.1.5 /WARN (Warning) Signal 6-10 6.1.6 /TGON (Rotation Detection) Signal 6-11 6.1.7 /S-RDY (Servo Ready) Signal 6-12
	6.2	Operation for Momentary Power Interruptions 6-13
	6.3	SEMI F47 Function 6-14
	6.4	Setting the Motor Maximum Speed 6-16
	6.5	Speed Control
		6.5.1 Basic Settings for Speed Control 6-17 6.5.2 Soft Start Settings 6-24 6.5.3 Speed Reference Filter 6-24 6.5.4 Zero Clamping 6-25 6.5.5 /V-CMP (Speed Coincidence Detection) Signal 6-27 6.5.6 Operation Examples for Changing the Motor Direction 6-28

6.6	Positi	ion Control
	6.6.1 6.6.2 6.6.3 6.6.4 6.6.5 6.6.6 6.6.7	Basic Settings for Position Control
6.7	Torqu	e Control
	6.7.1 6.7.2 6.7.3 6.7.4	Basic Settings for Torque Control.6-40Adjusting the Torque Reference Offset.6-41Torque Reference Filter Settings.6-45Speed Limit during Torque Control.6-45
6.8	Enco	der Divided Pulse Output6-48
	6.8.1 6.8.2	Encoder Divided Pulse Output Signals
6.9	Intern	nal Set Speed Control6-55
	6.9.1 6.9.2 6.9.3 6.9.4	Input Signals for Internal Set Speed Control.6-55Setting the Control Method to Internal Set Speed Control.6-56Settings for Internal Set Speed Control.6-56Changing Internal Set Speeds with Input Signals.6-57
6.10	Selec	ting Combined Control Methods6-59
		Setting Pn000 = $n.\Box\Box X\Box$ (Control Method Selection) to 4, 5, or 6 6-59 Setting Pn000 = $n.\Box\Box X\Box$ (Control Method Selection) to 7, 8, or 9 6-62 Setting Pn000 = $n.\Box\Box X\Box$ (Control Method Selection) to A or B 6-62
6.11	Selec	ting Torque Limits 6-64
	6.11.3 6.11.4	Internal Torque Limits
6.12	Abso	lute Encoders6-74
	6.12.3 6.12.4 6.12.5 6.12.6	Connecting an Absolute Encoder
		the Absolute Encoder
6.13		lute Linear Encoders
	6.13.1 6.13.2 6.13.3 6.13.4 6.13.5 6.13.6	Connecting an Absolute Linear Encoder

6.14	Softw	vare Reset	6-97
		Preparations	. 6-97
6.15	Initia	lizing the Vibration Detection Level	6-99
	6.15.3	Preparations	6-100 6-100
6.16	Adjus	sting the Motor Current Detection Signal Offset 6	-103
		Automatic Adjustment	
6.17	Forci	ng the Motor to Stop 6	-107
	6.17.2	FSTP (Forced Stop Input) Signal	6-107
6.18	Overl	heat Protection 6	-110
		Connecting the Overheat Protection Input (TH) Signal	
	<u> </u>	peration and Actual Operation	_
7.1		of Trial Operation	
	7.1.1 7.1.2	Flow of Trial Operation for Rotary Servomotors	
7.2	Inspe	ections and Confirmations before Trial Operation	. 7-6
7.3	Trial	Operation for the Servomotor without a Load	. 7-7
	7.3.1 7.3.2 7.3.3	Preparations	7-8
7.4	Trial O	peration from the Host Controller for the Servomotor without a Load	7-10
	7.4.1 7.4.2 7.4.3	Preparing the Servomotor for Trial Operation	. 7-13
	7.4.4	the SERVOPACK Used for Speed Control	
7.5	Trial (Operation with the Servomotor Connected to the Machine	7-17
	7.5.1 7.5.2 7.5.3	Precautions	. 7-18
7.6	Conv	enient Function to Use during Trial Operation	7-20
	7.6.1 7.6.2 7.6.3	Program Jogging	. 7-25

Tuning

8.8.4

8.8.5 8.8.6 8.8.7

8.1	Overv	view and Flow of Tuning8-4
	8.1.1 8.1.2	Tuning Functions
8.2	Monit	toring Methods 8-7
8.3	Preca	autions to Ensure Safe Tuning 8-8
	8.3.1 8.3.2 8.3.3 8.3.4 8.3.5	Overtravel Settings
8.4	Tunin	g-less Function
	8.4.1 8.4.2 8.4.3 8.4.4 8.4.5 8.4.6	Application Restrictions
8.5	Estim	ating the Moment of Inertia8-16
	8.5.1 8.5.2 8.5.3 8.5.4	Outline 8-16 Restrictions 8-17 Applicable Tools 8-17 Operating Procedure 8-18
8.6	Autot	uning without Host Reference8-24
	8.6.1 8.6.2 8.6.3 8.6.4 8.6.5 8.6.6 8.6.7	Outline8-24Restrictions8-25Applicable Tools8-26Operating Procedure8-26Troubleshooting Problems in Autotuning without a Host Reference8-31Automatically Adjusted Function Settings8-32Related Parameters8-34
8.7	Autot	uning with a Host Reference 8-35
	8.7.1 8.7.2 8.7.3 8.7.4 8.7.5 8.7.6 8.7.7	Outline8-35Restrictions8-35Applicable Tools8-36Operating Procedure8-36Troubleshooting Problems in Autotuning with a Host Reference8-40Automatically Adjusted Function Settings8-41Related Parameters8-41
8.8	Custo	om Tuning
	8.8.1 8.8.2 8.8.3	Outline.8-42Preparations.8-42Applicable Tools.8-43

Operating Procedure8-43

	8.9	Anti-F	Resonance Control Adjustment 8	-51
		8.9.1 8.9.2 8.9.3 8.9.4 8.9.5 8.9.6	Outline. Preparations Applicable Tools Operating Procedure Related Parameters Suppressing Different Vibration Frequencies with Anti-resonance Control	8-51 8-52 8-52 8-54
	8.10	Vibrat	tion Suppression	5-56
		8.10.1 8.10.2 8.10.3 8.10.4 8.10.5 8.10.6	Applicable Tools	8-57 8-57 8-57 8-59
	8.11	Speed	d Ripple Compensation	6-60
		8.11.1 8.11.2 8.11.3	Outline Setting Up Speed Ripple Compensation Setting Parameters	8-60
	8.12	Addit	ional Adjustment Functions8	3-66
		8.12.1 8.12.2 8.12.3 8.12.4 8.12.5 8.12.6 8.12.7 8.12.8	Current Gain Level Setting	8-70 8-71 8-73 8-73 8-74 8-74
	8.13	Manu	al Tuning	-76
			Tuning the Servo Gains	
	8.14	Diagn	ostic Tools8	8-93
		8.14.1 8.14.2	Mechanical Analysis	
9	M	lonito	ring	_
	9.1	Monit	toring Product Information	9-2
		9.1.1 9.1.2	Items That You Can Monitor	
	9.2	Monit	toring SERVOPACK Status	9-4
		9.2.1 9.2.2 9.2.3	Servo Drive Status	. 9-4
	9.3	Monit	oring Machine Operation Status and Signal Waveforms	9-8
		9.3.1 9.3.2 9.3.3	Items That You Can Monitor Using the SigmaWin+ Using the Analog Monitors	9-9

9.4	Monitoring Product Life		9-15
	9.4.1 9.4.2 9.4.3	Items That You Can Monitor	.9-16
9.5	Alarm Tracing		9-18
	9.5.1 9.5.2	Data for Which Alarm Tracing Is Performed	
10 F	ully-C	losed Loop Control	
10.1	Fully-	Closed System	10-2
10.2	SERV	OPACK Commissioning Procedure	10-3
10.3	Paran	neter Settings for Fully-Closed Loop Control	10-5
	10.3.1 10.3.2 10.3.3 10.3.4 10.3.5 10.3.6 10.3.7 10.3.8	Control Block Diagram for Fully-Closed Loop Control Setting the Motor Direction and the Machine Movement Direction Setting the Number of External Encoder Scale Pitches Setting the PAO, PBO, and PCO (Encoder Divided Pulse Output) Signals External Absolute Encoder Data Reception Sequence Electronic Gear Setting. Alarm Detection Settings Analog Monitor Signal Settings Setting to Use an External Encoder for Speed Feedback	.10-5 .10-6 .10-7 .10-7 .10-8 .10-8 .10-8
11 Sa	afety	Functions	
1111	Introd	luction to the Safety Functions	11_2
	11.1.1	Safety Functions	.11-3
11.2	Hard	Wire Base Block (HWBB)	11-4
	11.2.3 11.2.4 11.2.5 11.2.6 11.2.7 11.2.8 11.2.9 11.2.10	Risk Assessment Hard Wire Base Block (HWBB) State Resetting the HWBB State Detecting Errors in HWBB Signal HWBB Input Signal Specifications Operation without a Host Controller /S-RDY (Servo Ready Output) Signal /BK (Brake Output) Signal. Stopping Methods Settings to Clear the Position Deviation ALM (Servo Alarm) Signal and ALO1, ALO2, and ALO3 (Alarm Code Output) Signals	.11-5 .11-6 .11-6 .11-6 .11-7 .11-7 .11-7
11.3		(External Device Monitor)	
	11.3.1	EDM1 Output Signal Specifications	.11-9

11.4	Applications Examples for Safety Functions
	11.4.1 Connection Example 11-10 11.4.2 Failure Detection Method 11-10 11.4.3 Procedure 11-11
11.5	Validating Safety Functions
11.6	Connecting a Safety Function Device
M	laintenance
(12)	
12.1	Inspections and Part Replacement
	12.1.1 Inspections 12-2 12.1.2 Guidelines for Part Replacement 12-2 12.1.3 Replacing the Battery 12-3
12.2	Alarm Displays
	12.2.1 List of Alarms 12-5 12.2.2 Troubleshooting Alarms 12-12 12.2.3 Resetting Alarms 12-41 12.2.4 Displaying the Alarm History 12-42 12.2.5 Clearing the Alarm History 12-43 12.2.6 Resetting Alarms Detected in Option Modules 12-44 12.2.7 Resetting Motor Type Alarms 12-46
12.3	Warning Displays
	12.3.1 List of Warnings
12.4	Troubleshooting Based on the Operation and Conditions of the Servomotor 12-56
13 P	anel Displays and Panel Operator Procedures
13.1	Panel Operator
	13.1.1 Panel Operator Key Names and Functions13-313.1.2 Changing Modes13-313.1.3 Status Displays13-4
13.2	Parameter (Pn□□□) Operations on the Panel Operator 13-6
	13.2.1 Setting Parameters That Require Numeric Settings
13.3	Monitor Display (Un□□□) Operations on the Panel Operator 13-8
	13.3.1Basic Monitor Display Operations13-813.3.2Input Signal Monitor (Un005)13-813.3.3Output Signal Monitor (Un006)13-913.3.4Safety Input Signal Monitor (Un015)13-1013.3.5Upper Limit Setting Monitor for Maximum Motor Speed/ Upper Limit Setting for Encoder Output Resolution (Un010)13-11
	13.3.6 Polarity Sensor Signal Monitor (Un011)

13.4	Utility	Function (Fn□□□) Operations on the Panel Operator	13-12
	13.4.1	Display Alarm History (Fn000)	
	13.4.2 13.4.3	Jog (Fn002) Origin Search (Fn003)	
	13.4.4	Jog Program (Fn004)	
	13.4.5	Initialize Parameters (Fn005)	
		Clear Alarm History (Fn006)	
		Reset Absolute Encoder (Fn008)	
		Autotune Analog (Speed/Torque) Reference Offset (Fn009)	
		Manually Adjust Speed Reference Offset (Fn00A)	
		Manually Adjust Torque Reference Offset (Fn00B)	
		Adjust Analog Monitor Output Offset (Fn00C)	
		Adjust Analog Monitor Output Gain (Fn00D)	
		Autotune Motor Current Detection Signal Offset (Fn00E)	
		Write Prohibition Setting (Fn010)	
		Display Servomotor Model (Fn011)	
		Display Software Version (Fn012)	
		Multiturn Limit Setting after Multiturn Limit Disagreement Alarm (Fn013)	
		Reset Option Module Configuration Error (Fn014)	
		Initialize Vibration Detection Level (Fn01B)	
		Display SERVOPACK and Servomotor IDs (Fn01E)	
		Display Servomotor ID from Feedback Option Module (Fn01F)	
		Set Absolute Linear Encoder Origin (Fn020)	
		Resetting Motor Type Alarms (Fn021)	
		Polarity Detection (Fn080)	
		Tuning-less Level Setting (Fn200)	
		Advanced Autotuning without Reference (Fn201)	
		Advanced Autotuning with Reference (Fn202)	
	13.4.30	One-Parameter Tuning (Fn203)	13-31
		Adjust Anti-resonance Control (Fn204)	
		Vibration Suppression (Fn205)	
	13.4.33	Easy FFT (Fn206)	13-32
Pa	arame	eter Lists	
(14)			
14.1	List o	f Parameters	. 14-2
		Interpreting the Parameter Lists	
14.2	Paran	neter Recording Table	14-34

15

Appendices

15.1	Exan	ples of Connections to Host Controllers 15-2
		Example of Connections to MP2000/MP3000-Series SVA-01 Motion Module 15-2 Example of Connections to Yokogawa Electric's F3YP2□-0P
	15.1.3	Positioning Module for Position Control
		Positioning Module for Position Control
		Example of Connections to an OMRON Position Control Unit 15-5 Example of Connection to Mitsubishi's QD75D□ Positioning Module for
		Position Control
15.2	Corre	sponding SERVOPACK and SigmaWin+ Function Names 15-7
		Corresponding SERVOPACK Utility Function Names

Index

Revision History

Basic Information on SERVOPACKs

This chapter provides information required to select SERVOPACKs, such as SERVOPACK models and combinations with Servomotors.

1.1	The 2	C-7 Series1-2	
1.2	Interpreting the Nameplate1-3		
1.3	Part I	Names1-4	
1.4	Mode	el Designations1-6	
	1.4.1 1.4.2	Interpreting SERVOPACK Model Numbers 1-6 Interpreting Servomotor Model Numbers 1-7	
1.5	Comb	inations of SERVOPACKs and Servomotors1-9	
	1.5.1 1.5.2	Combinations of Rotary Servomotors and SERVOPACKs	
	1.5.3	Combinations of Linear Servomotors and SERVOPACKs	
1.6	Func	tions	

1.1

The Σ -7 Series


The Σ -7-series SERVOPACKs are designed for applications that require frequent high-speed and high-precision positioning. The SERVOPACK will make the most of machine performance in the shortest time possible, thus contributing to improving productivity.

The following three types of Σ -7-Series Servo Drives are available.


Type	Description
Σ-7S	Single-axis SERVOPACKs
Σ-7W	Two-axis SERVOPACKs
Σ-7C	Two-axis SERVOPACKs with Built-in Controllers

1.2 Interpreting the Nameplate

The following basic information is provided on the nameplate.

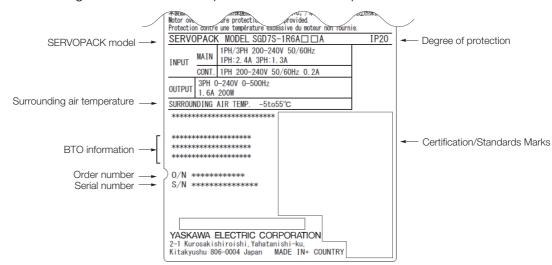

1.3 Part Names

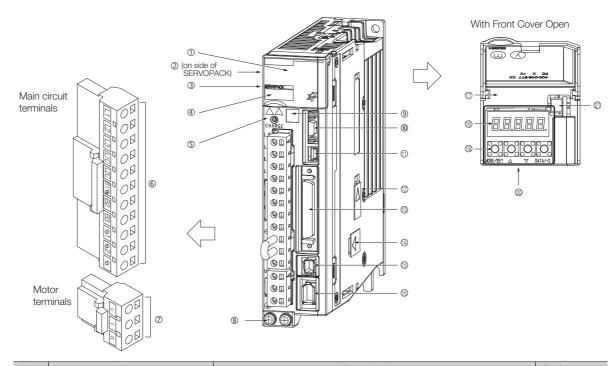

No.	Name	Description	Reference
①	Front Cover	-	_
2	Nameplate	Indicates the SERVOPACK model and ratings.	page 1-3
3	Input Voltage	-	-
4	Model	The model of the SERVOPACK.	page 1-6
(\$)	CHARGE	Lit while the main circuit power is being supplied. Note: Even if you turn OFF the main circuit power supply, this indicator will be lit as long as the internal capacitor remains charged. Do not touch the main circuit or motor terminals while this indicator is lit. Doing so may result in electric shock.	I
6	Main Circuit Terminals	The terminals depend on the main circuit power supply input specifications of the SERVOPACK.	page 4-11
7	Servomotor Terminals (U, V, and W)	The connection terminals for the Servomotor Main Circuit Cable (power line).	page 4-25
8	Ground Terminal (((=))	The ground terminals to prevent electric shock. Always connect this terminal.	_
9	QR Code	The QR code that is used by the MechatroCloud service.	_
10	Serial Communications Connector (CN3)	Connects to the Digital Operator (a peripheral device) or a computer (RS-422).	page 4-52
11)	Computer Connector (CN7)	A USB connector to connect a computer.	page 4-52
12	Safety Option Module Connector	Connects to a Safety Option Module.	-
13	I/O Signal Connector (CN1)	Connects to reference input signals and sequence I/O signals.	page 4-35
(14)	Feedback Option Module Connector	Connects to a Feedback Option Module.	-
15	Safety Connector (CN8)	Connects to a safety function device.	page 4-50
16	Encoder Connector (CN2)	 Rotary Servomotor: Connects to the encoder in the Servomotor. Linear Servomotor: Connects to a Serial Converter Unit or linear encoder. 	page 4-25
17	Serial Number	-	_

Continued from previous page.

No.	Name	Description	Reference
18	Panel Display	Used to display SERVOPACK status, alarm numbers, and parameters.	
19	Panel Operator Keys	Used to set parameters.	page 13-3
20	Panel Operator	-	
21)	Analog Monitor Connector (CN5)	You can use a special cable (peripheral device) to monitor the motor speed, torque reference, or other values.	page 4-52

1.4.1 Interpreting SERVOPACK Model Numbers

1.4

Model Designations

1.4.1 Interpreting SERVOPACK Model Numbers

SGD7S

1st+2nd+3rd

4th

5th+6th

7th digit

001 8th+9th+10th digits 000 11th+12th+13th

14th

 Σ -7-Series Σ -7S SERVOPACKs

1st+2nd+3rd digits

Maximum Applicable Motor Capacity

Voltage		Specification
	R70*1	0.05 kW
	R90*1	0.1 kW
	1R6*1	0.2 kW
	2R8*1	0.4 kW
	3R8	0.5 kW
	5R5*1	0.75 kW
Three-	7R6	1.0 kW
Phase,	120 ^{*2}	1.5 kW
200 VAC	180	2.0 kW
	200	3.0 kW
	330	5.0 kW
	470	6.0 kW
	550	7.5 kW
	590	11 kW
	780	15 kW
	R70	0.05 kW
Single- Phase,	R90	0.1 kW
100 VAC	2R1	0.2 kW
	2R8	0.4 kW

4th digit Voltage

Code	Specification
Α	200 VAC
F	100 VAC

5th+6th digits Interface*3

Code	Specification
00	Analog voltage/pulse train reference

7th digit Design Revision Order

8th+9th+10th digits Hardware Options Specification

	epeeme		
Code	Specification	Applicable Models	
None	Without options	All models	
000			
001	Rack-mounted	SGD7S-R70A to -330A	
	Tidok modritod	SGD7S-R70F to -2R8F	
	Duct-ventilated	SGD7S-470A to -780A	
002	Varnished	All models	
800	Single-phase, 200-VAC power supply input SGD7S-120A		
	No dynamia broka	SGD7S-R70A to -2R8A	
020*4	No dynamic brake	SGD7S-R70F to -2R8F	
	External dynamic brake resistor	SGD7S-3R8A to -780A	



14th digit BTO Specification*5

Code	Specification
None	None
В	BTO specification

- *1. You can use these models with either a single-phase or three-phase input.
- *2. A model with a single-phase, 200-VAC power supply input is available as a hardware option (model: SGD7S-120A00A008).
- *3. The same SERVOPACKs are used for both Rotary Servomotors and Linear Servomotors.
- *4. Refer to the following manual for details.
 - Σ-7-Series Σ-7S/Σ-7W SERVOPACK with Dynamic Brake Hardware Option Specifications Product Manual (Manual No.: SIEP S800001 73)
- *5. The BTO specification indicates if the SEVOPACK is customized by using the MechatroCloud BTO service. This service is available in Japan only.

You need a BTO number to order SÉRVOPACKs with customized specifications.

Refer to the following catalog for details on the BTO specification.

 \square AC Servo Drives Σ-7 Series (Catalog No.: KAEP S800001 23)

1.4.2 Interpreting Servomotor Model Numbers

This section outlines the model numbers of Σ -7-series Servomotors. Refer to the relevant manual in the following list for details.

- Ω Σ-7-Series Rotary Servomotor Product Manual (Manual No.: SIEP S800001 36)
- Σ-7-Series Linear Servomotor Product Manual (Manual No.: SIEP S800001 37)
- Ω Σ-7-Series Direct Drive Servomotor Product Manual (Manual No.: SIEP S800001 38)

Rotary Servomotors



Series	Σ -7 Series Servomotors

Code	Specification
SGM7M	Low inertia , ultra-small capacity
SGM7J	Medium inertia, high speed
SGM7A	Low inertia, high speed
SGM7P	Medium inertia, flat
SGM7G	Medium inertia, low speed, high torque
SGMMV	Low inertia, ultra-small capacity



- 3rd digit Power Supply Voltage
- 200 VAC
- 4th digit Serial Encoder Specification
- 17-bit absolute encoder
- 20-bit absolute encoder
- 24-bit batteryless absolute encoder
- 24-bit absolute encoder
- 24-bit incremental encoder

5th digit Design Revision Order



- Straight
- With key and tap
- With two flat seats



- With 24-V holding brake
- With oil seal

Direct Drive Servomotors

SGM - 02 B 3 C 1 1

Series 1st+2nd 3rd 4th 5th 6th 7th digit digit digit digit digit

Series Σ-7 Series Servomotors

Code	Specification
SGM7E	Small capacity, coreless inner rotor
SGM7F	Small capacity, with core inner rotor
SGIVITE	Medium capacity, with core inner rotor
SGMCV	Small capacity, with core inner rotor
SGMCS	Small capacity, coreless inner rotor
SGIVICS	Medium capacity, with core inner rotor

1st+2nd digits Rated Torque

3rd digit Servomotor Outer Diameter

4th digit Serial Encoder Specification

5th digit Design Revision Order

6th digit Flange Specification


- Cable drawn to load side
- Cable drawn to non-load side

7th digit Option Specification

High mechanical precision

1.4.2 Interpreting Servomotor Model Numbers

Linear Servomotors

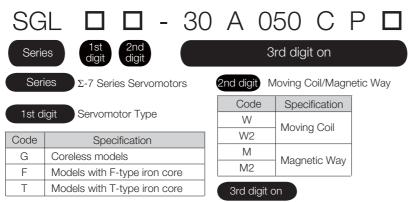

The specifications for the 3rd digit on depend on the Servomotor type.

1.5.1 Combinations of Rotary Servomotors and SERVOPACKs

1.5 Combinations of SERVOPACKs and Servomotors

1.5.1 Combinations of Rotary Servomotors and SERVOPACKs

Datawi Cawiawatan Madal		0	SERVOPACK Model
Rotary Servomotor Model		Capacity	SGD7S-
SGM7M	SGM7M-A1A	11 W	- R90A or R90F
(Low Inertia, Ultra-small Capacity),	SGM7M-A2A	22 W	1190/4 01 11901
3000 min ⁻¹	SGM7M-A3A	33 W	1R6A or 2R1F
	SGM7J-A5A	50 W	R70A or R70F
	SGM7J-01A	100 W	R90A or R90F
SGM7J (Medium Inertia,	SGM7J-C2A	150 W	1R6A or 2R1F
Small Capacity),	SGM7J-02A	200 W	THOA OF ZITT
3,000 min ⁻¹	SGM7J-04A	400 W	2R8A or 2R8F
	SGM7J-06A	600 W	5R5A
	SGM7J-08A	750 W	JIIJA
	SGM7A-A5A	50 W	R70A or R70F
	SGM7A-01A	100 W	R90A or R90F
	SGM7A-C2A	150 W	1R6A or 2R1F
	SGM7A-02A	200 W	THOA OF ZITTI
	SGM7A-04A	400 W	2R8A or 2R8F
	SGM7A-06A	600 W	5R5A
SGM7A	SGM7A-08A	750 W	JIIJA
(Low Inertia, Small Capacity),	SGM7A-10A	1.0 kW	120A
3,000 min ⁻¹	SGM7A-15A	1.5 kW	IZOA
	SGM7A-20A	2.0 kW	180A
	SGM7A-25A	2.5 kW	200A
	SGM7A-30A	3.0 kW	200A
	SGM7A-40A	4.0 kW	330A
	SGM7A-50A	5.0 kW	330A
	SGM7A-70A	7.0 kW	550A
	SGM7P-01A	100 W	R90A or R90F
SGM7P	SGM7P-02A	200 W	2R8A or 2R1F
(Medium Inertia, Flat),	SGM7P-04A	400 W	2R8A or 2R8F
3,000 min ⁻¹	SGM7P-08A	750 W	5R5A
	SGM7P-15A	1.5 kW	120A
	SGM7G-03A	300 W	3R8A
	SGM7G-05A	450 W	SHOA
	SGM7G-09A	850 W	7R6A
	SGM7G-13A	1.3 kW	120A
SGM7G	SGM7G-20A	1.8 kW	180A
(Medium Inertia, Medium Capacity), 1,500 min ⁻¹	SGM7G-30A	2.9 kW ^{*1}	330A
	SGM7G-44A	4.4 kW	
	SGM7G-55A	5.5 kW	470A
	SGM7G-75A	7.5 kW	550A
	SGM7G-1AA	11 kW	590A
	SGM7G-1EA	15 kW	780A
SGMMV*2	SGMMV-A1A	10 W	DOOM or DOOF
(Low Inertia,	SGMMV-A2A	20 W	R90A or R90F
Ultra-small Capacity), 3,000 min ⁻¹	SGMMV-A3A	30 W	1R6A or 2R1F

1.5.2 Combinations of Direct Drive Servomotors and SERVOPACKs

- *1. 2.4 kW when using the Servomotor with a SGD7S-200A SERVOPACK.
- *2. The SGMMV Servomotor is an older model. When purchasing a new Servomotor, we recommend selecting a SGM7M Servomotor.

1.5.2 Combinations of Direct Drive Servomotors and SERVOPACKs

		Rated Torque	Instantaneous	SERVOPACK Model
Direct Drive S	ervomotor Model	[N·m]	Maximum Torque [N·m]	SGD7S-
	SGM7E-02B	2	6	
	SGM7E-05B	5	15	2R8A or 2R1F
	SGM7E-07B	7	21	
	SGM7E-04C	4	12	
SGM7E	SGM7E-10C	10	30	
(Small Capacity, Coreless,	SGM7E-14C	14	42	2R8A or 2R8F
Inner Rotor)	SGM7E-08D	8	24	ZNOA UI ZNOF
	SGM7E-17D	17	51	
	SGM7E-25D	25	75	
	SGM7E-16E	16	48	CDC A
	SGM7E-35E	35	105	- 5R5A
	SGM7F-02A	2	6	0D0A av 0D4E
	SGM7F-05A	5	15	- 2R8A or 2R1F
	SGM7F-07A	7	21	
	SGM7F-04B	4	12	2R8A or 2R8F
SGM7F	SGM7F-10B	10	30	
(Small Capacity, With Core,	SGM7F-14B	14	42	5R5A
Inner Rotor)	SGM7F-08C	8	24	2R8A or 2R8F
	SGM7F-17C	17	51	5R5A
	SGM7F-25C	25	75	7R6A
	SGM7F-16D	16	48	5R5A
	SGM7F-35D	35	105	7R6A* or 120A
	SGM7F-45M	45	135	7R6A
SGM7F	SGM7F-80M	80	240	1004
(Medium Capacity,	SGM7F-80N	80	240	120A
With Core,	SGM7F-1AM	110	330	180A
Inner Rotor)	SGM7F-1EN	150	450	200A
	SGM7F-2ZN	200	600	200A
SGMCV (Small Capacity, With Core,	SGMCV-04B	4	12	
	SGMCV-10B	10	30	2R8A or 2R8F
	SGMCV-14B	14	42	5R5A
	SGMCV-08C	8	24	2R8A or 2R8F
	SGMCV-17C	17	51	5R5A
Inner Rotor)	SGMCV-25C	25	75	7R6A
	SGMCV-16D	16	48	5R5A
	SGMCV-35D	35	105	7R6A* or 120A

Continued from previous page.

		Rated Torque	Instantaneous	SERVOPACK Model
Direct Drive S	Direct Drive Servomotor Model		Maximum Torque [N·m]	SGD7S-
	SGMCS-02B	2	6	
	SGMCS-05B	5	15	2R8A or 2R1F
	SGMCS-07B	7	21	
	SGMCS-04C	4	12	
SGMCS	SGMCS-10C	10	30	
(Small Capacity, Coreless,	SGMCS-14C	14	42	2R8A or 2R8F
Inner Rotor)	SGMCS-08D	8	24	
,	SGMCS-17D	17	51	
	SGMCS-25D	25	75	
	SGMCS-16E	16	48	5R5A
	SGMCS-35E	35	105	ACAC
	SGMCS-45M	45	135	7R6A
SGMCS (Medium Capacity, With Core, Inner Rotor)	SGMCS-80M	80	240	120A
	SGMCS-80N	80	240	
	SGMCS-1AM	110	330	180A
	SGMCS-1EN	150	450	200A
	SGMCS-2ZN	200	600	

1.5.3 Combinations of Linear Servomotors and SERVOPACKs

Linear Serv	vomotor Model	Rated Force	Instantaneous Maximum Force	SERVOPACK Model
		[N]	[N]	SGD7S-
	SGLGW-30A050C	12.5	40	R70A or R70F
	SGLGW-30A080C	25	80	- R90A or R90F
	SGLGW-40A140C	47	140	11904 01 11901
SGLG	SGLGW-40A253C	93	280	1R6A or 2R1F
(Coreless),	SGLGW-40A365C	140	420	2R8A or 2R8F
Used with	SGLGW-60A140C	70	220	1R6A or 2R1F
Standard-Force	SGLGW-60A253C	140	440	2R8A or 2R8F
Magnetic Way	SGLGW-60A365C	210	660	5R5A
	SGLGW-90A200C	325	1300	120A
	SGLGW-90A370C	550	2200	180A
	SGLGW-90A535C	750	3000	200A
	SGLGW-40A140C	57	230	1R6A or 2R1F
SGLG (Coreless),	SGLGW-40A253C	114	460	2R8A or 2R8F
	SGLGW-40A365C	171	690	3R8A
Used with High-Force	SGLGW-60A140C	85	360	1R6A or 2R1F
Magnetic Way	SGLGW-60A253C	170	720	3R8A
	SGLGW-60A365C	255	1080	7R6A

1.5.3 Combinations of Linear Servomotors and SERVOPACKs

Continued from previous page.

		Data d Farra	Instantaneous	SERVOPACK Model
Linear Serv	vomotor Model	Rated Force [N]	Maximum Force [N]	SGD7S-
	SGLFW-20A090A	25	86	
	SGLFW-20A120A	40	125	1R6A or 2R1F
	SGLFW-35A120A	80	220	
	SGLFW-35A230A	160	440	3R8A
	SGLFW-50A200B	280	600	5R5A
	SGLFW-50A380B	560	1200	120A
	SGLFW-1ZA200B	360	1200	120A
	SGLFW-1ZA380B	1120	2400	200A
	SGLFW2-30A070A	45	135	1R6A or 2R1F
SGLF	SGLFW2-30A120A	90	270	THOA OF ZHIT
(With F-type Iron	SGLFW2-30A230A*	180	540	3R8A
Cores)	SGLFWZ-SUAZSUA	170	500	2R8A or 2R8F
	SGLFW2-45A200A	280	840	5R5A
	COLEMO 45 4 2 9 0 4 *	560	1680	180A
	SGLFW2-45A380A*	560	1500	120A
	SGLFW2-90A200A□1	560	1680	120A
	SGLFW2-90A200A□L	896	1680	120A
	SGLFW2-90A380A	1120	3360	200A
	SGLFW2-90A560A	1680	5040	330A
	SGLFW2-1DA380A	1680	5040	200A
	SGLFW2-1DA560A	2520	7560	330A
	SGLTW-20A170A	130	380	3R8A
	SGLTW-20A320A	250	760	7R6A
	SGLTW-20A460A	380	1140	120A
	SGLTW-35A170A	220	660	- 5R5A
	SGLTW-35A170H	300	600	SNOA
	SGLTW-35A320A	440	1320	- 120A
SGLT (With T-type Iron Cores)	SGLTW-35A320H	600	1200	120A
	SGLTW-35A460A	670	2000	180A
	SGLTW-40A400B	670	2600	TOUA
	SGLTW-40A600B	1000	4000	330A
	SGLTW-50A170H	450	900	5R5A
	SGLTW-50A320H	900	1800	120A
	SGLTW-80A400B	1300	5000	330A
	SGLTW-80A600B	2000	7500	550A

^{*} The force depends on the SERVOPACK that is used with the Servomotor.

1.6 Functions

This section lists the functions provided by SERVOPACKs. Refer to the reference pages for details on the functions.

· Functions Related to the Machine

Function	Reference
Power Supply Type Settings for the Main Circuit and Control Circuit	page 5-14
Automatic Detection of Connected Motor	page 5-16
Motor Direction Setting	page 5-18
Linear Encoder Pitch Setting	page 5-19
Writing Linear Servomotor Parameters	page 5-20
Selecting the Phase Sequence for a Linear Servomotor	page 5-24
Polarity Sensor Setting	page 5-26
Polarity Detection	page 5-27
Overtravel Function and Settings	page 5-31
Holding Brake	page 5-36
Motor Stopping Methods for Servo OFF and Alarms	page 5-41
Resetting the Absolute Encoder	page 5-52
Setting the Origin of the Absolute Encoder	page 5-55
Setting the Regenerative Resistor Capacity	page 5-58
Operation for Momentary Power Interruptions	page 6-13
SEMI F47 Function	page 6-14
Setting the Motor Maximum Speed	page 6-16
Multiturn Limit Setting	page 6-83
Adjustment of Motor Current Detection Signal Offset	page 6-103
Forcing the Motor to Stop	page 6-107
Overheat Protection	page 6-110
Speed Ripple Compensation	page 8-60
Current Control Mode Selection	page 8-73
Current Gain Level Setting	page 8-73
Speed Detection Method Selection	page 8-74
Fully-Closed Loop Control	page 10-1
Safety Functions	page 11-1

• Functions Related to the Host Controller

Function	Reference
Electronic Gear Settings	page 5-46
I/O Signal Allocations	page 6-5
ALM (Servo Alarm) Signal	page 6-9
ALO1 to ALO3 (Alarm Code) Signals	page 6-10
/WARN (Warning) Signal	page 6-10
/TGON (Rotation Detection) Signal	page 6-11
/S-RDY (Servo Ready) Signal	page 6-12
Speed Control	page 6-17
Basic Settings for Speed Control	page 6-17
Speed Reference Filter	page 6-24
Zero Clamping	page 6-25
/V-CMP (Speed Coincidence Detection) Signal	page 6-27
Position Control	page 6-30
Reference Pulse Form	page 6-31
CLR (Position Deviation Clear) Signal Function and Settings	page 6-33
Reference Pulse Input Multiplication Switching	page 6-34
/COIN (Positioning Completion) Signal	page 6-37
/NEAR (Near) Signal	page 6-38
Reference Pulse Inhibition and Settings	page 6-40
Torque Control	page 6-40
Basic Settings for Torque Control	page 6-40
Torque Reference Filter Settings	page 6-45
Speed Limit during Torque Control	page 6-45
/VLT (Speed Limit Detection) Signal	page 6-46
Encoder Divided Pulse Output	page 6-48
Selecting Torque Limits	page 6-64
Vibration Detection Level Initialization	page 6-99
Alarm Reset	page 12-41
Replacing the Battery	page 12-3
Setting the Position Deviation Overflow Alarm Level	page 8-8

• Functions to Achieve Optimum Motions

Function	Reference
Speed Control	page 6-17
Soft Start Settings	page 6-24
Position Control	page 6-30
Smoothing Settings	page 6-35
Torque Control	page 6-40
Tuning-less Function	page 8-12
Autotuning without a Host Reference	page 8-24
Autotuning with a Host Reference	page 8-35
Custom Tuning	page 8-42
Anti-Resonance Control Adjustment	page 8-51
Vibration Suppression	page 8-56
Gain Selection	page 8-66
Friction Compensation	page 8-70
Gravity Compensation	page 8-71
Model Following Control	page 8-83
Compatible Adjustment Functions	page 8-87
Mechanical Analysis	page 8-93
Easy FFT	page 8-95

• Functions for Trial Operation during Setup

Function	Reference
Software Reset	page 6-97
Trial Operation for the Servomotor without a Load	page 7-7
Program Jogging	page 7-20
Origin Search	page 7-25
Test without a Motor	page 7-27
Monitoring Machine Operation Status and Signal Waveforms	page 9-8

• Functions for Inspection and Maintenance

Function	Reference
Write Prohibition Setting for Parameters	page 5-8
Initializing Parameter Settings	page 5-11
Automatic Detection of Connected Motor	page 5-16
Monitoring Product Information	page 9-2
Monitoring Product Life	page 9-2
Alarm History Display	page 12-42
Alarm Tracing	page 9-18

Selecting a SERVOPACK

2

This chapter provides information required to select SERVOPACKs, such as specifications, block diagrams, dimensional drawings, and connection examples.

2.1	Rating	gs and Specifications2-2
	2.1.1 2.1.2	Ratings
	2.1.3	Characteristics
2.2	Block	Diagrams 2-12
	2.2.1 2.2.2 2.2.3 2.2.4 2.2.5 2.2.6 2.2.7 2.2.8 2.2.9 2.2.10	SGD7S-R70A, -R90A, and -1R6A 2-12 SGD7S-2R8A 2-12 SGD7S-3R8A, -5R5A, and -7R6A 2-13 SGD7S-120A 2-14 SGD7S-180A and -200A 2-15 SGD7S-330A 2-16 SGD7S-470A and -550A 2-17 SGD7S-590A and -780A 2-18 SGD7S-R70F, -R90F, and -2R1F 2-18 SGD7S-2R8F 2-19
2.3	Exter	nal Dimensions2-20
	2.3.1	Front Cover Dimensions and Connector Specifications
2.4	Examples of	of Standard Connections between SERVOPACKs and Peripheral Devices2-27

2.1.1 Ratings

2.1

Ratings and Specifications

This section gives the ratings and specifications of SERVOPACKs.

2.1.1 Ratings

Three-Phase, 200 VAC

	Model SGD7S-			R90A	1R6A	2R8A	3R8A	5R5A	7R6A	120A	180A	200A	330A		
	Maximum Applicable Motor Capacity [kW]		0.05	0.1	0.2	0.4	0.5	0.75	1.0	1.5	2.0	3.0	5.0		
Continuo	ous Output Cu	urrent [Arms]	0.66	0.91	1.6	2.8	3.8	5.5	7.6	11.6	18.5	19.6	32.9		
Instanta Current	neous Maxin [Arms]	num Output	2.1	3.2	5.9	9.3	11	16.9	17	28	42	56	84		
	Power Sup	ply		•		200 VA	C to 2	40 VAC	, 50 Hz	/60 Hz	•				
Main Circuit	Permitted \ ation	/oltage Fluctu-					-15	% to +1	0%						
	Input Curre	nt [Arms]*	0.4	0.8	1.3	2.5	3.0	4.1	5.7	7.3	10	15	25		
	Power St	upply				200 VA	C to 2	40 VAC	, 50 Hz	/60 Hz					
Con- trol	Permitted Voltage Fluctuation		ŭ						-15	% to +1	0%				
	Input Current [Arms]*		0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.25	0.25	0.3		
Power S	Supply Capac	city [kVA]*	0.2	0.3	0.5	1.0	1.3	1.6	2.3	3.2	4.0	5.9	7.5		
	Main Circuit [W]	Power Loss	5.0	7.0	11.9	22.5	28.5	38.9	49.2	72.6	104.2	114.2	226.6		
Power Loss*	Control Circ Loss [W]	cuit Power	12	12	12	12	14	14	14	15	16	16	19		
L055	Built-in Reg Resistor Po	generative ower Loss [W]	-	-	_	-	8	8	8	12	12	12	36		
	Total Powe	r Loss [W]	17.0	19.0	23.9	34.5	50.5	60.9	71.2	97.6	136.2	146.2	281.6		
	Built-In	Resistance $[\Omega]$	_	_	_	_	40	40	40	20	12	12	8		
Regen- erative Resis-	Regener- ative Resistor	Capacity [W]	_	_	_	_	40	40	40	60	60	60	180		
tor	Minimum A nal Resista	llowable Exter- nce [Ω]	40	40	40	40	40	40	40	20	12	12	8		
Overvolt	tage Categor	у						Ш							

^{*} This is the net value at the rated load.

	Model SGD7S-	470A	550A	590A	780A		
Maximum Applicable	Motor Capacity [kW]	6.0	7.5	11	15		
Continuous Output (Current [Arms]	46.9	54.7	58.6	78.0		
Instantaneous Maxir	num Output Current [Arms]	110	130	140	170		
	Power Supply	200) VAC to 240 V	/AC, 50 Hz/60	Hz		
Main Circuit	Permitted Voltage Fluctuation		-15% to	+10%			
	Input Current [Arms]*1	29	37	54	73		
	Power Supply	200) VAC to 240 V	/AC, 50 Hz/60	Hz		
Control	Permitted Voltage Fluctuation	-15% to +10%					
	Input Current [Arms]*1	0.3	0.3	0.4	0.4		
Power Supply Capa	city [kVA]*1	10.7	14.6	21.7	29.6		
	Main Circuit Power Loss [W]	271.7	326.9	365.3	501.4		
	Control Circuit Power Loss [W]	21	21	28	28		
Power Loss*1	External Regenerative Resistor Unit Power Loss [W]	180 ^{*2}	350* ³	350*³	350*3		
	Total Power Loss [W]	292.7	347.9	393.3	529.4		
	Resistance $[\Omega]$	6.25* ²	3.13* ³	3.13 ^{*3}	3.13*3		
External Regenera- tive Resistor Unit	Capacity [W]	880*2	1760*3	1760*3	1760*3		
	Minimum Allowable External Resistance $[\Omega]$	5.8	2.9	2.9	2.9		
Overvoltage Categor	ry		11	I			

^{*1.} This is the net value at the rated load.

Single-Phase, 200 VAC

N	R70A	R90A	1R6A	2R8A	5R5A	120A			
Maximum Applicable M	0.05	0.1	0.2	0.4	0.75	1.5			
Continuous Output Cur	rent [Arms]		0.66	0.91	1.6	2.8	5.5	11.6	
Instantaneous Maximur	m Output Cu	rrent [Arms]	2.1	3.2	5.9	9.3	16.9	28	
	Power Sup	pply	200 VAC to 240 VAC, 50 Hz/60 Hz						
Main Circuit	Permitted \	Voltage Fluctuation			-15% to	+10%			
	Input Curre	ent [Arms]*	0.8	1.6	2.4	5.0	8.7	16	
	Power Sup	pply		200 VA	C to 240 \	/AC, 50 H	z/60 Hz		
Control	Permitted \	Voltage Fluctuation			-15% to	+10%			
	Input Curre	ent [Arms]*	0.2	0.2	0.2	0.2	0.2	0.25	
Power Supply Capacity	*		0.3	0.6	1.2	1.9	4.0		
	Main Circu	it Power Loss [W]	5.0	7.1	12.1	23.7	39.2	71.8	
	Control Cir	cuit Power Loss [W]	12	12	12	12	14	16	
Power Loss*	Built-in Reg Loss [W]	generative Resistor Power	-	_	_	_	8	12	
	Total Powe	er Loss [W]	17.0	19.1	24.1	35.7	61.2	103.8	
	Built-In	Resistance $[\Omega]$	_	_	_	_	40	12	
Regenerative Resistor	Regener- ative Resistor	Capacity [W]	-	-	-	_	40	60	
	Minimum A tance $[\Omega]$	Allowable External Resis-	40	40	40	40	40	12	
Overvoltage Category				·	1	II .			

^{*} This is the net value at the rated load.

st2. This value is for the optional JUSP-RA04-E Regenerative Resistor Unit.

^{*3.} This value is for the optional JUSP-RA05-E Regenerative Resistor Unit.

2.1.1 Ratings

270 VDC

Mod	R70A	R90A	1R6A	2R8A	3R8A	5R5A	7R6A	120A	
Maximum Applicable Mo	otor Capacity [kW]	0.05	0.1	0.2	0.4	0.5	0.75	1.0	1.5
Continuous Output Curr	rent [Arms]	0.66	0.91	1.6	2.8	3.8	5.5	7.6	11.6
Instantaneous Maximum	n Output Current [Arms]	2.1	3.2	5.9	9.3	11.0	16.9	17.0	28.0
	Power Supply			270	O VDC t	o 324 V	DC		
Main Circuit	Permitted Voltage Fluctuation				-15% to	o +10%			
	Input Current [Arms]*1	0.5	1.0	1.5	3.0	3.8	4.9	6.9	11
	Power Supply	270 VDC to 324 VDC							
Control	Permitted Voltage Fluctuation	-15% to +10%							
	Input Current [Arms]*1	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2*2
Power Supply Capacity	$[kVA]^{*1}$	0.2	0.3	0.6	1	1.4	1.6	2.3	3.2
	Main Circuit Power Loss [W]	4.4	5.9	9.8	17.5	23.0	30.7	38.7	55.8
Power Loss*1	Control Circuit Power Loss [W]	12	12	12	12	14	14	14	15
	Total Power Loss [W]	16.4	17.9	21.8	29.5	37.0	44.7	52.7	70.8
Overvoltage Category				•		II		•	·

^{*1.} This is the net value at the rated load.

^{*2.} The value is 0.25 Arms for the SGD7S-120A00A008.

Mod	180A	200A	330A	470A	550A	590A	780A	
Maximum Applicable Mo	otor Capacity [kW]	2.0	3.0	5.0	6.0	7.5	11.0	15.0
Continuous Output Curr	ent [Arms]	18.5	19.6	32.9	46.9	54.7	58.6	78.0
Instantaneous Maximum	Output Current [Arms]	42.0	56.0	84.0	110	130	140	170
	Power Supply			270 VI	OC to 32	4 VDC		
Main Circuit	Permitted Voltage Fluctuation			-15	5% to +1	0%		
	Input Current [Arms]*	14	20	34	36	48	68	92
	Power Supply	270 VDC to 324 VDC						
Control	Permitted Voltage Fluctuation	-15% to +10%						
	Input Current [Arms]*	0.25	0.25	0.3	0.3	0.3	0.4	0.4
Power Supply Capacity	[kVA]*	4.0	5.9	7.5	10.7	14.6	21.7	29.6
	Main Circuit Power Loss [W]	82.7	83.5	146.2	211.6	255.3	243.6	343.4
Power Loss*	Control Circuit Power Loss [W]	16	16	19	21	21	28	28
Total Power Loss [W]			99.5	165.2	232.6	276.3	271.6	371.4
Overvoltage Category					III			

^{*} This is the net value at the rated load.

Single-Phase, 100 VAC

	Model SGD7S-	R70F	R90F	2R1F	2R8F			
Maximum App	olicable Motor Capacity [kW]	0.05	0.1	0.2	0.4			
Continuous O	utput Current [Arms]	0.66	0.91	2.1	2.8			
Instantaneous	Maximum Output Current [Arms]	2.1	3.2	6.5	9.3			
	Power Supply	100	O VAC to 120 \	/AC, 50 Hz/60	Hz			
Main Circuit	Permitted Voltage Fluctuation		-15% to	o +10%				
	Input Current [Arms]*	1.5	2.5	5	10			
	Power Supply	100 VAC to 120 VAC, 50 Hz/60 Hz						
Control	Permitted Voltage Fluctuation	-15% to +10%						
	Input Current [Arms]*	0.38	0.38	0.38	0.38			
Power Supply	Capacity [kVA]*	0.2	0.3	0.6	1.4			
	Main Circuit Power Loss [W]	5.3	7.8	14.2	26.2			
Power Loss*	Control Circuit Power Loss [W]	12	12	12	12			
	Total Power Loss [W]	17.3	19.8	26.2	38.2			
Regenera- tive Resistor	Minimum Allowable Resistance $[\Omega]$	40	40	40	40			
Overvoltage C	ategory		l	II	•			

^{*} This is the net value at the rated load.

2.1.2 SERVOPACK Overload Protection Characteristics


The overload detection level is set for hot start conditions with a SERVOPACK surrounding air temperature of 55°C.

An overload alarm (A.710 or A.720) will occur if overload operation that exceeds the overload protection characteristics shown in the following diagram (i.e., operation on the right side of the applicable line) is performed.

The actual overload detection level will be the detection level of the connected SERVOPACK or Servomotor that has the lower overload protection characteristics.

In most cases, that will be the overload protection characteristics of the Servomotor.


• SGD7S-R70A, -R90A, -1R6A, -2R8A, -R70F, -R90F, -2R1F, and -2R8F

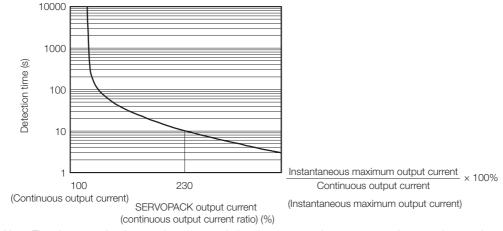

Note: The above overload protection characteristics do not mean that you can perform continuous duty operation with an output of 100% or higher.

For a Yaskawa-specified combination of SERVOPACK and Servomotor, maintain the effective torque within the continuous duty zone of the torque-motor speed characteristic of the Servomotor.

 SGD7S-3R8A, -5R5A, -7R6A, -120A, -180A, -200A, -330A, -470A, -550A, -590A, and -780A

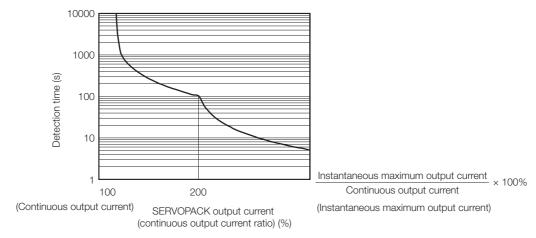

Note: The above overload protection characteristics do not mean that you can perform continuous duty operation with an output of 100% or higher.

For a Yaskawa-specified combination of SERVOPACK and Servomotor, maintain the effective torque within the continuous duty zone of the torque-motor speed characteristic of the Servomotor.

2.1.3 Specifications

	Item		Specification				
Control Met	hod	IGBT-based PWM control,	, sine wave current drive				
Feedback	With Rotary Servomotor	encoder)	bsolute encoder) 24 bits (incremental encoder/absolute bsolute encoder)				
reeuback	With Linear Servomotor	 Absolute linear encoder (The signal resolution depends on the absolute linear encoder.) Incremental linear encoder (The signal resolution depends on the incremental linear encoder or Serial Converter Unit.) 					
	Surrounding Air Temperature*1		ossible between 55°C and 60°C.) tion for derating specifications. ions on page 3-8				
	Storage Temperature	-20°C to 85°C					
	Surrounding Air Humidity	95% relative humidity max	x. (with no freezing or condensation)				
	Storage Humidity	95% relative humidity max	x. (with no freezing or condensation)				
	Vibration Resistance	4.9 m/s ²					
	Shock Resistance	19.6 m/s ²					
Environ- mental Conditions	Degree of Protection	Degree SERVOPACK Model: SGD7S- IP20 R70A, R90A, 1R6A, 2R8A, 3R8A, 5R5A, 7R6A, 120A, R70F, R90F, 2R1F, 2R8F IP10 120A00A008, 180A, 200A, 330A, 470A, 550A, 590A, 30A, 200A, 330A, 470A, 550A, 590A, 30A, 470A, 550A, 590A, 590A					
	Pollution Degree	Must be no corrosive or Must be no exposure to Must be no dust, salts,	water, oil, or chemicals.				
	Altitude*1	2,000 m.)	tion for derating specifications. ions on page 3-8				
	Others		CK in the following locations: Locations sub- oise, strong electromagnetic/magnetic fields,				
Compliant S	Standards	Refer to the following sec Compliance with UL St Other Safety Standards	andards, EU Directives, UK Regulations, and				
Mounting		Mounting	SERVOPACK Model: SGD7S-				
		Base-mounted	All Models				
		Rack-mounted	R70A, R90A, 1R6A, 2R8A, 3R8A, 5R5A, 7R6A, 120A, 180A, 200A, 330A, R70F, R90F, 2R1F, 2R8F				
		Duct-ventilated	470A, 550A, 590A, 780A				

2.1.3 Specifications

Continued from previous page.

	Item		Specification				
	Speed Con	trol Range	1:5000 (At the rated torque, the lower limit of the speed control range must not cause the Servomotor to stop.)				
			±0.01% of rated speed max. (for a load fluctuation of 0% to 100%)				
	Coefficient	of Speed	0% of rated speed max. (for a voltage fluctuation of ±10%)				
Perfor-	Fluctuation						
mance	Taotaation		±0.1% of rated speed max. (for a temperature fluctuation of 25°C ±25°C)				
	Torque Con sion (Repea		±1%				
	Soft Start T ting	ime Set-	0 s to 10 s (Can be set separately for acceleration and deceleration.)				
	Encoder Div Pulse Outp		Phase A, phase B, phase C: Line-driver output Number of divided output pulses: Any setting is allowed.				
	Overheat P	rotection	Number of input points: 1 Input voltage range: 0 V to +5 V				
			Allowable voltage range: 5 VDC ±5%				
		Fixed Input	Number of input points: 1				
			(Input method: Sink inputs or source inputs)				
			SEN (Absolute Data Request) signal				
			Allowable voltage range: 24 VDC ±20% Number of input points: 7				
			(Input method: Sink inputs or source inputs)				
			Input Signals				
			P-OT (Forward Drive Prohibit) and N-OT (Reverse Drive Prohibit) signal				
I/O Signals			nals				
	Sequence		/ALM-RST (Alarm Reset) signal				
	Input Signals	Input	/P-CL (Forward External Torque Limit) and /N-CL (Reverse External Torque Limit) signals				
	3 - 1	Signals That Can	/SPD-D (Motor Direction) signal				
		Be Allo-	/SPD-A and /SPD-B (Internal Set Speed Selection) signals				
		cated	/C-SEL (Control Selection) signal				
			/ZCLAMP (Zero Clamping) signal // INTEREST (2) (2) (2) (2) (2) (2) (2) (2) (2) (2)				
			/INHIBIT (Reference Pulse Inhibit) signal /G-SEL (Gain Selection) signal				
			/P-DET (Polarity Detection) signal				
			SEN (Absolute Data Request) signal				
			/PSEL (Reference Pulse Input Multiplication Switch) signal				
			FSTP (Forced Stop Input) signal A signal can be allocated and the positive and pagetive logic can be				
			A signal can be allocated and the positive and negative logic can be changed.				
	1	1	<u>-</u>				

Continued from previous page.

	Item		Specification				
			Allowable voltage range: 5 VDC to 30 VDC				
		Fixed	Number of output points: 1				
		Output	(A photocoupler output (isolated) is used.)				
			Output signal: ALM (Servo Alarm) signal				
			Allowable voltage range: 5 VDC to 30 VDC				
			Number of output points: 6				
			(A photocoupler output (isolated) is used for three of the outputs.) (An open-collector output (non-isolated) is used for the other three out-				
			puts.)				
			Output Signals				
	Sequence		/COIN (Positioning Completion) signal				
I/O Signals	Output	Output	V-CMP (Speed Coincidence Detection) signal				
	Signals	Signals	/TGON (Rotation Detection) signal /S-RDY (Servo Ready) signal				
		That Can Be	CLT (Torque Limit Detection) signal				
		Allocated	/VLT (Speed Limit Detection) signal				
			• /BK (Brake) signal				
			/WARN (Warning) signal /NEAR (Near) signal				
			PSELA (Reference Pulse Input Multiplication Switching Output) sig-				
			nal				
			• ALO1, ALO2, and ALO3 (Alarm Code) signals				
			A signal can be allocated and the positive and negative logic can be changed.				
		Inter-	Digital Operator (JUSP-OP05A-1-E) and personal computer (with Sig-				
		faces	maWin+)				
	RS-422A Communications (CN3)	1:N					
		Commu-	Up to N = 15 stations possible for RS-422A port				
		nications					
Communi-		Axis Address	Set with parameters.				
cations		Setting	'				
	USB	Interface	Personal computer (with SigmaWin+)				
	Communi-	Commu- nica-					
	cations	tions	Conforms to USB2.0 standard (12 Mbps).				
	(CN7)	Standard					
Displays/Ind			CHARGE indicator and five-digit seven-segment display				
Panel Opera	tor		Four push switches				
			Number of points: 2				
			Output voltage range: ±10 VDC (effective linearity range: ±8 V) Resolution: 16 bits				
Analog Moni	itor (CN5)		Accuracy: ±20 mV (Typ)				
			Maximum output current: ±10 mA				
			Settling time (±1%): 1.2 ms (Typ)				
Dynamic Bra	ake (DB)		Activated when a servo alarm or overtravel (OT) occurs, or when the				
	-		power supply to the main circuit or servo is OFF. Built-in (An external resistor must be connected to the SGD7S-470A to				
Danier	- Dua !:-		-780A.)				
Regenerative	e Processing		Refer to the following catalog for details.				
			AC Servo Drives Σ-7 Series (Catalog No.: KAEP S800001 23)				
Overtravel (C	OT) Prevention	n	Stopping with dynamic brake, deceleration to a stop, or coasting to a stop for the P-OT (Forward Drive Prohibit) or N-OT (Reverse Drive Pro-				
Svortiaver (C	o i ji i Toveridol		hibit) signal				
Protective Fu	unctions		Overcurrent, overvoltage, low voltage, overload, regeneration error, etc.				
Utility Functi			Gain adjustment, alarm history, jogging, origin search, etc.				
			Continued on next page				

2.1.3 Specifications

Continued from previous page.

Item					Continued from previous page.					
					Specification Specification					
		Input			/HWBB1 and /HWBB2: Base block signals for Power Modules					
Safe		Outp			EDM1: Monitors the status of built-in safety circuit (fixed output).					
run	ctions	Com _l Stand	oliant dards ^{*3}	3	ISO13849-1 PLe (Category 3) and IEC61508 SIL3					
App	Applicable Option Modules		es	Fully-closed Modules and Safety Modules Note: You cannot use a Fully-closed Module and a Safety Module together.						
		Soft Star		ime Set-	0 s to 10 s (Can be set separately for acceleration and deceleration.)					
		3	Refer- ence Voltage		 Maximum input voltage: ±12 V (forward motor rotation for positive reference). 6 VDC at rated speed (default setting). Input gain setting can be changed. 					
		Input Signa		Input Imped- ance	Approx. 14 kΩ					
	Speed Con- trol			Circuit Time Con- stant	30 μs					
		Internal Set Spee Control	Set Speed Sele		With Proportional Control signal					
Controls		S		Speed Selec- tion	With Forward/Reverse External Torque Limit signals (speed 1 to 3 selection). Servomotor stops or another control method is used when both signals are OFF.					
Con			Feedforward Compensation		0% to 100%					
		tionin	Output Signal Positioning Completed Width Setting		0 to 1,073,741,824 reference units					
				Refer- ence Pulse Form	One of the following is selected: Sign + pulse train, CW + CCW pulse trains, and two-phase pulse trains with 90° phase differential					
	Posi-		Dof	Input Form	Line driver or open collector					
	tion Con- trol	In- put Sig- nals	n- out Sig- nals	mum Input	 Line Driver Sign + pulse train or CW + CCW pulse trains: 4 Mpps Two-phase pulse trains with 90° phase differential: 1 Mpps Open Collector Sign + pulse train or CW + CCW pulse trains: 200 kpps Two-phase pulse trains with 90° phase differential: 200 kpps 					
				Input Multiplica- tion Switching	1 to 100 times					
			Clear	Signal	Position deviation clear Line driver or open collector					

2.1.3 Specifications

Continued from previous page.

Item				Specification
Controls	Torque Con- trol	Input Signal	Refer- ence Voltage	 Maximum input voltage: ±12 V (forward torque output for positive reference). 3 VDC at rated torque (default setting). Input gain setting can be changed.
			Input Imped- ance	Approx. 14 k Ω
			Circuit Time Constant	16 μs

^{*1.} If you combine a Σ -7-Series SERVOPACK with a Σ -V-Series Option Module, the following Σ -V-Series SERVOPACKs specifications must be used: a surrounding air temperature of 0°C to 55°C and an altitude of 1,000 m max. Also, the applicable surrounding range cannot be increased by derating.


Coefficient of speed fluctuation = $\frac{\text{No-load motor speed - Total-load motor speed}}{\text{Rated motor speed}} \times 100\%$

^{*2.} The coefficient of speed fluctuation for load fluctuation is defined as follows:


^{*3.} Always perform risk assessment for the system and confirm that the safety requirements are met.

2.2 Block Diagrams


2.2.1 SGD7S-R70A, -R90A, and -1R6A

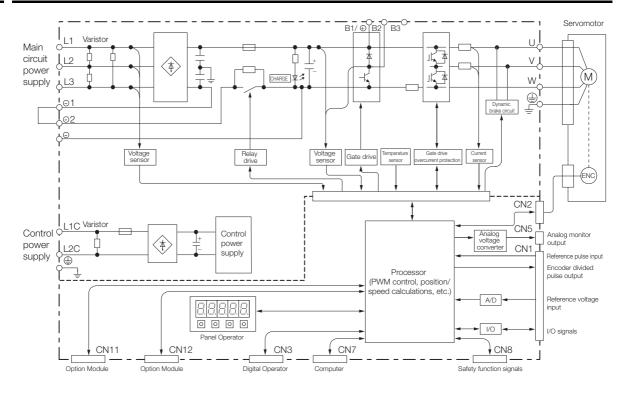

2.2.2 SGD7S-2R8A

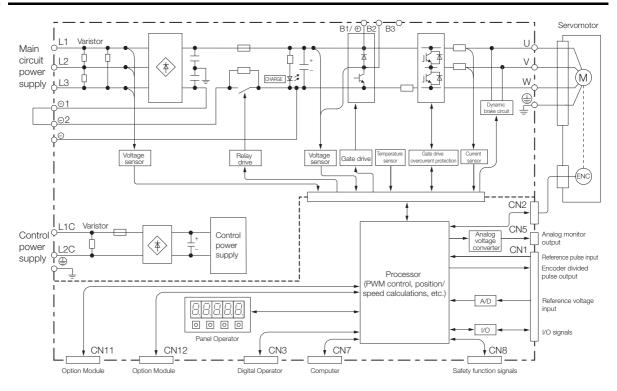


2.2.3 SGD7S-3R8A, -5R5A, and -7R6A

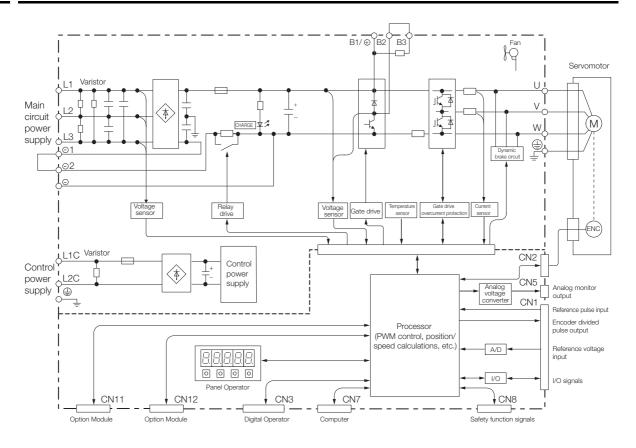


2.2.4 SGD7S-120A


• Standard Specifications: Three-Phase, 200-VAC Power Supply Input

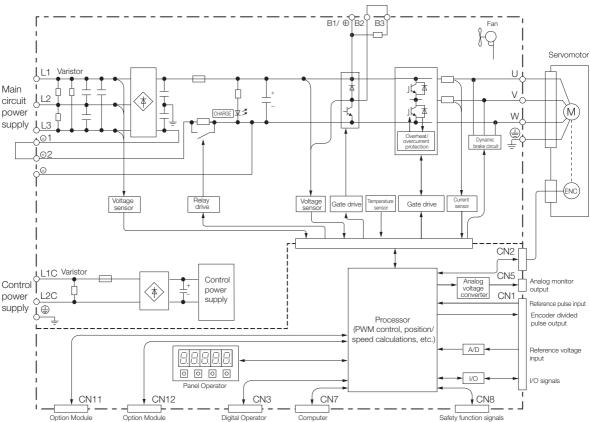


• Optional Specifications: Single-Phase, 200-VAC Power Supply Input (SERVOPACK Model: SGD7S-120A00A008)

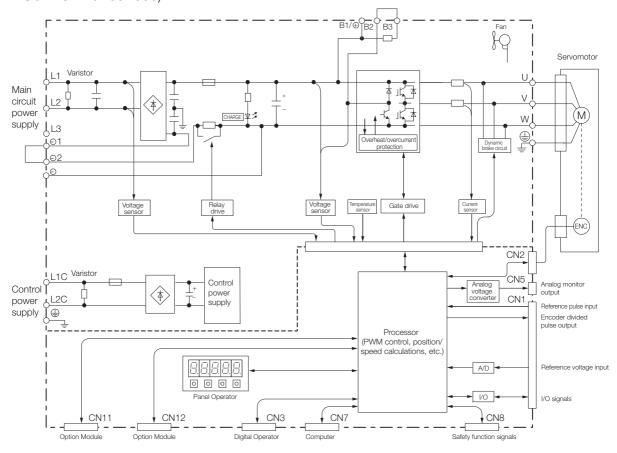


2.2.5 SGD7S-180A and -200A

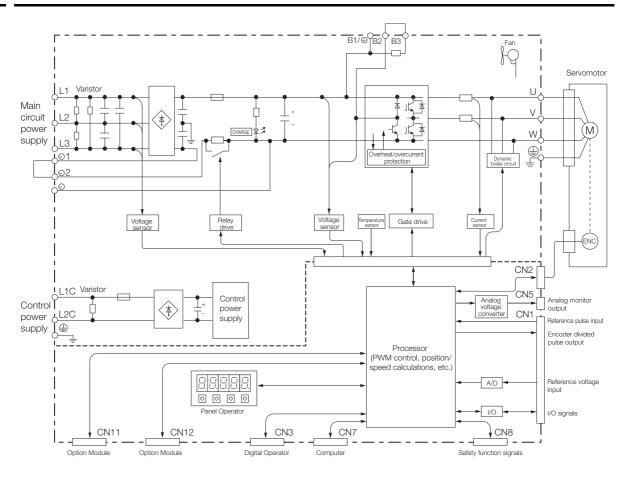


2.2.6 SGD7S-330A

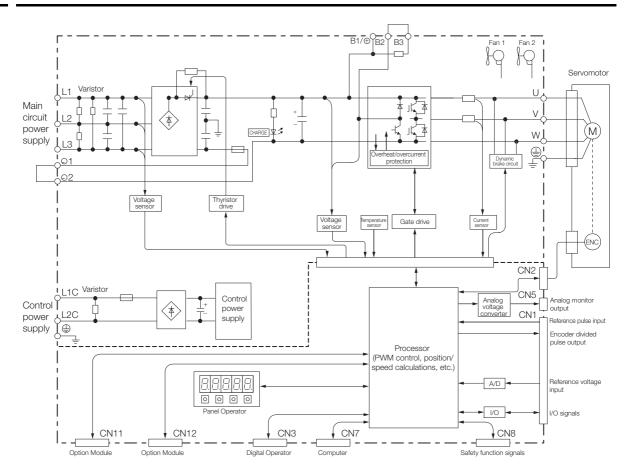


2.2.7 SGD7S-470A and -550A

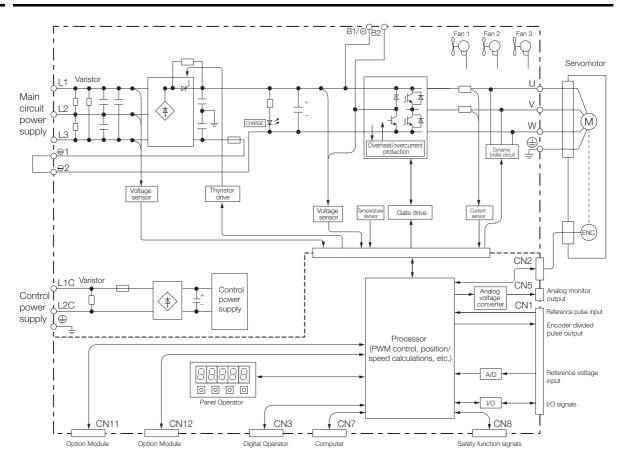


2.2.8 SGD7S-590A and -780A

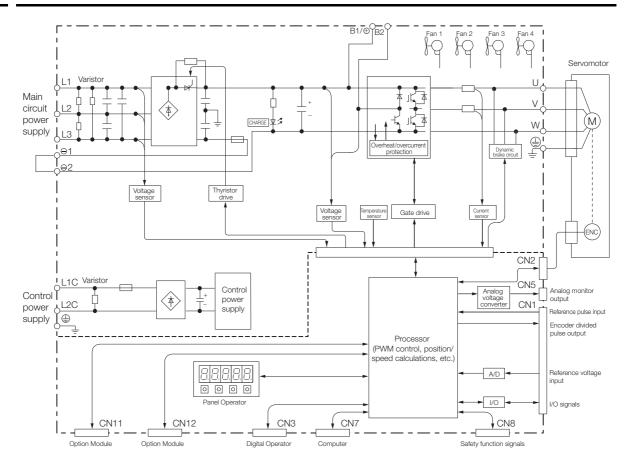

2.2.9 SGD7S-R70F, -R90F, and -2R1F

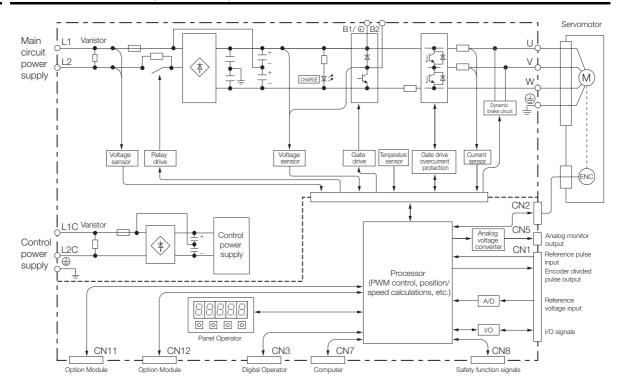

2.2.10 SGD7S-2R8F

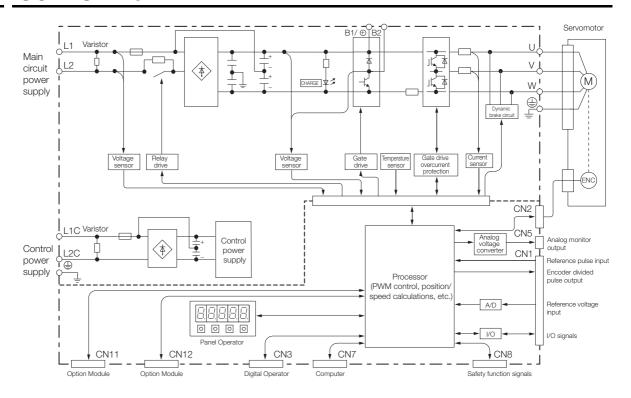

2.3.1 Front Cover Dimensions and Connector Specifications


2.3

External Dimensions

2.3.1 Front Cover Dimensions and Connector Specifications

The front cover dimensions and panel connector section are the same for all models. Refer to the following figures and table.

· Front Cover Dimensions

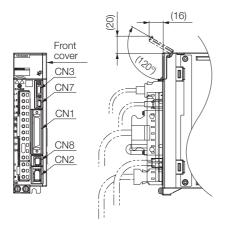

· Connector Specifications


Connector No.	Model	Number of Pins	Manufacturer
CN1	10250-59A3MB	50	3M Japan Limited
CN2	3E106-0220KV	6	3M Japan Limited
CN3	HDR-EC14LFDTN-SLD-PLUS	14	Honda Tsushin Kogyo Co., Ltd.
CN7	2172034-1	5	Tyco Electronics Japan G.K.
CN8	1981080-1	8	Tyco Electronics Japan G.K.

Note: The above connectors or their equivalents are used for the SERVOPACKs.


2.3.2 SERVOPACK External Dimensions

Base-mounted SERVOPACKs


• Three-phase, 200 VAC: SGD7S-R70A, -R90A, and -1R6A

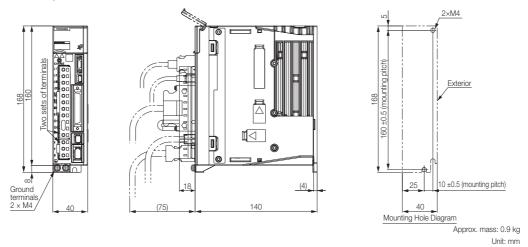

 Three-phase, 200 VAC: SGD7S-2R8A; Single-phase, 100 VAC: SGD7S-R70F, -R90F, and -2R1F

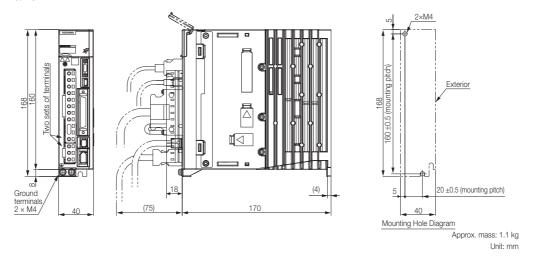


 Three-phase, 200 VAC: SGD7S-3R8A, -5R5A, and -7R6A; Single-phase, 100 VAC: SGD7S-2R8F

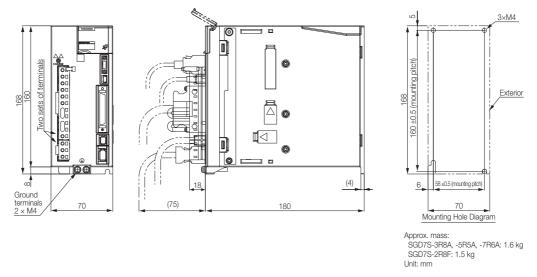


2.3.2 SERVOPACK External Dimensions


• Three-phase, 200 VAC: SGD7S-120A

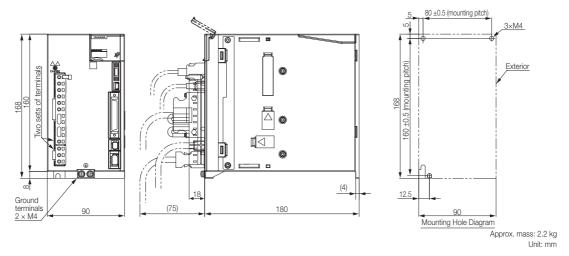


 Three-phase, 200 VAC: SGD7S-180A and -200A; Single-phase, 200 VAC: SGD7S-120A00A008

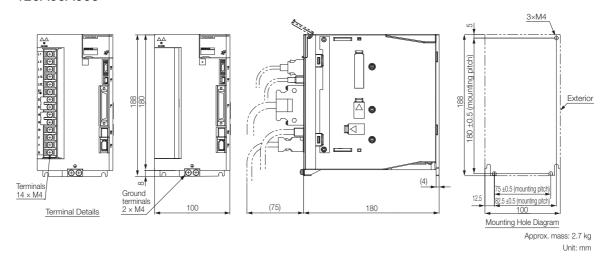


• Three-phase, 200 VAC: SGD7S-330A

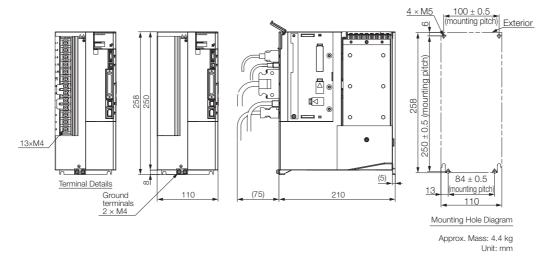

• Three-phase, 200 VAC: SGD7S-470A and -550A

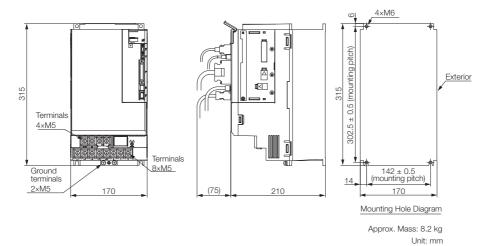


• Three-phase, 200 VAC: SGD7S-590A and -780A

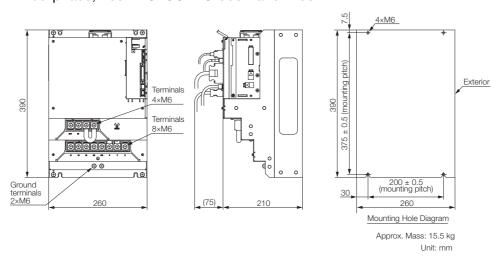


Rack-mounted SERVOPACKs

Hardware Option Code: 001


• Three-phase, 200 VAC: SGD7S-R70A, -R90A, and -1R6A

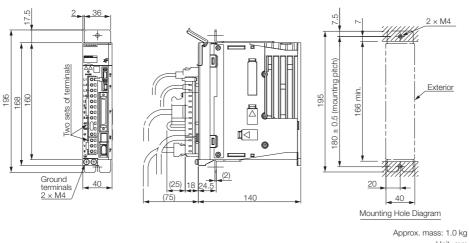


 Three-phase, 200 VAC: SGD7S-2R8A; Single-phase, 100 VAC: SGD7S-R70F, -R90F, and -2R1F

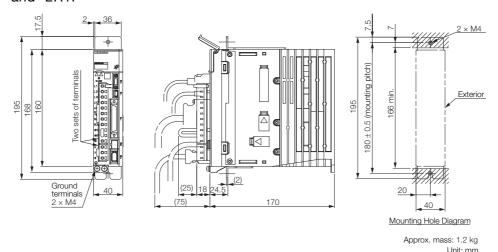

 Three-phase, 200 VAC: SGD7S-3R8A, -5R5A, and -7R6A; Single-phase, 100 VAC: SGD7S-2R8F

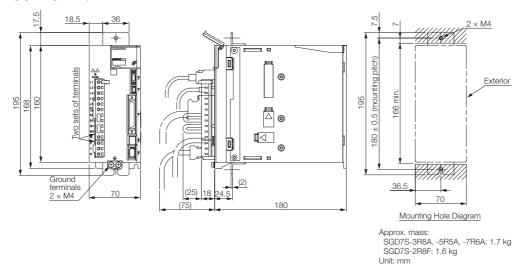


• Three-phase, 200 VAC: SGD7S-120A

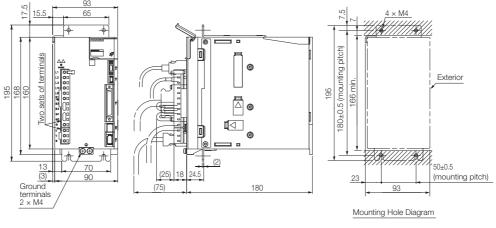


Approx. mass: 2.3 kg Unit: mm

• Three-phase, 200 VAC: SGD7S-180A and -200A

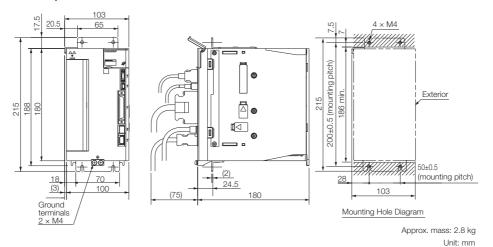

• Three-phase, 200 VAC: SGD7S-330A

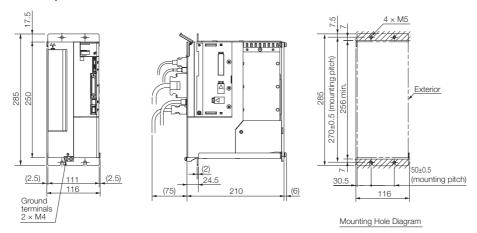


Approx. mass: 4.9 kg Unit: mm

Duct-ventilated SERVOPACKs

Hardware Option Code: 001


• Three-phase, 200 VAC: SGD7S-470A and -550A

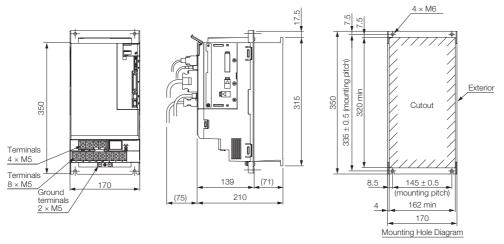

Approx. mass: 8.4 kg Unit: mm


Unit: mm

• Three-phase, 200 VAC: SGD7S-590A and -780A

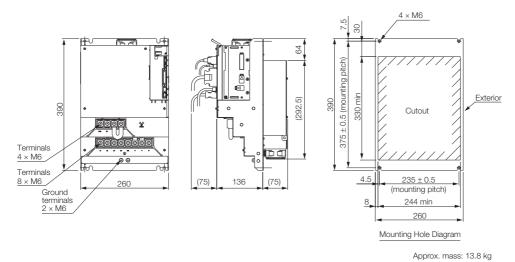

Examples of Standard Connections between SERVOPACKs and Peripheral Devices


Rotary Servomotors

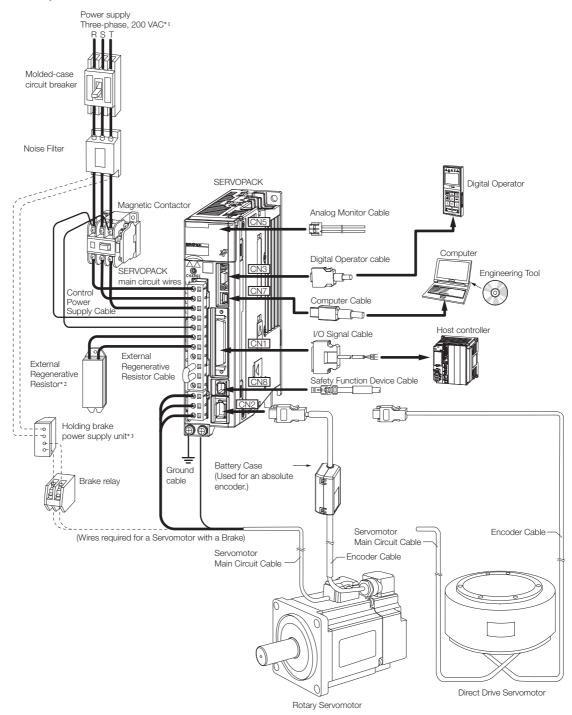

- *1. This example is for a SERVOPACK with a three-phase, 200-VAC power supply input. The pin layout of the main circuit connector depends on the voltage.
- *2. External Regenerative Resistors are not provided by Yaskawa.
- *3. The power supply for the holding brake is not provided by Yaskawa. Select a power supply based on the holding brake specifications.

If you use a 24-V brake, install a separate power supply for the 24-VDC power supply from other power supplies, such as the one for the I/O signals of the CN1 connector. If the power supply is shared, the I/O signals may malfunction.

· Linear Servomotor

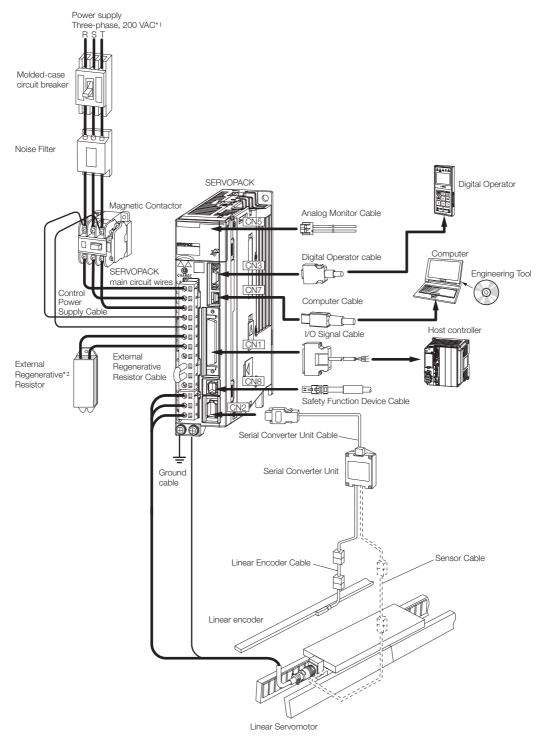

- *1. This example is for a SERVOPACK with a three-phase, 200-VAC power supply input. The pin layout of the main circuit connector depends on the voltage.
- *2. External Regenerative Resistors are not provided by Yaskawa.

SERVOPACK Installation

3

This chapter provides information on installing SERVO-PACKs in the required locations.

3.1	Installation Precautions 3-2				
3.2	Mounting Types and Orientation 3-3				
3.3	Mounting Hole Dimensions 3-4				
3.4	Mounting Interval3-6				
	 3.4.1 Installing One SERVOPACK in a Control Panel 3-6 3.4.2 Installing More Than One SERVOPACK in a Control Panel				
3.5	Monitoring the Installation Environment 3-7				
3.6	Derating Specifications				
3.7	EMC Installation Conditions3-9				

3.1

Installation Precautions

Refer to the following section for the ambient installation conditions. *2.1.3 Specifications* on page 2-7

■ Installation Near Sources of Heat

Implement measures to prevent temperature increases caused by radiant or convection heat from heat sources so that the ambient temperature of the SERVOPACK meets the ambient conditions.

■ Installation Near Sources of Vibration

Install a vibration absorber on the mounting surface of the SERVOPACK so that the SERVO-PACK will not be subjected to vibration.

■ Other Precautions

Do not install the SERVOPACK in a location subject to high temperatures, high humidity, water drops, cutting oil, excessive dust, excessive dirt, excessive iron powder, corrosive gasses, or radioactivity.


3.2 Mounting Types and Orientation

The SERVOPACKs come in the following mounting types: base-mounted, rack-mounted, and duct-ventilated types. Regardless of the mounting type, mount the SERVOPACK vertically, as shown in the following figures.


Also, mount the SERVOPACK so that the front panel is facing toward the operator.

Note: Prepare two to four mounting holes for the SERVOPACK and mount it securely in the mounting holes. (The number of mounting holes depends on the capacity of the SERVOPACK.)


Base-mounted SERVOPACK

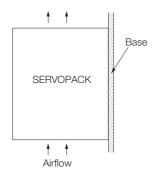

Rack-mounted SERVOPACK

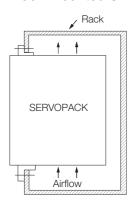

Duct-ventilated SERVOPACK

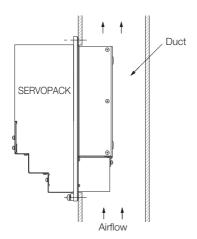


3.3

Mounting Hole Dimensions

Use mounting holes to securely mount the SERVOPACK to the mounting surface.

Note: To mount the SERVOPACK, you will need to prepare a screwdriver that is longer than the depth of the SERVOPACK.

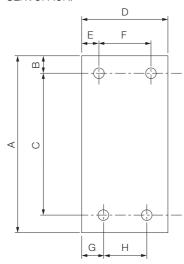

♦ Σ-7-series Mounting Hole Dimensions

SERVOPACK Model		Dimensions (mm)								Screw	Number
		Α	В	С	D	Е	F	G	Н	Size	of Screws
	R70A, R90A, 1R6A	168	5	160±0.5	40	35	-	25	_	M4	2
	2R8A, R70F, R90F, 2R1F	168	5	160±0.5	40	5	-	25	_	M4	2
	3R8A, 5R5A, 7R6A, 2R8F	168	5	160±0.5	70	6	58±0.5	64	_	M4	3
SGD7S-	120A	168	5	160±0.5	90	5	80±0.5	12.5	_	M4	3
	180A, 200A, 120A□□□008	188	5	180±0.5	100	95	-	12.5	75±0.5	M4	3
	330A	258	6	250±0.5	110	5	100±0.5	13	84±0.5	M5	4
	470A, 550A	315	6	302.5±0.5	170	14	142±0.5	14	142±0.5	M6	4
	590A, 780A	390	7.5	375±0.5	260	30	200±0.5	30	200±0.5	M6	4

lacktriangle Σ -V-series-Compatible Mounting Hole Dimensions

If you are replacing a Σ -V-Series SERVOPACK with a Σ -7-Series SERVOPACK, you can also use the mounting holes that were used for the Σ -V-Series SERVOPACK. Refer to the following table.

		Dimensions (mm)								Screw	Number
SERVO	SERVOPACK Model		В	С	D	Е	F	G	Н	Size	of Screws
	R70A, R90A, 1R6A	168	5	150±0.5	40	35	-	35	_	M4	2
	2R8A, R70F, R90F, 2R1F	168	5	150±0.5	40	5	-	35	_	M4	2
	3R8A, 5R5A, 7R6A, 2R8F	168	5	150±0.5	70	6	58±0.5	6	_	M4	3
SGD7S-	120A	168	5	150±0.5	90	5	80±0.5	5	-	M4	3
	180A, 200A, 120A□□□008	188	5	170±0.5	100	95	-	5	90±0.5	M4	3
	330A	250	6	238.5±0.5	110	5	100±0.5	5	100±0.5	M5	4
	470A, 550A, 590A, 780A	A spe		tachment is	require	ed. Co	ntact your	· Yaska	awa repres	sentative	for


3.4.1 Installing One SERVOPACK in a Control Panel

3.4

Mounting Interval

3.4.1 Installing One SERVOPACK in a Control Panel


Provide the following spaces around the SERVOPACK.

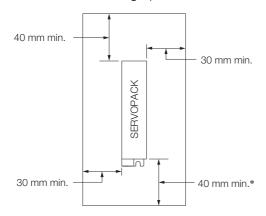

^{*} For this dimension, ignore items protruding from the main body of the SERVOPACK.

3.4.2 Installing More Than One SERVOPACK in a Control Panel

When multiple SERVOPACKs are installed close together in an enclosed space, natural convection may provide insufficient air circulation to distribute heat uniformly through the space, resulting in the air surrounding the SERVOPACKs to locally exceed the surrounding air temperature range. In this case, you must take measures to disperse the localized hot spots, such as by using fans. When using fans, install them as shown below.

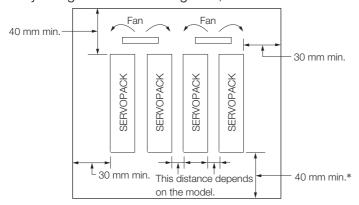

^{*} For this dimension, ignore items protruding from the main body of the SERVOPACK.

The space required on the right side of a SERVOPACK (when looking at the SERVOPACK from the front) depends on the SERVOPACK models. Refer to the following table.

SERVOPACK Model		Space on Right Side	Cooling Fan Installation Conditions 10 mm above SERVOPACK's Top Surface
SGD7S-	R70A, R90A, 1R6A, 2R8A, 3R8A, 5R5A, 7R6A, R70F, R90F, 2R1F, 2R8F	1 mm min.	Air speed: 0.5 m/s min.
	120A, 180A, 200A, 330A, 470A, 550A, 590A, 780A	10 mm min.	Air speed: 0.5 m/s min.

Note: When option modules are mounted on SERVOPACKs, the SERVOPACK installation conditions will depend on the option modules that are mounted. For details, refer to the manual for option module.

3.5 Monitoring the Installation Environment

You can use the SERVOPACK Installation Environment Monitor parameter to check the operating conditions of the SERVOPACK in the installation environment.

You can check the SERVOPACK installation environment monitor with either of the following methods.

- Using the SigmaWin+: Life Monitor Installation Environment Monitor SERVOPACK
- Panel Operator or Digital Operator: Un025 (Installation Environment Monitor [%])

Implement one or more of the following actions if the monitor value exceeds 100%.

- Lower the surrounding temperature.
- · Decrease the load.



The value of the SERVOPACK Installation Environment Monitor parameter will increase by about 10% for each 10°C increase in the ambient temperature.




Always observe the surrounding air temperature given in the SERVOPACK environment conditions. Even if the monitor value is 100% or lower, you cannot use a SERVOPACK in a location that exceeds the specified surrounding air temperature.

3.6


Derating Specifications

If you use the SERVOPACK at a surrounding air temperature of 55°C to 60°C or at an altitude of 1,000 m to 2,000 m, you must apply the derating rates given in the following graphs.

• SGD7S-R70A, -R90A, -1R6A, -2R8A, -R70F, -R90F, -2R1F, and -2R8F

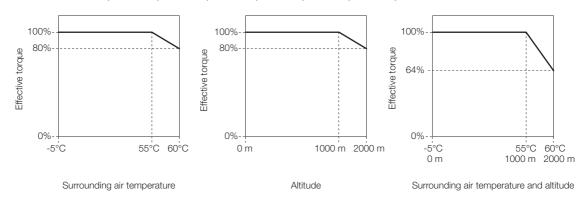

• SGD7S-3R8A, -5R5A, -7R6A, -120A, -180A, -200A, -330A, -470A, -550A, -590A, and -780A

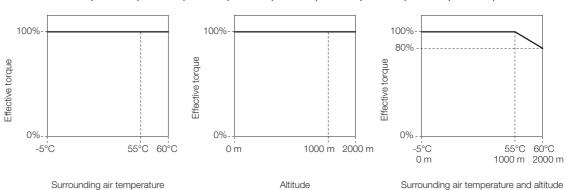

3.7 EMC Installation Conditions

This section gives the recommended installation conditions that were used for EMC certification testing.

The EMC installation conditions that are given here are the conditions that were used to pass testing criteria at Yaskawa. The EMC level may change under other conditions, such as the actual installation structure and wiring conditions. These Yaskawa products are designed to be built into equipment. Therefore, you must implement EMC measures and confirm compliance for the final equipment.


The compliant standards are EN 55011 group 1 class A, EN 61000-6-2, EN 61000-6-4, and EN 61800-3 (category C2, second environment).

WARNING

• In a domestic environment, this product may cause radio interference in which case supplementary mitigation measures may be required.


↑ CAUTION

- This equipment is not intended for use in residential environments and may not provide adequate protection to radio reception in such environments.
- Three-Phase, 200 VAC

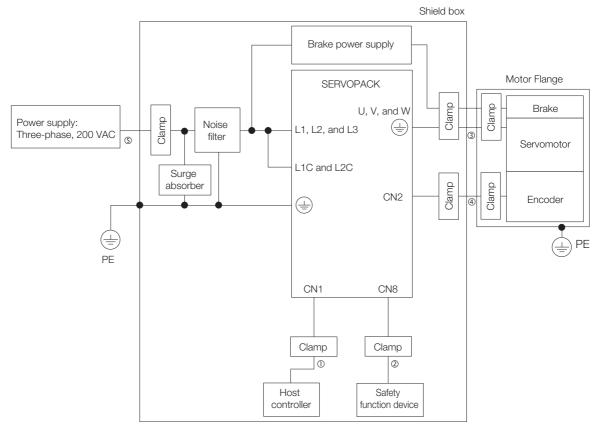


Symbol	Cable Name	Specification
1	I/O Signal Cable	Shielded cable
2	Safety Function Device Cable	Shielded cable
3	Servomotor Main Circuit Cable	Shielded cable
4	Encoder Cable	Shielded cable
(5)	Main Circuit Power Cable	Shielded cable

• Single-Phase, 200 VAC

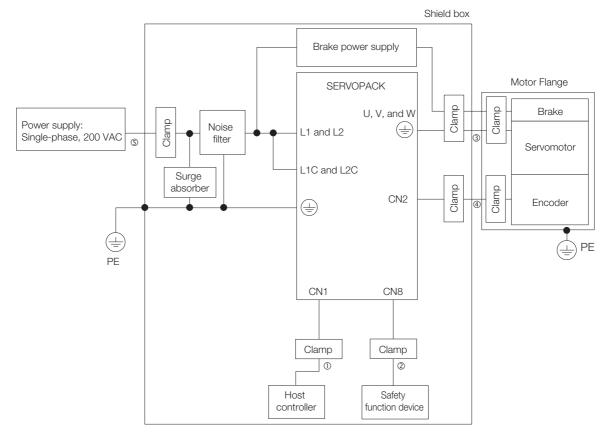

Symbol	Cable Name	Specification
1	I/O Signal Cable	Shielded cable
2	Safety Function Device Cable	Shielded cable
3	Servomotor Main Circuit Cable	Shielded cable
4	Encoder Cable	Shielded cable
(5)	Main Circuit Power Cable	Shielded cable

• Single-Phase, 100 VAC

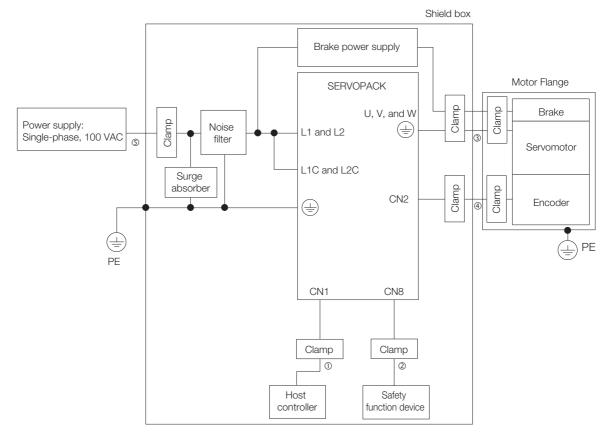

Symbol	Cable Name	Specification
①	I/O Signal Cable	Shielded cable
2	Safety Function Device Cable	Shielded cable
3	Servomotor Main Circuit Cable	Shielded cable
4	Encoder Cable	Shielded cable
(5)	Main Circuit Power Cable	Shielded cable

Wiring and Connecting SERVOPACKs

4

This chapter provides information on wiring and connecting SERVOPACKs to power supplies and peripheral devices.

4.1	Wiring	g and Connecting SERVOPACKs4-3
	4.1.1 4.1.2 4.1.3	General Precautions4-3Countermeasures against Noise4-5Grounding4-8
4.2	Basic	Wiring Diagrams4-9
4.3	Wiring	the Power Supply to the SERVOPACK 4-11
	4.3.1 4.3.2 4.3.3 4.3.4 4.3.5 4.3.6	Terminal Symbols and Terminal Names 4-11 Wiring Procedure for Main Circuit Connector 4-14 Power ON Sequence
4.4	Wiring	Servomotors
	4.4.1 4.4.2	Terminal Symbols and Terminal Names 4-25 Pin Arrangement of Encoder Connector (CN2)
	4.4.3 4.4.4	Wiring the SERVOPACK to the Encoder 4-26 Wiring the SERVOPACK to the Holding Brake 4-34

4.5	I/O S	ignal Connections4-35
	4.5.1	I/O Signal Connector (CN1) Names and Functions
	4.5.2	I/O Signal Connector (CN1) Pin Arrangement4-38
	4.5.3	I/O Signal Wiring Examples4-39
	4.5.4	I/O Circuits
4.6	Conn	ecting Safety Function Signals4-50
	4.6.1	Pin Arrangement of Safety Function Signals (CN8)
	4.6.2	I/O Circuits
4.7	Conn	ecting the Other Connectors 4-52
	4.7.1 4.7.2 4.7.3	Serial Communications Connector (CN3) 4-52 Computer Connector (CN7)

4.1 Wiring and Connecting SERVOPACKs

4.1.1 General Precautions

A DANGER

Do not change any wiring while power is being supplied.
 There is a risk of electric shock or injury.

MARNING

- Wiring and inspections must be performed only by qualified engineers. There is a risk of electric shock or product failure.
- Check all wiring and power supplies carefully.
 Incorrect wiring or incorrect voltage application to the output circuits may cause short-circuit failures. If a short-circuit failure occurs as a result of any of these causes, the holding brake will not work. This could damage the machine or cause an accident that may result in death or injury.
- Connect the AC and DC power supplies to the specified SERVOPACK terminals.
 - Connect an AC power supply to the L1, L2, and L3 terminals and the L1C and L2C terminals on the SERVOPACK.
 - Connect a DC power supply to the B1/⊕ and ⊕2 terminals and the L1C and L2C terminals on the SERVOPACK.

There is a risk of failure or fire.

 If you use a SERVOPACK with the Dynamic Brake Hardware Option, connect an External Dynamic Brake Resistor that is suitable for the machine and equipment specifications to the specified terminals.

There is a risk of unexpected operation, machine damage, burning, or injury when an emergency stop is performed.

4.1.1 General Precautions

M CAUTION

- Wait for at least six minutes after turning OFF the power supply (with a SERVOPACK for a 100-VAC power supply input, wait for at least nine minutes) and then make sure that the CHARGE indicator is not lit before starting wiring or inspection work. Do not touch the power supply terminals while the CHARGE lamp is lit because high voltage may still remain in the SERVOPACK even after turning OFF the power supply.
 There is a risk of electric shock.
- Observe the precautions and instructions for wiring and trial operation precisely as described in this document.

Failures caused by incorrect wiring or incorrect voltage application in the brake circuit may cause the SERVOPACK to fail, damage the equipment, or cause an accident resulting in death or injury.

- Check the wiring to be sure it has been performed correctly.
 Connectors and pin layouts are sometimes different for different models. Always confirm the pin layouts in technical documents for your model before operation.
 There is a risk of failure or malfunction.
- Connect wires to power supply terminals and motor connection terminals securely with the specified methods and tightening torque.
 Insufficient tightening may cause wires and terminal blocks to generate heat due to faulty contact, possibly resulting in fire.
- Use shielded twisted-pair cables or screened unshielded multi-twisted-pair cables for I/O Signal Cables and Encoder Cables.
- The maximum wiring length is 3 m for I/O Signal Cables, and 50 m for Encoder Cables or Servomotor Main Circuit Cables.
- Observe the following precautions when wiring the SERVOPACK's main circuit terminals.
 - Turn ON the power supply to the SERVOPACK only after all wiring, including the main circuit terminals, has been completed.
 - If a connector is used for the main circuit terminals, remove the main circuit connector from the SERVOPACK before you wire it.
 - Insert only one wire per insertion hole in the main circuit terminals.
 - When you insert a wire, make sure that the conductor wire (e.g., whiskers) does not come into contact with adjacent wires.
- Install molded-case circuit breakers and other safety measures to provide protection against short circuits in external wiring.

There is a risk of fire or failure.

NOTICE

- Whenever possible, use the Cables specified by Yaskawa.
 If you use any other cables, confirm the rated current and application environment of your model and use the wiring materials specified by Yaskawa or equivalent materials.
- Securely tighten cable connector screws and lock mechanisms.
 Insufficient tightening may result in cable connectors falling off during operation.
- Do not bundle power lines (e.g., the Main Circuit Cable) and low-current lines (e.g., the I/O Signal Cables or Encoder Cables) together or run them through the same duct. If you do not place power lines and low-current lines in separate ducts, separate them by at least 30 cm. If the cables are too close to each other, malfunctions may occur due to noise affecting the lowcurrent lines.
- Install a battery at either the host controller or on the Encoder Cable.

 If you install batteries both at the host controller and on the Encoder Cable at the same time, you will create a loop circuit between the batteries, resulting in a risk of damage or burning.
- When connecting a battery, connect the polarity correctly. There is a risk of battery rupture or encoder failure.



- Use a molded-case circuit breaker or fuse to protect the main circuit. The SERVOPACK connects directly to a commercial power supply; it is not isolated through a transformer or other device. Always use a molded-case circuit breaker or fuse to protect the servo system from accidents involving different power system voltages or other accidents.
- Install an earth leakage breaker. The SERVOPACK does not have a built-in ground fault protective circuit. To configure a safer system, install a ground fault detector against overloads and short-circuiting, or install a ground fault detector combined with a molded-case circuit breaker.
- Do not turn the power supply ON and OFF more than necessary.
 - Do not use the SERVOPACK for applications that require the power supply to turn ON and OFF frequently. Such applications will cause elements in the SERVOPACK to deteriorate.
 - After you have started actual operation, allow at least one hour between turning the power supply ON and OFF (as a guideline).

To ensure safe, stable application of the servo system, observe the following precautions when wiring.

• Use the cables specified by Yaskawa. Design and arrange the system so that each cable is as short as possible.

Refer to the following manual or catalog for information on the specified cables.

- \square AC Servo Drives Σ-7 Series (Catalog No.: KAEP S800001 23)
- Σ-7-Series Peripheral Device Selection Manual (Manual No.: SIEP S800001 32)
- The signal cable conductors are as thin as 0.2 mm² or 0.3 mm². Do not subject them to excessive bending stress or tension.

4.1.2 Countermeasures against Noise



The SERVOPACK is designed as an industrial device. It therefore provides no measures to prevent radio interference. The SERVOPACK uses high-speed switching elements in the main circuit. Therefore peripheral devices may be affected by switching noise.

If the equipment is to be used near private houses or if radio interference is a problem, take countermeasures against noise.

The SERVOPACK uses microprocessors. Therefore, it may be affected by switching noise from peripheral devices.


To prevent the noise from the SERVOPACK or the peripheral devices from causing malfunctions of any devices, take the following countermeasures against noise as required.

- Install the input reference device and Noise Filter as close to the SERVOPACK as possible.
- Always install a Surge Absorber for relays, solenoids, and Magnetic Contactor coils.
- Do not place the following cables in the same duct or bundle them together. Also, separate the cables from each other by at least 30 cm.
 - •Main Circuit Cables and I/O Signal Cables
 - •Main Circuit Cables and Encoder Cables
- Do not share the power supply with an electric welder or electrical discharge machine. If the SERVOPACK is placed near a high-frequency generator, install Noise Filters on the input side on the Main Circuit Power Supply Cable and Control Power Supply Cable even if the same power supply is not shared with the high-frequency generator. Refer to the following section for information on connecting Noise Filters.
 - Noise Filters on page 4-6
- Implement suitable grounding measures. Refer to the following section for information on grounding measures.
 - (3 4.1.3 Grounding on page 4-8

4.1.2 Countermeasures against Noise

Noise Filters

You must attach Noise Filters in appropriate places to protect the SERVOPACK from the adverse effects of noise. The following is an example of wiring for countermeasures against noise.

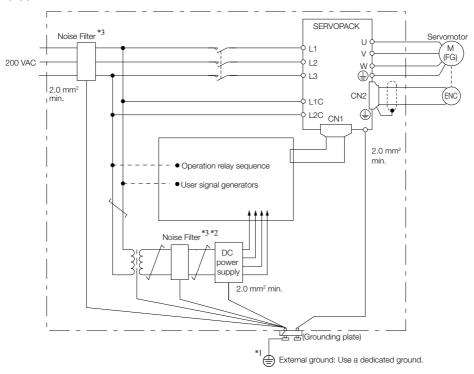

- *1. For the ground wire, use a wire with a thickness of at least 2.0 mm² (preferably, flat braided copper wire).
- *2. Whenever possible, use twisted-pair wires to wire all connections marked with
- *3. Refer to the following section for precautions when using Noise Filters.


 **Refer to the following section for precautions when using Noise Filters.

 **The process of the following section for precautions on page 4-7


Noise Filter Wiring and Connection Precautions

Always observe the following precautions when wiring or connecting Noise Filters.


• Separate input lines from output lines. Do not place input lines and output lines in the same duct or bundle them together.

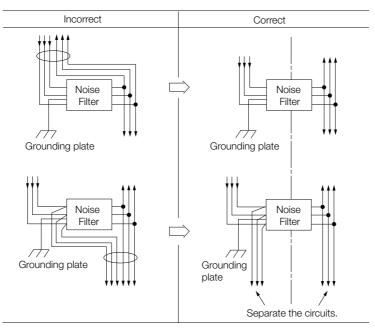

• Separate the Noise Filter ground wire from the output lines. Do not place the Noise Filter ground wire, output lines, and other signal lines in the same duct or bundle them together.

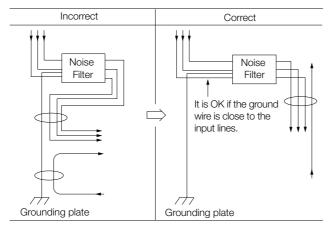


 Connect the Noise Filter ground wire directly to the grounding plate. Do not connect the Noise Filter ground wire to other ground wires.

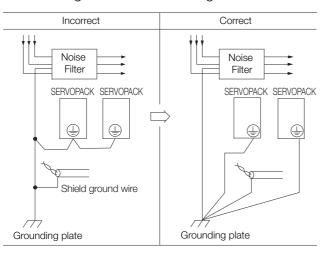

4.1.3 Grounding

• If a Noise Filter is located inside a control panel, first connect the Noise Filter ground wire and the ground wires from other devices inside the control panel to the grounding plate for the control panel, then ground the plate.

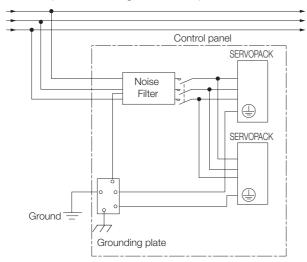

4.1.3 Grounding

Implement grounding measures as described in this section. Implementing suitable grounding measures will also help prevent malfunctions, which can be caused by noise.

Observe the following precautions when wiring the ground cable.

- Ground the SERVOPACK to a resistance of 100 Ω or less.
- Be sure to ground at one point only.
- Ground the Servomotor directly if the Servomotor is insulated from the machine.

Motor Frame Ground or Motor Ground

If you ground the Servomotor through the machine, a current resulting from switching noise can flow from the main circuit of the SERVOPACK through the stray capacitance of the Servomotor. To prevent this, always connect the FG terminal of the Servomotor Main Circuit Cable connected to the Servomotor to the ground terminal $\textcircled{\oplus}$ on the SERVOPACK. Also be sure to ground the ground terminal $\textcircled{\oplus}$. Always connect the shield wire of the Encoder Cable connected to the Servomotor to the connector case (shell).


Ground both the Moving Coil and Magnetic Way of a Linear Servomotor.

Noise on I/O Signal Cables

If noise enters the I/O Signal Cable, connect the shield of the I/O Signal Cable to the connector shell to ground it. If the Servomotor Main Circuit Cable is placed in a metal conduit, ground the conduit and its junction box. For all grounding, ground at one point only.

4.2 Basic Wiring Diagrams

This section provide the basic wiring diagrams. Refer to the reference sections given in the diagrams for details.

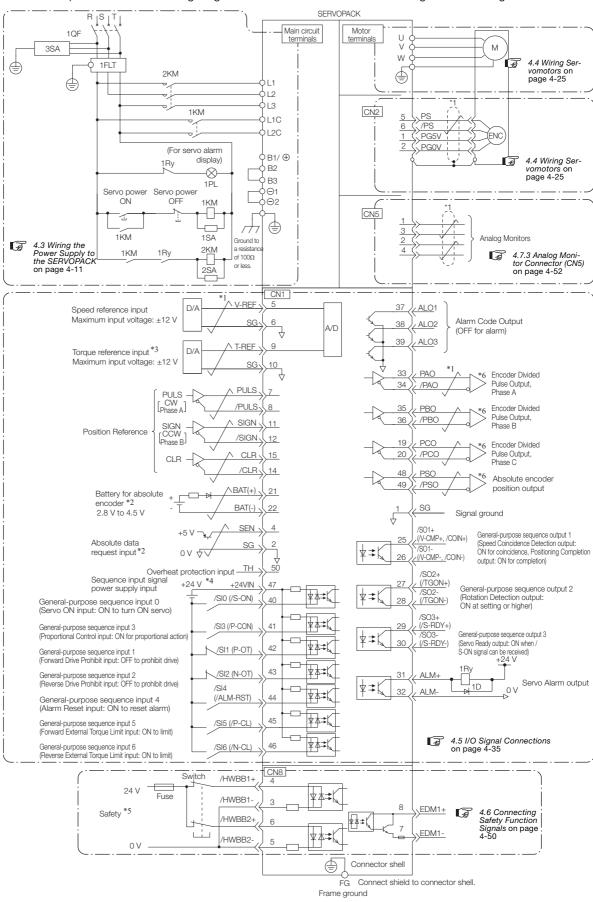

- *1. represents twisted-pair wires.
 *2. Connect these when using an absolute encoder. If the Encoder Cable with a Battery Case is connected, do not connect a backup battery.
- *3. You can enable this function with a parameter setting.
- *4. The 24-VDC power supply is not provided by Yaskawa. Use a 24-VDC power supply with double insulation or reinforced insulation.
- *5. Refer to the following chapter if you use a safety function device.

Chapter 11 Safety Functions

If you do not use the safety function, insert the Safety Jumper Connector (provided as an accessory) into CN8 when you use the SERVOPACK.

- *6. Always use line receivers to receive the output signals.
- Note: 1. If you use a 24-V brake, install a separate power supply for the 24-VDC power supply from other power supplies, such as the one for the I/O signals of the CN1 connector. If the power supply is shared, the I/O signals may malfunction.
 - 2. Default settings are given in parentheses.

Wiring the Power Supply to the SERVOPACK

Refer to the following manual or catalog for information on cables and peripheral devices.

- AC Servo Drives Σ-7 Series (Catalog No.: KAEP S800001 23)
- Σ-7-Series Peripheral Device Selection Manual (Manual No.: SIEP S800001 32)

Terminal Symbols and Terminal Names 4.3.1

Use the main circuit connector on the SERVOPACK to wire the main circuit power supply and control circuit power supply to the SERVOPACK.

CAUTION

• Wire all connections correctly according to the following table and specified reference information. There is a risk of SERVOPACK failure or fire if incorrect wiring is performed.

The SERVOPACKs have the following four types of main circuit power supply input specifications.

- Information 1. For the single-phase, 100 VAC power supply input specification, only a single-phase AC power supply can be connected to the control power supply terminals.
 - 2. For the other main circuit power supply input specifications, excluding the single-phase, 100 VAC power supply input specification, a single-phase AC power supply or a DC power supply can be connected to the control power supply terminals.

• Three-Phase, 200-VAC Power Supply Input

Terminal Symbols	Terminal Name	Specifications and Reference			
L1, L2, L3	Main circuit power supply input terminals for AC power supply input	Three-phase, 200 VAC to 240 VAC, -15% to +10%, 50 Hz/60 Hz			
	Control power supply	AC power supply	Single-phase, 200 VAC to 240 VAC, -15% to +10%, 50 Hz/60 Hz		
L1C, L2C	Control power supply terminals	DC power supply	L1C: 270 VDC to 324 VDC, -15% to +10%, L2C: 0 VDC or L2C: 270 VDC to 324 VDC, -15% to +10%, L1C: 0 VDC		
		€ 4.3.5 V	Viring Regenerative Resistors on page 4-22		
	Regenerative Resistor terminals	■ For SGD7S-R70A, -R90A, -1R6A, and -2R8A If the regenerative capacity is insufficient, connect an External Regenerative Resistor between B1/⊕ and B2. The External Regenerative Resistor is not included. Obtain it separately.			
B1/⊕, B2, B3		■ For SGD7S-3R8A, - 5R5A, -7R6A, -120A, -180A, -200A, and -330A If the internal regenerative resistor is insufficient, remove the lead or short bar between B2 and B3 and connect an External Regenerative Resistor between B1/⊕ and B2. The External Regenerative Resistor is not included. Obtain it separately.			
		■ For SGD7S-470A, -550A, -590A, and -780A Connect a Regenerative Resistor Unit between B1/⊕ and B2. Obtain a Regenerative Resistor Unit separately. These models on thave a B3 terminal.			
·	DC Reactor terminals	€ 4.3.6 V	Viring Reactors for Harmonic Suppression on page 4-24		
⊖1, ⊖2	for power supply har- monic suppression		inals are used to connect a DC Reactor for power supply suppression.		
\ominus	_	None. (Do	not connect anything to this terminal.)		

4.3.1 Terminal Symbols and Terminal Names

• Single-Phase, 200-VAC Power Supply Input

Terminal Symbols	Terminal Name	Specifications and Reference			
L1, L2	Main circuit power supply input terminals for AC power supply input	Single-phase, 200 VAC to 240 VAC, -15% to +10%, 50 Hz/60 Hz			
	Control nower supply	AC power supply	Single-phase, 200 VAC to 240 VAC, -15% to +10%, 50 Hz/60 Hz		
L1C, L2C	Control power supply terminals	DC power	L1C: 270 VDC to 324 VDC, -15% to +10%, L2C: 0 VDC		
		supply	or L2C: 270 VDC to 324 VDC, -15% to +10%, L1C: 0 VDC		
B1/⊕, B2, B3	Regenerative Resistor terminals	4.3.5 Wiring Regenerative Resistors on page 4-22			
		■ For SGD7S-R70A, -R90A, -1R6A, and -2R8A If the regenerative capacity is insufficient, connect an External Regenerative Resistor between B1/⊕ and B2. The External Regenerative Resistor is not included. Obtain it separately.			
		If the inte or short be erative Re	7S-5R5A and 120A□0A008 rnal regenerative resistor is insufficient, remove the lead par between B2 and B3 and connect an External Regenerative between B1/⊕ and B2. rnal Regenerative Resistor is not included. Obtain it sepa-		
	DC Reactor terminals	€ 4.3.6 V	/iring Reactors for Harmonic Suppression on page 4-24		
⊝1, ⊝2	for power supply har- monic suppression	These terminals are used to connect a DC Reactor for power supply harmonic suppression.			
L3, ⊖	_	None. (Do	not connect anything to these terminals.)		

You can use a single-phase, 200-VAC power supply input with the following models.

• SGD7S-R70A, -R90A, -1R6A, -2R8A, -5R5A

If you use a single-phase, 200-VAC power supply input for the SERVOPACK's main circuit power supply, set parameter Pn00B to n. \$\sim\$1\$\subseteq\$ (Use a three-phase power supply input as a single-phase power supply input). Refer to the following section for details.

5.3.2 Single-phase AC Power Supply Input/Three-phase AC Power Supply Input Setting on page 5-15

Information

You do not need to change the setting of Pn00B to n.□1□□ (Use a three-phase power supply input as a single-phase power supply input) for a SERVOPACK with a single-phase 200-VAC power supply input (model numbers: SGD7S-120A□□□008).

• DC Power Supply Input

Terminal Symbols	Terminal Name	Specifications and Reference	
L1C, L2C	Control power supply terminals	AC power supply	Single-phase, 200 VAC to 240 VAC, -15% to +10%, 50 Hz/60 Hz
		DC power supply	L1C: 270 VDC to 324 VDC, -15% to +10%, L2C: 0 VDC or L2C: 270 VDC to 324 VDC, -15% to +10%, L1C: 0 VDC
B1/⊕	Main circuit power	270 VDC to 324 VDC, -15% to +10%	
⊝2	supply input terminals for DC power supply input	0 VDC	
L1, L2, L3, B2, B3, ⊝1, ⊝	-	None. (Do not connect anything to these terminals.)	
		Note: 1. SGD7S-470A to 780A do not have a B3 terminal. 2. SGD7S-330A to 780A do not have a ⊖ terminal.	

If you use a DC power supply input to the SERVOPACK, make sure to set parameter Pn00E to n. \$\square\$ 1 (DC power supply input supported) before inputting the power supply. Refer to the following section for details.

5.3.1 AC Power Supply Input/DC Power Supply Input Setting on page 5-14

• Single-Phase, 100-VAC Power Supply Input

Terminal Symbols	Terminal Name	Specifications and Reference
L1, L2	Main circuit power supply input terminals for AC power supply input	Single-phase, 100 VAC to 120 VAC, -15% to +10%, 50 Hz/60 Hz
L1C, L2C	Control power supply terminals	Single-phase, 100 VAC to 120 VAC, -15% to +10%, 50 Hz/60 Hz
B1, B2		4.3.5 Wiring Regenerative Resistors on page 4-22
	Regenerative Resistor termi-	If the regenerative capacity is insufficient, connect an External
	nals	Regenerative Resistor between B1/⊕ and B2. The External Regenerative Resistor is not included. Obtain it separately.


You can use a single-phase, 100-VAC power supply input with the following models.
• SGD7S-R70F, -R90F, -2R1F, and -2R8F

4.3.2 Wiring Procedure for Main Circuit Connector


· Required Items

Required Item	Remarks
Spring Opener or Flat- blade Screwdriver	 Spring Opener SERVOPACK accessory (You can also use model 1981045-1 from Tyco Electronics Japan G.K.)
biade Sciewdriver	Flat-blade screwdriver Commercially available screwdriver with tip width of 3.0 mm to 3.5 mm


1. Remove the main circuit connector and motor connector from the SERVOPACK.

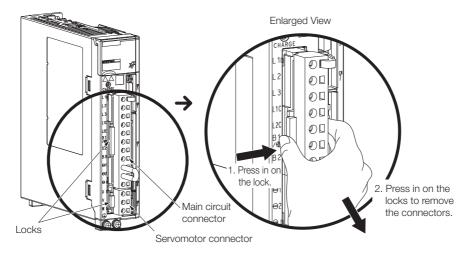

2. Remove the sheath from the wire to connect.

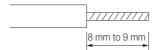

3. Open the wire insertion hole on the terminal connector with the tool. There are the following two ways to open the insertion hole. Use either method.

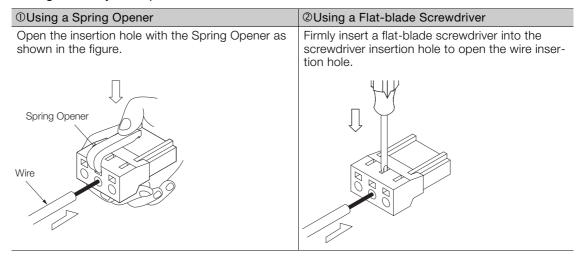


- **4.** Insert the conductor into the wire insertion hole. Then, remove the Spring Opener or flat-blade screwdriver.
- 5. Make all other connections in the same way.
- 6. When you have completed wiring, attach the connectors to the SERVOPACK.

4.3.3 Power ON Sequence

Consider the following points when you design the power ON sequence.

• The ALM (Servo Alarm) signal is output for up to five seconds when the control power supply is turned ON. Take this into consideration when you design the power ON sequence, and turn ON the main circuit power supply to the SERVOPACK when the ALM signal is OFF (alarm cleared).

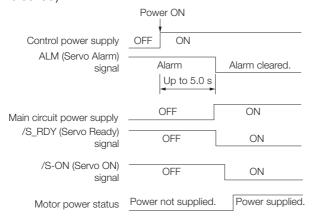


Information

If the servo ON state cannot be achieved by turning ON the /S_ON signal, the /S_RDY signal is not ON. Check the status of the /S_RDY signal. Refer to the following section for details.

6.1.7 /S-RDY (Servo Ready) Signal on page 6-12

• If you use a DC power supply input with any of the following SERVOPACKs, use the power ON sequence shown below: SGD7S-330A, -470A, -550A, -590A, or -780A.

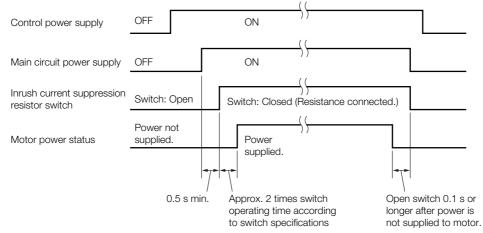

- Design the power ON sequence so that main circuit power supply is turned OFF when an ALM (Servo Alarm) signal is output.
- Make sure that the power supply specifications of all parts are suitable for the input power supply.
- Allow at least 1 s after the power supply is turned OFF before you turn it ON again.




Turn ON the control power supply before the main circuit power supply or turn ON the control power supply and the main circuit power supply at the same time. Turn OFF the main circuit power supply first, and then turn OFF the control power supply.

MARNING


 Even after you turn OFF the power supply, a high residual voltage may still remain in the SERVOPACK. To prevent electric shock, do not touch the power supply terminals after you turn OFF the power. When the voltage is discharged, the CHARGE indicator will turn OFF.
 Make sure the CHARGE indicator is OFF before you start wiring or inspection work.

Using Only One SERVOPACK


Wiring Example for Three-Phase, 200-VAC Power Supply Input: SGD7S-R70A, -R90A, -1R6A, -2R8A, -3R8A, -5R5A, -7R6A, -120A, -180A, -200A, and -330A

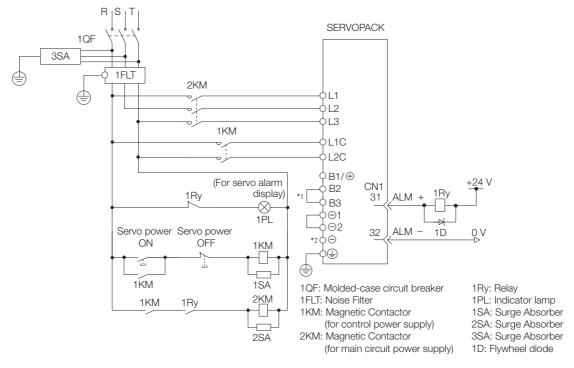

- *1. You do not have to connect B2 and B3 for the following models: SGD7S-R70A, SGD7S-R90A, SGD7S-1R6A, and SGD7S-2R8A. Do not connect them.
- *2. A SGD7S-330A SERVOPACK does not have a terminal.
- Wiring Example for Three-Phase, 200-VAC Power Supply Input: SGD7S-470A, -550A, -590A, and -780A

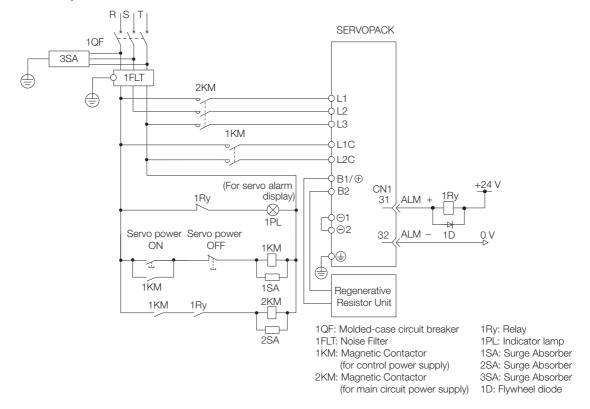


• Wiring Example for Single-Phase, 200-VAC Power Supply Input

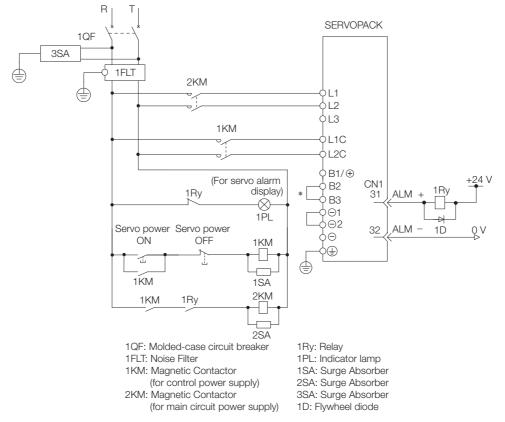


^{*} You do not have to connect B2 and B3 for the following models: SGD7S-R70A, SGD7S-R90A, SGD7S-1R6A, and SGD7S-2R8A. Do not connect them.

Wiring Example for DC Power Supply Input: SGD7S-R70A, -R90A, -1R6A, -2R8A, -3R8A, -5R5A, -7R6A, -120A, -180A, and -200A

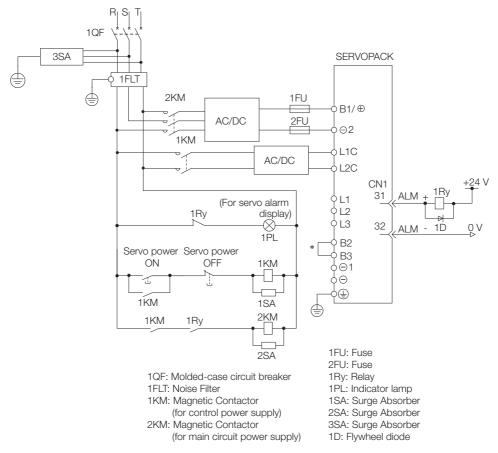

^{*} You do not have to connect B2 and B3 for the following models: SGD7S-R70A, SGD7S-R90A, SGD7S-1R6A, and SGD7S-2R8A. Do not connect them.

• Wiring Example for DC Power Supply Input: SGD7S-330A, -470A, -550A, -590A, and -780A

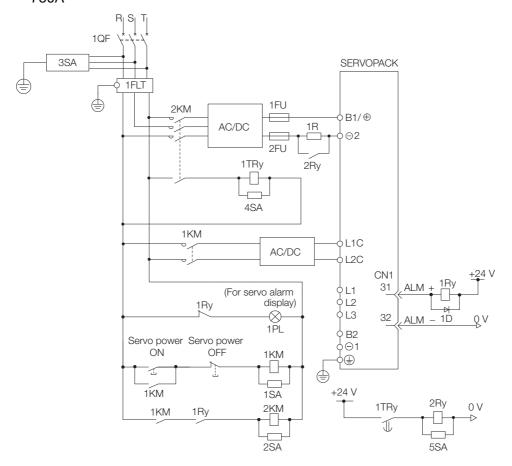

1QF: Molded-case circuit breaker

1FLT: Noise Filter

1KM: Magnetic Contactor (for control power supply)

2KM: Magnetic Contactor (for main circuit power supply, auxiliary contact)

1FU: Fuse, positive side

2FU: Fuse, negative side

1Ry: Relay

2Ry: Relay (for inrush current suppression resistor switch)

1TRy: Timer relay 1PL: Indicator lamp 1SA: Surge Absorber

2SA: Surge Absorber


3SA: Surge Absorber 4SA: Surge Absorber

5SA: Surge Absorber

1D: Flywheel diode

1R: External inrush current suppression resistor

• Wiring Example for Single-Phase, 100-VAC Power Supply Input: SGD7S-R70F, -R90F, -2R1F, or -2R8F

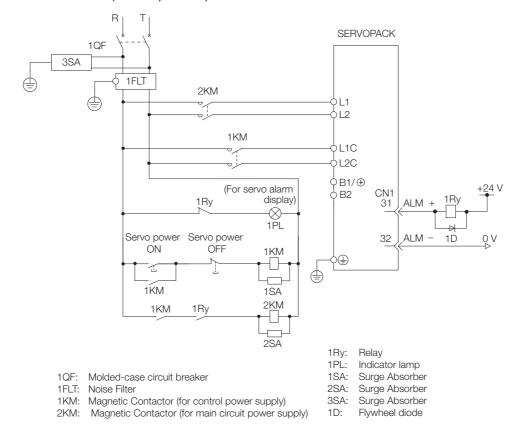


Using More Than One SERVOPACK

Connect the ALM (Servo Alarm) output for these SERVOPACKs in series to operate the alarm detection relay (1RY).

When a SERVOPACK alarm is activated, the ALM output signal transistor turns OFF.

The following diagram shows the wiring to stop all of the Servomotors when there is an alarm for any one SERVOPACK.

More than one SERVOPACK can share a single Noise Filter. However, always select a Noise Filter that has a large enough capacity to handle the total power supply capacity of all the SERVOPACKs. Be sure to consider the load conditions.

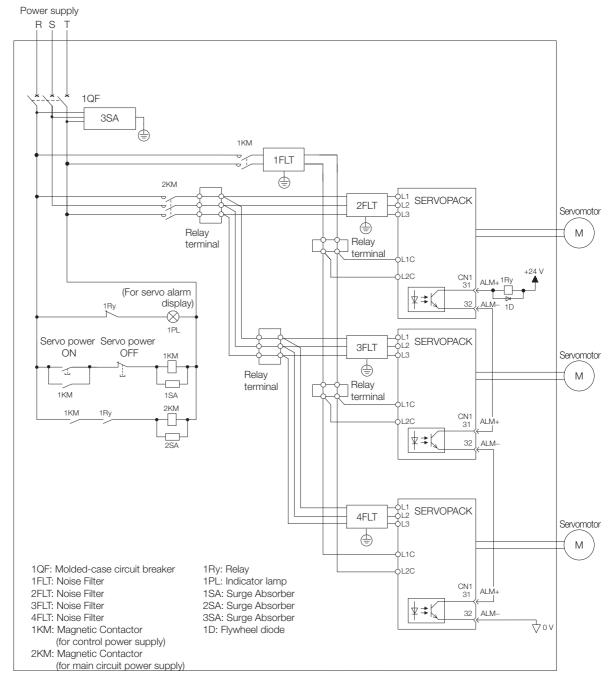

To comply with UL/cUL standards, you must install a branch circuit protective device at the power supply input section to each SERVOPACK. Refer to the following manual for details. \square Σ -7-Series Σ -7S/ Σ -7W/ Σ -7C SERVOPACK Safety Precautions (Manual No.:TOMP C710828 00)

4.3.5 Wiring Regenerative Resistors

This section describes how to connect External Regenerative Resistors.

Refer to the following manual to select the capacity of a Regenerative Resistor.


 \square Σ -7-Series Peripheral Device Selection Manual (Manual No.: SIEP S800001 32)

MARNING


Be sure to wire Regenerative Resistors correctly. Do not connect B1/⊕ and B2.
 Doing so may result in fire or damage to the Regenerative Resistor or SERVOPACK.

Connecting Regenerative Resistors


- ◆ SERVOPACK Models SGD7S-R70A, -R90A, -1R6A, -2R8A, -R70F, -R90F, -2R1F, and -2R8F
- Connect the External Regenerative Resistor between the B1/⊕ and B2 terminals on the SERVOPACK.

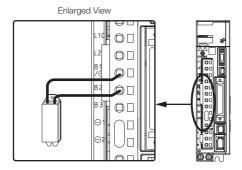

- 2. Set Pn600 (Regenerative Resistor Capacity) and Pn603 (Regenerative Resistance). Refer to the following section for details on the settings.
 5.19 Setting the Regenerative Resistor Capacity on page 5-58
- ◆ SERVOPACK Models SGD7S-3R8A, -5R5A, -7R6A, -120A, -180A, -200A, and -330A
- 1. Remove the lead from between the B2 and B3 terminals on the SERVOPACK.

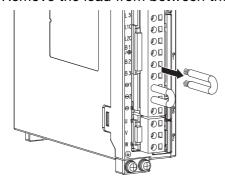


2. Connect the External Regenerative Resistor between the B1/⊕ and B2 terminals.

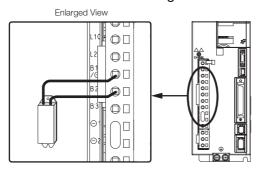

- 3. Set Pn600 (Regenerative Resistor Capacity) and Pn603 (Regenerative Resistance). Refer to the following section for details on the settings.

 5.19 Setting the Regenerative Resistor Capacity on page 5-58
- ◆ SERVOPACK Models SGD7S-470A, -550A, -590A, and -780A
- 1. Connect the R1 and R2 terminals on the Regenerative Resistor Unit to the B1/⊕ and B2 terminals on the SERVOPACK.

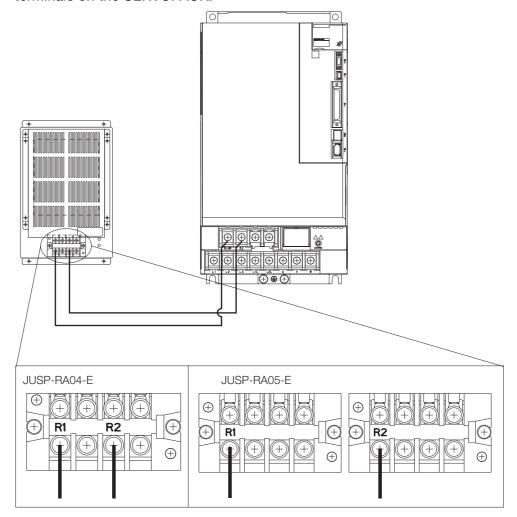

- 2. Set Pn600 (Regenerative Resistor Capacity) and Pn603 (Regenerative Resistance) as required.
 - When using the Yaskawa-recommended Regenerative Resistor Unit, use the default settings for Pn600 and Pn603.
 - If you use any other external regenerative resistor, set Pn600 and Pn603 according to the specifications of the regenerative resistor.

Refer to the following section for details on the settings.


5.19 Setting the Regenerative Resistor Capacity on page 5-58

4.3.6 Wiring Reactors for Harmonic Suppression

You can connect a reactor for harmonic suppression to the SERVOPACK when power supply harmonic suppression is required. Refer to the following manual for details on reactors for harmonic suppression.

Σ-7-Series Peripheral Device Selection Manual (Manual No.: SIEP S800001 32)

Refer to the following figures to connect reactors.

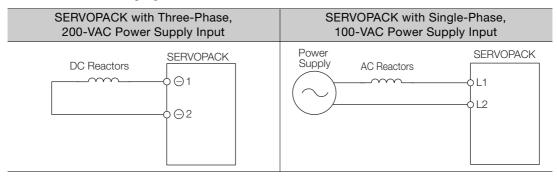

Note: 1. Connection terminals \ominus 1 and \ominus 2 for a DC Reactor are connected when the SERVOPACK is shipped. Remove the lead wire and connect a DC Reactor.

- 2. Reactors are optional products. (Purchase them separately.)
- 3. You cannot connect a DC Reactor to a SERVOPACK with a single-phase, 100-VAC power supply input.

4.4 Wiring Servomotors

4.4.1 Terminal Symbols and Terminal Names

The SERVOPACK terminals or connectors that are required to connect the SERVOPACK to a Servomotor are given below.

Terminal/Connector Symbols	Terminal/Connector Name	Remarks
U, V, and W	Servomotor terminals	Refer to the following section for the wiring procedure. 4.3.2 Wiring Procedure for Main Circuit Connector on page 4-14
	Ground terminal	-
CN2	Encoder connector	_

4.4.2 Pin Arrangement of Encoder Connector (CN2)

· When Using a Rotary Servomotor

Pin No.	Signal	Function		
1	PG5V	Encoder power supply +5 V		
2	PG0V	Encoder power supply 0 V		
3	BAT (+)*	Battery for absolute encoder (+)		
4	BAT (-)*	Battery for absolute encoder (-)		
5	PS	Serial data (+)		
6	/PS	Serial data (-)		
Shell	Shield	-		

^{*} No wiring is required for an incremental encoder or a batteryless absolute encoder.

· When Using a Direct Drive Servomotor

Pin No.	Signal	al Function				
1	PG5V	Encoder power supply +5 V				
2	PG0V	Encoder power supply 0 V				
3	_	- (Do not use.)				
4	_	- (Do not use.)				
5	PS	Serial data (+)				
6	/PS	Serial data (-)				
Shell	Shield	_				

• When Using a Linear Servomotor

Pin No.	Signal	Function
1	PG5V	Linear encoder power supply +5 V
2	PG0V	Linear encoder power supply 0 V
3	_	- (Do not use.)
4	_	- (Do not use.)
5	PS	Serial data (+)
6	/PS	Serial data (-)
Shell	Shield	_

4.4.3 Wiring the SERVOPACK to the Encoder


When Using an Absolute Encoder

If you use an absolute encoder, use an Encoder Cable with a JUSP-BA01-E Battery Case or install a battery on the host controller.

Refer to the following section for the battery replacement procedure.

12.1.3 Replacing the Battery on page 12-3


· Wiring Example When Using an Encoder Cable with a Battery Case

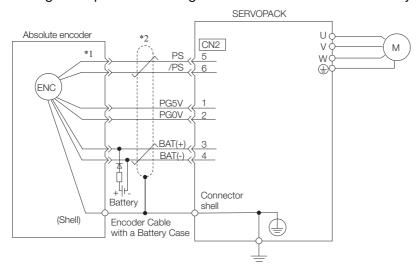

*1. The absolute encoder pin numbers for wiring the connector depend on the Servomotor that you use.



· Wiring Example When Installing a Battery on the Host Controller

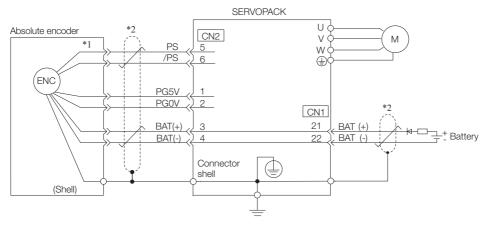

*1. The absolute encoder pin numbers for wiring the connector depend on the Servomotor that you use.




- When Installing a Battery on the Encoder Cable
 Use the Encoder Cable with a Battery Case that is specified by Yaskawa.
 Refer to the following manual for details.
- Σ-7-Series Peripheral Device Selection Manual (Manual No.: SIEP S800001 32)
- When Installing a Battery on the Host Controller Insert a diode near the battery to prevent reverse current flow.

Circuit Example

Required Component Specifications

- Schottky Diode Reverse Voltage: Vr ≥ 40 V Forward Voltage: Vf ≤ 0.37 V Reverse current: Ir ≤ 5 µA Junction temperature: Tj ≥ 125°C
- Resistor Resistance: 22 Ω Tolerance: $\pm 5\%$ max. Rated power: 0.25 W min.

When Using an Incremental Encoder or Batteryless Absolute Encoder

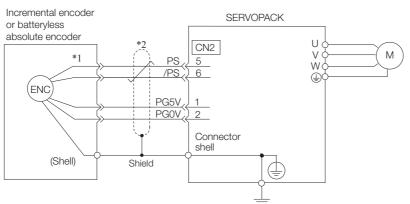

- *1. The encoder pin numbers for wiring the connector depend on the Servomotor that you use.
- *2. represents a shielded twisted-pair cable.


4.4.3 Wiring the SERVOPACK to the Encoder

When Using an Absolute Linear Encoder

The wiring depends on the manufacturer of the linear encoder.

Connections to Linear Encoder from Dr. JOHANNES HEIDENHAIN GmbH

■ LIC4100 Series, LIC2100 Series, LC115, and LC415

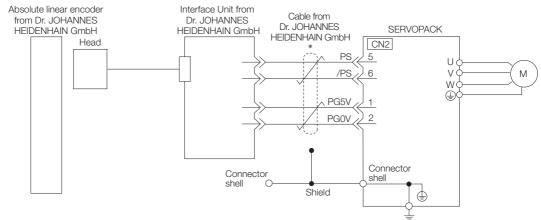


* represents a shielded twisted-pair cable.

Information


Sales of the interface unit EIB3391Y with the LIC4100 and LIC2100 series have ended due to the release of the LIC4190, LIC3190, and LIC2190 series.

■ LIC4190, LIC3190, and LIC2190 Series

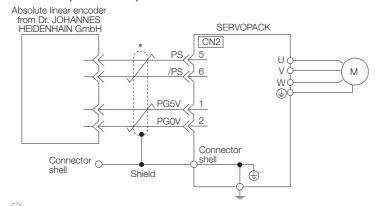


* represents a shielded twisted-pair cable.

◆ Connections to Linear Encoder from RSF Elektronik GmbH

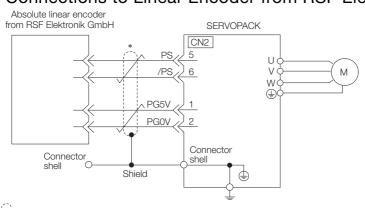


◆ Connections to Linear Encoder from Mitutoyo Corporation

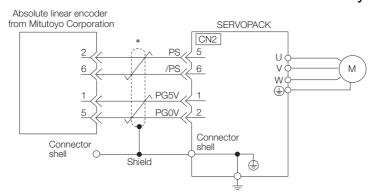


* represents a shielded twisted-pair cable.

◆ Connections to Absolute Linear Encoder from Renishaw PLC

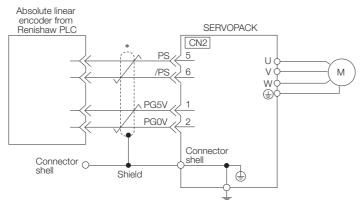


* represents a shielded twisted-pair cable.

Connections to Linear Encoder from RLS d.o.o.

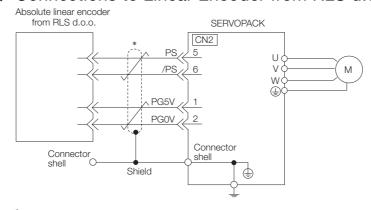


4.4.3 Wiring the SERVOPACK to the Encoder


◆ Connections to Absolute Linear Encoder from Magnescale Co., Ltd.

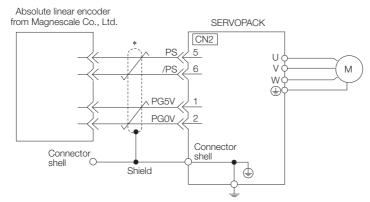

- * represents a shielded twisted-pair cable.
- Connections to Absolute Linear Encoder from Fagor Automation S. Coop.

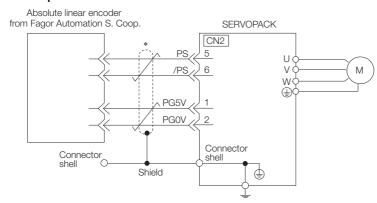


- * represents a shielded twisted-pair cable.
- ◆ Connections to Absolute Linear Encoder from Canon Precision Inc.

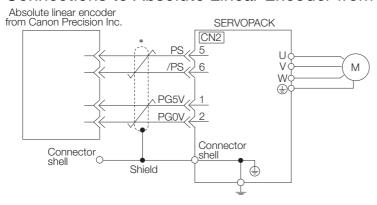

When Using an Incremental Linear Encoder


The wiring depends on the manufacturer of the linear encoder.

Connections to Linear Encoder from Dr. JOHANNES HEIDENHAIN GmbH

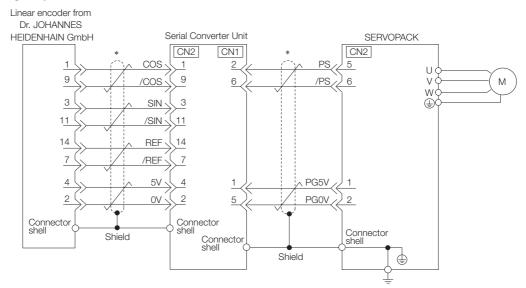

* represents a shielded twisted-pair cable.

◆ Connections to Linear Encoder from Renishaw PLC

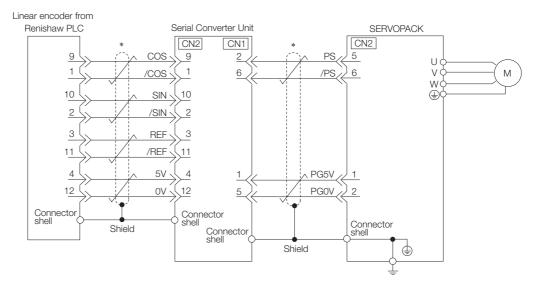


4.4.3 Wiring the SERVOPACK to the Encoder

◆ Connections to Linear Encoder from Magnescale Co., Ltd.

If you use a linear encoder from Magnescale Co., Ltd., the wiring will depend on the model of the linear encoder.

■ SR75 and SR85

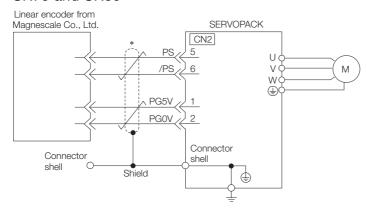


* represents a shielded twisted-pair cable.

■ SL700, SL710, SL720, SL730, and SQ10

PL101-RY, MQ10-FLA, or MQ10-GLA Interpolator
 The following table gives the Linear Encoder and Interpolator combinations.


Linear Encoder Model	Interpolator Model
SL700, SL710, SL720, and SL730	PL101-RY*1
SQ10	MQ10-FLA*2
3010	MQ10-GLA*2

- *1. This is the model of the Head with Interpolator.
- *2. This is the model of the Interpolator.

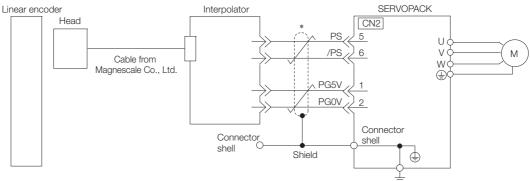


■ SL700, SL710, SL720, and SL730

• MJ620-T13 Interpolator

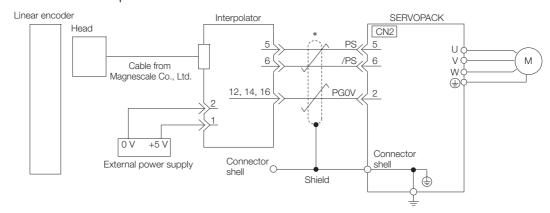

* represents a shielded twisted-pair cable.

◆ Connections to Linear Encoder from Canon Precision Inc.

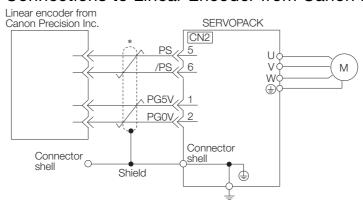

4.4.4 Wiring the SERVOPACK to the Holding Brake


4.4.4 Wiring the SERVOPACK to the Holding Brake




• If you use a Rotary Servomotor, select a Surge Absorber according to the brake current and brake power supply. Refer to the following manual for details.

Σ-7-Series Peripheral Device Selection Manual (Manual No.: SIEP S800001 32)

 After the Surge Absorber is connected, check the brake operation delay time in your application. The Surge Absorber may affect the brake operation delay time.
 Configure the relay circuit to activate the holding brake for an emergency stop.

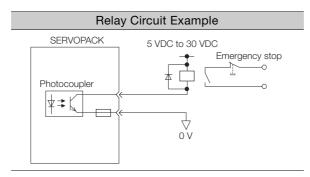

- The /BK (Brake) signal cannot be used with the default settings. You must allocate the output signal. Refer to the following section for details.
 - Allocating the /BK (Brake) Signal on page 5-38
- If you use a 24-V brake, install a separate power supply for the 24-VDC power supply from other power supplies, such as the one for the I/O signals of the CN1 connector. If the power supply is shared, the I/O signals may malfunction.

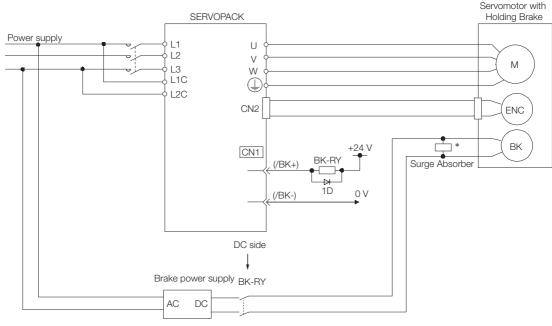

BK-RY: Brake control relay 1D: Flywheel diode

^{*} Install the surge absorber near the brake terminals on the Servomotor.

5 I/O Signal Connections

4.5.1 I/O Signal Connector (CN1) Names and Functions

The following table gives the pin numbers, names, and functions the I/O signal pins for the default settings.

Input Signals

Default settings are given in parentheses.

Control Method	Signal	Pin No.	Name	Function	Reference Page
/SI0* (/S-ON) /SI3* (/P-CON)		40	General-purpose Sequence Input 0 (Servo ON Input)	You can allocate the input signal to use with a parameter. (Controls turning the Servomotor ON and OFF (supplying/not supplying power).)	page 5-17
	41	General-purpose Sequence Input 3 (Proportional Control Input)	You can allocate the input signal to use with a parameter. (Changes the speed control loop from PI (proportional/integral) to P (proportional) control when turned ON.)	page 8-75	
	/SI1* (P-OT)	42	General-purpose Sequence Input 1 (Forward Drive Prohibit Input)	You can allocate the input signals to use with parameters. (Stops Servomotor drive (to prevent over-	page 5-31
	/SI2* (N-OT)	43	General-purpose Sequence Input 2 (Reverse Drive Prohibit Input)	travel) when the moving part of the machine exceeds the range of movement.)	page 3-31
/SI5* (/P-CL) Any Control Method /SI6* (/N-CL)	45	General-purpose Sequence Input 5 (Forward Exter- nal Torque Limit Input)	You can allocate the input signals to use with parameters.	page 6-65	
		46	General-purpose Sequence Input 6 (Reverse Exter- nal Torque Limit Input)	(Activates/deactivates external torque limiting.)	page o oo
	/SI4* (/ALM- RST)	44	General-purpose Sequence Input 4 (Alarm Reset Input)	You can allocate the input signal to use with a parameter. (Clears alarms.)	page 12-41
	+24VIN	47	Sequence Input Signal Power Supply Input	Inputs the sequence input signal power supply. Allowable voltage range: 24 VDC ±20% The 24-VDC power supply is not provided by Yaskawa.	_
	SEN	4 (2)	Absolute Data Request Input (SEN)	Inputs the position data request signal for an absolute encoder.	page 6-74 page 6-88
	BAT+	21	Battery for absolute encoder (+)	These are the pins to connect the absolute encoder backup battery.	
	BAT-	22	Battery for absolute encoder (-)	Do not connect these pins if you use the Encoder Cable with a Battery Case.	_
	ТН	50	Overheat Protection Input	Inputs the overheat protection signal from a Linear Servomotor or from a sensor attached to the machine.	page 6-110
Speed Control	V-REF	5 (6)	Speed Reference	Inputs the speed reference. Maximum input voltage: ±12 V	page 6-13

Continued on next page.

4.5.1 I/O Signal Connector (CN1) Names and Functions

Continued from previous page.

Control Method	Signal	Pin No.	Name	Function	Reference Page
	PULS /PULS	7 8	Pulse Reference Input	One of the following input pulse forms is set. • Sign + pulse train	page 6-31
Position Control	0.0		Sign of Reference Input	CW + CCW pulse trains 90° phase-differential pulses	page 6-31
	CLR 15 /CLR 14		Position Deviation Clear Input	Clears the position deviation during position control.	page 6-33
Torque Control	T-REF	9 (10)	Torque Refer- ence Input	Inputs the torque reference. Maximum input voltage: ±12 V	page 6-40

 $[\]boldsymbol{\ast}$ You can change the allocations. Refer to the following section for details.

Note: 1. Pin numbers in parentheses () indicate signal grounds.

^{6.1.1} Input Signal Allocations on page 6-5

^{2.} If forward drive prohibition or reverse drive prohibition is used, the SERVOPACK is stopped by software controls. If the application does not satisfy the safety requirements, add external safety circuits as required.

Output Signals

Default settings are given in parentheses.

Control Method	Signal	Pin No.	Name	Function	Reference Page	
	ALM+ 31 ALM- 32		Servo Alarm Output	Turns OFF (opens) when an error is detected.	page 6-9	
	/SO2+* (/TGON+)	27	General-pur- pose Sequence	You can allocate the output signal to use with a parameter.		
	/SO2-* (/TGON-)	28	Output 2 (Rota- tion Detection Output)	(Turns ON (closes) when the Servomotor speed exceeds a set value.)	page 6-11	
	/SO3+* (/S-RDY+)	29	General-pur- pose Sequence	You can allocate the output signal to use with a parameter.	0 10	
	/SO3-* (/S-RDY-)	30	Output 3 (Servo Ready Output)	(Turns ON (closes) when the SERVO-PACK is ready to acknowledge the /S-ON (Servo ON) signal.)	page 6-12	
	PAO	33	Encoder Divided			
Any	/PAO	34	Pulse Output, Phase A	Output the encoder divided pulse output		
Control	PBO	35	Encoder Divided	signals with a 90° phase differential.		
Method	/PBO	36	Pulse Output, Phase B		page 6-74 page 6-88	
	PCO	19	Encoder Divided	Outputs the origin signal once every		
	/PCO	20	Pulse Output, Phase C	encoder rotation.		
	PSO	48	Absolute	Outputs the position data of the absolute		
	/PSO	49	Encoder Position Output	encoder.		
	ALO1*	37 (1)				
	ALO2*	38 (1)	Alarm Code Output	Output a 3-bit alarm code.	page 6-10	
	ALO3*	39 (1)	par			
	FG	Shell	Frame ground	Connected to the frame ground if the shield of the I/O Signal Cable is connected to the connector shell.	_	
	/SO1+* (/V-CMP+)	25	General-pur- pose Sequence	You can allocate the output signal to use with a parameter.		
Speed Control	/SO1-* (/V-CMP-)	26	Output 1 (Speed Coincidence Detection Out- put)	(Turns ON (closes) if the motor speed is within the set range and matches the reference speed value when speed control is selected.)	page 6-27	
	/SO1+* (/COIN+)	25	General-pur- pose Sequence	You can allocate the output signals to use with parameters.		
Position	/SO1-* (/COIN-)	26	Output 1 (Positioning Completion Output)	(Turns ON (closes) if the position deviation reaches the set value when position control is selected.)	page 6-37	
Control	PL1	3	Open-Collector			
	PL2	13	Power Supply Output for Refer-	Outputs the open-collector power supply for reference pulses.	_	
	PL3	18	ence Pulses	io. Totorono paroso.		
_	_	16 17 23 24	_	Do not use these terminals.	_	

 $[\]ensuremath{^{*}}$ You can change the allocations. Refer to the following section for details.

6.1.2 Output Signal Allocations on page 6-8

Note: Pin numbers in parentheses () indicate signal grounds.


4.5.2 I/O Signal Connector (CN1) Pin Arrangement

The following figure gives the pin arrangement of the of the I/O signal connector (CN1) for the default settings.

	2	SG	Signal Ground	1	SG	Signal Ground	27	/SO2+ (/TGON+)	General- purpose Sequence	26	/SO1- (/V-CMP-)	General- purpose Sequence Output 1
	4	SEN	Absolute Data Request Input	3	PL1	Open-Collector Power Supply Output for Reference Pulses	29	/SO3+ (/S-RDY+)	Output 2 General- purpose Sequence	28	/SO2- (/TGON-)	General- purpose Sequence Output 2
			(SEN)			Speed Refer-			Output 3 Servo		/SO3-	General- purpose
	6	SG	Signal Ground	5	V-REF	ence Input	31	ALM+	Alarm Output	30	(/S-RDY-)	Sequence Output 3
	8	/PULS	Pulse Reference	7	PULS	Pulse Reference Input	33	PAO	Encoder Divided Pulse	32	ALM-	Servo Alarm Output
			Input			Torque Refer-			Output, Phase A			Encoder Divided
Pin 1	10	SG	Signal	9	T-REF	ence Input	35	PBO	Encoder Divided Pulse	34	/PAO	Pulse Output, Phase A
Pin 2			Ground			Sign of Refer-			Output, Phase B			Encoder Divided
Pin 24 Pin 26 Pin 27 Pin 24 Pin 24 Pin 49	12	/SIGN	Sign of Refer- ence	11	SIGN	ence Input	37	ALO1	Alarm Code Output	36	/PBO	Pulse Output, Phase B
Pin 24 Pin 49	14 /	/CLR	Input Position Deviation Clear Input	10	PL2	Open-Collector Power Supply Output for Reference Pulses	39	ALO3	Alarm Code Output	38	ALO2	Alarm Code Output
The above view is from the direc-				13								
tion of the follow- ing arrow without the connector shell attached.	16	-	-	15	CLR	Position Deviation Clear Input	41	/SI3 (/P-CON)	General- purpose Sequence Input 3	40	/SI0 (/S-ON)	General- purpose Sequence Input 0
	10	PL3	Open- Collector Power Supply	17	_	-	4.3	/SI2 (N-OT)	General- purpose Sequence Input 2	42	/SI1 (P-OT)	General- purpose Sequence Input 1
	18 PL3	FLS	Output for Refer- ence Pulses	19	PCO	Encoder Divided Pulse Output, Phase C				44	/SI4 (/ALM- RST)	General- purpose Sequence Input 4
	20	/PCO	Encoder Divided Pulse Output, Phase C	21	BAT+	Battery for Absolute Encoder (+)	45	/SI5 (/P-CL)	General- purpose Sequence Input 5	46	/SI6 (/N-CL)	General- purpose Sequence Input 6
	22	BAT-	Battery for Abso- lute Encoder (-)	23	_	-	47	+24VIN	Sequence Input Sig- nal Power Supply Input	48	PSO	Absolute Encoder Position Output
	24	-	-	25	/SO1+ (/V-CMP+)	General-pur- pose Sequence Output 1	49	/PSO	Absolute Encoder Position Output	50	TH	Overheat Protec- tion Input

4.5.3 I/O Signal Wiring Examples


Speed Control with a Rotary Servomotor

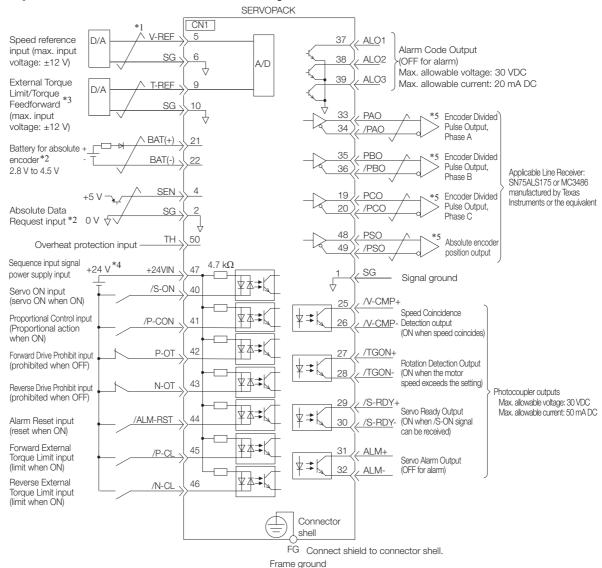

- *1. represents twisted-pair wires.
- *2. Connect these when using an absolute encoder. If the Encoder Cable with a Battery Case is connected, do not connect a backup battery.
- *3. You can enable this function with a parameter setting.
- *4. The 24-VDC power supply is not provided by Yaskawa. Use a 24-VDC power supply with double insulation or reinforced insulation.
- *5. Always use line receivers to receive the output signals.

Note: If you use a 24-V brake, install a separate power supply for the 24-VDC power supply from other power supplies, such as the one for the I/O signals of the CN1 connector. If the power supply is shared, the I/O signals may malfunction.


Speed Control with a Linear Servomotor

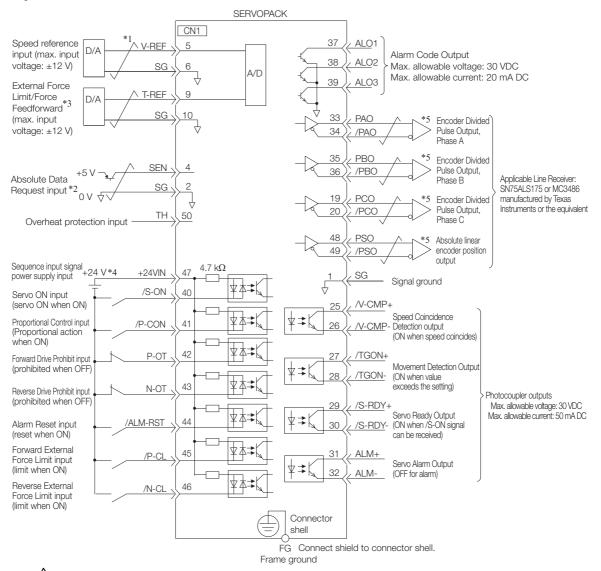

- *1. represents twisted-pair wires.
- *2. Connect these when using an absolute linear encoder.
- *3. You can enable this function with a parameter setting.
- *4. The 24-VDC power supply is not provided by Yaskawa. Use a 24-VDC power supply with double insulation or reinforced insulation.
- *5. Always use line receivers to receive the output signals.

Note: If you use a 24-V brake, install a separate power supply for the 24-VDC power supply from other power supplies, such as the one for the I/O signals of the CN1 connector. If the power supply is shared, the I/O signals may malfunction.

Position Control with a Rotary Servomotor

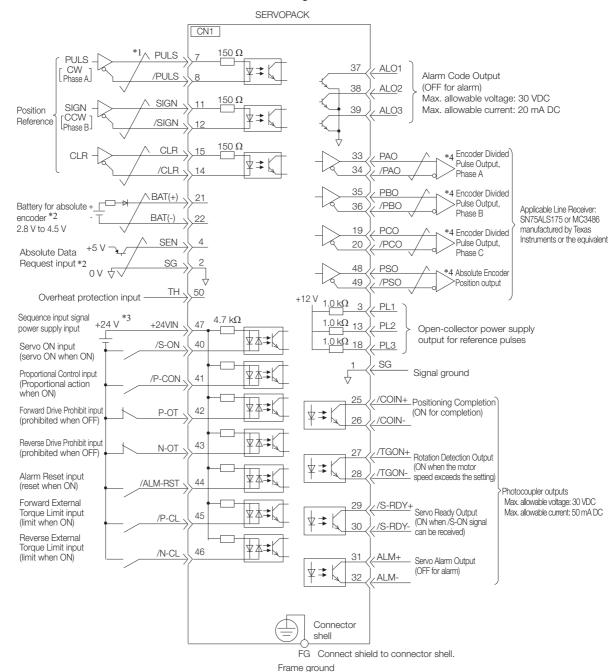


- *1. Trepresents twisted-pair wires.
- *2. Connect these when using an absolute encoder. If the Encoder Cable with a Battery Case is connected, do not connect a backup battery.
- *3. The 24-VDC power supply is not provided by Yaskawa. Use a 24-VDC power supply with double insulation or reinforced insulation.
- *4. Always use line receivers to receive the output signals.

Note: If you use a 24-V brake, install a separate power supply for the 24-VDC power supply from other power supplies, such as the one for the I/O signals of the CN1 connector.

If the power supply is shared, the I/O signals may malfunction.

Position Control with a Linear Servomotor

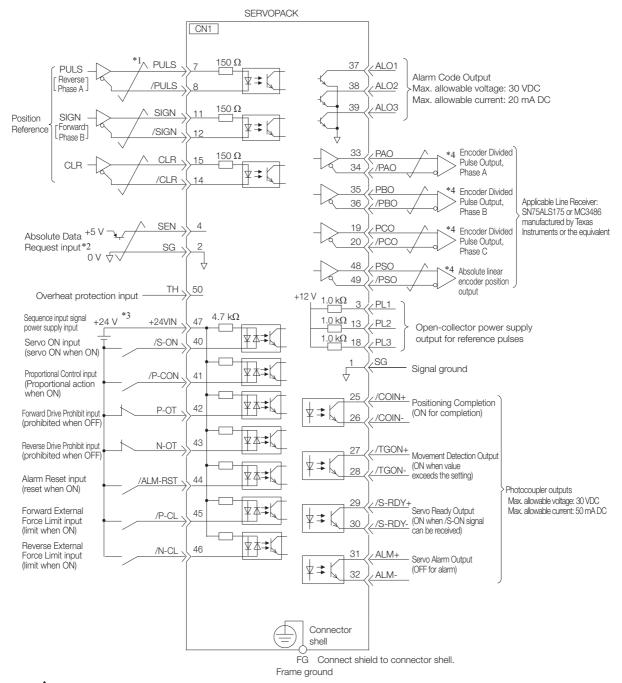

^{*1.} \nearrow represents twisted-pair wires.


Note: If you use a 24-V brake, install a separate power supply for the 24-VDC power supply from other power supplies, such as the one for the I/O signals of the CN1 connector. If the power supply is shared, the I/O signals may malfunction.

^{*2.} Connect when using an absolute linear encoder.

^{*3.} The 24-VDC power supply is not provided by Yaskawa. Use a 24-VDC power supply with double insulation or reinforced insulation.

^{*4.} Always use line receivers to receive the output signals.

Torque Control with a Rotary Servomotor

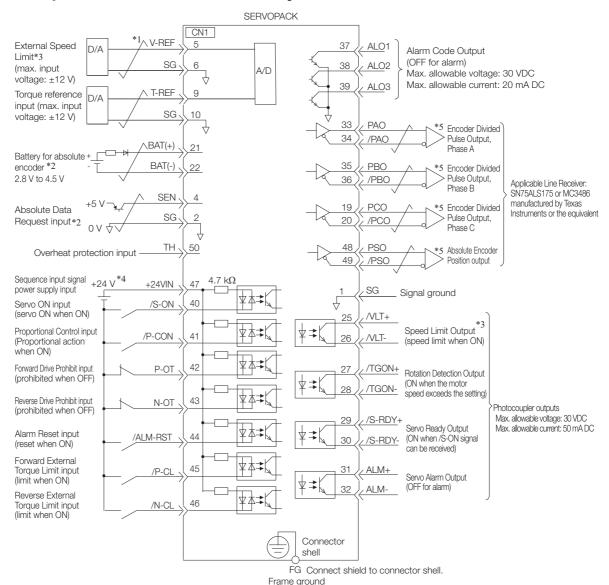


- *1. Trepresents twisted-pair wires.
- *2. Connect these when using an absolute encoder. If the Encoder Cable with a Battery Case is connected, do not connect a backup battery.
- *3. You can enable this function with a parameter setting.
- *4. The 24-VDC power supply is not provided by Yaskawa. Use a 24-VDC power supply with double insulation or reinforced insulation.
- *5. Always use line receivers to receive the output signals.

Note: If you use a 24-V brake, install a separate power supply for the 24-VDC power supply from other power supplies, such as the one for the I/O signals of the CN1 connector.

If the power supply is shared, the I/O signals may malfunction.

Torque Control with a Linear Servomotor

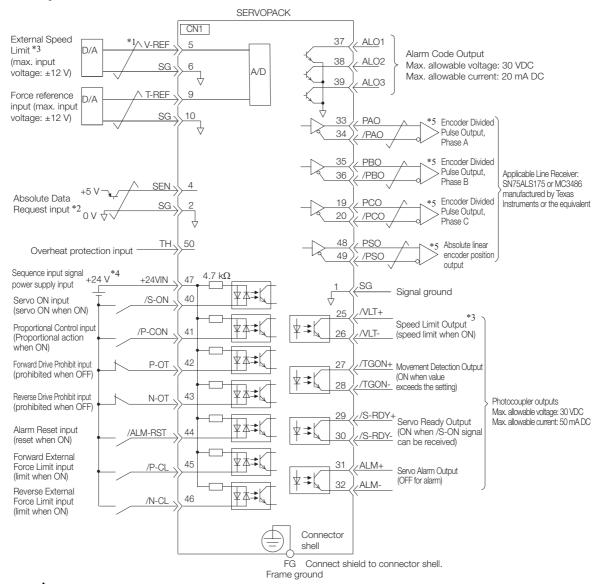

- *1. 🖊 represents twisted-pair wires.
- *2. Connect when using an absolute linear encoder.
- *3. You can enable this function with a parameter setting.
- *4. The 24-VDC power supply is not provided by Yaskawa. Use a 24-VDC power supply with double insulation or reinforced insulation.
- *5. Always use line receivers to receive the output signals.

Note: If you use a 24-V brake, install a separate power supply for the 24-VDC power supply from other power supplies, such as the one for the I/O signals of the CN1 connector. If the power supply is shared, the I/O signals may malfunction.

4.5.4 I/O Circuits

Reference Input Circuits


◆ Analog Input Circuits

This section describes CN1 connector terminals 5-6 (Speed Reference Input) and 9-10 (Torque Reference Input).

The analog signals are used as either speed or torque reference signals. The input impedance is as follows:

- Speed Reference Input: Approx. 14 $\mbox{k}\Omega$
- Torque Reference Input: Approx. 14 k Ω


The maximum allowable voltage for input signals is ±12 V.

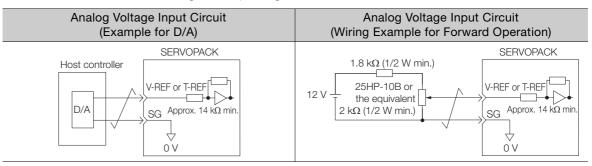

◆ Position Reference Input Circuits

This section describes CN1 connector terminals 7-8 (Reference Pulse Input), 11-12 (Reference Sign Input), and 15-14 (Clear Input).

The output circuits for the reference pulses and Position Deviation Clear signal from the host controller can be either line-driver outputs or open-collector outputs. The following diagrams show these by output type.

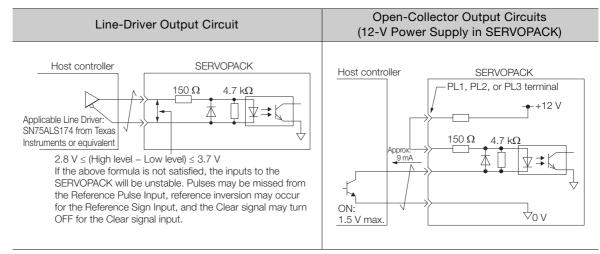

4.5.4 I/O Circuits




Precaution When Host Controller Uses Open-Collector Output with User-Supplied Power Supply

The SERVOPACK may fail depending on the relationship between the pull-up voltage (Vcc) and the pull-up resistance (R1). Before you wire the circuits, confirm that the specifications of the host controller satisfy the values shown in the following table.

Pull-Up Voltage (Vcc)	Pull-Up Resistance (R1)	Output Current (i)
24 V	1.8 k Ω to 2.7 k Ω	
12 V max.	820 Ω to 1.5 kΩ	20 mA max.
5 V max.	180 Ω to 470 Ω	


Circuit Example for Open-Collector Outputs

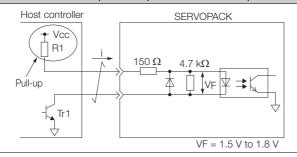

Sequence Input Circuits

◆ Photocoupler Input Circuits

This section describes CN1 connector terminals 40 to 47. The circuits are connected through relay or open-collector transistor circuits. If you connect through a relay, use a low-current relay. If you do not use a low-current relay, a faulty contact may result.

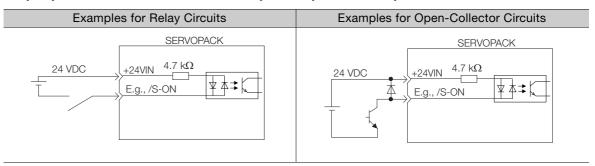


Note: The 24-VDC external power supply capacity must be 50 mA minimum.

Information Refer to the following section for the interface for the SEN signal input circuit.

© 6.12.2 Structure of the Position Data of the Absolute Encoder on page 6-75

The SERVOPACK input circuits use bidirectional photocouplers. Select either a sink circuit or source circuit according to the specifications required by the machine.

Note: The connection examples in 4.5.3 I/O Signal Wiring Examples on page 4-39 are for sink circuit connections.

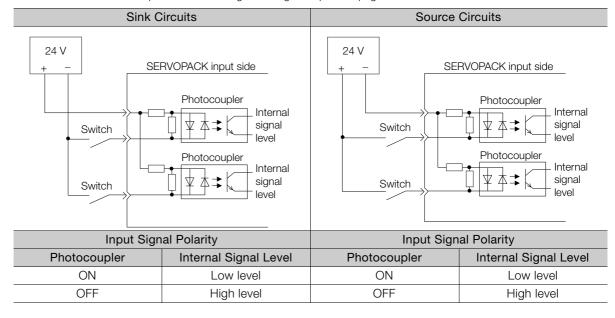

4.5.4 I/O Circuits

Sequence Output Circuits




Incorrect wiring or incorrect voltage application to the output circuits may cause short-circuit failures.

If a short-circuit failure occurs as a result of any of these causes, the holding brake will not work. This could damage the machine or cause an accident that may result in death or injury.

◆ Open-Collector Output Circuits

This section describes CN1 connector terminals 37 to 39 (Alarm Code Output).

The Alarm Code (ALO1, ALO2, and ALO3) signals are output from open-collector transistor output circuits. Connect an open-collector output circuit to a photocoupler, relay, or line-receiver circuit.

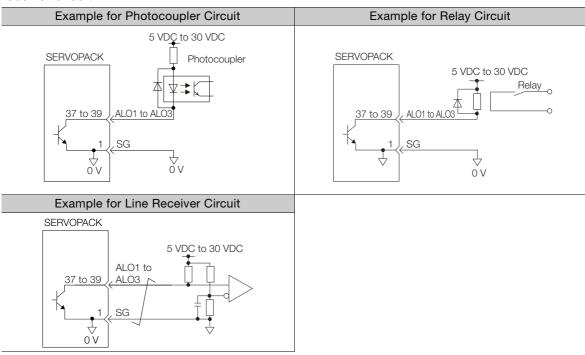


Note: The maximum allowable voltage and maximum allowable current for open-collector output circuits are as follows:

Maximum allowable voltage: 30 VDC

• Maximum allowable current: 20 mA DC

◆ Photocoupler Output Circuits

Photocoupler output circuits are used for the ALM (Servo Alarm), /S-RDY (Servo Ready), and other sequence output signals. Connect a photocoupler output circuit to a photocoupler, relay, or line-receiver circuit.

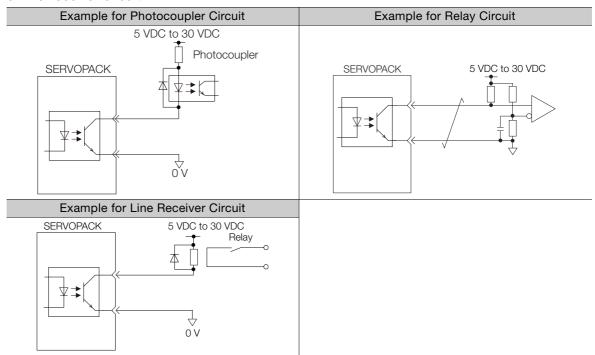


Note: The maximum allowable voltage and current range for photocoupler output circuits are as follows:

- Maximum allowable voltage: 30 VDC
- Current range: 5 mA to 50 mA DC

◆ Line-Driver Output Circuits

This section describes CN1 connector pins 33-34 (Phase-A Signal), 35-36 (Phase-B Signal), 19-20 (Phase-C Signal) and 48-49 (Phase-S Signal).

The serial data from the encoder is converted to two-phase (phases A and B) pulses. The resulting output signals (PAO, /PAO and PBO, /PBO), origin pulse signal (PCO and /PCO), and the absolute encoder position output signals (PSO and /PSO) are output with line-driver output circuits. Connect the line-driver output circuits to line-receiver circuits at the host controller.

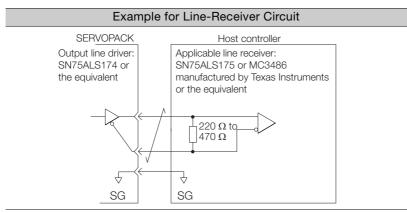

4.6.1 Pin Arrangement of Safety Function Signals (CN8)

4.6

Connecting Safety Function Signals

This section describes the wiring required to use a safety function.

Refer to the following chapter for details on the safety function.

Chapter 11 Safety Functions

4.6.1 Pin Arrangement of Safety Function Signals (CN8)

Pin No.	Signal	Name	Function		
1	_	- (Do not use these pins because they	are connected to internal circuits)		
2	_	- (Do not use these pins because they	are connected to internal circuits.)		
3	/HWBB1-	Hard Wire Base Block Input 1			
4	/HWBB1+	Traid Wife base block input i	For a hard wire base block input. The base block (motor power turned OFF) is in effect when the signal is OFF.		
5	/HWBB2-	Hard Wire Rose Plack Input 2			
6	/HWBB2+	Hard Wire Base Block Input 2			
7	EDM1-		Turns ON when the /HWBB1 and the / HWBB2 signals are input and the		
8	EDM1+	External Device Monitor Output	SERVOPACK enters a base block state.		

4.6.2 I/O Circuits



For safety function signal connections, the input signal is the 0-V common and the output signal is a source output. This is opposite to other signals described in this manual.


To avoid confusion, the ON and OFF status of signals for the safety function are defined as follows:

ON: The state in which the relay contacts are closed or the transistor is ON and current flows into the signal line.

OFF: The state in which the relay contacts are open or the transistor is OFF and no current flows into the signal line.

Safety Input Circuits

Use a 0-V common to connect the safety function signals. You must connect redundant input signals.

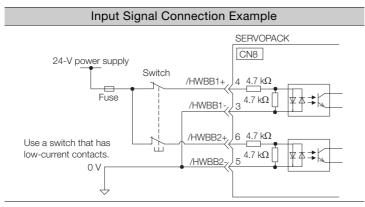

◆ Input (HWBB) Signal Specifications


Туре	Signal	Connector Pin No.	Status	Meaning
/HWBB1 /HWBB2	CN8-4	ON (closed)	Does not activate the HWBB (normal operation).	
	/HVVDD1	CN8-3	OFF (open)	Activates the HWBB (motor current shut-OFF request).
	/HWBB2	CN8-6 CN8-5	ON (closed)	Does not activate the HWBB (normal operation).
			OFF (open)	Activates the HWBB (motor current shut-OFF request).

The input (HWBB) signals have the following electrical characteristics.

Item	Characteristics	Remarks
Internal Impedance	4.7 kΩ	-
Operating Voltage Range	+24 V ±20%	-
Maximum Delay Time	8 ms	Time from /HWBB1 and /HWBB2 signals turning OFF until HWBB is activated

Diagnostic Output Circuits

The EDM1 output signal uses a source circuit. The following figure shows a connection example.

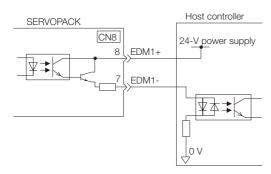

◆ EDM1 Output Signal Specifications

Type	Signal	Pin No.	Output Status	Meaning
Output	EDM1	CN8-8 CN8-7	ON	Both the /HWBB1 and /HWBB2 signals are operating normally.
Output			OFF	The /HWBB1 signal, the /HWBB2 signal, or both are not operating.

The electrical characteristics of the EDM1 signal are as follows:

Item	Characteristics	Remarks
Maximum Allowable Voltage	30 VDC	_
Maximum Allowable Current	50 mA DC	_
Maximum ON Voltage Drop	1.0 V	Voltage between EDM1+ and EDM1- when current is 50 mA
Maximum Delay Time	8 ms	Time from a change in /HWBB1 or /HWBB2 until a change in EDM1

4.7.1 Serial Communications Connector (CN3)

4.7

Connecting the Other Connectors

4.7.1 Serial Communications Connector (CN3)

To use a Digital Operator or to connect a computer with an RS-422 cable, connect CN3 on the SERVOPACK.

Refer to the following manual for the operating procedures for the Digital Operator.

Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)

4.7.2 Computer Connector (CN7)

To use the SigmaWin+ Engineering Tool, connect the computer on which the SigmaWin+ is installed to CN7 on the SERVOPACK.

Refer to the following manual for the operating procedures for the SigmaWin+. AC Servo Drive Engineering Tool SigmaWin+ Operation Manual (Manual No.: SIET S800001 34)




Use the Yaskawa-specified cables. Operation will not be dependable due to low noise resistance with any other cable.

4.7.3 Analog Monitor Connector (CN5)

To use an analog monitor, connect CN5 on the SERVOPACK.

Wiring Example

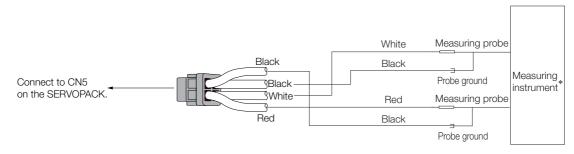

^{*} The measuring instrument is not provided by Yaskawa.

Refer to the following section for information on the monitoring methods for an analog monitor. § 9.3 Monitoring Machine Operation Status and Signal Waveforms on page 9-8

Basic Functions That Require Setting before Operation

This chapter describes the basic functions that must be set before you start servo system operation. It also describes the setting methods.

5.1	Mani	pulating Parameters (Pn□□□)5-4
	5.1.1 5.1.2 5.1.3 5.1.4 5.1.5	Parameter Classification5-4Notation for Parameters5-5Parameter Setting Methods5-6Write Prohibition Setting for Parameters5-8Initializing Parameter Settings5-11
5.2	Conti	rol Method Selection5-13
5.3	Power S	supply Type Settings for the Main Circuit and Control Circuit5-14
	5.3.1	AC Power Supply Input/DC Power Supply Input Setting
	5.3.2	Single-phase AC Power Supply Input/ Three-phase AC Power Supply Input Setting 5-15
5.4	Autor	matic Detection of Connected Motor5-16
5.5	Function	ons and Settings for the /S-ON (Servo ON) Signal 5-17
	5.5.1 5.5.2	Function of the /S-ON (Servo ON) Signal 5-17 Setting to Keep the Servo ON and Supply Power to the Motor Continuously 5-17
5.6	Moto	r Direction Setting5-18
5.7	Settir	ng the Linear Encoder Pitch5-19

5.9	Selecting the Phase Sequence for a Linear Servomotor5-24				
5.10	Polar	ity Sensor Setting5-26			
5.11	Polari	ity Detection5-27			
	5.11.1 5.11.2	Restrictions			
	5.11.3	Using the /P-DET (Polarity Detection) Signal to Perform Polarity Detection			
	5.11.4	Using a Tool Function to Perform Polarity Detection			
5.12	Overt	ravel and Related Settings5-31			
	5.12.1 5.12.2 5.12.3 5.12.4	Overtravel Signals.5-32Setting to Enable/Disable Overtravel.5-32Motor Stopping Method for Overtravel.5-33Overtravel Warnings.5-34			
5.13	Holdi	ng Brake5-36			
	5.13.1 5.13.2 5.13.3	Brake Operating Sequence			
	5.13.4	the Servomotor Is Stopped			
5.14	Motor	Stopping Methods for Servo OFF and Alarms 5-41			
	5.14.1 5.14.2	Stopping Method for Servo OFF			
5.15	Moto	r Overload Detection Level5-44			
	5.15.1	Detection Timing for Overload Warnings (A.910)			
	5.15.2	Detection Timing for Overload Alarms (A.720)5-45			
5.16	Electi	ronic Gear Settings5-46			
	5.16.1 5.16.2	Electronic Gear Ratio Settings			
5.17	Reset	tting the Absolute Encoder5-52			
	5.17.1 5.17.2 5.17.3 5.17.4	Precautions on Resetting.5-52Preparations.5-52Applicable Tools.5-53Operating Procedure.5-53			
5.18	Settin	g the Origin of the Absolute Encoder 5-55			
	5.18.1	Setting the Origin of the Absolute Linear Encoder			

5.19 Setting the Regenerative Resistor Capacity . . 5-58

5.1.1 Parameter Classification

5.1

Manipulating Parameters (Pn□□□)

This section describes the classifications, notation, and setting methods for the parameters given in this manual.

5.1.1 Parameter Classification

There are the following two types of SERVOPACK parameters.

Classification	Meaning
Setup Parameters	Parameters for the basic settings that are required for operation.
Tuning Parameters	Parameters that are used to adjust servo performance.



When you edit parameters with the SigmaWin+, setup parameters and tuning parameters are displayed.

When you edit parameters with a Panel Operator or Digital Operator, only setup parameters are displayed by default. To edit tuning parameters, set Pn00B to n. \$\square\$ (Display all parameters).

Parameter		Meaning	When Enabled	Classification
Pn00B	n.□□□0 (default setting)	Display only setup parameters.	After restart	Setup
	n.□□□1	Display all parameters.		


The setting method for each type of parameter is described below.

Setup Parameters

You can use the Panel Operator, Digital Operator, or SigmaWin+ to set the setup parameters individually.

Information

We recommend that you use the Setup Wizard of the SigmaWin+ to easily set the required setup parameters by setting the operating methods, machine specifications, and I/O signals according to on-screen Wizard instructions.

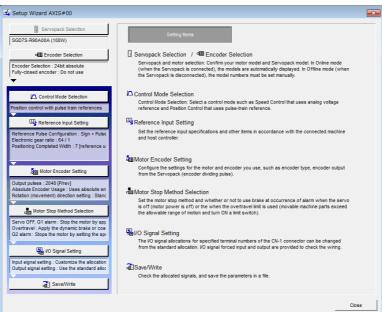

5.1.2 Notation for Parameters

Tuning Parameters

Normally the user does not need to set the tuning parameters individually.

Use the various SigmaWin+ tuning functions to set the related tuning parameters to increase the response even further for the conditions of your machine. Refer to the following sections for details.

- 8.6 Autotuning without Host Reference on page 8-24
- 8.7 Autotuning with a Host Reference on page 8-35
- 8.8 Custom Tuning on page 8-42


You can also set the tuning parameters individually to make adjustments. Refer to the following section for details.

8.13 Manual Tuning on page 8-76

5.1.2 Notation for Parameters

There are two types of notation used for parameters that depend on whether the parameter requires a numeric setting (parameter for numeric setting) or requires the selection of a function (parameter for selecting a function).

· Parameters for Numeric Settings

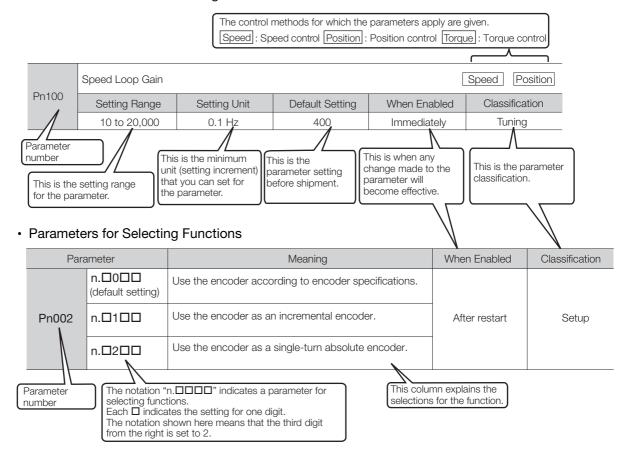


5.1.3 Parameter Setting Methods

You can use the SigmaWin+, a Digital Operator, or the Panel Operator to set parameters. Use the following procedure to set the parameters.

Setting Parameters with the SigmaWin+

- 1. Click the 🔑 Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Edit Parameters in the Menu Dialog Box. The Parameter Editing Dialog Box will be displayed.
- **3.** Click the cell of the parameter to edit.

If the parameter to edit is not displayed in the Parameter Editing Dialog Box, click the <a> or <a> Button to display the parameter to edit.

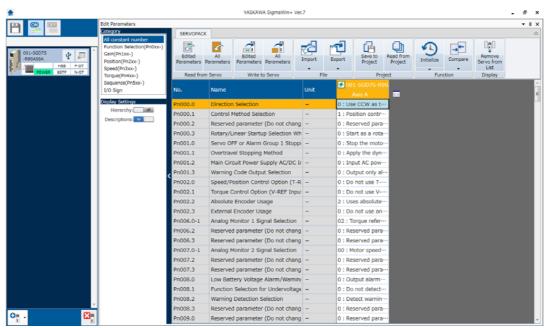


4. Change the setting of the parameter.



- 1. For a parameter for a numeric setting, input the numeric setting.
- 2. If the parameter requires selection of a function, select the function from the list of selections.
- **5.** Press the **Enter** Key.


The background of the edited parameter cell will change to green.



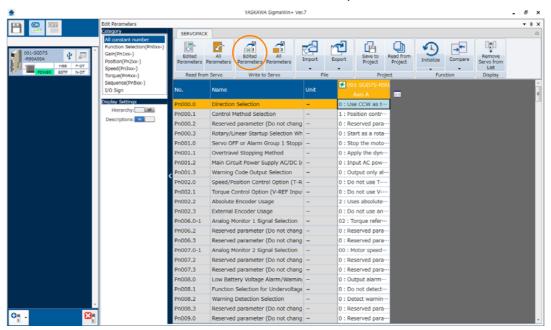

The edited parameters are written to the SERVOPACK and the backgrounds of the cells change to white.

7. Click the OK Button.

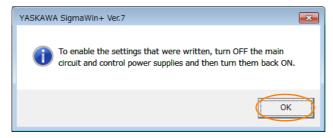

8. To enable changes to the settings, turn the power supply to the SERVOPACK OFF and ON again.

This concludes the procedure to set the parameters.

Setting Parameters with a Digital Operator

Refer to the following manual for information on setting the parameters with a Digital Operator. Σ -7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)

Setting Parameters with the Panel Operator

Refer to the following section for information on setting the parameters with the Panel Operator.

13.2 Parameter (Pn \(\Pi \) \(\D\) Operations on the Panel Operator on page 13-6

5.1.4 Write Prohibition Setting for Parameters

You can prohibit writing parameters from the Panel Operator or the Digital Operator. Even if you do, you will still be able to change parameter settings from the SigmaWin+.

Preparations

No preparations are required.

Applicable Tools

The following table lists the tools that you can use to change the Write Prohibition Setting.

Tool	Fn No./Function Name	Reference
Panel Operator	Fn010	13.4.15 Write Prohibition Setting (Fn010) on page 13-23
Digital Operator	Fn010	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Others - Write Prohibited Setting	© Operating Procedure on page 5-8

Operating Procedure

Use the following procedure to prohibit or permit writing parameter settings.

- 1. Click the P Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Write Prohibited Setting in the Menu Dialog Box. The Write Prohibition Setting Dialog Box will be displayed.
- 3. Press the ▼ or ▲ for the rightmost digit and set one of the following. 0000: Writing is permitted (default setting). 0001: Writing is prohibited.




4. Click the **Setting** Button.



5. Click the OK Button.

The setting will be written to the SERVOPACK.

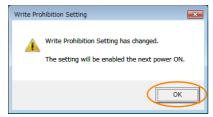

6. To enable the new setting, turn the power supply to the SERVOPACK OFF and ON again.

This concludes the procedure to prohibit or permit writing parameter settings.

Restrictions

If you prohibit writing parameter settings, you will no longer be able to execute some functions. Refer to the following table.

SigmaWin+		Panel Operator or Digital Operator		When		
Button in Menu Dialog Box	SigmaWin+ Function Name	Fn No.	Utility Function Name	Writing Is Prohibited	Reference	
	Initialize*1	Fn005	Initializing Parameters	Cannot be executed.	page 5-11	
	Software Reset	Fn030	Software Reset	Can be executed.	page 6-97	
Basic		Fn011	Display Servomotor Model	Can be executed.		
Functions	Product Information	Fn012	Display Software Version	Can be executed.	page 9-2	
	Product information	Fn01E	Display SERVOPACK and Servomotor IDs	Can be executed.	page 9-2	
		Fn01F	Display Servomotor ID from Feedback Option Module	Can be executed.		
	Reset Absolute Encoder	Fn008	Reset Absolute Encoder	Cannot be executed.	page 5-52	
En en den	Multi-turn Limit Setup	Fn013	Multiturn Limit Setting after Multiturn Limit Disagreement Alarm	Cannot be executed.	page 6-85	
Setting	Search Origin*2	Fn003	Origin Search	Cannot be executed.	page 7-25	
	Zero Point Position Setting	Fn020	Set Absolute Linear Encoder Origin	Cannot be executed.	page 5-55	
	Polarity Detection	Fn080	Polarity Detection	Cannot be executed.	page 5-30	
		Fn000	Display Alarm History	Can be executed.	page 12-42	
Trouble-	Display Alarm	Fn006	Clear Alarm History	Cannot be executed.	page 12-43	
shooting		Fn014	Reset Option Module Configuration Error	Cannot be executed.	page 12-44	
	Reset Motor Type Alarm	Fn021	Reset Motor Type Alarm	Cannot be executed.	page 12-46	
Operation	Jog	Fn002	Jog	Cannot be executed.	page 7-7	
Operation	Program JOG Operation	Fn004	Jog Program	Cannot be executed.	page 7-20	
Trouble-	Multi-turn Limit Setup Search Origin*2 Zero Point Position Setting Polarity Detection Display Alarm Reset Motor Type Alarm Jog	Fn013 Fn003 Fn020 Fn080 Fn000 Fn006 Fn014 Fn021 Fn002	Multiturn Limit Setting after Multiturn Limit Disagreement Alarm Origin Search Set Absolute Linear Encoder Origin Polarity Detection Display Alarm History Clear Alarm History Reset Option Module Configuration Error Reset Motor Type Alarm Jog	executed. Cannot be executed. Can be executed. Cannot be executed.	page 6-85 page 7-25 page 5-55 page 5-30 page 12-4 page 12-4 page 12-4 page 12-4 page 7-7	

Continued on next page.

5.1.4 Write Prohibition Setting for Parameters

Continued from previous page.

SigmaWin+		Panel Operator or Digital Operator		Whon	1 0
Button in Menu Dialog Box	Sigmawin+ Function		Utility Function Name	When Writing Is Prohibited	Reference
	Tuning - Autotuning without Host Reference	Fn201	Advanced Autotuning with- out Reference	Cannot be executed.	page 8-24
	Tuning - Autotuning with Host Reference	Fn202	Advanced Autotuning with Reference	Cannot be executed.	page 8-35
	Tuning - Custom Tuning	Fn203	One-Parameter Tuning	Cannot be executed.	page 8-42
Tuning	Tuning - Custom Tuning - Adjust Anti-resonance Control	Fn204	Adjust Anti-resonance Control	Cannot be executed.	page 8-51
	Tuning - Custom Tuning - Vibration Suppression	Fn205	Vibration Suppression	Cannot be executed.	page 8-56
	Response Level Setting	Fn200	Tuning-less Level Setting	Cannot be executed.	page 8-12
Diagnostic	Easy FFT	Fn206	Easy FFT	Cannot be executed.	page 8-95
		Fn009	Autotune Analog (Speed/ Torque) Reference Offset	Cannot be executed.	page 6-20, page 6-41
	Adjust the Speed and Torque Reference Offset	Fn00A	Manually Adjust Speed Reference Offset	Cannot be executed.	page 6-22
		Fn00B	Manually Adjust Torque Reference Offset	Cannot be executed.	page 6-43
	Adjust the Analog Monitor Output	Fn00C	Adjust Analog Monitor Output Offset	Cannot be executed.	page 0.10
Others		Fn00D	Adjust Analog Monitor Output Gain	Cannot be executed.	page 9-10
	Adjust the Motor Current	Fn00E	Autotune Motor Current Detection Signal Offset	Cannot be executed.	none 6 100
	Detection Offsets	Fn00F	Manually Adjust Motor Cur- rent Detection Signal Offset	Cannot be executed.	page 6-103
	Initialize Vibration Detection Level	Fn01B	Initialize Vibration Detection Level	Cannot be executed.	page 6-99
	Write Prohibited Setting	Fn010	Write Prohibition Setting	Can be executed.	page 5-8

^{*1.} An **Initialize** Button will be displayed in the Parameter Editing Dialog Box. *2. Cannot be used when connecting a Linear Servomotor.

5.1.5 Initializing Parameter Settings

You can return the parameters to their default settings.

This function will not initialize the settings of the parameters that are adjusted for the Fn009, Fn00A, Fn00B, Fn00C, Fn00D, Fn00E, and Fn00F utility functions.



To enable the new settings, turn the power supply to the SERVOPACK OFF and ON again after you complete the operation.

Preparations

Always check the following before you initialize the parameter settings.

- The parameters must not be write prohibited.
- The servo must be OFF.

Applicable Tools


The following table lists the tools that you can use to initialize the parameter settings.

Tool	Fn No./Function Name	Reference
Panel Operator	Fn005	13.4.5 Initialize Parameters (Fn005) on page 13-16
Digital Operator	Fn005	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Basic Functions - Edit Parameters	© Operating Procedure on page 5-11

Operating Procedure


Use the following procedure to initialize the parameter settings.

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Edit Parameters in the Menu Dialog Box. The Parameter Editing Dialog Box will be displayed.
- 3. Select any parameter of the axis to initialize.
- 4. Click the Initialize Button in the Function Group.

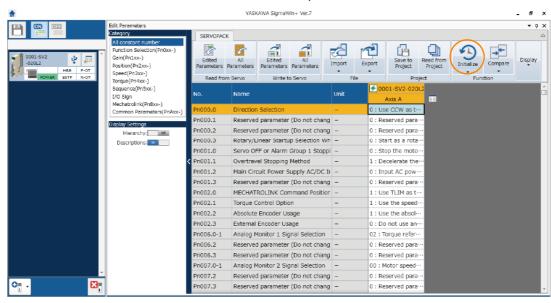


5.1.5 Initializing Parameter Settings

5. Click the OK Button.

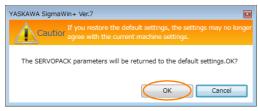

Click the Cancel Button to cancel initialization. The Parameter Editing Dialog Box will return.

6. Click the OK Button.

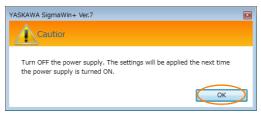

7. Turn the power supply to the SERVOPACK OFF and ON again after the parameter settings have been initialized.

This concludes the procedure to initialize the parameter settings.

5.2 Control Method Selection

You can use the SERVOPACK for speed control, position control, or torque control. You set the control method in $Pn000 = n.\square\square X\square$ (Control Method Selection).

Control Method Selection						
Pn000 = n.□□X□	Control Method	Outline	Reference			
n.□□0□ (default setting)	Speed control	The speed of the Servomotor is controlled with an analog voltage speed reference. Use speed control in the following cases. To control speed For position control using encoder pulse outputs from the SERVOPACK to form a position loop in the host controller	page 6-17			
n.0010	Position control	The position of the machine is controlled with a pulse train position reference. The position is controlled with the number of input pulses, and the speed is controlled with the input pulse frequency. Use position control when positioning is required.	page 6-30			
n.□□2□	Torque control	The torque output by the Servomotor is controlled with an analog voltage torque reference. Use torque control to output the required torque for operations such as pressing.	page 6-40			
n.□□3□	Internal set speed control	Three internal set speeds that are preset in the SERVOPACK are used as references to perform speed control. An analog reference is not necessary for this control method.	page 6-55			
n.□□4□	Switching between internal set speed control and speed control with analog references					
n.□□5□	Switching between internal set speed control and position control					
n.□□6□	Switching between internal set speed control and torque control	These are switching methods that you can use to change between two of the above four control methods. You can select the combination that is required for the application.	page 6-59			
n.□□7□	Switching between position control and speed control					
n.□□8□	Switching between position control and torque control					
n.□□9□	Switching between torque control and speed control					
n.□□A□	Switching between speed control with analog references and speed control with zero clamping	You can use zero clamping for speed control.	page 6-25			
n.□□B□	Switching between normal position con- trol and position con- trol with reference pulse inhibition	You can use reference pulse inhibition for position control.	page 6-40			

5.3.1 AC Power Supply Input/DC Power Supply Input Setting

5.3

Power Supply Type Settings for the Main Circuit and Control Circuit

A SERVOPACK with a 200-VAC power supply input can be operated on either an AC power supply input or DC power supply input to the main and control circuits. If you select an AC power supply input, you can operate the SERVOPACK on either a single-phase power supply input or a three-phase power supply input. This section describes the settings related to the power supplies.



You cannot input DC power to a SERVOPACK with a single-phase, 100-VAC power supply input.

5.3.1 AC Power Supply Input/DC Power Supply Input Setting

Set Pn001 = n. \(\PiX\Pi\Pi\) (Main Circuit Power Supply AC/DC Input Selection) to specify whether to use an AC or DC power supply input for the main circuit power supply to the SERVOPACK.

If the setting of Pn001 = $n.\Box X\Box\Box$ does not agree with the actual power supply input, an A.330 alarm (Main Circuit Power Supply Wiring Error) will occur.

Example

Examples of When an A.330 Alarm (Main Circuit Power Supply Wiring Error) Occurs

- A DC power supply is connected between the B1/⊕ and ⊝2 terminals, but an AC power supply input is specified (Pn001 = n.□0□□).
- An AC power supply is input to the L1, L2, and L3 terminals, but a DC power supply is specified (Pn001 = n.□1□□).

Parameter		Meaning	When Enabled	Classification
Pn001	n.□0□□ (default setting)	Use an AC power supply input.	After restart	Setup
	n.🗆1🗆 🗆	Use a DC power supply input.		

MARNING

- Connect the AC or DC power supplies to the specified SERVOPACK terminals.
 - Connect an AC power supply to the L1, L2, and L3 terminals and the L1C and L2C terminals on the SERVOPACK.
 - Connect a DC power supply to the B1/⊕ and ⊕2 terminals and the L1C and L2C terminals on the SERVOPACK.

There is a risk of failure or fire.

- Always specify a DC power supply input (Pn001 = n.□1□□) before you input DC power for the main circuit power supply.
 - If you input DC power without specifying a DC power supply input (i.e., without setting Pn001 to $n.\Box 1\Box\Box$), the SERVOPACK's internal elements may burn and may cause fire or damage to the equipment.
- With a DC power supply input, time is required to discharge electricity after the main power supply is turned OFF. A high residual voltage may remain in the SERVOPACK after the power supply is turned OFF. Be careful not to get an electric shock.
- Install fuses on the power supply line if you use DC power.
- The Servomotor returns regenerative energy to the power supply. If you use a SERVOPACK
 with a DC power supply input, regenerative energy is not processed. Process the regenerative energy at the power supply.
- If you use a DC power supply input with any of the following SERVOPACKs, externally connect an inrush current limiting circuit and use the power ON and OFF sequences recommended by Yaskawa: SGD7S-330A, -470A, -550A, -590A, or -780A.

There is a risk of equipment damage.

Refer to the following section for the power ON and OFF sequences.

4.3.3 Power ON Sequence on page 4-15

Refer to the following section for information on wiring the SERVOPACK.

4.3.4 Power Supply Wiring Diagrams on page 4-16

5.3.2 Single-phase AC Power Supply Input/Three-phase AC Power Supply Input Setting

5.3.2 Single-phase AC Power Supply Input/Three-phase AC Power Supply Input Setting

Some models of Three-phase 200-VAC SERVOPACKs can also operate on a single-phase 200-VAC power supply.

You can use a single-phase, 200-VAC power supply input with the following models.

• SGD7S-R70A, -R90A, -1R6A, -2R8A, and -5R5A

If you use a single-phase, 200-VAC power supply input for the SERVOPACK's main circuit power supply, set parameter Pn00B to n. \$\sim\$1 \$\sim\$ (Use a three-phase power supply input as a single-phase power supply input).

Information

You do not need to change the setting of Pn00B to n.□1□□ (Use a three-phase power supply input as a single-phase power supply input) for a SERVOPACK with a single-phase 200-VAC power supply input (model numbers: SGD7S-120A□□□008) or for a SERVOPACK with a single-phase 100-VAC power supply input.

Parameter		Meaning	When Enabled	Classification
Pn00B	n.□0□□ (default setting)	Use a three-phase power supply input.	After restart	Setup
THOOD	n.□1□□	Use a three-phase power supply input as a single-phase power supply input.	Aitel lestait	Getap



- 1. If you use a single-phase power supply input without specifying a single-phase AC power supply (Pn00B = n.□1□□), an A.F10 alarm (Power Supply Line Open Phase) will occur.
- 2. Not all SERVOPACKs can be run on a single-phase AC power supply input. If you connect a single-phase AC power supply input to a SERVOPACK that does not support single-phase power, an A.F10 alarm (Power Supply Line Open Phase) will occur.
- 3. If you use a single-phase 200-VAC power supply input, the torque-motor speed characteristic of the Servomotor will not be the same as for a three-phase AC power supply input. Decide whether to use a single-phase or three-phase AC power supply input after checking the characteristics given in the Servomotor manual or catalog.

Refer to the following section for information on wiring a single-phase AC power supply input to the SERVOPACK.

• Wiring Example for Single-Phase, 200-VAC Power Supply Input on page 4-17

Automatic Detection of Connected Motor

You can use a SERVOPACK to operate either a Rotary Servomotor or a Linear Servomotor. If you connect the Servomotor encoder to the CN2 connector on the SERVOPACK, the SERVOPACK will automatically determine which type of Servomotor is connected. Therefore, you normally do not need to specify the Servomotor type.

Information

If an encoder is not connected, e.g., for a test without a motor, you can specify a Rotary Servomotor or a Linear Servomotor in $Pn000 = n.X \square \square \square$ (Rotary/Linear Servomotor Startup Selection When Encoder Is Not Connected). If you specify either a Rotary or Linear Servomotor, only the parameters, monitors, alarms, and functions for the specified motor type will be enabled.

Parameter		Meaning	When Enabled	Classification
Pn000	n.0□□□ (default setting)	When an encoder is not connected, start as SERVOPACK for Rotary Servomotor.		Setup
	n.1□□□	When an encoder is not connected, start as SERVOPACK for Linear Servomotor.	After restart	

5.5 Functions and Settings for the /S-ON (Servo ON) Signal

The /S-ON (Servo ON) signal is used to enable Servomotor operation.

This section describes the function of and settings for the /S-ON signal.

5.5.1 Function of the /S-ON (Servo ON) Signal

Type	Signal	Connector Pin No.	Signal Status	Function
Input /S ON	CN1-40	ON (closed)	Power is supplied to the Servomotor to enable operation.	
πραι	Input /S-ON (default setting)	OFF (open)	Power supply to the Servomotor is stopped and operation is disabled.	

You can use $Pn50A = n.\square\square X\square$ (/S-ON (Servo ON) Signal Allocation) to allocate the /S-ON signal to a different input signal terminal. Refer to the following section for details on input signal allocation.

6.1.1 Input Signal Allocations on page 6-5



- Always input the /S-ON signal before you input a speed, position, or torque reference to start the Servomotor. Never input the reference first and then use the /S-ON signal or turn ON the AC power supply to start the Servomotor. Doing so will degrade internal elements and may cause an accident.
- 2. Input the /S-ON signal while the Servomotor is stopped. You cannot turn ON the servo while the Servomotor is operating.

5.5.2 Setting to Keep the Servo ON and Supply Power to the Motor Continuously

You can set $Pn50A = n.\square\square X\square$ (/S-ON (Servo ON) Signal Allocation) to 7 (The signal is always active) to keep the servo ON and supply power to the motor continuously.

Parameter		Meaning	When Enabled	Classification	
Pn50A	n.□□0□ (default setting)	The S-ON signal is active when CN1-40 input signal is ON (closed).	After restart	Setup	
THOOA	n.0070	The signal is always active. (The /S-ON signal is always active.)	Alter restait	Getup	



- 1. If you set this parameter to keep the servo ON continuously, power will be supplied to the motor as soon the main circuit power supply to the SERVOPACK is turned ON. If there is already a speed, position, or torque reference input, the Servomotor or machine may perform unexpected operation. Always implement safety measures.
- 2. If a resettable alarm occurs and operation is disabled (power is not supplied to the motor), operation will be automatically enabled (power will be supplied to the motor) when the alarm is reset. If you set this parameter to keep the servo ON continuously, the Servomotor or machine may perform unexpected operation when an alarm is reset.

Motor Direction Setting

You can reverse the direction of Servomotor rotation by changing the setting of Pn000 = $n.\Box\Box\Box$ X (Rotation Direction Selection) without changing the polarity of the speed or position reference.

This causes the rotation direction of the Servomotor to change, but the polarity of the signals, such as encoder output pulses, output from the SERVOPACK do not change. Set the appropriate direction for your system.

Refer to the following section for details on the encoder divided pulse output.

6.8 Encoder Divided Pulse Output on page 6-48

Rotary Servomotors

The default setting for forward rotation is counterclockwise (CCW) as viewed from the load end of the Servomotor.

Parameter		Forward/Reverse Reference	Motor Direction and En	Applicable Overtravel Signal (OT)	
	n.□□□0 Use CCW as	Forward reference	Torque reference Time Motor speed	Encoder Divided Pulse Outputs PAO TOTAL Phase-B lead	P-OT (Forward Drive Prohibit) signal
the forward direction. (default setting)	Reverse reference	Torque reference Time Motor speed	Encoder Divided Pulse Outputs PAO Phase-A lead PBO PBO	N-OT (Reverse Drive Prohibit) signal	
n.□□□1 Use CW as the forward direction. (Reverse Rotation Mode)	Forward reference	Torque reference Time Motor speed	Encoder Divided Pulse Outputs PAOPhase-B lead	P-OT (Forward Drive Prohibit) signal	
	tion. (Reverse Rota-	Reverse reference	Torque reference Time Motor speed	Encoder Divided Pulse Outputs PAO Phase-A lead PBO PBO	N-OT (Reverse Drive Prohibit) signal

Note: The trace waveforms of the SigmaWin+ are shown in the above table for the torque reference and motor speed diagrams. If you measure them on a measuring instrument, e.g., with an analog monitor, the polarity will be reversed.

Linear Servomotors

Before you set this parameter, make sure that $Pn080 = n.\square\square X\square$ (Motor Phase Sequence Selection) is set correctly.

Parameter		Forward/Reverse Reference		nd Encoder Divided Pulse puts	Applicable Overtravel Signal (OT)
n.□□□0 Use the direction in which the linear encoder counts up as the forward direction. (default setting) Pn000 n.□□□1 Use the direction in which the linear encoder counts down as the forward direction.	Use the direction in which	Forward reference	Moves in the count-up direction. Here Force reference Time Time Motor speed	Encoder Divided Pulse Outputs PAO PBO Phase-B lead	P-OT (For- ward Drive Prohibit) signal
	Reverse reference	Moves in the count-down direction. Force reference Time Count-down Motor speed	Encoder Divided Pulse Outputs PAO Phase-A lead PBO PBO	N-OT (Reverse Drive Prohibit) signal	
	n.□□□1 Use the direction in which	Forward reference	Moves in the count-down direction.	Encoder Divided Pulse Outputs PAO PBO Phase-B lead	P-OT (For- ward Drive Prohibit) signal
	down as the forward direc-	Reverse reference	Moves in the count-up direction.	Encoder Divided Pulse Outputs PAO Phase-A lead PBO PBO	N-OT (Reverse Drive Prohibit) signal

Note: The trace waveforms of the SigmaWin+ are shown in the above table for the force reference and motor speed diagrams. If you measure them on a measuring instrument, e.g., with an analog monitor, the polarity will be reversed.

Setting the Linear Encoder Pitch

If you connect a linear encoder to the SERVOPACK through a Serial Converter Unit, you must set the scale pitch of the linear encoder in Pn282.

If a Serial Converter Unit is not connected, the setting of the Pn282 is disabled.



Serial Converter Unit

The Serial Converter Unit converts the signal from the linear encoder into a form that can be read by the SERVOPACK.

Term

Scale Pitch

A linear encoder has a scale for measuring lengths (positions). The length of one division on this scale is the scale pitch.

	Linear Encoder Sc	ale Pitch	Speed Position Force		
Pn282	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 6,553,600	0.01 μm	0	After restart	Setup

You will not be able to control the Linear Servomotor if Pn282 is not set correctly. Check the above table and always set the correct value before you operate the Linear Servomotor.

Type of Linear Encoder	Manufacturer	Model	Serial Converter Unit Model	Linear Encoder Pitch [μm]	
		LIDA48□	JZDP-H003-□□□-E	20	
Incremental .	Dr. JOHANNES HEIDENHAIN GmbH		JZDP-J003-□□□-E		
			JZDP-H003-□□□-E	4	
		LIF40 L	JZDP-J003-□□□-E	4	
	Renishaw PLC	RGH22B	JZDP-H005-□□□-E	20	
	nenisnaw FLO	NGH22B	JZDP-J005-□□□-E	20	

The first time you supply power to the SERVOPACK, the panel display on the front of the Servomotor will display an A.080 alarm (Linear Encoder Pitch Setting Error). The A.080 alarm is displayed because the setting of Pn282 has not been changed. The A.080 alarm will be cleared when you change the setting of Pn282 and then turn the power supply OFF and ON again.



Linear Encoder Pitch

If you do not use a Serial Converter Unit, the linear encoder pitch is automatically set and the setting of the Pn282 is disabled. Refer to the following section for details.

Feedback Resolution of Linear Encoder on page 5-49


Writing Linear Servomotor Parameters

If you connect a linear encoder to the SERVOPACK without going through a Serial Converter Unit, you must use the SigmaWin+ to write the motor parameters to the linear encoder. The motor parameters contain the information that is required by the SERVOPACK to operate the Linear Servomotor.

⚠ WARNING

Check the Servomotor and linear encoder information before you write the motor parameters.

If you do not write the correct motor parameters, the Servomotor may run out of control or burning may occur, possibly resulting in equipment damage or fire.

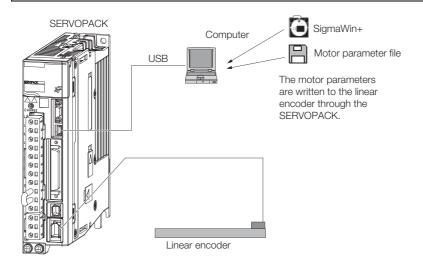



Serial number information is not included in the motor parameters. You cannot use the monitor functions of the SERVOPACK to monitor the serial number.

If you attempt to monitor the serial number, ****** will be displayed.

Precautions

- If the encoder parameters are not written to the linear encoder, an A.CAO alarm (Encoder Parameter Error) will occur. Consult the manufacturer of the linear encoder.
- If the motor parameters are not written to the linear encoder, an A.CAO alarm (Encoder Parameter Error) will not occur, but the following alarms will occur.
 - A.040 (Parameter Setting Error), A.041 (Encoder Output Pulse Setting Error),
 - A.050 (Combination Error), A.051 (Unsupported Device Alarm),
 - A.550 (Maximum Speed Setting Error), A.710 (Instantaneous Overload),
 - A.720 (Continuous Overload), and A.C90 (Encoder Communications Error)

Applicable Tools

The following table lists the tools that you can use to write the parameters to the Linear Servomotor.

Tool	Fn No./Function Name	Reference		
Panel Operator	You cannot write Linear Servomotor parameters from the Panel Operator.			
Digital Operator	You cannot write Linear Servomotor parameters from the Digital Operator.			
SigmaWin+	Encoder Setting – Motor Parameter Scale Write	© Operating Procedure on page 5-21		

Operating Procedure

Use the following procedure to write the motor parameters to the Linear Encoder.


- 1. Prepare the motor parameter file to write to the linear encoder.
- 2. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **3.** Select Motor Parameter Scale Write in the Menu Dialog Box. The Motor Parameter Scale Write Dialog Box will be displayed.
- 4. Click the OK Button.




Click the **Cancel** Button to cancel writing the motor parameters to the linear encoder. The Main Window will return.

If the write is completed normally, the Motor Parameter Scale Write - File Select Dialog Box will be displayed.


5. Click the Ref. Button.

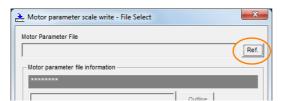

6. Select the motor parameter file that you prepared and click the Open Button.

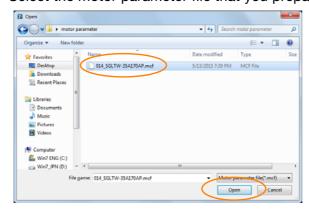


7. Confirm that the motor parameter file information that is displayed is suitable for your Servomotor, and then click the **Next** Button.

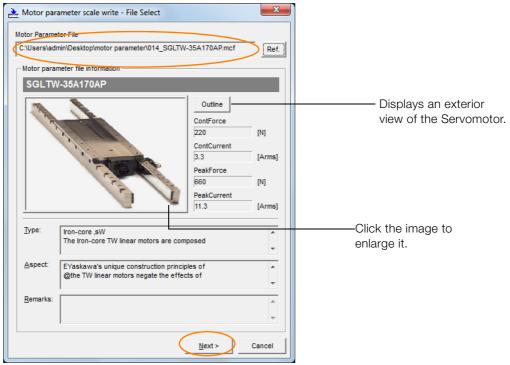


Click the **Cancel** Button to cancel writing the motor parameters to the linear encoder. The Main Window will return.

8. Click the Write Button.

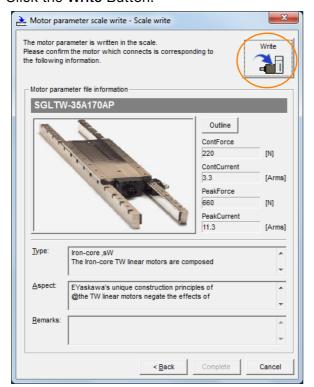


9. Click the Yes Button.

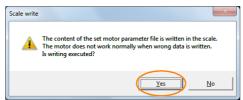


Click the No Button to cancel writing the motor parameters to the linear encoder.

If you click the Yes Button, writing the motor parameter scale will start.

10. Click the Complete Button.

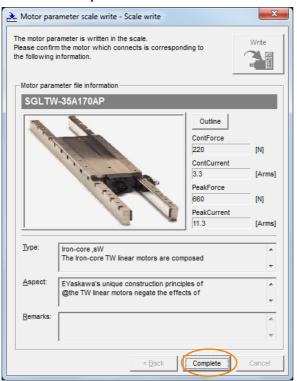

11. Click the OK Button.

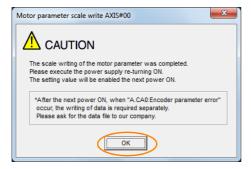

12. Turn the power supply to the SERVOPACK OFF and ON again.

This concludes the procedure to write the motor parameters.

Confirming If the Motor Parameters Have Been Written

After you write the motor parameters, you can use a monitor function to confirm that the motor parameters are in the encoder.

If the motor parameters have not been written, no information on the Servomotor will be displayed.

9.1 Monitoring Product Information on page 9-2

Selecting the Phase Sequence for a Linear Servomotor

You must select the phase sequence of the Linear Servomotor so that the forward direction of the Linear Servomotor is the same as the encoder's count-up direction.

Before you set the Linear Servomotor phase sequence ($Pn080 = n.\square\square X\square$), check the following items.

- Confirm that the signal from the linear encoder is being received normally.
- Make sure that the forward direction of the Linear Servomotor and the count-up direction of the linear encoder are in the same direction.



If you do not confirm the above items before you attempt to operate the Servomotor, the Servomotor may not operate or it may run out of control. Always confirm these items before you operate the Servomotor.

Related Parameters

Parameter		Meaning	When Enabled	Classification
Pn080	n.□□0□ (default setting)	Set a phase-A lead as a phase sequence of U, V, and W.	After restart	Setup
1 11000	n.□□1□	Set a phase-B lead as a phase sequence of U, V, and W.	7 (tol lestart	Colup

Operating Procedure

Use the following procedure to select the phase sequence for a Linear Servomotor.

- 1. Set Pn000 to n.□□□0 (Set a phase-A lead as a phase sequence of U, V, and W). This setting is to make following confirmation work easier to understand.
- 2. Select Monitor in the Menu Dialog Box.


The Operation Pane will be displayed so that you can check the feedback pulse counter. To check the feedback pulse counter with the Panel Operator or Digital Operator, use Un00D (Feedback Pulse Counter).

3. Manually move the Moving Coil from one end to the other of the stroke and confirm that only the correct number of feedback pulses is returned.

If the correct number and only the correct number of pulses is returned, the signal is being received correctly from the linear encoder.

Example

In this example, assume that a linear encoder with a scale pitch of 20 μm and a resolution of 256 is used. If you manually move the Moving Coil 1 cm in the count-up direction of the linear encoder, the number of feedback pulses would be as follows: 1 cm/(20 $\mu m/256$) = 128,000 pulses

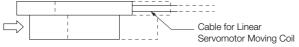


If there are 128,000 pulses on the feedback pulse counter after you manually move the Moving Coil in the direction of the cable, you have completed the confirmation.

Note: The actual monitor display will be offset by the error in the travel distance. There is no problem as long as the above value is close to the calculated value.

Information

If the correct value is not displayed for the feedback pulse counter, the following conditions may exist. Check the situation and correct any problems.

- The linear encoder pitch is not correct.
 If the scale pitch that is set in Pn282 does not agree with the actual scale pitch, the expected number of feedback pulses will not be returned. Check the specifications of the linear encoder.
- The linear encoder is not adjusted properly.
 If the linear encoder is not adjusted properly, the output signal level from the linear encoder will drop and the correct number of pulses will not be counted. Check the adjustment of the linear encoder. Contact the manufacturer of the linear encoder for details.
- There is a mistake in the wiring between the linear encoder and the Serial Converter Unit.
 - If the wiring is not correct, the correct number of pulses will not be counted. Correct the wiring.
- **4.** Manually move the Moving Coil in the direction of the cable and check the value of the feedback pulse counter in the Operation Pane to confirm that it is counting up.

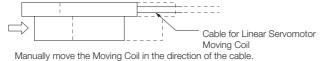

- 5. If the feedback pulse counter counts up, set a phase-A lead as a phase sequence of U, V, and W (Pn080 = n.□□0□).
 If the feedback pulse counter counts down, set a phase-B lead as a phase sequence of U, V, and W (Pn080 = n.□□1□).
- 6. Turn the power supply to the SERVOPACK OFF and ON again.
- 7. If necessary, return $Pn000 = n.\Box\Box\BoxX$ (Direction Selection) to its original setting.

This concludes the procedure to set the phase sequence of the Linear Servomotor.

Polarity Sensor Setting

The polarity sensor detects the polarity of the Servomotor. You must set a parameter to specify whether the Linear Servomotor that is connected to the SERVOPACK has a polarity sensor. Specify whether there is a polarity sensor in $Pn080 = n.\square\square\square\square X$ (Polarity Sensor Selection).

If the Linear Servomotor has a polarity sensor, set Pn080 to n. \$\square\$ (Use polarity sensor) (default setting).

If the Linear Servomotor does not have a polarity sensor, set Pn080 to n. \$\square\$ 1 (Do not use polarity sensor). Turn the power supply OFF and ON again to enable the new setting.

Parameter		Meaning	When Enabled	Classification
Pn080	n.□□□0 (default setting)	Use polarity sensor.	After restart	Setup
	n.□□□1	Do not use polarity sensor.		

Information

If you set Pn080 to n. \$\square\$ old (Use polarity sensor) and the Linear Servomotor that is connected to the SERVOPACK does not have a polarity sensor, an A.C21 alarm (Polarity Sensor Error) will occur when you turn the power supply OFF and ON again.

5.11 Polarity Detection

If you use a Linear Servomotor that does not have a polarity sensor, then you must detect the polarity.

Detecting the polarity means that the position of the electrical angle phase on the electrical angle coordinates of the Servomotor is detected. The SERVOPACK cannot control the Servomotor correctly unless it accurately knows the position of the electrical angle coordinate of the Servomotor.

The execution timing and execution method for polarity detection depend on the encoder specification as described in the following table.

Encoder Specification	Polarity Detection Execution Timing	Polarity Detection Execution Method
Incremental encoder	Each time the control power supply to the SERVOPACK is turned ON (Even after you execute polarity detection, the position of the polarity will be lost the next time the control power supply to the SERVOPACK is turned OFF.)	 Use the /S-ON (Servo ON) signal. Use the /P-DET (Polarity Detection) signal. Use the polarity detection function of the SigmaWin+. Execute the Fn080 (Polarity Detection) utility function from the Digital Operator or Panel Operator.
Absolute encoder	Only for initial setup, or after the SERVOPACK, linear encoder, or Servomotor has been replaced (The results of polarity detection is stored in the absolute encoder, so the polarity position is not lost when the control power supply is turned OFF.)	 Use the polarity detection function of the SigmaWin+. Execute the Fn080 (Polarity Detection) utility function from the Digital Opera- tor or Panel Operator.

Information

If you use a Linear Servomotor that does not have a polarity sensor, you will not be able to turn ON the servo until polarity detection has been completed.

5.11.1 Restrictions

Assumed Conditions

The Servomotor will move when you execute polarity detection. The following conditions must be met before you start.

- It must be OK to move the Moving Coil about 10 mm.
 (If polarity detection fails, the Moving Coil may move approximately 5 cm. The amount of movement depends on conditions.)
- The linear encoder pitch must be 100 μm or less. (We recommend a pitch of 40 μm or less for an incremental encoder.)
- As much as possible, the motor must not be subjected to an imbalanced external force. (We recommend 5% or less of the rated force.)
- The mass ratio must be 50x or less.
- The axis must be horizontal.
- There must be friction equivalent to a few percent of the rated force applied to the guides. (Air sliders cannot be used.)

5.11.2 Using the /S-ON (Servo ON) Signal to Perform Polarity Detection

Preparations

Always check the following before you execute polarity detection.

- Not using a polarity sensor must be specified (Pn080 = n. □□□1).
- The servo must be OFF.
- The main circuit power supply must be ON.
- There must be no hard wire base block (HWBB).
- There must be no alarms except for an A.C22 alarm (Phase Information Disagreement).
- The parameters must not be write prohibited. (This item applies only when using the SigmaWin+ or Digital Operator.)
- The test without a motor function must be disabled (Pn00C = n.□□□□0).
- There must be no overtravel.
- If the motor parameters have been written or the origin of the absolute linear encoder has been set, the power supply to the SERVOPACK must be turned OFF and ON again after completion of the writing or setting operation.




- 1. Power is supplied to the Servomotor during polarity detection. Be careful not to get an electric shock. Also, the Moving Coil of the Linear Servomotor may greatly move during detection. Do not approach the moving parts of the Servomotor.
- Polarity detection is affected by many factors.
 For example, polarity detection may fail if the mass ratio or friction is too large or the cable tension is too strong.

5.11.2 Using the /S-ON (Servo ON) Signal to Perform Polarity Detection

You can use the /S-ON (Servo ON) signal to perform polarity detection only with an incremental linear encoder.

Polarity detection will be performed when you turn the control power supply to the SERVO-PACK OFF and then ON again, and then input the /S-ON signal. As soon as polarity detection is completed, the /S-RDY (Servo Ready) signal will turn ON.

Туре	Signal	Connector Pin No.	Signal Status	Meaning
Input	Input /S-ON CN1-40 (default setting)	ON (closed)	The servo is turned ON (power is supplied to the motor), polarity detection is performed once, and then the servo is left ON. (The /S-RDY signal will turn ON.)	
			OFF (open)	The servo is turned OFF (power is not supplied to the motor) and operation is disabled.

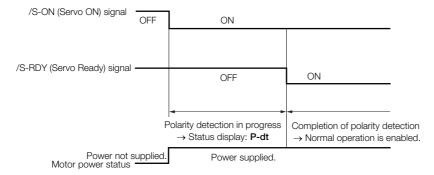

5.11.3 Using the /P-DET (Polarity Detection) Signal to Perform Polarity Detection

5.11.3 Using the /P-DET (Polarity Detection) Signal to Perform Polarity Detection

You can allocate the /P-DET (Polarity Detection) signal if you want to create a sequence on the host computer to monitor the /S-RDY (Servo Ready) signal and output the /S-ON (Servo ON) signal, or if you want to perform polarity detection at times other than when the /S-ON signal turns ON.

On the falling edge of the /P-DET signal, the servo will turn ON and polarity detection will be performed once. As soon as polarity detection is completed, the servo will turn ON and the /S-RDY (Servo Ready) signal will turn ON. After polarity detection has been completed, it will not be executed again even if you turn ON the /P-DET signal.

Туре	Signal	Connector Pin No.	Signal Status	Meaning
/S-ON Input /P-DET	/S ON	CN1-40	ON (closed)	Turns ON the servo (supplies power to the motor) and enables operation.
	(default setting)	OFF (open)	Turns OFF the servo (stops power supply to the motor) and disables operation.	
	/P-DET	Must be allocated.	ON (closed)	Executes polarity detection, but only on the first falling edge of the signal after the power supply is turned ON.
			OFF (open)	_

Note: You must allocate the /P-DET signal to use it. Use the following parameters to allocate signals.


- Pn50A = n.□□□1 (Change the sequence input signal allocations.)
- Pn50D = n.XDDD (/P-DET (Polarity Detection Input) Signal Allocation)

Refer to the following section for details.

6.1.1 Input Signal Allocations on page 6-5



When the /P-DET (Polarity Detection) signal is set to be always active, polarity detection will automatically start when the main circuit power supply is turned ON. This can result in unexpected operation of the Servomotor. Always implement safety measures when you preform polarity detection.

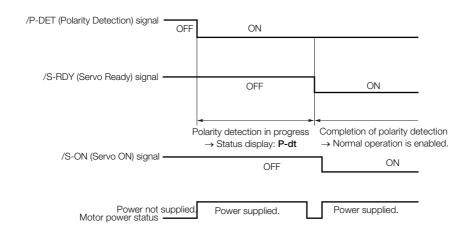

5.11.4 Using a Tool Function to Perform Polarity Detection

Applicable Tools


The following table lists the tools that you can use to perform polarity detection.

Tool	Fn No./Function Name	Reference	
Panel Operator	Fn080	13.4.26 Polarity Detection (Fn080) on page 13-29	
Digital Operator	Fn080	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)	
SigmaWin+	Encoder Setting - Polarity Detection	© Operating Procedure on page 5-30	

Operating Procedure

Use the following procedure to perform polarity detection.


- 1. Click the 🔎 Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Polarity Detection in the Menu Dialog Box. The Polarity Detection Dialog Box will be displayed.
- 3. Click the Continue Button.

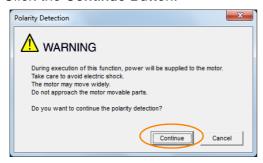

Click the Cancel Button to cancel polarity detection. The Main Window will return.

4. Click the Start Button.

Polarity detection will be executed.

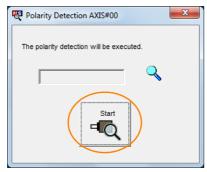

This concludes the polarity detection procedure.


5.12 Overtravel and Related Settings

Overtravel is a function of the SERVOPACK that forces the Servomotor to stop in response to a signal input from a limit switch that is activated when a moving part of the machine exceeds the safe range of movement.

The overtravel signals include the P-OT (Forward Drive Prohibit) and the N-OT (Reverse Drive Prohibit) signals.

You use the P-OT and N-OT signals to stop the machine by installing limit switches at the positions where you want to stop the machine that is operated by the Servomotor.

A SERVOPACK wiring example is provided below.

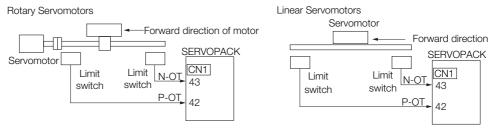

Using the overtravel function is not necessary for rotating applications such as rotary tables and conveyors. No wiring for overtravel input signals is required.

This section describes the parameters settings related to overtravel.

M CAUTION

- To prevent accidents that may result from contact faults or disconnections, use normally closed limit switches.
 - Do not change the default settings of the polarity of the overtravel signals (P-OT and N-OT).
- If you use a Servomotor for a vertical axis, the /BK (Brake) signal will remain ON (i.e., the brake will be released) when overtravel occurs. This may result in the workpiece falling when overtravel occurs. To prevent the workpiece from falling, set Pn001 to n.□□1□ to place the Servomotor in a zero-clamped state when it stops.
- A base block state is entered after stopping for overtravel. This may cause the Servomotor to be pushed back by an external force on the load shaft. To prevent the Servomotor from being pushed back, set Pn001 to n.□□1□ to place the Servomotor in a zero-clamped state when it stops.

5.12.1 Overtravel Signals

5.12.1 Overtravel Signals

The overtravel signals include the P-OT (Forward Drive Prohibit) and the N-OT (Reverse Drive Prohibit) signals.

Type	Signal	Connector Pin No.	Signal Status	Meaning
Input	P-OT	CN1-42	ON	Forward drive is enabled (actual operation).
			OFF	Forward drive is prohibited (forward overtravel).
	N-OT	CN1-43	ON	Reverse drive is enabled (actual operation).
			OFF	Reverse drive is prohibited (reverse overtravel).

You can operate the Servomotor in the opposite direction during overtravel by inputting a reference.



When the Servomotor stops due to overtravel during position control, the position deviation is held.

You must input the CLR (Clear) signal to clear the position deviation.

Refer to the following section for information on the CLR signal.

6.6.2 CLR (Position Deviation Clear) Signal Function and Settings on page 6-33

5.12.2 Setting to Enable/Disable Overtravel

You can use Pn50A = n.X (P-OT (Forward Drive Prohibit) Signal Allocation) and Pn50B = n. (N-OT (Reverse Drive Prohibit) Signal Allocation) to enable and disable the overtravel function

You do not need to wire the overtravel input signals if you are not going to use the overtravel function.

Parameter		Meaning	When Enabled	Classification
Pn50A	n.2□□□ (default setting)	The forward overtravel function is enabled and the P-OT (Forward Drive Prohibit) signal is input from CN1-42.		Setup
	n.8□□□	The forward overtravel function is disabled. Forward drive is always enabled.	After restart	
Pn50B	n.□□□3 (default setting)	The reverse overtravel function is enabled and the N-OT (Reverse Drive Prohibit) signal is input from CN1-43.	Alter restart	
	n.□□□8	The reverse overtravel function is disabled. Reverse drive is always enabled.		

You can allocate the P-OT and N-OT signals to other connector pins. Refer to the following section for details.

6.1.1 Input Signal Allocations on page 6-5

5.12.3 Motor Stopping Method for Overtravel

You can set the stopping method of the Servomotor when overtravel occurs in Pn001 = n.□□XX (Motor Stopping Method for Servo OFF and Group 1 Alarms and Overtravel Stopping Method).

Parameter		Motor Stopping Method*	Status after Stopping	When Enabled	Classification
Pn001	n.□□00 (default setting)	Dynamic brake	_		Setup
	n.□□01		Coasting		
	n.□□02	Coasting			
	n.□□1□	Deceleration	Zero clamp	After restart	
	n.□□2□	according to setting of Pn406	Coasting		
	n.□□3□	Deceleration	Zero clamp		
	n.□□4□	according to setting of Pn30A	Coasting		

^{*} You cannot decelerate a Servomotor to a stop during torque control. For torque control, the Servomotor will be stopped with the dynamic braking or coast to a stop (according to the setting of Pn001 = n.□□□X (Motor Stopping Method for Servo OFF and Group 1 Alarms)), and then the Servomotor will enter a coasting state.

Refer to the following section for information on stopping methods other than those for overtravel

5.14.1 Stopping Method for Servo OFF on page 5-42

Stopping the Servomotor by Setting Emergency Stop Torque

To stop the Servomotor by setting emergency stop torque, set Pn406 (Emergency Stop Torque).

If $Pn001 = n.\Box\Box X\Box$ is set to 1 or 2, the Servomotor will be decelerated to a stop using the torque set in Pn406 as the maximum torque.

The default setting is 800%. This setting is large enough to allow you to operate the Servomotor at the maximum torque. However, the maximum emergency stop torque that you can actually use is the maximum torque of the Servomotor.

	Emergency Stop Torque			Speed Position	
Pn406	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	800	Immediately	Setup

^{*} Set a percentage of the motor rated torque.

5.12.4 Overtravel Warnings


Stopping the Servomotor by Setting the Deceleration Time

To specify the Servomotor deceleration time and use it to stop the Servomotor, set Pn30A (Deceleration Time for Servo OFF and Forced Stops).

	Deceleration Time for Servo OFF and Forced Stops			Speed Position	
Pn30A	Setting Range Setting Unit Default Setting		Default Setting	When Enabled	Classification
	0 to 10,000	1 ms	0	Immediately	Setup

If you set Pn30A to 0, the Servomotor will be stopped with a zero speed.

The deceleration time that you set in Pn30A is the time to decelerate the Servomotor from the maximum motor speed.

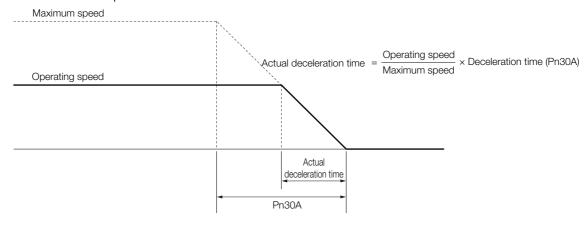

5.12.4 Overtravel Warnings

You can set the system to detect an A.9A0 warning (Overtravel) if overtravel occurs while the servo is ON. This allows the SERVOPACK to notify the host controller with a warning even when the overtravel signal is input only momentarily. An alarm occurs only if overtravel occurs while the servo is ON. An overtravel warning will not be detected when the servo is OFF, even if overtravel occurs.




- 1. The occurrence of an A.9A0 warning will not stop the motor or have any affect on host controller motion operations. The next step (e.g., the next motion or command) can be executed even if an overtravel warning exists.
 - However, depending on the processing specifications and programming for warnings in the host controller, operation may be affected when an overtravel warning occurs (e.g., motion may stop or not stop). Confirm the specifications and programming in the host controller.
- 2. When overtravel occurs, the SERVOPACK will perform stop processing for overtravel. Therefore, when an A.9A0 warning occurs, the Servomotor may not reach the target position specified by the host controller. Check the feedback position to make sure that the axis is stopped at a safe position.

The following parameter is set for this function.

Parameter		Meaning	When Enabled	Classification
Pn00D	n.0□□□ (default setting)	Do not detect overtravel warnings.	Immediately	Setup
	n.1□□□	Detect overtravel warnings.		

A timing chart for warning detection is provided below.

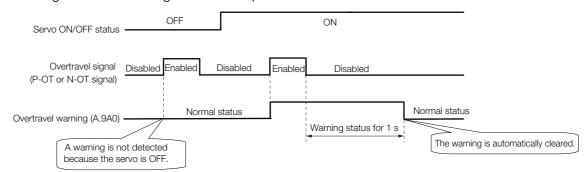

Information


- 1. Warnings are detected for overtravel in the same direction as the reference.
- 2. Warnings are not detected for overtravel in the opposite direction from the reference. Example: A warning will not be output for a forward reference even if the N-OT signal turns ON.
- 3. A warning can be detected in either the forward or reverse direction if there is no reference.
- 4. A warning will not be detected when the servo is turned ON even if overtravel status exists.
- 5. The warning status will be held for one second after the overtravel status no longer exists and it will then be cleared automatically.

5.13.1 Brake Operating Sequence

5.13 Holding Brake

A holding brake is used to hold the position of the moving part of the machine when the SERVOPACK is turned OFF so that moving part does not move due to gravity or an external force. You can use the brake that is built into a Servomotor with a Brake, or you can provide one on the machine.

The holding brake is used in the following cases.

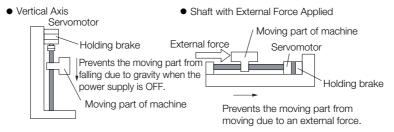



The brake built into a Servomotor with a Brake is a de-energization brake. It is used only to hold the Servomotor and cannot be used for braking. Use the holding brake only to hold a Servomotor that is already stopped.

5.13.1 Brake Operating Sequence

You must consider the brake release delay time and the brake operation delay time to determine the brake operation timing, as described below.




Brake Release Delay Time

The time from when the /BK (Brake) signal is turned ON until the brake is actually released.

Brake Operation Delay Time

The time from when the /BK (Brake) signal is turned OFF until the brake actually operates.

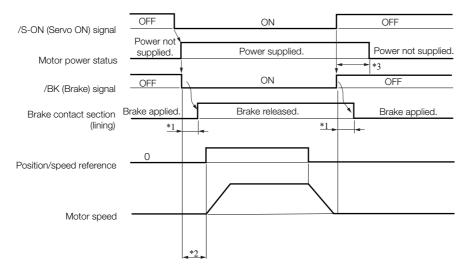

*1. Rotary Servomotors: The brake delay times for Servomotors with Holding Brakes are given in the following table. The operation delay times in the following table are examples for when the power supply is switched on the DC side. You must evaluate the actual brake delay times on the actual equipment before using the application.

Model	Voltage	Brake Release Delay Time [ms]	Brake Operation Delay Time [ms]
SGM7M-A1 to -A3		60	
SGM7J-A5 to -04		60	
SGM7J-06 and -08		80	100
SGM7A-A5 to -04		60	
SGM7A-06 to -10	24 VDC	80	
SGM7A-15 to -25		170	80
SGM7A-30 to -50		100	60
SGM7P-01	24 VDC	20	
SGM7P-02 and -04		40	100
SGM7P-08 and -15		20	
SGM7G-03 to -20		100	80
SGM7G-30 to -44		170	100
SGM7G-55 to -1A		170	80
SGM7G-1E		250	00

Linear Servomotors: The brake delay times depend on the brake that you use. Set the parameters related to /BK signal output timing according to the delay times for the brake that you will actually use.

- *2. Before you output a reference from the host controller to the SERVOPACK, wait for at least 50 ms plus the brake release delay time after you turn ON the /S-ON signal.
- *3. Use the following parameters to set the timing of when the brake will operate and when the servo will be turned OFF.
 - Rotary Servomotors: Pn506 (Brake Reference-Servo OFF Delay Time), Pn507 (Brake Reference Output Speed Level), and Pn508 (Servo OFF-Brake Command Waiting Time)
 - Linear Servomotors: Pn506 (Brake Reference-Servo OFF Delay Time), Pn508 (Servo OFF-Brake Command Waiting Time), and Pn583 (Brake Reference Output Speed Level)

Connection Examples

Refer to the following section for information on brake wiring.

4.4.4 Wiring the SERVOPACK to the Holding Brake on page 4-34

5.13.2 /BK (Brake) Signal

The following settings are for the output signal that controls the brake. The /BK (Brake) signal is not allocated by default. To use the brake, change the setting of Pn50F = $n.\Box X\Box\Box$ (/BK (Brake Output) Signal Allocation).

The /BK signal is turned OFF (to operate the brake) when the servo is turned OFF or when an alarm is detected. You can adjust the timing of brake operation (i.e., the timing of turning OFF the /BK signal) with the servo OFF delay time (Pn506).

Type	Signal	Connector Pin No.	Signal Status	Meaning
Output	utput /BK	Must be allocated.	ON (closed)	Releases the brake.
Output			OFF (open)	Activates the brake.

Information The /BK signal will remain ON during overtravel. The brake will not be applied.

5.13.3 Output Timing of /BK (Brake) Signal When the Servomotor Is Stopped

Allocating the /BK (Brake) Signal

To use the brake, you must allocate an output signal for the /BK signal. Set the allocation for the /BK signal in Pn50F = $n.\Box X\Box\Box$ (/BK (Brake Output) Signal Allocation).

Parameter		Connector Pin No.		Meaning	When	Classification
		+ Pin	- Pin	iviearing	Enabled	Classification
Pn50F	n.□0□□ (default setting)	_	_	The /BK signal is not used.		Setup
	n.□1□□	CN1-25	CN1-26	The /BK signal is output from CN1-25 and CN1-26.	After restart	
	n.□2□□	CN1-27	CN1-28	The /BK signal is output from CN1-27 and CN1-28.	Alter restart	
	n.□3□□	CN1-29	CN1-30	The /BK signal is output from CN1-29 and CN1-30.		



 Signals other than the /BK signal are allocated to the connector pins by default. To allocate connector pins to the /BK signal, you must clear the allocations for the originally allocated signals.

Example: Allocating the /BK Signal to CN1-25 and CN1-26 By default, the /COIN (Positioning Completion) signal is allocated to CN1-25 and the /V-CMP (Speed Coincidence Detection) signal is allocated to CN1-26. Therefore, to allocate the connector pins to the /BK signal, you must change the settings of the following two parameters.

- Pn50F = n.□1□□ (Output the /BK signal from CN1-25 and CN1-26.)
- Set Pn50E = n.□□XX to a value other than 1. (This clears the allocations of the /COIN and / V-CMP signals to CN1-25 and CN1-26.)
- 2. If you allocate more than one signal to the same output connector pin, a logical OR of the signals is output. Allocate the /BK signal to its own output connector pin, i.e., do not use the same output terminal for another signal.


For example, never allocate the /TGON (Rotation Detection) signal and /BK signal to the same output connector pin. If you did so, the /TGON signal would be turned ON by the falling speed on a vertical axis, and the brake would not operate.

5.13.3 Output Timing of /BK (Brake) Signal When the Servomotor Is Stopped

When the Servomotor is stopped, the /BK signal turns OFF at the same time as the /S-ON signal turns OFF. Use the servo OFF delay time (Pn506) to change the timing to turn OFF power supply to the motor after the /S-ON signal turns OFF.

	Brake Reference-Se	ervo OFF Delay Time	Speed Position	on Torque	
Pn506	Setting Range	ing Range Setting Unit Default Setting		When Enabled	Classification
	0 to 50	10 ms	0	Immediately	Setup

- When the Servomotor is used to control a vertical axis, the machine moving part may move slightly due to gravity or an external force.
 You can eliminate this slight motion by setting the servo OFF delay time (Pn506) so that power supply to the motor is stopped after the brake is applied.
- This parameter sets the timing of stopping power supply to the Servomotor while the Servomotor is stopped.

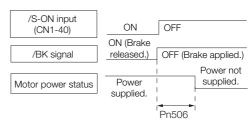



Power supply to the Servomotor will be stopped immediately when an alarm occurs, regardless of the setting of this parameter. The machine moving part may move due to gravity or an external force before the brake is applied.

5.13.4 Output Timing of /BK (Brake) Signal When the Servomotor Is Operating

If an alarm occurs while the Servomotor is operating, the Servomotor will start stopping and the /BK signal will be turned OFF. You can adjust the timing of /BK signal output by setting the brake reference output speed level (Rotary Servomotors: Pn507, Linear Servomotors: Pn583) and the Servo OFF-Brake Command Waiting Time (Pn508).

Note: If zero-speed stopping is set as the stopping method for alarms, the setting of Pn506 (Brake Reference-Servo OFF Delay Time) is used after the motor stops.

· Rotary Servomotors


Pn507	Brake Reference O	utput Speed Level	Speed Position Torque		
	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 min ⁻¹	100	Immediately	Setup
	Servo OFF-Brake C	ommand Waiting Ti	Speed Positi	on Torque	
Pn508	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	10 to 100	10 ms	50	Immediately	Setup

Linear Servomotors

	Brake Reference O	utput Speed Level	Speed Position Force		
Pn583	Setting Range	Setting Unit Default Setting		When Enabled	Classification
	0 to 10,000	1 mm/s 10		Immediately	Setup
	Servo OFF-Brake C	ommand Waiting Tir	Speed Positi	on Force	
Pn508	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	10 to 100 10 ms 50			Immediately	Setup


The brake operates when either of the following conditions is satisfied:

 When the Motor Speed Goes below the Level Set in Pn507 for a Rotary Servomotor or in Pn583 for a Linear Servomotor after the Power Supply to the Motor Is Stopped

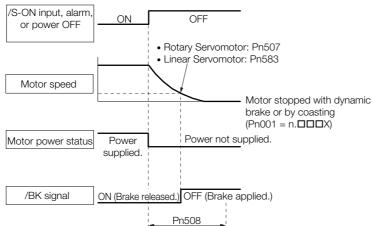

5.13.4 Output Timing of /BK (Brake) Signal When the Servomotor Is Operating

• When the Time Set In Pn508 Elapses after the Power Supply to the Motor Is Stopped

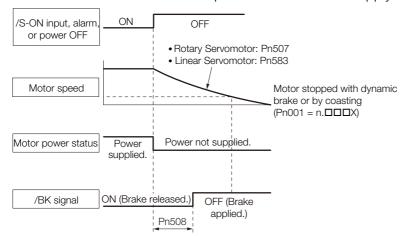



The Servomotor will be limited to its maximum speed even if the brake reference output speed level (Rotary Servomotor: Pn507, Linear Servomotor: Pn583) is higher than the maximum speed.

5.14

Motor Stopping Methods for Servo OFF and Alarms

You can use the following methods to stop the Servomotor when the servo is turned OFF or an alarm occurs.

There are the following four stopping methods.

Motor Stopping Method	Meaning	
Stopping by Applying the Dynamic Brake	The electric circuits are internally connected to stop the Servomotor quickly.	
Coasting to a Stop	The motor stops naturally due to friction during operation.	
Zero-speed Stopping	The speed reference is set to 0 to stop the Servomotor quickly.	
Decelerating to a Stop	Emergency stop torque is used to decelerate the motor to a stop.	

There are the following three conditions after stopping.

Status after Stopping	Meaning
Dynamic Brake Applied	The electric circuits are internally connected to hold the Servomotor.
Coasting	The SERVOPACK does not control the Servomotor. (The machine will move in response to a force from the load.)
Zero Clamping	A position loop is created and the Servomotor remains stopped at a position reference of 0. (The current stop position is held.)



- The dynamic brake is used for emergency stops. The dynamic brake circuit will operate frequently if the power supply is turned ON and OFF or the servo is turned ON and OFF while a reference input is applied to start and stop the Servomotor. This may result in deterioration of the internal elements in the SERVOPACK. Use speed input references or position references to start and stop the Servomotor.
- If you turn OFF the main circuit power supply or control power supply during operation before you turn OFF the servo, the Servomotor stopping method depends on the SERVOPACK model as shown in the following table.

	Servomotor Stopping Method			
Condition	SGD7S-R70A, -1R6A, -2R8A, -3R8A, -5R5A, -7R6A, -120A, -180A, -200A, -R70F, -R90F, -2R1F, or -2R8F	SGD7S-330A, -470A, -550A, -590A, or -780A		
Main circuit power supply turned OFF before turning OFF the servo	Stopping with dynamic brake			
Control power supply turned OFF before turning OFF the servo	Stopping with dynamic brake	Coasting to a stop		

- If the Servomotor must be stopped by coasting rather than with the dynamic brake when the main circuit power supply or the control power supply is turned OFF before the servo is turned OFF, use a SERVOPACK with the dynamic brake option.
- To minimize the coasting distance of the Servomotor to come to a stop when an alarm occurs, zero-speed stopping is the default method for alarms to which it is applicable. However, depending on the application, stopping with the dynamic brake may be more suitable than zero-speed stopping.

For example, when coupling two shafts (twin-drive operation), machine damage may occur if a zero-speed stopping alarm occurs for one of the coupled shafts and the other shaft stops with a dynamic brake. In such cases, change the stopping method to the dynamic brake.

5.14.1 Stopping Method for Servo OFF

5.14.1 Stopping Method for Servo OFF

Set the stopping method for when the servo is turned OFF in Pn001 = $n.\Box\Box\Box$ X (Motor Stopping Method for Servo OFF and Group 1 Alarms).

Parameter		Servomotor Stopping Method	Status after Servomotor Stops	When Enabled	Classification	
D004	n.□□□0 (default setting)	Dynamic brake*	Dynamic brake*	After restart	Setup	
Pn001	n.□□□1		Coasting			
	n.□□□2	Coasting	Coasting			

^{*} The Servomotor will coast to a stop when the SERVOPACK is not equipped with a built-in Dynamic Brake Resistor or an External Dynamic Brake Resistor is not connected.

Note: If Pn001 is set to n. \(\sigma\) \(\sigma\) (Stop the motor by applying the dynamic brake) and the Servomotor is stopped or operates at a low speed, braking force may not be generated, just like it is not generated for coasting to a stop.

5.14.2 Servomotor Stopping Method for Alarms

There are two types of alarms, group 1 (Gr. 1) alarms and group 2 (Gr. 2) alarms. A different parameter is used to set the stopping method for alarms for each alarm type.

Refer to the following section to see which alarms are in group 1 and which are in group 2.

12.2.1 List of Alarms on page 12-5

Motor Stopping Method for Group 1 Alarms

When a group 1 alarm occurs, the Servomotor will stop according to the setting of Pn001 = $n.\Box\Box\Box$ X. The default setting is to stop by applying the dynamic brake.

Refer to the following section for details.

5.14.1 Stopping Method for Servo OFF on page 5-42

Motor Stopping Method for Group 2 Alarms

When a group 2 alarm occurs, the Servomotor will stop according to the settings of the following three parameters. The default setting is for zero clamping.

- Pn001 = n.□□□X (Motor Stopping Method for Servo OFF and Group 1 Alarms)
- Pn00A = n.□□□X (Motor Stopping Method for Group 2 Alarms)
- Pn00B = n.□□X□ (Motor Stopping Method for Group 2 Alarms)

However, during torque control, the group 1 stopping method is always used.

If you set Pn00B to n. \$\square\$ (Apply dynamic brake or coast Servomotor to a stop), you can use the same stopping method as group 1. If you are coordinating a number of Servomotors, you can use this stopping method to prevent machine damage that may result because of differences in the stopping method.

The following table shows the combinations of the parameter settings and the resulting stopping methods.

	Paramete	er	Servomotor	Status after	When	
Pn00B	Pn00A	Pn001	Stopping Method	Servomotor Stops	Enabled	Classification
n.□□0□ (default	-	n.□□□0 (default setting)	Zero-speed stop-	Dynamic brake		
setting)		n.□□□1 n.□□□2	ping	Coasting		
n.0010		n.□□□0 (default setting)	Dynamic brake	Dynamic brake		
	_	n.□□□1 n.□□□2	Coasting	Coasting		
		n.□□□0 (default setting)	Dynamic brake	Dynamic brake	_	Setup
	n.□□□0	n.□□□1 n.□□□2	Coasting	Coasting		
	n.□□□1 (default setting)	n.□□□0 (default setting)		Dynamic brake	After restart	
		n.□□□1 n.□□□2	Motor is decelerated using the torque set in Pn406 as the maximum torque.	Coasting		
n.□□2□	n.□□□2	n.□□□0 (default setting)		Coasting		
		n.□□□1 n.□□□2				
	- 0000	n.□□□0 (default setting)		Dynamic brake		
	n.□□□3	n.□□□1 n.□□□2	Motor is deceler-	Coasting		
	n 0004	n.□□□0 (default setting)	ated according to setting of Pn30A.	Coasting		
	n.□□□4	n.□□□1 n.□□□2		Ouasing		

Note: 1. The setting of Pn00A is ignored if Pn00B is set to n. \square \square 0 \square or n. \square 1 \square .

- 2. The setting of Pn00A = n. \$\square\$ \square\$ is enabled for position control and speed control. During torque control, the setting of Pn00A = n. \$\square\$ \square\$ is enabled for position control and speed control. During torque control, the setting of Pn00A = n. \$\square\$ \square\$ is enabled for position control and speed control. During torque control, the setting of Pn00A = n. \$\square\$ \square\$ is enabled for position control and speed control. During torque control, the setting of Pn00A = n. \$\square\$ is enabled for position control and speed control. During torque control, the setting of Pn00A = n. \$\square\$ \square\$ is enabled for position control and speed control. During torque control, the setting of Pn00A = n. \$\square\$ is enabled for position control and speed control.
- 3. Refer to the following section for details on Pn406 (Emergency Stop Torque).
 - Stopping the Servomotor by Setting Emergency Stop Torque on page 5-33
- 4. Refer to the following section for details on Pn30A (Deceleration Time for Servo OFF and Forced Stops).
 - Stopping the Servomotor by Setting the Deceleration Time on page 5-34

5.15.1 Detection Timing for Overload Warnings (A.910)

5.15

Motor Overload Detection Level

The motor overload detection level is the threshold used to detect overload alarms and overload warnings when the Servomotor is subjected to a continuous load that exceeds the Servomotor ratings.


It is designed to prevent Servomotor overheating.

You can change the detection timing for A.910 warnings (Overload) and A.720 alarms (Continuous Overload). You cannot change the detection level for A.710 alarms (Instantaneous Overload).

5.15.1 Detection Timing for Overload Warnings (A.910)

With the default setting for overload warnings, an overload warning is detected in 20% of the time required to detect an overload alarm. You can change the time required to detect an overload warning by changing the setting of the overload warning level (Pn52B). You can increase safety by using overload warning detection as an overload protection function matched to the system.

The following graph shows an example of the detection of overload warnings when the overload warning level (Pn52B) is changed from 20% to 50%. An overload warning is detected in half of the time required to detect an overload alarm.

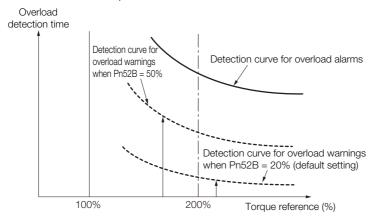

	Overload Warning L	evel	Speed Position	Torque	
Pn52B	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	1 to 100	1%	20	Immediately	Setup

5.15.2 Detection Timing for Overload Alarms (A.720)


If Servomotor heat dissipation is insufficient (e.g., if the heat sink is too small), you can lower the overload alarm detection level to help prevent overheating.

To reduce the overload alarm detection level, change the setting of Pn52C (Base Current Derating at Motor Overload Detection).

	Base Current Derati	ng at Motor Overloa	Speed Position	Torque	
Pn52C	Setting Range	Setting Unit	Default Setting	When Enabled Classification	
	10 to 100	1%	100	After restart	Setup

An A.720 alarm (Continuous Overload) can be detected earlier to protect the Servomotor from overloading.

Overload detection time

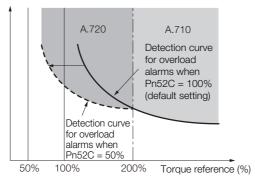

Note: The gray areas in the above graph show where A.710 and A.720 alarms occur.

Refer to the relevant manual given below for a diagram that shows the relationships between the Servomotor heat dissipation conditions (heat sink size, surrounding air temperature, and derating). You can protect the Servomotor from overloads more effectively by setting this derating value in Pn52C.

- Ω Σ-7-Series Rotary Servomotor Product Manual (Manual No.: SIEP S800001 36)
- Σ-7-Series Linear Servomotor Product Manual (Manual No.: SIEP S800001 37)
- Σ-7-Series Direct Drive Servomotor Product Manual (Manual No.: SIEP S800001 38)

5.16

Electronic Gear Settings

The minimum unit of the position data that is used to move a load is called the reference unit. The reference unit is used to give travel amounts, not in pulses, but rather in distances or other physical units (such as μm or °) that are easier to understand.

The electronic gear is used to convert the travel distances that are specified in reference units to pulses, which are required for actual movements.

With the electronic gear, one reference unit is equal to the workpiece travel distance per reference pulse input to the SERVOPACK. In other words, if you use the SERVOPACK's electronic gear, pulses can be read as reference units.


Note: 1. If you set an electronic gear in the host controller, normally set the electronic gear ratio in the SERVOPACK to 1:1.

2. If you enable reference pulse input multiplication switching, the reference unit is defined as the position data that is n times the reference pulses input from the host controller. ("n" is the reference pulse input multiplier.)

The difference between using and not using the electronic gear is shown below.

Rotary Servomotors

In this example, the following machine configuration is used to move the workpiece 10 mm.

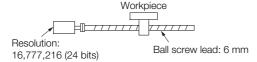

When the Electronic Gear Is Not Used

To move a workpiece 10 mm:

①Calculate the number of revolutions.

The Servomotor will move 6 mm for each revolution, so 10/6 revolutions are required to move 10 mm.

©Calculate the required number of reference pulses.

One revolution is 16,777,216 pulses, therefore $10/6 \times 16,777,216 = 27,962,026.66$ pulses. ③Input 27,962,027 pulses as the reference.

Calculating the number of reference pulses for each reference is troublesome.



When the Electronic Gear Is Used


If you use reference units to move the workpiece when one reference unit is set to 1 μ m, the travel distance is 1 μ m per pulse.

To move the workpiece 10 mm (10,000 μ m), 10,000 ÷ 1 = 10,000 pulses, so 10,000 pulses would be input.

Calculating the number of reference pulses for each reference is not necessary.


Linear Servomotors

In this example, the following machine configuration is used to move the load 10 mm. We'll assume that the resolution of the Serial Converter Unit is 256 and that the linear encoder pitch is $20 \, \mu m$.

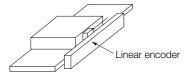

When the Electronic Gear Is Not Used

To move the load 10 mm: $10 \times 1000 \div 20 \times 256 = 128,000$ pulses, so 128,000 pulses are input as the reference.

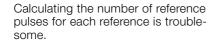



When the Electronic Gear Is Used

To use reference units to move the load 10 mm: If we set the reference unit to 1 μ m, the travel distance is 1 μ m per pulse. To move the load 10 mm (10,000 μ m), 10,000/1 = 10,000 pulses, so 10,000 pulses would be input as the reference.

Calculating the number of reference pulses for each reference is not necessary.

5.16.1 Electronic Gear Ratio Settings

Set the electronic gear ratio using Pn20E and Pn210.



The setting range of the electronic gear depends on the setting of $Pn040 = n.\square\square X\square$ (Encoder Resolution Compatibility Selection).

- Pn040 = n.□□0□ (Use the encoder resolution of the Servomotor.)
 Set the electronic gear ratio within the following range.
 0.001 ≤ Electronic gear ratio (B/A) ≤ 64,000
 If the electronic gear ratio is outside of this range, an A.040 alarm (Paran
- If the electronic gear ratio is outside of this range, an A.040 alarm (Parameter Setting Error) will occur.
- Pn040 = n.□□1□ (Use a resolution of 20 bits when connected to an SGM7J, SGM7A, SGM7P, SGM7G, SGM7E, or SGM7F Servomotor.)
 Set the electronic gear ratio within the following range.
 0.001 ≤ Electronic gear ratio (B/A) ≤ 4,000

If the electronic gear ratio is outside of this range, an A.040 alarm (Parameter Setting Error) will occur.

	Electronic Gear Ratio (Numerator)			Position		
Pn20E	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	1 to 1,073,741,824	1	64	After restart	Setup	
	Electronic Gear Ratio (Denominator)			Position		
Pn210	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	1 to 1,073,741,824	1	1	After restart	Setup	

5.16.1 Electronic Gear Ratio Settings

Calculating the Settings for the Electronic Gear Ratio


Rotary Servomotors

If the gear ratio between the Servomotor shaft and the load is given as n/m, where n is the number of load rotations for m Servomotor shaft rotations, the settings for the electronic gear ratio can be calculated as follows:

Electronic gear ratio
$$\frac{B}{A} = \frac{Pn20E}{Pn210} = \frac{Encoder\ resolution}{Travel\ distance\ per\ load\ shaft\ revolution\ (reference\ units)} \times \frac{m}{n}$$

■ Encoder Resolution

You can check the encoder resolution in the Servomotor model number.

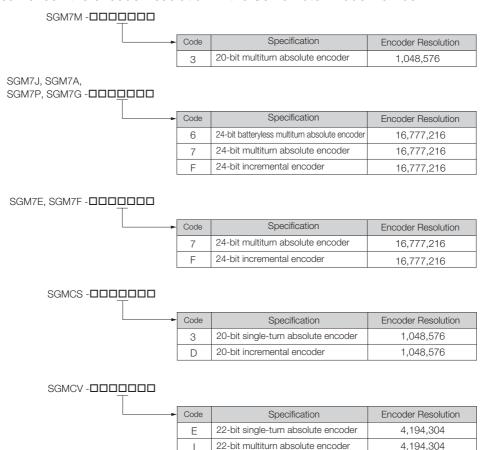

◆ Linear Servomotors

You can calculate the settings for the electronic gear ratio with the following equation:

When Not Using a Serial Converter Unit

Use the following formula if the linear encoder and SERVOPACK are connected directly or if a linear encoder that does not require a Serial Converter Unit is used.

Electronic gear ratio
$$\frac{B}{A} = \frac{Pn20E}{Pn210} = \frac{Travel distance per reference unit (reference units) × Linear encoder resolution Linear encoder pitch (the value from the following table)$$

When Using a Serial Converter Unit

$$\text{Electronic gear ratio} \, \frac{B}{A} = \frac{\text{Pn20E}}{\text{Pn210}} = \, \frac{\text{Travel distance per reference unit (reference units)} \times \text{Resolution of the Serial Converter Unit} }{\text{Linear encoder pitch (setting of Pn282)} }$$

■ Feedback Resolution of Linear Encoder

The linear encoder pitches and resolutions are given in the following table. Calculate the electronic gear ratio using the values in the following table.

Type of Linear Encoder	Manufacturer	Linear Encoder Model	Linear Encoder Pitch [µm]*1	Relay Device Model between SERVOPACK and Linear Encoder	Resolution	Resolution	
	D.*	1 IDA 40 D	20	JZDP-H003-□□□-E*2	256	0.078 μm	
	Dr. JOHANNES	LIDA48□	20	JZDP-J003- □□□ -E*2	4,096	0.0049 μm	
	HEIDENHAIN	11540	4	JZDP-H003-□□□-E*2	256	0.016 μm	
	GmbH	LIF48□	4	JZDP-J003- □□□ -E*2	4,096	0.00098 μm	
	Renishaw	RGH22B	00	JZDP-H005- □□□ -E*2	256	0.078 μm	
	PLC		20	JZDP-J005- □□□ -E*2	4,096	0.0049 μm	
		SR75-□□□□□□LF*3	80	_	8,192	0.0098 μm	
Incre-		SR75-DDDDDMF	80	_	1,024	0.078 μm	
mental		SR85-□□□□□□LF*3	80	_	8,192	0.0098 μm	
	Magnescale	SR85-DDDDDMF	80	_	1,024	0.078 μm	
	Co., Ltd.	SL700*3, SL710*3,	000	PL101-RY*4	0.400	0.0077	
		SL720*3, SL730*3	800	MJ620-T13*5	8,192	0.0977 μm	
		SQ10	400	MQ10-FLA*5 MQ10-GLA*5	8,192	0.0488 μm	
	Canon	PH03-36110	128	_	2,048	0.0625 μm	
	Precision Inc.	PH03-36120	128	_	2,048	0.0625 μm	
		LIC4100 Series*6	20.48	EIB3391Y*7	4,096	0.005 μm	
		LIC2100 Series*6	204.8	EIB3391Y*7	4,096	0.05 μm	
			409.6	EIB3391Y*7	4,096	0.1 μm	
		LIC4190 Series	40.96	_	4,096	0.01 μm	
	Dr. JOHANNES HEIDENHAIN GmbH		20.48	_	4,096	0.005 μm	
			4.096	_	4,096	0.001 μm	
		LIC3190 Series	40.96	_	4,096	0.01 μm	
			LIC2190 Series	409.6	_	4,096	0.1 μm
			204.8	-	4,096	0.05 μm	
		LC115	40.96	EIB3391Y*7	4,096	0.01 μm	
		LC415	40.96	EIB3391Y*7	4,096	0.01 μm	
		MC15Y Series	409.6	_	4,096	0.1 μm	
Absolute	GmbH	OTTO 4 A /OTTO 4 A I	204.8	_	4,096	0.05 μm	
		ST781A/ST781AL	256	_	512	0.5 μm	
		ST782A/ST782AL	256	_	512	0.5 μm	
		ST783/ST783AL ST784/ST784AL	51.2 51.2	_	512	0.1 μm	
	Mitutoyo Corporation	ST788A/ST788AL	51.2	_	512 512	0.1 μm	
	Corporation	ST789A/ST789AL	25.6	_	512	0.1 μm 0.05 μm	
		ST1381	5.12		512	0.03 μm	
		ST1382	0.512	_	512	0.001 μm	
		EL36Y 0050F 00	12.8	_	256	0.05 μm	
		EL36Y 100F 100F	25.6	_	256	0.1 μm	
	Renishaw	EL36Y 0 0 500F 0 0	128	_	256	0.7 μm	
	PLC	RL36Y 0050 000 000	12.8	_	256	0.05 μm	
		RL36Y 0001 0001	0.256	_	256	0.00 μm	
			0.200			n nevt nage	

Continued on next page.

5.16.1 Electronic Gear Ratio Settings

Continued from previous page.

Type of			Linear	Relay Device Model		erroue page.
	Manufacturer	Linear Encoder Model	Encoder Pitch [µm]*1	between SERVOPACK and Linear Encoder	Resolution	Resolution
			2,000	_	2,048	0.9765 μm
	RLS d.o.o.	LA11YA Series	2,000	_	4,096	0.4882 μm
			2,000	_	8,192	0.2441 μm
		SR77-0000LF*3	80	_	8,192	0.0098 μm
		SR77-DDDDDMF	80	_	1,024	0.078 μm
		SR87-□□□□□□LF*3	80	_	8,192	0.0098 μm
		SR87-DDDDDMF	80	_	1,024	0.078 μm
	Magnescale Co., Ltd.	SQ47/SQ57- □□□□□SF□□□ SQ47/SQ57- □□□□□TF□□□	20.48	_	4,096	0.005 μm
Absolute		SQ47/SQ57- □□□□□□AF□□□ SQ47/SQ57- □□□□□□FF□□□	40.96	_	4,096	0.01 μm
		L2AK208	20	_	256	0.078 μm
		L2AK211	20	_	2,048	0.0098 μm
		LAK209	40	_	512	0.078 μm
		LAK212	40	_	4,096	0.0098 µm
	Fagor Automation S.	S2AK208	20	_	256	0.078 μm
	Coop.	SV2AK208	20	_	256	0.078 μm
		G2AK208	20	_	256	0.078 μm
		S2AK211	20	_	2,048	0.0098 μm
		SV2AK211	20	_	2,048	0.0098 µm
		G2AK211	20	_	2,048	0.0098 μm
	Canon Precision Inc.	PH03-36E00	128	-	2,048	0.0625 μm

^{*1.} These are reference values for setting SERVOPACK parameters. Contact the manufacturer for actual linear encoder scale pitches.

6.8.2 Setting for the Encoder Divided Pulse Output on page 6-53

- *4. This is the model of the Head with Interpolator.
- *5. This is the model of the Interpolator.
- *6. Sales of the interface unit EIB3391Y with the LIC4100 and LIC2100 series have ended due to the release of the LIC4190, LIC3190, and LIC2190 series.
- *7. This is the model of the Interface Unit.

Information


Resolution

You can calculate the resolution that is used inside the SERVOPACK (i.e., the travel distance per feedback pulse) with the following formula.

Resolution (travel distance per feedback pulse) = Linear encoder pitch

Resolution of Serial Converter Unit or linear encoder

The SERVOPACK uses feedback pulses as the unit to control a Servomotor.

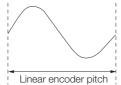

Linear encoder pitch

=Distance for one cycle of the analog voltage feedback signal from the linear encoder

^{*2.} This is the model of the Serial Converter Unit.

^{*3.} If you use an encoder pulse output with this linear encoder, the setting range of the encoder output resolution (Pn281) is restricted. Refer to the following section for details on the encoder output resolution (Pn281).

5.16.2 Electronic Gear Ratio Setting Examples

Setting examples are provided in this section.

• Rotary Servomotors

			Machine Configuration	
		Ball Screw	Rotary Table	Belt and Pulley
Step Description		Reference unit: 0.001 mm Load shaft Encoder: Ball screw lead: 24 bits 6 mm	Reference unit: 0.01° Gear ratio: 1/100 Load shaft Encoder: 24 bits	Reference unit: 0.005 mm Load shaft Gear ratio: Pulley dia.: 1/50
1	Machine Specifications	Ball screw lead: 6 mm Gear ratio: 1/1	Rotational angle per revolution: 360° Gear ratio: 1/100	Pulley dia.: 100 mm (Pulley circumference: 314 mm) Gear ratio: 1/50
2	Encoder Resolution	16,777,216 (24 bits)	16,777,216 (24 bits)	16,777,216 (24 bits)
3	Reference Unit	0.001 mm (1 μm)	0.01°	0.005 mm (5 μm)
4	Travel Distance per Load Shaft Revolution (Reference Units)	6 mm/0.001 mm = 6,000	360°/0.01° = 36,000	314 mm/0.005 mm = 62,800
5	Electronic Gear Ratio	$\frac{B}{A} = \frac{16,777,216}{6,000} \times \frac{1}{1}$	$\frac{B}{A} = \frac{16,777,216}{36,000} \times \frac{100}{1}$	$\frac{B}{A} = \frac{16,777,216}{62,800} \times \frac{50}{1}$
6	Parameters	Pn20E: 16,777,216	Pn20E: 167,772,160	Pn20E: 838,860,800
О	T didifictors	Pn210: 6,000	Pn210: 3,600	Pn210: 62,800

• Linear Servomotors

A setting example for a Serial Converter Unit resolution of 256 is given below.

		Machine Configuration
Step	Description	Reference unit: 0.02 mm (20 µm) Forward direction
1	Linear encoder pitch	0.02 mm (20 μm)
2	Reference Unit	0.001 mm (1 μm)
3	Electronic Gear Ratio	$\frac{B}{A} = \frac{1 (\mu m)}{20 (\mu m)} \times 256$
4	Setting Parameters	Pn20E: 256
	Detung Faranteters	Pn210: 20

5.17.1 Precautions on Resetting

5.17

Resetting the Absolute Encoder

In a system that uses an absolute encoder, the multiturn data must be reset at startup. An alarm related to the absolute encoder (A.810 or A.820) will occur when the absolute encoder must be reset, such as when the power supply is turned ON.

When you reset the absolute encoder, the multiturn data is reset and any alarms related to the absolute encoder are cleared.

Reset the absolute encoder in the following cases.

- When an A.810 alarm (Encoder Backup Alarm) occurs
- When an A.820 alarm (Encoder Checksum Alarm) occurs
- · When starting the system for the first time
- · When you want to reset the multiturn data in the absolute encoder
- · When the Servomotor has been replaced

A CAUTION

 The multiturn data will be reset to a value between -2 and +2 rotations when the absolute encoder is reset. The reference position of the machine system will change. Adjust the reference position in the host controller to the position that results from resetting the absolute encoder.

If the machine is started without adjusting the position in the host controller, unexpected operation may cause personal injury or damage to the machine.

Information

- The multiturn data will always be zero in the following cases. It is never necessary to reset the absolute encoder in these cases. An alarm related to the absolute encoder (A.810 or A.820) will not occur.
 - · When you use a single-turn absolute encoder
 - When the encoder is set to be used as a single-turn absolute encoder (Pn002 = n.□2□□)
- 2. If a batteryless absolute encoder is used, an A.810 alarm (Encoder Backup Alarm) will occur the first time the power is turned ON. After you reset the absolute encoder, the A.810 alarm will no longer occur.

5.17.1 Precautions on Resetting

- You cannot use the /ALM-RST (Alarm Reset) signal from the SERVOPACK to clear the A.810 alarm (Encoder Backup Alarm) or the A.820 alarm (Encoder Checksum Alarm). Always use the operation to reset the absolute encoder to clear these alarms.
- If an A.8□□ alarm (Internal Encoder Monitoring Alarm) occurs, turn OFF the power supply to reset the alarm.

5.17.2 Preparations

Always check the following before you reset an absolute encoder.

- The parameters must not be write prohibited.
- The servo must be OFF.

5.17.3 Applicable Tools


The following table lists the tools that you can use to reset the absolute encoder.

Tool	Fn No./Function Name	Reference
Panel Operator	Fn008	13.4.7 Reset Absolute Encoder (Fn008) on page 13-17
Digital Operator	Fn008	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Encoder Setting – Reset Absolute Encoder	5.17.4 Operating Procedure on page 5-53

5.17.4 Operating Procedure


Use the following procedure to reset the absolute encoder.

- 1. Confirm that the servo is OFF.
- 2. Click the 🔎 Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **3.** Select Reset Absolute Encoder in the Menu Dialog Box. The Absolute Encoder Reset Dialog Box will be displayed.
- 4. Click the Continue Button.

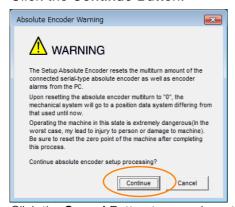

Click the **Cancel** Button to cancel resetting the absolute encoder. The Main Window will return.


5. Click the Execute setting Button.

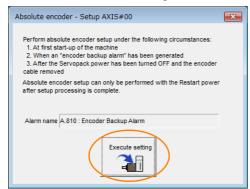

The current alarm code and name will be displayed in the **Alarm name** Box.

5.17.4 Operating Procedure

6. Click the Continue Button.

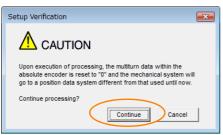

Click the Cancel Button to cancel resetting the absolute encoder. The previous dialog box will return.

7. Click the OK Button.

The absolute encoder will be reset.

When Resetting Fails

If you attempted to reset the absolute encoder when the servo was ON in the SERVOPACK, the following dialog box will be displayed and processing will be canceled.



Click the **OK** Button. The Main Window will return. Turn OFF the servo and repeat the procedure from step 1.

When Resetting Is Successful

The following dialog box will be displayed when the absolute encoder has been reset.



The Main Window will return.

8. To enable the change to the settings, turn the power supply to the SERVOPACK OFF and ON again.

This concludes the procedure to reset the absolute encoder.

5.18.1 Setting the Origin of the Absolute Linear Encoder

5.18 Setting the Origin of the Absolute Encoder

5.18.1 Setting the Origin of the Absolute Linear Encoder

You can set any position as the origin in the following Linear Encoders.

- Dr. JOHANNES HEIDENHAIN GmbH LIC4190, LIC3190, or LIC2190 Series
- RSF Elektronik GmbH MC15Y Series
- Mitutoyo Corporation ABS ST780A Series or ST1300 Series Models: ABS ST78□A/ST78□AL/ST13□□
- Renishaw PLC EVOLUTE Series

Models: EL36YDDDDDDDD

 Renishaw PLC RESOLUTE Series

Models: RL36YDDDDDDDDD

 Canon Precision Inc. Model: PH03-36E00



- After you set the origin, the /S-RDY (Servo Ready) signal will become inactive because the system position data was changed. Always turn the SERVOPACK power supply OFF and ON again.
- 2. After you set the origin, the Servomotor phase data in the SERVOPACK will be discarded. If you are using a Linear Servomotor without a Polarity Sensor, execute polarity detection again to save the Servomotor phase data in the SERVOPACK.

Preparations

Always check the following before you set the origin of an absolute encoder.

- The parameters must not be write prohibited.
- The servo must be OFF.

Applicable Tools

The following table lists the tools that you can use to set the origin of the absolute linear encoder.

Tool	Fn No./Function Name	Reference
Panel Operator	Fn020	13.4.23 Set Absolute Linear Encoder Origin (Fn020) on page 13-28
Digital Operator	Fn020	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Encoder Setting - Zero Point Position Setting	Operating Procedure on page 5-55

Operating Procedure

Use the following procedure to set the origin of an absolute linear encoder.


- 1. Click the P Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select **Zero Point Position Setting** in the Menu Dialog Box. The Set Origin Dialog Box will be displayed.

5.18.1 Setting the Origin of the Absolute Linear Encoder


3. Click the Continue Button.



4. Click the Execute Button.

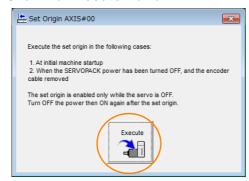


5. Click the Continue Button.

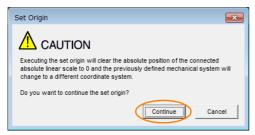

Click the **Cancel** Button to cancel setting the origin of the absolute linear encoder. The previous dialog box will return.

6. Click the OK Button.

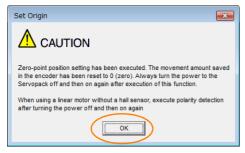

7. Turn the power supply to the SERVOPACK OFF and ON again.

5.18.1 Setting the Origin of the Absolute Linear Encoder

8. If you use a Linear Servomotor that does not have a polarity sensor, perform polarity detection.

Refer to the following section for details on the polarity detection.

5.11 Polarity Detection on page 5-27

This concludes the procedure to set the origin of the absolute linear encoder.

5.19

Setting the Regenerative Resistor Capacity

The regenerative resistor consumes regenerative energy that is generated by the Servomotor, e.g., when the Servomotor decelerates.

If an External Regenerative Resistor is connected, you must set Pn600 (Regenerative Resistor Capacity) and Pn603 (Regenerative Resistance).

Refer to the following manual to select the capacity of a Regenerative Resistor.

Σ-7-Series Peripheral Device Selection Manual (Manual No.: SIEP S800001 32)

MARNING

- If you connect an External Regenerative Resistor, set Pn600 and Pn603 to suitable values.
 If a suitable value is not set, A.320 alarms (Regenerative Overload) will not be detected correctly, and the External Regenerative Resistor may be damaged or personal injury or fire may result.
- When you select an External Regenerative Resistor, make sure that it has a suitable capacity.

There is a risk of personal injury or fire.

	Regenerative Resiste	or Capacity		Speed Pos	Sition Torque
Pn600	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to SERVOPACK's maximum applicable motor capacity	10 W	0	Immediately	Setup
	Regenerative Resistance			Speed Pos	Sition Torque
Pn603	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	10 mΩ	0	Immediately	Setup

Set the regenerative resistor capacity to a value that is consistent with the allowable capacity of the External Regenerative Resistor. The setting depends on the cooling conditions of the External Regenerative Resistor.

- For self-cooling (natural convection cooling): Set the parameter to a maximum 20% of the capacity (W) of the actually installed regenerative resistor.
- For forced-air cooling: Set the parameter to a maximum 50% of the capacity (W) of the actually installed regenerative resistor.

Example

For a self-cooling 100-W External Regenerative Resistor, set Pn600 to 2 (\times 10 W) (100 W \times 20% = 20 W).

Note: 1. An A.320 alarm will be displayed if the setting is not suitable.

2. The default setting of 0 specifies that the SERVOPACK's built-in regenerative resistor or Yaskawa's Regenerative Resistor Unit is being used.



- 1. When an External Regenerative Resistor is used at the normal rated load ratio, the resistor temperature increases to between 200°C and 300°C. Always apply derating. Consult the manufacturer for the resistor's load characteristics.
- 2. For safety, use an External Regenerative Resistor with a thermoswitch.

Application Functions

This chapter describes the application functions that you can set before you start servo system operation. It also describes the setting methods.

6.1	I/O Si	ignal Allocations6-5
	6.1.1 6.1.2 6.1.3 6.1.4 6.1.5 6.1.6 6.1.7	Input Signal Allocations 6-5 Output Signal Allocations 6-8 ALM (Servo Alarm) Signal 6-9 ALO1 to ALO3 (Alarm Code) Signals 6-10 /WARN (Warning) Signal 6-10 /TGON (Rotation Detection) Signal 6-11 /S-RDY (Servo Ready) Signal 6-12
6.2	Opera	tion for Momentary Power Interruptions6-13
6.3	SEMI	F47 Function6-14
6.4	Settir	ng the Motor Maximum Speed6-16
6.5	Spee	d Control 6-17
	6.5.1 6.5.2 6.5.3 6.5.4 6.5.5	Basic Settings for Speed Control 6-17 Soft Start Settings 6-24 Speed Reference Filter 6-24 Zero Clamping 6-25 /V-CMP (Speed Coincidence Detection) Signal 6-27

6.6	Positi	on Control
	6.6.1 6.6.2	Basic Settings for Position Control6-31 CLR (Position Deviation Clear) Signal Function and Settings6-33
	6.6.3	Reference Pulse Input Multiplication Switching
	6.6.4 6.6.5	Smoothing Settings
	6.6.6 6.6.7	/NEAR (Near) Signal
6.7	Torqu	e Control
	6.7.1 6.7.2 6.7.3 6.7.4	Basic Settings for Torque Control
	0.7.4	Speed Limit during Torque Control
6.8	Enco	der Divided Pulse Output6-48
	6.8.1 6.8.2	Encoder Divided Pulse Output Signals 6-48 Setting for the Encoder Divided Pulse Output 6-53
6.9	Intern	nal Set Speed Control6-55
	6.9.1 6.9.2	Input Signals for Internal Set Speed Control6-55 Setting the Control Method to Internal Set Speed Control
	6.9.3 6.9.4	Settings for Internal Set Speed Control 6-56 Changing Internal Set Speeds with Input Signals
6.10	Selec	ting Combined Control Methods6-59
0110	6.10.1	Setting Pn000 = n.□□X□
	6.10.2	(Control Method Selection) to 4, 5, or 6 6-59 Setting Pn000 = $n \cdot \square \square X \square$
	6.10.3	(Control Method Selection) to 7, 8, or 9 6-62 Setting Pn000 = $n.\Box\Box X\Box$ (Control Method Selection) to A or B 6-62
6 11	Soloo	ting Torque Limite
6.11		ting Torque Limits6-64
	6.11.1 6.11.2	Internal Torque Limits
	6.11.3	Limiting Torque with an Analog Reference6-68
	6.11.4	Limiting Torque with an External Torque Limit and an Analog Voltage Reference6-70
	6.11.5	/CLT (Torque Limit Detection) Signal6-73

6.12	Absol	ute Encoders6-74
	6.12.1 6.12.2	Connecting an Absolute Encoder 6-75 Structure of the Position Data of the Absolute Encoder
	6.12.3	Output Ports for the Position Data from the Absolute Encoder 6-76
	6.12.4	Reading the Position Data from the Absolute Encoder
	6.12.5 6.12.6	Transmission Specifications 6-81 Calculating the Current Position in Machine Coordinates
	6.12.7	Alarm Output from Output Ports for the Position Data from the Absolute Encoder 6-83
	6.12.8 6.12.9	Multiturn Limit Setting 6-83 Multiturn Limit Disagreement Alarm (A.CC0) 6-85
6.13	Absol	ute Linear Encoders 6-88
	6.13.1 6.13.2	Connecting an Absolute Linear Encoder 6-88 Structure of the Position Data of the Absolute
	6.13.3	Linear Encoder
	6.13.4	Reading the Position Data from the Absolute Linear Encoder
	6.13.5 6.13.6	Transmission Specifications 6-94 Calculating the Current Position in Machine Coordinates
	6.13.7	Alarm Output from the Output Ports for the Position Data from the Absolute Linear Encoder 6-96
6.14	Softw	are Reset6-97
	6.14.1 6.14.2 6.14.3	Preparations
6.15	Initiali	zing the Vibration Detection Level 6-99
	6.15.1 6.15.2 6.15.3 6.15.4	Preparations
6.16	Adjusti	ng the Motor Current Detection Signal Offset6-103
	6.16.1 6.16.2	Automatic Adjustment 6-103 Manual Adjustment 6-105
6.17	Forcir	ng the Motor to Stop6-107
	6.17.1 6.17.2	FSTP (Forced Stop Input) Signal 6-107 Stopping Method Selection for
	6.17.3	Forced Stops

6.18	Overh	neat Protection6-110
	6.18.1	Connecting the Overheat Protection Input (TH)
		Signal6-110
	6.18.2	Overheat Protection Selection 6-111

6.1 I/O Signal Allocations

Functions are allocated to the pins on the I/O signal connector (CN1) in advance. You can change the allocations and the polarity for some of the connector pins. Function allocations and polarity settings are made with parameters.

This section describes the I/O signal allocations.

6.1.1 Input Signal Allocations

Although you can use the input signals with the default settings, you can also allocate the desired input signals to pins 40 to 46 on the I/O signal connector (CN1).

Specify the allocation method to use in Pn50A = n. DDDX (Input Signal Allocation Mode).

Parameter		Description	When Enabled	Classification
	n.□□□0 (default setting)	Use the sequence input signal terminals with the default allocations.	- After restart	Setup
PhouA	n.□□□1	Change the individual sequence input signal allocations.	Alter restait	Setup

Using the Default Settings

The default settings for signal allocations are given in the following table. If you change the control method that is set in $Pn000 = n.\square\square X\square$, the signals will be allocated as required for the specified control method, as given in the following table.

If the control method is set to internal set speed control with contact commands ($Pn000 = \square \square 3 \square$), the /P-CON signal (CN1-41) will be allocated as the /SPD-D signal, the /P-CL signal (CN1-45) as the /SPD-A signal, and the /N-CL signal (CN1-46) as the /SPD-B signal.

D=000	2000		CN1 Pin No.						
Pn000 = n.□□X□	Control Method Selection	40	41	42	43	44	45	46	
0	Speed control								
1	Position control		/P-CON				/P-CL	/N-CL	
2	Torque control								
3	Internal set speed control								
4	Switching between internal set speed control and speed control with analog references								
5	Switching between internal set speed control and position control		/SPD-D			T /ALM- RST	/SPD-A	/SPD-B	
6	Switching between internal set speed control and torque control	/S-		БОТ					
7	Switching between position control and speed control	ON		P-OT	N-OT		/P-CL	/N-CL	
8	Switching between position control and torque control		/C-SEL						
9	Switching between torque control and speed control								
Α	Switching between speed control with analog references and speed control with zero clamping		/ZCLAMP						
В	Switching between normal position control and position control with reference pulse inhibition		/INHIBIT						

6.1.1 Input Signal Allocations

Changing Input Signal Allocations



- If you change the default polarity settings for the /S-ON (Servo ON), P-OT (Forward Drive Prohibit), or N-OT (Reverse Drive Prohibit) signal, the main circuit power supply will not be turned OFF and the overtravel function will not operate if there are signal line disconnections or other problems. If you must change the polarity of one of these signals, verify operation and make sure that no safety problems will exist.
- If you allocate two or more signals to the same input circuit, a logical OR of the inputs will be used and all of the allocated signals will operate accordingly. This may result in unexpected operation.

The input signals that you can allocate to the pins on the I/O signal connector (CN1) and the related parameters are given in the following table.

Input Signal	Input Signal Input Signal Name	
/S-ON	Servo ON	Pn50A = n.□□X□
/P-CON	Proportional Control	Pn50A = n.□X□□
P-OT	Forward Drive Prohibit	Pn50A = n.X□□□
N-OT	Reverse Drive Prohibit	Pn50B = n.□□□X
/ARM-RST	Alarm Reset	Pn50B = n.□□X□
/P-CL	Forward External Torque Limit	Pn50B = n.□X□□
/N-CL	Reverse External Torque Limit	Pn50B = n.X□□□
/SPD-D	Motor Direction	Pn50C = n.□□□X
/SPD-A	Internal Set Speed Selection	Pn50C = n.□□X□
/SPD-B	Internal Set Speed Selection	Pn50C = n.□X□□
/C-SEL	Control Selection	Pn50C = n.X□□□
/ZCLAMP	Zero Camping	Pn50D = n.□□□X
/INHIBIT	Reference Pulse Inhibit	Pn50D = n.□□X□
/G-SEL	Gain Selection	Pn50D = n.□X□□
/P-DET	Polarity Detection	Pn50D = n.X□□□
SEN	Absolute Data Request	Pn515 = n.□□□X
/PSEL	Reference Pulse Input Multiplication Switch	Pn515 = n.□□X□
FSTP	Forced Stop	Pn516 = n.□□□X

Relationship between Parameter Settings, Allocated Pins, and Polarities

The following table shows the relationship between the input signal parameter settings, the pins on the I/O signal connector (CN1), and polarities.

Parameter Setting	Pin No.	Description	
0	40		
1	41	+24 V	
2	42	Ţ	
3	43	A reverse signal (a signal with "/" before the signal abbreviation, such as the /	
4	44	S-ON signal) is active when the contacts are ON (closed).	
5	45	A signal that does not have "/" before the signal abbreviation (such as the P-OT signal) is active when the contacts are OFF (open).	
6	46	or digital, to dollar whom the contacts are or r (open).	
7	_	The input signal is not allocated to a connector pin and it is always active. If the signal is processed on a signal edge, then it is always inactive.	
8	_	The input signal is not allocated to a connector pin and it is always inactive. Set the parameter to 8 if the signal is not used.	
9	40		
А	41	+24 V	
В	42	→ → → → → → → → → →	
С	43	A reverse signal (a signal with "/" before the signal abbreviation, such as the /	
D	44	S-ON signal) is active when the contacts are OFF (open).	
E	45	A signal that does not have "/" before the signal abbreviation (such as the P-OT signal) is active when the contacts are ON (closed).	
F	46		

Note: Refer to the following section for details on input signal parameter settings.

14.1 List of Parameters on page 14-2

Example of Changing Input Signal Allocations

The following example shows reversing the P-OT (Forward Drive Prohibit) signal allocated to CN1-42 and the /P-CL (External Torque Limit) signal allocated to CN1-45.

Pn50A = n.2
$$\square$$
0 Pn50B = n. \square 5 \square 0 Before change
$$\downarrow \qquad \qquad \downarrow$$
 Pn50A = n.5 \square 0 Pn50B = n. \square 2 \square 0 After change

Refer to the following section for the parameter setting procedure.

5.1.3 Parameter Setting Methods on page 5-6

Confirming the Allocation Status of Input Signals

You can confirm the allocation status of input signals with the I/O Signal Allocations Window of the SigmaWin+. Refer to the following section for details.

9.2.3 I/O Signals Status Monitor on page 9-6

6.1.2 Output Signal Allocations

You can allocate the desired output signals to pins 25 to 30 and 37 to 39 on the I/O signal connector (CN1). You set the allocations in the following parameters: Pn50E, Pn50F, Pn510, Pn512, Pn513, Pn514, and Pn517.



- The signals that are not detected are considered to be OFF. For example, the /COIN (Positioning Completion) signal is considered to be OFF during speed control.
- Reversing the polarity of the /BK (Brake) signal, i.e., changing it to positive logic, will prevent the holding brake from operating if its signal line is disconnected. If you must change the polarity of this signal, verify operation and make sure that no safety problems will exist.
- If you allocate more than one signal to the same output circuit, a logical OR of the signals will be output.

The following table shows the relationship between the parameters and the output signals that can be allocated to the pins on the I/O signal connector (CN1).

Output Signals	Output Signal Name	Parameter
/COIN	Positioning Completion	Pn50E = n.□□□X
/V-CMP	Speed Coincidence Detection	Pn50E = n.□□X□
/TGON	Rotation Detection	Pn50E = n.□X□□
/S-RDY	Servo Ready	Pn50E = n.X□□□
/CLT	Torque Limit Detection	Pn50F = n.□□□X
/VLT	Speed Limit Detection	Pn50F = n.□□X□
/BK	Brake	Pn50F = n.□X□□
/WARN	Warning	Pn50F = n.X□□□
/NEAR	Near	Pn510 = n.□□□X
/PSELA	Reference Pulse Input Multiplication Switching Output	Pn510 = n.□X□□
/PM	Preventative Maintenance	Pn514 = n.□X□□
ALO1		Pn517 = n.□□□X
ALO2	Alarm Code Output	Pn517 = n.□□X□
ALO3		Pn517 = n.□X□□

◆ Relationship between Parameter Settings and Allocated Pin Numbers

The following table shows the relationship between the output signal parameter settings and the pin numbers on the I/O signal connector (CN1).

Parameter Setting	Pin No.	Description
0	_	Disable (signal output is not used)
1	25 or 26	Output the allocated signal from the CN1-25 or CN1-26 output terminal.
2	27 or 28	Output the allocated signal from the CN1-27 or CN1-28 output terminal.
3	29 or 30	Output the allocated signal from the CN1-29 or CN1-30 output terminal.
4	37	Output the allocated signal from the CN1-37 output terminal.
5	38	Output the allocated signal from the CN1-38 output terminal.
6	39	Output the allocated signal from the CN1-39 output terminal.

Output Signal Polarity Switching

The polarity of output signals is switched using Pn512 and Pn513.

	Parameter				
Parameter No.		Setting Value	Pin No.	Description	
	n.□□□X	0	25 or 26	The signal is not inverted.	
		1	23 01 20	The signal is inverted.	
	n.□□X□	0	27 or 28	The signal is not inverted.	
Pn512		1	21 01 20	The signal is inverted.	
F11012	n.□X□□	0	29 or 30	The signal is not inverted.	
		1		The signal is inverted.	
	VDDD	0	37	The signal is not inverted.	
	n.XDDD	1		The signal is inverted.	
	n.□□□X	0	38	The signal is not inverted.	
Pn513	11.000	1	38	The signal is inverted.	
FIIDIO	» ППVП	0	39	The signal is not inverted.	
	n.□□X□	1	39	The signal is inverted.	

Example of Changing Output Signal Allocations

The following example shows disabling the /COIN (Positioning Completion) signal allocated to CN1-25 and CN1-26 and allocating the /BK (Brake) signal.

Pn50E = n.
$$\square$$
 \square \square Pn50F = n. \square \square Before change
$$\downarrow \qquad \qquad \downarrow$$
 Pn50E = n. \square \square Pn50F = n. \square \square After change

Refer to the following section for the parameter setting procedure.

5.1.3 Parameter Setting Methods on page 5-6

Confirming the Allocation Status of Output Signals

You can confirm the allocation status of output signals with the I/O Signal Allocations Window of the SigmaWin+. Refer to the following section for details.

9.2.3 I/O Signals Status Monitor on page 9-6

6.1.3 ALM (Servo Alarm) Signal

This signal is output when the SERVOPACK detects an error.



Configure an external circuit so that this alarm output turns OFF the main circuit power supply to the SERVOPACK whenever an error occurs.

Туре	Signal	Connector Pin No.	Signal Status	Meaning
Output	ALM	CN1-31 and	ON (closed)	Normal SERVOPACK status
		CN1-32	OFF (open)	SERVOPACK alarm

Alarm Reset Methods

Refer to the following section for information on the alarm reset methods.
12.2.3 Resetting Alarms on page 12-41

6.1.4 ALO1 to ALO3 (Alarm Code) Signals

The ALO1 to ALO3 (Alarm Code) signals report alarms and warnings that occur in the SERVO-PACK. Use the alarm code output signals as required to display the contents of the alarm at the host controller (e.g., HMI).

Refer to the following sections for the relationship between the alarm code output and the alarms/warnings.

12.2.1 List of Alarms on page 12-5

12.3.1 List of Warnings on page 12-48

ALO1 to ALO3 (Alarm Code) Signals

The ALO1 to ALO3 signals are allocated to the following output signal terminals (CN1) by default.

Type	Signal	Name	Pin No.
	ALO1		CN1-37
Output	ALO2	Alarm Code Output	CN1-38
Output	ALO3		CN1-39
	SG	Signal ground for alarm code output	CN1-1

You can allocate the ALO1 to ALO3 signals to connector pins other than those given above. Refer to the following section for details.

6.1.2 Output Signal Allocations on page 6-8

6.1.5 /WARN (Warning) Signal

Both alarms and warnings are generated by the SERVOPACK. Alarms indicate errors in the SERVOPACK for which operation must be stopped immediately. Warnings indicate situations that may results in alarms but for which stopping operation is not yet necessary.

The /WARN (Warning) signal indicates that a condition exists that may result in an alarm.

Type	Signal	Connector Pin No.	Signal Status	Meaning
Output	/WARN	Must be allocated.	ON (closed)	Warning
Output			OFF (open)	Normal status

Note: You must allocate the /WARN signal to use it. Use Pn50F = n.X□□□ (/WARN (Warning Output) Signal Allocation) to allocate the signal to a connector pin. Refer to the following section for details.

6.1.2 Output Signal Allocations on page 6-8

Setting the Warning Code Output

You can use the ALO1 to ALO3 (Alarm Code Output) signals to output warning codes. Use $Pn001 = n.X\square\square\square$ (Warning Code Output Selection) to set the output.

Refer to the following sections for details on the warnings.

12.3.1 List of Warnings on page 12-48

P	arameter	Description	When Enabled	Classification
	n.0□□□ (default setting)	Output only alarm codes on the ALO1 to ALO3 terminals.		
Pn001	n.1□□□	Output both warning codes and alarm codes on the ALO1 to ALO3 terminals. If there is an alarm, the alarm code is output.	After restart	Setup

6.1.6 /TGON (Rotation Detection) Signal

The /TGON signal indicates that the Servomotor is operating.

This signal is output when the shaft of the Servomotor rotates at the setting of Pn502 (Rotation Detection Level) or faster or the setting of Pn581 (Zero Speed Level) or faster.

The /TGON signal is allocated to CN1-27 and CN1-28 by default.

Type	Signal	Connector Pin No.	Signal Status	Servomotor	Meaning
Output	/TGON		ON (closed)	Rotary Servomotors	The Servomotor is operating at the setting of Pn502 or faster.
			ON (Closed)	Linear Servomotors	The Servomotor is operating at the setting of Pn581 or faster. The Servomotor operating at a speed that is slower than the setting of Pn502.
		CN1-27 and CN1- 28 (default setting)	OFF (open)	Rotary Servomotors	
			Off (open)	Linear Servomotors	The Servomotor is operating at a speed that is slower than the setting of Pn581.

Note: Use Pn50E = n.□X□□ (/TGON (Rotation Detection Output) Signal Allocation) to allocate the /TGON signal to another connector pin. Refer to the following section for details.

6.1.2 Output Signal Allocations on page 6-8

Setting the Rotation Detection Level

Use the following parameter to set the speed detection level at which to output the /TGON signal.

· Rotary Servomotors

	Rotation Detection I	_evel	Speed Position Torque		
Pn502	Setting Range	Setting Unit	Default Setting	When Enabled Classification	
	1 to 10,000	1 min ⁻¹	20	Immediately	Setup

• Linear Servomotors

	Zero Speed Level		Speed Position Force		
Pn581	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	1 to 10,000	1 mm/s	20	Immediately	Setup

6.1.7 /S-RDY (Servo Ready) Signal

The /S-RDY (Servo Ready) signal turns ON when the SERVOPACK is ready to accept the /S-ON (Servo ON) input signal.

The /S-RDY signal is turned ON under the following conditions.

- Main circuit power supply is ON.
- There is no hard wire base block state.
- · There are no alarms.
- There is no forced stop state (FSTP).
- If an absolute encoder is used, the SEN (Absolute Data Request) signal is ON (high level).
- If a Servomotor without a polarity sensor is used, polarity detection has been completed. *
- If an absolute encoder is used, the SERVOPACK must be ready to accept the /S-ON (Servo ON) signal and, if the SEN signal is ON (high level), the output of the position data from the absolute encoder to the host controller must have been completed.
- * Do not include this condition if the /S-ON (Servo ON) signal is input for the first time after the control power supply was turned ON. In that case, when the first /S-ON signal is input, polarity detection is started immediately and the /S-RDY signal turns ON at the completion of polarity detection.

The /S-RDY signal is allocated to CN1-29 and CN1-30 by default.

Type	Signal	Connector Pin No.	Signal Status	Meaning
Output	/S-RDY	CN1-29 and CN1-30 (default setting)	ON (closed)	Ready to receive the /S-ON (Servo ON) signal.
				Not ready to receive the /S-ON (Servo ON) signal.

Note: 1. Use Pn50E = n.XDDD (/S-RDY (Servo Ready) Signal Allocation) to allocate the /S-RDY signal to another connector pin. Refer to the following section for details.

6.1.2 Output Signal Allocations on page 6-8

2. Refer to the following section for information on the hard wire base block and the /S-RDY signal.

11.2.7 /S-RDY (Servo Ready Output) Signal on page 11-7

6.2

Operation for Momentary Power Interruptions


Even if the main power supply to the SERVOPACK is interrupted momentarily, power supply to the motor (servo ON status) will be maintained for the time set in Pn509 (Momentary Power Interruption Hold Time).


	Momentary Power In	terruption Hold Tim	Speed Position	n Torque	
Pn509	Setting Range	Setting Unit	Default Setting	When Enabled Classification	
	20 to 50,000	1 ms	20	Immediately	Setup

If the momentary power interruption time is equal to or less than the setting of Pn509, power supply to the motor will be continued. If it is longer than the setting, power supply to the motor will be stopped. Power will be supplied to the motor again when the main circuit power supply recovers.

Setting of Pn509 ≥ Momentary power interruption time

Setting of Pn509 < Momentary power interruption time

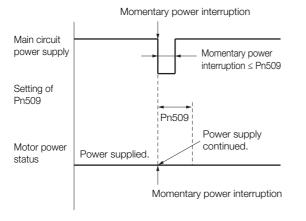

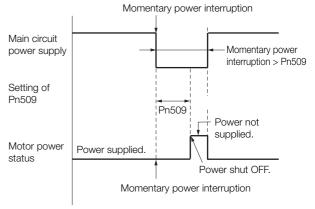

Information

- 1. If the momentary power interruption time exceeds the setting of Pn509, the /S-RDY (Servo Ready) signal will turn OFF.
- 2. If uninterruptible power supplies are used for the control power supply and main circuit power supply, the SERVOPACK can withstand a power interruption that lasts longer than 50,000 ms.
- 3. The holding time of the SERVOPACK control power supply is approximately 100 ms. If control operations become impossible during a momentary power interruption of the control power supply, the setting of Pn509 will be ignored and the same operation will be performed as for when the power supply is turned OFF normally.



The holding time of the main circuit power supply depends on the output from the SERVOPACK. If the load on the Servomotor is large and an A.410 alarm (Undervoltage) occurs, the setting of Pn509 will be ignored.

6.3

SEMI F47 Function

The SEMI F47 function detects an A.971 warning (Undervoltage) and limits the output current if the DC main circuit power supply voltage to the SERVOPACK drops to a specified value or lower because the power was momentarily interrupted or the main circuit power supply voltage was temporarily reduced.

This function complies with the SEMI F47 standards for semiconductor manufacturing equipment.

You can combine this function with the momentary power interruption hold time (Pn509) to allow the Servomotor to continue operating without stopping for an alarm or without recovery work even if the power supply voltage drops.

Execution Sequence

This function can be executed either with the host controller or with the SERVOPACK. Use $Pn008 = n.\square\squareX\square$ (Function Selection for Undervoltage) to specify whether the function is executed by the host controller or by the SERVOPACK.


The default setting (Pn008 = $n.\Box\Box0\Box$) disables detection of an A.971 warning (Undervoltage).

Parameter		Description	When Enabled	Classification
n.□□0□ (default setting)		Do not detect undervoltage.		
Pn008	n.□□1□	Detect undervoltage warning and limit torque at host controller.	After restart	Setup
	n.□□2□	Detect undervoltage warning and limit torque with Pn424 and Pn425 (i.e., only in SERVO-PACK).		

◆ Execution with the Host Controller (Pn008 = n.□□1□)


The host controller limits the torque in response to an A.971 warning (Undervoltage).

The host controller removes the torque limit after the Undervoltage warning is cleared.

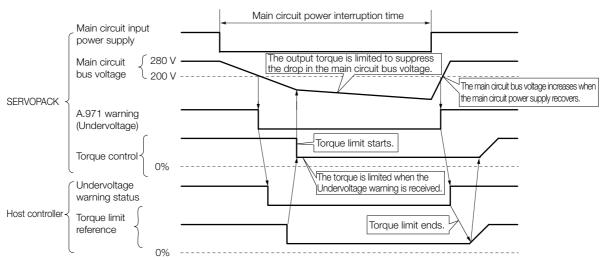

◆ Execution with the SERVOPACK (Pn008 = n.□□2□)

The torque is limited in the SERVOPACK in response to an Undervoltage warning. The SERVOPACK controls the torque limit for the set time after the Undervoltage warning is cleared.

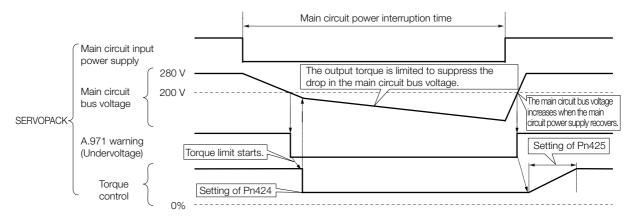

Related Parameters

The following parameters are related to the SEMI F47 function.

	Torque Limit at Main Circuit Voltage Drop			Speed Position	Torque
Pn424	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 100	1%*	50	Immediately	Setup
	Release Time for To	rque Limit at Main C	ircuit Voltage Drop	Speed Position	Torque
Pn425	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 1,000	1 ms	100	Immediately	Setup
	Momentary Power I	e	Speed Position	Torque	
Pn509	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	20 to 50,000	1 ms	20	Immediately	Setup

^{*} Set a percentage of the motor rated torque.

Note: If you will use the SEMI F47 function, set the time to 1,000 ms.



- This function handles momentary power interruptions for the voltage and time ranges stipulated in SEMI F47. An uninterruptible power supply (UPS) is required as a backup for momentary power interruptions that exceed these voltage and time ranges.
- Set the host controller or SERVOPACK torque limit so that a torque reference that exceeds the specified acceleration torque will not be output when the power supply for the main circuit is restored.
- For a vertical axis, do not limit the torque to a value that is lower than the holding torque.
- This function limits torque within the range of the SERVOPACK's capability for power interruptions. It is not intended for use under all load and operating conditions. Set the parameters while monitoring operation on the actual machine.
- You can set the momentary power interruption hold time to increase the amount of time from when the power supply is turned OFF until power supply to the motor is stopped. To stop the power supply to the motor immediately, use the /S-ON (Servo ON) signal.

6.4

Setting the Motor Maximum Speed

You can set the maximum speed of the Servomotor with the following parameter.

• Rotary Servomotors

	Maximum Motor Speed			Speed Positi	Torque
Pn316	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	1 min ⁻¹	10,000	After restart	Setup

Linear Servomotors

Ī		Maximum Motor Speed			Speed Posit	ion Force
	Pn385	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
		1 to 100	100 mm/s	50	After restart	Setup

You can achieve the following by lowering the maximum speed of the Servomotor.

- If the Servomotor speed exceeds the setting, an A.510 alarm (Overspeed) will occur.
- With a Linear Servomotor, you can increase the upper limit for the setting of Pn281 (Encoder Output Resolution). Refer to the following section for details.

6.8 Encoder Divided Pulse Output on page 6-48

Changing the setting of the parameter is effective in the following cases.

- To protect the machine by stopping machine operation with an alarm when the set speed is reached or exceeded
- To limit the speed so that the load is driven beyond the allowable moment of inertia Refer to relevant manual from the following list for the relationship between the speed and the allowable moment of inertia.
 - Ω Σ-7-Series Rotary Servomotor Product Manual (Manual No.: SIEP S800001 36)
 - Ω Σ-7-Series Direct Drive Servomotor Product Manual (Manual No.: SIEP S800001 38)
 - Σ-7-Series Linear Servomotor Product Manual (Manual No.: SIEP S800001 37)
- To increase the encoder output resolution and increase the position resolution managed by the host controller (for a Linear Servomotor)

6.5 Speed Control

There are two types of speed control: speed control with an analog voltage reference and speed control with internal set speeds. This section describes speed control with an analog voltage reference.

You input a speed reference into the SERVOPACK with an analog voltage to operate the Servomotor at the reference speed. Refer to the following section for information on speed control with internal set speeds.

6.9 Internal Set Speed Control on page 6-55

- If you create a position loop in the host controller, you use the SERVOPACK for speed control.
- If you need to control only the speed of the Servomotor, you use the SERVOPACK for speed control.

You set the control method in $Pn000 = n.\square\square X\square$ (Control Method Selection).

Set Pn000 to n. □□0□ to set the control method to speed control.

Parameter		Meaning	When Enabled	Classification
Pn000	n.□□0□ (default setting)	Speed control with analog references	After restart	Setup

6.5.1 Basic Settings for Speed Control

This section describes the use of the V-REF (Speed Reference Input) Signal, /SPD-D (Motor Direction Input) Signal, speed reference input gain, and speed reference offset adjustment in speed control with analog voltages.


V-REF (Speed Reference Input) Signal

Input the V-REF (Speed Reference Input) signal to the SERVOPACK to operate the Servomotor at a speed that is proportional to the input voltage.

Туре	Signal	Connector Pin No.	Meaning	
Input	V-REF	CN1-5	Speed reference input signal	
	SG	CN1-6	Signal ground for speed reference input signal	

Maximum input voltage: ±12 VDC

If you will use a host controller, such as a programmable controller, for position control, connect the above output pins to the speed reference output terminals on the host controller.

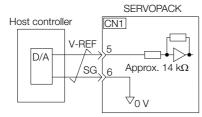

Note: Always use twisted-pair cables to control noise.

/SPD-D (Motor Direction Input) Signal

You can turn the /SPD-D signal ON and OFF to change the direction of the Servomotor.

Classification	Signal	Connector Pin No.	Description
Input	/SPD-D	Must be allocated.	Changes the Servomotor direction.


Note: You must allocate the /SPD-D signal to use it. Use Pn50C = n.□□□X (/SPD-D (Motor Direction) Signal Allocation) to allocate the signal to a connector pin. Refer to the following section for details.

6.1.1 Input Signal Allocations on page 6-5

6.5.1 Basic Settings for Speed Control

Relation between the /SPD-D (Motor Direction Input) Signal and V-REF (Speed Reference Input) Signal

The following graphs show the relationship between the V-REF (Speed Reference Input) signal and the speed reference depending on whether the /SPD-D signal is ON or OFF.

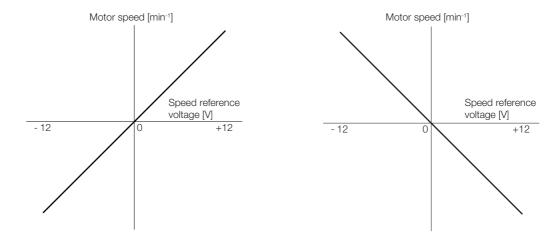

/SPD-D (Motor Direction Input) Signal: OFF

/SPD-D (Motor Direction Input) Signal: ON

Example

Speed Reference Input Example If Pn300 is set to 600, the motor would operate at the rated speed for 6.00 $\rm V.$

• For Rotary Servomotors

Speed Reference Input	/SPD-D Signal	Rotation Direction	Motor Speed	For SGM7A Servomotor
.0.1/	ON	Reverse	Rated	-3000 min ⁻¹
+6 V	OFF	Forward	motor speed	3000 min ⁻¹
0.1/	ON	Forward	1/2 of rated	1500 min ⁻¹
-3 V	OFF	Reverse	motor speed	-1500 min ⁻¹
	ON	Reverse	1/6 of rated	-500 min ⁻¹
+1 V	OFF	Forward	motor speed	500 min ⁻¹


Linear Servomotors

Speed Reference Input	/SPD-D Signal	Rotation Direction	Movement Speed	For SGLGW-30A Linear Servomotor
	ON	Reverse	Rated	-1500 mm/s
+6 V	OFF	Forward	motor speed	1500 mm/s
	ON	Forward	1/2 of rated	750 mm/s
-3 V	OFF	Reverse	motor speed	-750 mm/s
	ON	Reverse	1/6 of rated	-250 mm/s
+1 V	OFF	Forward	motor speed	250 mm/s

Setting the Speed Reference Input Gain (Pn300)

The reference voltage for the rated motor speed is set for the speed reference input gain (Pn300) to define the relationship between the position reference voltage and the motor speed.

	Speed Reference Input Gain			Speed Position	Torque
Pn300	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
111000	150 to 3,000	0.01 V	600 (rated speed for 6.00 V)	Immediately	Setup

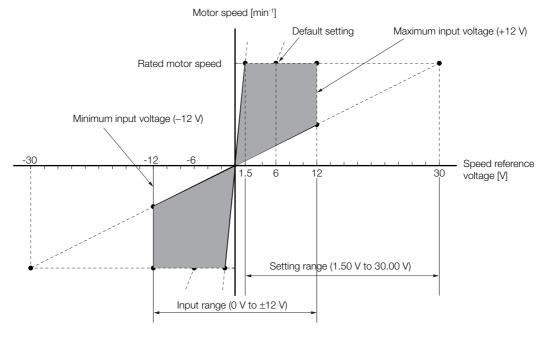


Adjusting the Speed Reference Offset

With speed control, the Servomotor may sometimes rotate at a very low speed for a speed reference of 0 V (with a reference speed of 0 or when the speed reference is stopped). This occurs because the internal reference in the SERVOPACK has a slight offset.

If the Servomotor moves at a very low speed, the offset needs to be eliminated by adjusting the offset.

You can adjust the speed reference offset either automatically or manually.

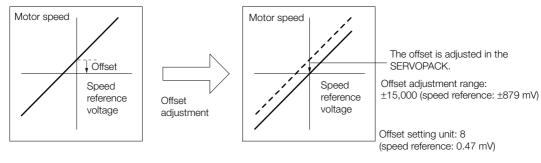

6.5.1 Basic Settings for Speed Control

◆ Automatically Adjusting the Speed Reference Offset

To automatically adjust the speed reference offset, the amount of offset is measured and the speed reference voltage is adjusted automatically.

The measured offset is saved in the SERVOPACK.

Information The offset does not use a parameter, so it will not change even if the parameter settings are initialized.

■ Preparations

The following conditions must be met to automatically adjust the reference offset.

- The parameters must not be write prohibited.
- · The servo must be OFF.
- There must not be a position loop in the host controller.

■ Applicable Tools


The following table lists the tools that you can use to automatically adjust the speed reference offset.

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	Fn009	13.4.8 Autotune Analog (Speed/Torque) Reference Offset (Fn009) on page 13-18
Digital Operator	Fn009	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Others – Adjust the Speed and Torque Reference Offset	☐ ■Operating Procedure on page 6-20

Operating Procedure


Use the following procedure to automatically adjust the speed reference offset.

- 1. Confirm that the servo is OFF in the SERVOPACK.
- 2. Input a 0-V reference voltage from the host controller or an external circuit.

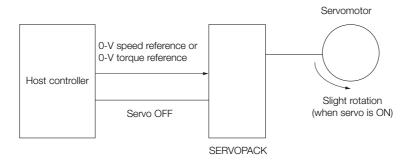


- 3. Click the 🔎 Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **4.** Select Adjust the Speed and Torque Reference Offset in the Menu Dialog Box. The Adjust the Speed and Torque Reference Offset Dialog Box will be displayed.
- 5. Click the Automatic Adjustment Tab.

6. Click the Adjust Button.

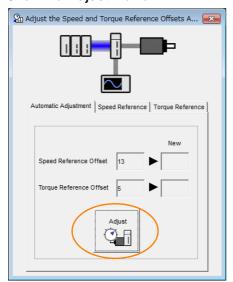

The value that results from automatic adjustment will be displayed in the **New** Box.

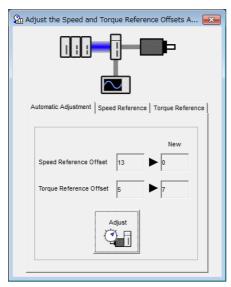

This concludes the procedure to automatically adjust the speed reference offset.

6.5.1 Basic Settings for Speed Control

Manually Adjusting the Speed Reference Offset

You can directly input a speed reference offset to adjust the speed reference. The offset is adjusted manually in the following cases.

- When a position loop is created with the host computer and the position deviation when the Servomotor is stopped by a servo lock is to be set to 0
- To intentionally set the offset to a desired value
- To check an offset that was set automatically

Information The offset does not use a parameter, so it will not change even if the parameter settings are initialized.

Preparations

The following conditions must be met to manually adjust the reference offset.

• The parameters must not be write prohibited.

■ Applicable Tools


The following table lists the tools that you can use to manually adjust the speed reference offset.

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	Fn00A	13.4.9 Manually Adjust Speed Reference Offset (Fn00A) on page 13-18
Digital Operator	Fn00A	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Others – Adjust the Speed and Torque Reference Offset	☐ ■ Operating Procedure on page 6-22

Operating Procedure


Use the following procedure to manually adjust the speed reference offset.

1. Input a 0-V reference voltage from the host controller or an external circuit.

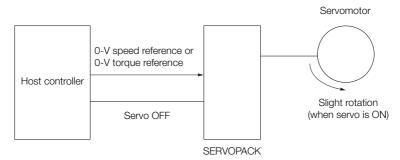


- 2. Click the P Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **3.** Select Adjust the Speed and Torque Reference Offset in the Menu Dialog Box. The Adjust the Speed and Torque Reference Offset Dialog Box will be displayed.

4. Click the Speed Reference Tab.

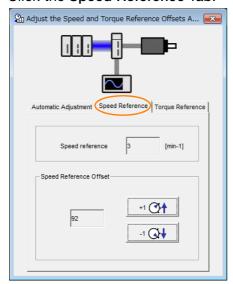

5. Use the +1 and -1 Buttons to adjust the value in the Speed Reference Box to 0.

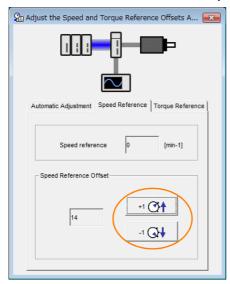


This concludes the procedure to manually adjust the speed reference offset.

6.5.2 Soft Start Settings

6.5.2 Soft Start Settings

The soft start function takes a stepwise speed reference input and applies the specified acceleration/deceleration rates to convert it to a trapezoidal speed reference.

You specify the acceleration/deceleration rates in Pn305 (Soft Start Acceleration Time) and Pn306 (Soft Start Deceleration Time).

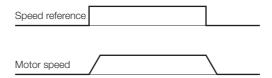

Use this function to perform smoother speed control (including internal set speed control).

	Soft Start Acceleration Time			Speed	
Pn305	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 ms	0	Immediately	Setup
	Soft Start Decelerat	ion Time	Speed		
Pn306	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 ms	0	Immediately	Setup

Pn305: The time required for the Servomotor to accelerate from a stopped state to the maximum motor speed.

Pn306: The time required for the Servomotor to decelerate from the maximum motor speed to a stopped state.

You can calculate the actual acceleration/deceleration times with the following formulas.

Pn305

6.5.3 Speed Reference Filter

The speed reference filter is a first order lag filter that is applied to the V-REF (Speed Reference Input) signal.

Pn306

You set the speed reference filter in Pn307 (Speed Reference Filter Time Constant).

It is normally not necessary to change this parameter. If the setting is too high, the response to the speed reference may be slowed down. Monitor the response to the speed reference as you set this parameter.


	Speed Reference Filter Time Constant			Speed Position	
Pn307	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	0.01 ms	40	Immediately	Setup

6.5.4 Zero Clamping

Zero clamping is used to lock the servo when the input voltage of the V-REF (Speed Reference Input) signal is equal to or lower than the speed set for the zero clamping level (Pn501 or Pn580) while the /ZCLAMP (Zero Clamping) signal is ON. The SERVOPACK internally forms a position loop, ignoring the speed reference.

Zero clamping is used for speed control in systems in which the host controller does not form a position loop.

The Servomotor is clamped within one pulse of the position where zero clamping was applied, and will return to the zero clamping position even if it is moved by an external force.

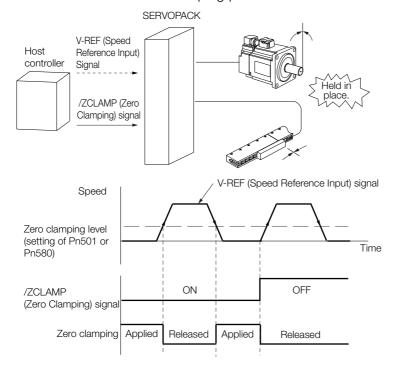

Adjust Pn102 (Position Loop Gain) if the Servomotor oscillates during zero clamping. If gain selection is used, you must also adjust Pn106 (Second Position Loop Gain).

/ZCLAMP (Zero Clamping) Signal

Use the /ZCLAMP signal to enable zero clamping.

◆ When Using the Default Input Signal Allocations (Pn50A = n.□□□0)

The /ZCLAMP signal is allocated to pin CN1-41 on the I/O signal connector by default.

Type	Signal	Connector Pin No.	Signal Status	Meaning
Input	/ZCLAMP	CN1-41	ON (closed)	Zero clamping is applied if the input voltage of the V-REF (Speed Reference Input) signal is equal to or lower than the speed set for the zero clamping level (Pn501 or Pn580).
			OFF (open)	Zero clamping is disabled.

6.5.4 Zero Clamping

◆ When Changing Input Signal Allocations (Pn50A = n.□□□1)

You must allocate the /ZCLAMP signal. Allocate the signal with Pn50D = $n.\Box\Box\Box$ X (/ZCLAMP (Zero Clamping Input) Signal Allocation).

Refer to the following section for details.

6.1.1 Input Signal Allocations on page 6-5

Type	Signal	Connector Pin No.	Signal Status	Meaning
Input	/ZCLAMP	Must be allocated.	ON (closed)	Zero clamping is applied if the input voltage of the V-REF (Speed Reference Input) signal is equal to or lower than the speed set for the zero clamping level (Pn501 or Pn580).
			OFF (open)	Zero clamping is disabled.

Enabling Zero Clamping

To enable using zero clamping, set the control method ($Pn000 = n.\square\square X\square$) to 0, 3, 4, 5, 6, 7, 9 or A. You can use zero clamping only for operation with speed control.

If $Pn000 = n.\square\squareX\square$ is set to 5, 6, 7, or 9, zero clamping will be disabled when the control method is changed to any method other than speed control.

Information

If you set the parameter to keep the /ZCLAMP always active (Pn50D = $n.\Box\Box\Box$ 7) for speed control, zero clamping will be applied whenever the speed reference is equal to or lower than the speed set for the zero clamping level. In this case, using the /ZCLAMP signal is not necessary.

Para	ameter	Control Method	Used Input Signals	When Enabled	Classification
	n.□□0□	Speed control	/ZCLAMP		
	n.□□3□	Internal set speed control	/ZCLAMP, SPD-A, SPD-B, SPD-D		
Pn000	n.□□4□	Switching between internal set speed control and speed control with analog references	/ZCLAMP, SPD-A, SPD-B, SPD-D, C-SEL		Setup
	n.□□5□	Switching between internal set speed control and position control	/ZCLAMP, SPD-A, SPD-B, SPD-D, C-SEL		
	n.□□6□	Switching between internal set speed control and torque control	/ZCLAMP, SPD-A, SPD-B, SPD-D, C-SEL	After restart	
	n.□□7□	Switching between position control and speed control	/ZCLAMP, C-SEL		
	n.□□9□	Switching between torque control and speed control	/ZCLAMP, C-SEL		
	n.□□A□	Switching between speed control with analog references and speed control with zero clamping	/ZCLAMP		

◆ Related Parameters

You set the speed at which to apply zero clamping as the zero clamping level (Pn501 or Pn580). If you set a value that exceeds the maximum speed of the Servomotor, the actual speed will be limited to the maximum speed of the Servomotor.

Rotary Servomotors

	Zero Clamping Level		Speed		
Pn501	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 min ⁻¹	10	Immediately	Setup

Linear Servomotors

	Zero Clamping Leve	I	Speed		
Pn580	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 mm/s	10	Immediately	Setup

6.5.5 /V-CMP (Speed Coincidence Detection) Signal

The /V-CMP (Speed Coincidence Output) signal is output when the Servomotor speed is the same as the reference speed. This signal is used, for example, to interlock the SERVOPACK and the host controller. You can use this output signal only during speed control.

The /V-CMP signal is described in the following table.

Type	Signal	Connector Pin No.	Signal Status	Meaning
Output /V-CMP	CN1-25 and CN1-26 (default setting)	ON (closed)	The speed coincides.	
		OFF (open)	The speed does not coincide.	

Note: You can use Pn50E = n. \$\square\$ \text{(V-CMP (Speed Coincidence Detection Output) Signal Allocation)}\$ to allocate the /V-CMP signal to different output connector pins. Refer to the following section for details on allocations.

6.1.2 Output Signal Allocations on page 6-8

You can set the speed detection width for the /V-CMP signal in Pn503 (Speed Coincidence Detection Signal Output Width) for a Rotary Servomotor or in Pn582 (Speed Coincidence Detection Signal Output Width) for a Linear Servomotor.


Rotary Servomotors

	Speed Coincidence	Detection Signal Ou	Speed		
Pn503	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 100	1 min ⁻¹	10	Immediately	Setup

The signal is output when the difference between the reference speed and motor speed is equal or less than the setting.

Example

If Pn503 is set to 100 and the speed reference is 2,000 min⁻¹, the signal would be output when the motor speed is between 1,900 min⁻¹ and 2,100 min⁻¹.

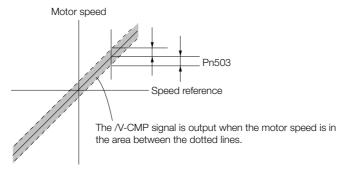


Linear Servomotors

	Speed Coincidence	Detection Signal Ou	Speed		
Pn582	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 100	1 mm/s	10	Immediately	Setup

The signal is output when the difference between the reference speed and motor speed is equal or less than the setting.

Example

If Pn582 is set to 100 and the speed reference is 2,000 mm/s the signal would be output when the motor speed is between 1,900 mm/s and 2,100 mm/s.

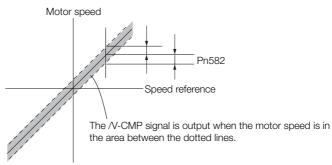

6.5.6 Operation Examples for Changing the Motor Direction


This section describes examples of using the /SPD-D (Motor Direction Input) signal in combination with zero clamping and internal set speed control.

Operation Example for Changing the Motor Direction and Zero Clamping

This section provides an example of changing the motor direction without changing the polarity of the speed reference voltage by using the /SPD-D (Motor Direction Input) signal.

		Polarity of Analog Speed Reference Voltage			
/ZCLAMP	/SPD-D	Positive	Zero Clamping Level or Lower ((Pn501 (Pn580))*	Negative	
		Rotation Direction	Operating Status	Rotation Direction	
OFF	OFF	CCW	Speed Control	CW	
OFF	ON	CW	Speed Control	CCW	
ON	OFF	CCW	Servo lock (clamped to zero)	CW	
ON	ON	CW	Servo lock (clamped to zero)	CCW	

^{*} Pn501 (Zero Clamping Level): Used with a Rotary Servomotor. Pn580 (Zero Clamping Level): Used with a Linear Servomotor.

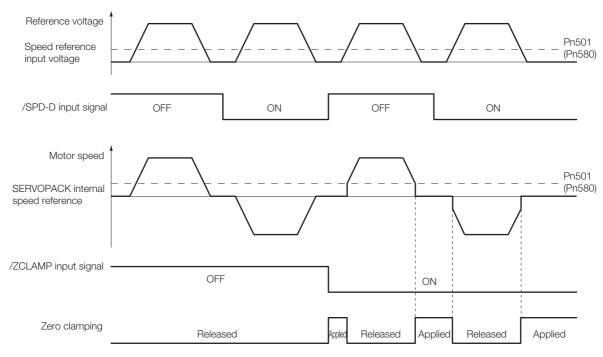

Note: The soft start function is used for the acceleration/deceleration time of the speed reference.

Operation Example for Changing the Motor Direction and Internal Set Speed Control


Even with a speed reference with the same polarity, you can change the Servomotor direction and stop the Servomotor by changing the control mode to internal set speed control and combining the /SPD-D (Motor Direction Input) signal and /C-SEL (Control Selection Input) signal.

The following operation example combines internal set speed control, the /SPD-D signal, and the /C-SEL signal. For this example, the internal set speeds must be set to 0.

◆ Parameter Settings

You must make the following parameter settings to combine internal set speed control, the /SPD-D signal, and the /C-SEL signal.

- Set Pn000 = n.□□X□ (Control Method Selection) to 4 (Switching between internal set speed control and speed control).
- Set Pn305 (Soft Start Acceleration Time) to the required acceleration time.
- Set Pn306 (Soft Start Deceleration Time) to the required deceleration time.
- Set Pn50A = n. \(\subset \text{DIDIX}\) (Input Signal Allocation Mode) to 1 (Change the sequence input signal allocations).
- Set Pn50C = n. \(\sigma\) \(\sigma\) (/SPD-D (Motor Direction) Signal Allocation) to any setting other than 7 (the signal is always active) or 8 (the signal is always inactive).
- Set Pn50C = n.□□X□ (/SPD-A (Internal Set Speed Selection Input) Signal Allocation) to 8 (the signal is always inactive).
- Set Pn50C = n.□X□□ (/SPD-B (Internal Set Speed Selection Input) Signal Allocation) to 8 (the signal is always inactive).
- Set Pn50C = n.XDDD (/C-SEL (Control Selection Input) Signal Allocation) to any setting other than 7 (the signal is always active) or 8 (the signal is always inactive).

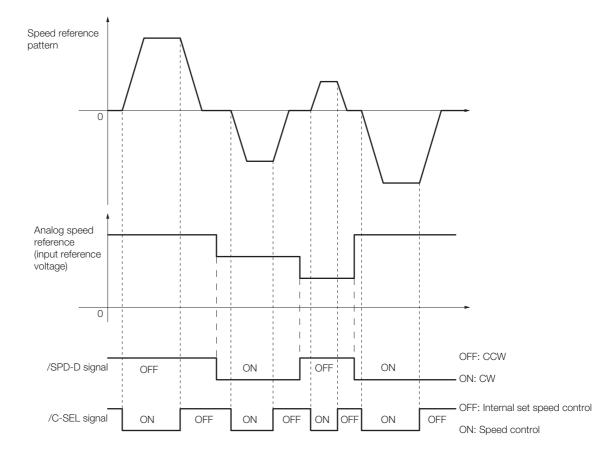

6.6

Position Control


Position control is used to input a pulse train reference from the host controller to the SERVO-PACK to move to a target position. The position is controlled with the number of input pulses, and the speed is controlled with the input pulse frequency. Use position control when positioning is required.

You set the control method to position control in $Pn000 = n . \square \square X \square$ (Control Method Selection).


Parameter I		Meaning	When Enabled	Classification
Pn000	n.□□1□	Position Control	After restart	Setup

The control block diagrams for position control are provided below.

· Rotary Servomotors

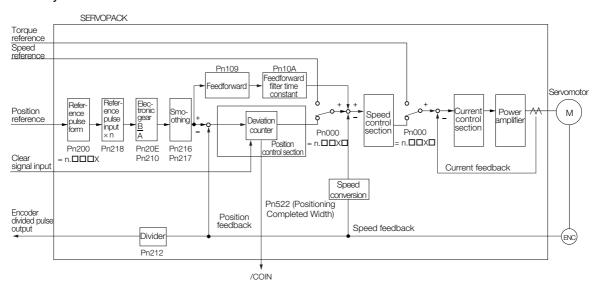

· Linear Servomotors

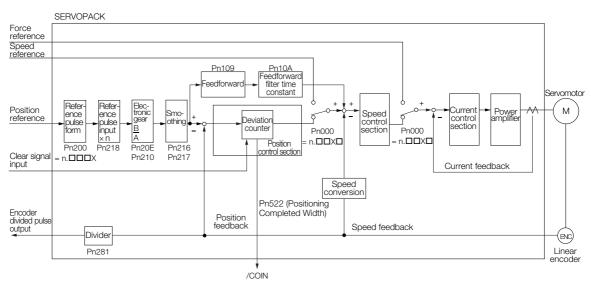

6.6.1 Basic Settings for Position Control

This section describes the reference pulse forms and input filters.

Reference Pulse Forms

To perform speed control, you must specify how the reference is input from the host controller (i.e., the reference pulse form). You set the reference pulse form in Pn200 (Position Control Reference Form Selections).

Parameter		Reference Pulse Form	Input Pulse Multiplier	Forward Reference	Reverse Reference
	n.□□□0 (default setting)	Sign and pulse train, positive logic.	-	PULS (CN1-7) High level	PULS (CN1-7)
	n.□□□1	CW and CCW pulse trains, positive logic	-	CW (CN1-7) Low level CCW (CN1-11)	CW (CN1-7)Low level (CN1-11)
	n.□□□2	90° phase-differen-	×1	→	→ ~ 90°
Pn200	n.□□□3		×2	Phase A	Phase A (CN1-7)
	n.□□□4	tial pulses	×4	Phase B	Phase B (CN1-11)
	n.□□□5	Sign and pulse train, negative logic.	-	PULS (CN1-7) SIGN Low level	PULS (CN1-7) SIGN (CN1-11) High level
	n.□□□6	CW and CCW pulse trains, negative logic	-	CW High level CCW (CN1-11)	CW (CN1-7) CCW (CN1-11) High level

Selecting an Input Filter

Р	Parameter Meaning		When Enabled	Classification
	n.0□□□ (default setting)	Use the reference input filter 1 for a line-driver signal. (1 Mpps max.)		
Pn200 n.1□□□		Use the reference input filter for an open-collector signal. (200 kpps max.)	After restart	Setup
	n.2□□□	Use reference input filter 2 for a line-driver signal. (1 to 4 Mpps)		

6.6.1 Basic Settings for Position Control

Electrical Specifications for Pulse Train Reference


The following table describes the forms for pulse train references.

Pulse Train Reference Form	Electrical Specifi	cations	Remarks
Sign and pulse train (SIGN and PLUS signals) Maximum reference frequency: 4 Mpps (maximum reference frequency for open-collector output: 200 kpps)	PULS t3 t1 t2 t7 PULS t4 t7 T t6 Reverse reference	t1, t2, t3, t7 \leq 0.025 μ s t4, t5, t6 \geq 0.5 μ s $\tau \geq$ 0.125 μ s T- $\tau \geq$ 0.125 μ s	SIGN is high for a forward refer- ence and low for a reverse refer- ence.
CW and CCW pulse trains Maximum reference frequency: 4 Mpps (maximum reference frequency for open-collector output: 200 kpps)	CCW t2 t3 Reverse reference	t1, t2 ≤ 0.025 μs t3 ≥ 0.5 μs τ ≥ 0.125 μs T- τ ≥ 0.125 μs	_
Two-phase pulse trains with 90° phase differential (phases A and B) Maximum reference frequency: 1 Mpps* (maximum reference frequency for open-collector output: 200 kpps)	Phase A Phase B Forward reference Phase B leads phase A by 90°. Reverse reference Phase B lags phase A by 90°.	$t1 \le 0.1 \mu s$ $t2 \le 0.1 \mu s$ $\tau \ge 0.5 \mu s$ $T-\tau \ge 0.5 \mu s$	-

st The maximum reference frequency for the multipliers before multiplication are as follows:

Timing Example for Pulse Train References

The following example shows the timing of inputting the pulse train reference after the servo turns ON when a signal and pulse train are used.

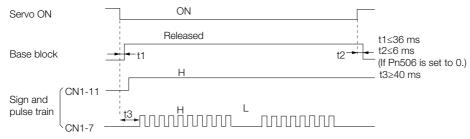

The interval (t3) between when the servo is turned ON until the pulse train reference is input must be at least 40 ms. If the reference is input in less than 40 ms, the reference pulses may not be received by the SERVO-PACK.

^{×1} multiplier: 1 Mpps ×2 multiplier: 1 Mpps ×4 multiplier: 1 Mpps

6.6.2 CLR (Position Deviation Clear) Signal Function and Settings

The CLR (Position Deviation Clear) signal is used to clear the deviation counter in the SERVO-PACK.

As long as the CLR signal is ON, the deviation counter will be 0, so a position loop will not be formed.



Deviation counter

The deviation counter counts the deviation between the reference input pulses and the feedback pulses from the encoder (i.e., the accumulated pulses).

CLR (Position Deviation Clear) Signal

Type	Signal	Connector Pin No.	Name	
Innut	CLR	CN1-15	Position deviation clear input	
Input	/CLR	CN1-14	Position deviation clear input	

Setting the Form of the CLR (Position Deviation Clear) Signal

You set the CLR signal form to use to clear the deviation counter in $Pn200 = n.\Box\Box X\Box$ (Clear Signal Form).

Parameter		Reference Form	Clear Timing	When Enabled	Classification
	n.□□0□ (default setting)	Clear position deviation when the signal is at high level.	CLR ON Cleared.		
Pn200	n.□□1□	Clear position deviation on the rising edge of the signal.	CLR ON (CN1-15) Cleared here just once.	After restart	Catus
P11200	n.□□2□ Wh	Clear position deviation when the signal is at low level.	CLR OFF (CN1-15) Cleared.	Alterrestart	Setup
	n.□□3□	Clear position deviation on the falling edge of the signal.	CLR OFF (CN1-15) Cleared here just once.		

Information

The pulse width of the CLR signal must meet the following condition.

- If Pn200 = n.□□X□ is set to 0 or 2, the width of the CLR signal must be at least 250 µs to reset the deviation counter.
- If Pn200 = n.□□X□ is set to 1 or 3, the width of the CLR signal must be at least 20 μs to reset the deviation counter.

Setting the Clear Operation (Pn200 = $n.\Box X\Box\Box$)

This parameter determines when the position error should be set to zero according to the condition of the SERVOPACK. Set $Pn200 = n.\square X \square \square$ (Clear Operation).

F	Parameter Meaning		When Enabled	Classification	
	n.□0□□ (default setting)	Clear position deviation at a base block (at servo OFF or when alarm occurs).			
Pn200	n.0100	Do not clear position deviation. The position deviation is cleared only with CLR (Clear Position Deviation) signal.	After restart	Setup	
	n.□2□□	Clear position deviation when an alarm occurs.			

6.6.3 Reference Pulse Input Multiplication Switching

You can switch the input multiplier for the position reference pulses with the /PSEL (Reference Pulse Input Multiplication Switch) signal. The number of reference pulses input to the SERVO-PACK is multiplied by the reference pulse input multiplier. You can change the multiplier from 1 to a specified value n (n can be up to 100). You set the multiplier in Pn218 (Reference Pulse Input Multiplier).

You can confirm if the multiplier was changed with the /PSELA (Reference Pulse Input Multiplication Switching Output) signal.

This section describes the /PSEL (Reference Pulse Input Multiplication Switch) signal, the reference pulse input multiplier, and restrictions.

/PSEL (Reference Pulse Input Multiplication Switch) Signal

Use the /PSEL signal to change to the reference pulse input multiplier that is set in Pn218 (Reference Pulse Input Multiplier).

Type	Signal	Connector Pin No.	Signal Status	Meaning
			ON (closed)	Enables the reference pulse input multiplier.
Input	/PSEL	Must be allocated.	OFF (open)	Disables the reference pulse input multiplier. The multiplier will be 1.

Note: You must allocate the /PSEL signal to use it. You can use the following parameters to allocate the signal to a terminal.

- Pn50A = n.□□□1 (Change the sequence input signal allocations.)
- Pn515 = n. \$\square\$ \text{/PSEL} (Reference Pulse Input Multiplication Switching Input) Signal Allocation) Refer to the following section for details.

6.1.1 Input Signal Allocations on page 6-5

/PSELA (Reference Pulse Input Multiplication Switching Output) Signal

You can confirm if the reference pulse input multiplier was changed with the /PSELA (Reference Pulse Input Multiplication Switching Output) signal.

Type	Signal	Connector Pin No.	Signal Status	Meaning
Output /PSELA	Must be allocated.	ON (closed)	The reference pulse input multiplier was enabled.	
Output	/F3LLA	wust be allocated.	OFF (open)	The reference pulse input multiplier was disabled.

Note: You must allocate the /PSELA signal to use it. You can use Pn510 = n. \(\Delta\)\(\Delta\)\(\text{D}\)\(\Delta\)\(\text{D}\)\(\text{ELA}\) (Reference Pulse Input Multiplication Switching Output) Signal Allocation) to allocate the signal to a terminal. Refer to the following section for details.

6.1.2 Output Signal Allocations on page 6-8

CAUTION


 Always use the /PSELA signal to confirm that the reference pulse input multiplier has been switched and make sure that there are no position reference pulses before you input a position reference.

Unexpected operation may occur if position reference pulses are input before the reference pulse input multiplier changes.

Setting the Reference Pulse Input Multiplier (Pn218)

	Reference Pulse Inp	out Multiplier	Positio	n	
Pn218	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	1 to 100	×1	1	Immediately	Setup

A timing chart for switching the reference pulse input multiplier is provided below.

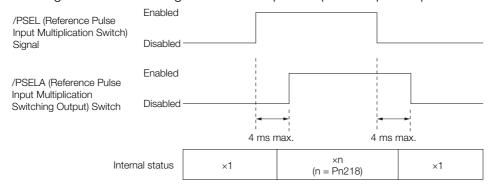

A CAUTION

If you change the reference pulse input multiplier (Pn218), perform trial operation of the Servomotor without the machine coupled to the Servomotor shaft to confirm that no problems will occur in operation before you couple the Servomotor to the machine.

Restrictions

The reference pulse input multiplier will not change during the following operations regardless of the status of the /PSEL signal.

- Program jogging
- · Autotuning without a reference input

6.6.4 Smoothing Settings

Smoothing allows you to apply a filter to the position reference to produce smoother Servomotor operation. Smoothing is effective in the following cases.

- When the host controller that outputs the references cannot perform acceleration or deceleration
- When the reference pulse frequency is very low

Note: Smoothing does not affect the travel distance (i.e., the number of reference pulses).

The following parameters are related to smoothing.

Change the settings while there is no reference pulse input and the Servomotor is stopped.

	Position Reference	Acceleration/Deceler	Positio	n		
Pn216	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
111210	0 to 65,535	0.1 ms	0*	Immediately after the motor stops	Setup	
	Average Position Reference Movement Time			Position		
Pn217	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 10,000	0.1 ms	0*	Immediately after the motor stops	Setup	

^{*} The filter is disabled if you set the parameter to 0

Information Changes to the settings in Pn216 or Pn217 are not applied while the Servomotor is operating. The changes will be enabled the next time the Servomotor comes to a stop.

6.6.4 Smoothing Settings


Restrictions

The limit value of the acceleration/deceleration filter is affected by the maximum motor speed and encoder resolution.

The Σ -7 Servomotor is subject to the following time constant restrictions.

Servomotor Model	Encoder Resolution [bit]	Maximum Motor Speed [min ⁻¹]	Time Constant [ms]
SGM7M	20	7000	No limit
SGM7J	24	6000	640
SGM7A	24	6000	640
SGM7P	24	6000	640
SGM7G	24	3000	1280
SGM7E	24	500	No limit
SGM7F	24	600	6400
SGMCV	22	600	No limit
SGMCS	20	500	No limit

The difference between the position reference acceleration/deceleration time constant (Pn216) and the average position reference movement time (Pn217) is shown below.

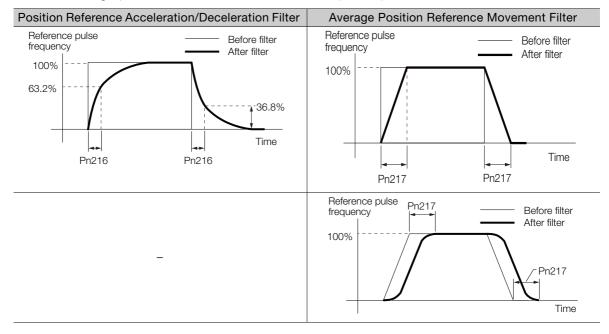

6.6.5 /COIN (Positioning Completion) Signal

The /COIN (Positioning Completion) signal indicates that Servomotor positioning has been completed during position control.

The /COIN signal is output when the difference between the reference position output by the host controller and the current position of the Servomotor (i.e., the position deviation as given by the value of the deviation counter) is equal to or less than the setting of the positioning completed width (Pn522).

Use this signal to check the completion of positioning from the host controller.

Type	Signal	Connector Pin No.	Signal Status	Meaning
Output /COIN	CN1-25 and CN1-26	ON (closed)	Positioning has been completed.	
Output	IDUL 1/GOIN 1/1 c 1 \	OFF (open)	Positioning has not been completed.	

Note: Use Pn50E = n. \(\subseteq \text{COIN} \) (Positioning Completion Output) Signal Allocation) to allocate the /COIN signal to other connector pins. Refer to the following section for details.


6.1.2 Output Signal Allocations on page 6-8

Setting the Positioning Completed Width

The /COIN signal is output when the difference between the reference position and the current position (i.e., the position deviation as given by the value of the deviation counter) is equal to or less than the setting of the positioning completed width (Pn522).

	Positioning Completed Width			Positio	n
Pn522	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 1,073,741,824	1 reference unit	7	Immediately	Setup

The setting of the positioning completed width has no effect on final positioning accuracy.

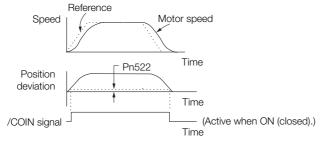

Note: If the parameter is set to a value that is too large, the /COIN signal may be output when the position deviation is low during a low-speed operation. If that occurs, reduce the setting until the signal is no longer output.

Setting the Output Timing of the /COIN (Positioning Completion Output) Signal

You can add a reference input condition to the output conditions for the /COIN signal to change the signal output timing.

If the position deviation is always low and a narrow positioning completed width is used, change the setting of $Pn207 = n.X \square \square \square \square$ (/COIN (Positioning Completion Output) Signal Output Timing) to change output timing for the /COIN signal.

Parameter		Description	When Enabled	Classification
	n.0□□□ (default setting)	Output the /COIN signal when the absolute value of the position deviation is the same or less than the setting of Pn522 (Positioning Completed Width).		
n. 1000	n. 1□□□	Output the /COIN signal when the absolute value of the position deviation is the same or less than the setting of Pn522 (Positioning Completed Width) and the reference after the position reference filter is 0.	After restart	Setup
	n. 2000	Output the /COIN signal when the absolute value of the position deviation is the same or less than the setting of Pn522 (Positioning Completed Width) and the reference input is 0.		

6.6.6 /NEAR (Near) Signal

The /NEAR (Near) signal indicates when positioning completion is being approached.

The host controller receives the NEAR signal before it receives the /COIN (Positioning Completion) signal, it can start preparations for the operating sequence to use after positioning has been completed. This allows you to reduce the time required for operation when positioning is completed.

The NEAR signal is generally used in combination with the /COIN signal.


Type	Signal	Connector Pin No.	Signal Status	Meaning
Output	Output /NEAR Must be alloc	Must be allegated	ON (closed)	The Servomotor has reached a point near to positioning completion.
Output	/INEAN	AR Must be allocated.	OFF (open)	The Servomotor has not reached a point near to positioning completion.


Note: You must allocate the /NEAR signal to use it. Use Pn510 = n. \(\subseteq \text{ID} \text{ (NEAR (Near) Signal Allocation)} \) to allocate the signal to a connector pin. Refer to the following section for details.

6.1.2 Output Signal Allocations on page 6-8

/NEAR (Near) Signal Setting

You set the condition for outputting the /NEAR (Near) signal (i.e., the near signal width) in Pn524 (Near Signal Width). The /NEAR signal is output when the difference between the reference position and the current position (i.e., the position deviation as given by the value of the deviation counter) is equal to or less than the setting of the near signal width (Pn524).

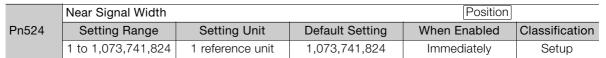

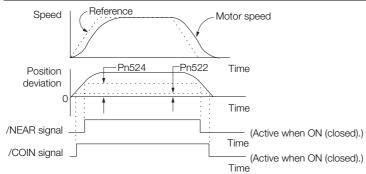

Note: Normally, set Pn524 to a value that is larger than the setting of Pn522 (Positioning Completed Width).

6.6.7 Reference Pulse Inhibition Function

You can stop the SERVOPACK from counting the reference input pulses during position control. When this function is enabled, the SERVOPACK will ignore the reference pulse input.

/INHIBIT (Reference Pulse Inhibit) Signal

If you set the control method to switch between normal position control and position control with reference pulse inhibition ($Pn000 = n.\square\square\square\square\square$), the /INHIBIT signal is used as the Reference Pulse Inhibit signal (default setting).

◆ When Using the Default Input Signal Allocations (Pn50A = n.□□□0)

Type	Signal	Connector Pin No.	Signal Status	Meaning
Input /INHIBIT	CN1-41	ON (closed)	Counting the reference pulses is stopped.	
	(default setting)	OFF (open)	The reference pulses are counted.	

◆ When Changing Input Signal Allocations (Pn50A = n.□□□1)

If you set $Pn000 = n.\square\square X\square$ (Control Method Selection) to 1, 5, 7, 8, or B, the /INHIBIT signal is used as the Reference Pulse Inhibit signal for reference pulse inhibition.

Type	Signal	Connector Pin No.	Signal Status	Meaning
Input	Input /INHIBIT	HIBIT Must be allocated. -	ON (closed)	Counting the reference pulses is stopped.
IIIput			OFF (open)	The reference pulses are counted.

Note: You must allocate the /INHIBIT signal to use it. Use Pn50D = n. \$\square\$ (/INHIBIT (Reference Pulse Inhibit Input) Signal Allocation) to allocate the signal to a connector pin. Refer to the following section for details. \$\iii 6.1.2 \text{ Output Signal Allocations}\$ on page 6-8

◆ Reference Pulse Inhibition Settings

To use reference pulse inhibition, set $Pn000 = n.\square\square X\square$ (Control Method Selection) to 1, 5, 7, 8, or B.

Parameter		Control Method	Used Input Signals	When Enabled	Classification
	n.0010	Position control	/INHIBIT		
	n.□□5□	Switching between internal set speed control and position control	/INHIBIT /SPD-A /SPD-B /SPD-D /C-SEL		
Pn000	n.□□7□	Switching between position control and speed control	/INHIBIT /C-SEL	After restart	Setup
	n.□□8□	Switching between position control and torque control	/INHIBIT /C-SEL		
n	n.□□B□	Switching between normal position control and position control with reference pulse inhibition	/INHIBIT		

Information Counting reference pulses can be inhibited only for position control.

6.7.1 Basic Settings for Torque Control

6.7

Torque Control

Torque control is performed by inputting a torque reference with an analog voltage reference to the SERVOPACK to control the Servomotor with a torque that is proportional to the input voltage.

Torque control is set by setting $Pn000 = n.\square\square X\square$ (Control Method Selection) to 2 (Torque control).

Par	ameter	Meaning	When Enabled	Classification
Pn000	n.□□2□	Torque control	After restart	Setup

6.7.1 Basic Settings for Torque Control

This section describes the torque reference input signal and torque reference input gain.

T-REF (Torque Reference Input) Signal

The T-REF signal is described in the following table.

Туре	Signal	Connector Pin No.	Name
Input	T-REF	CN1-9	Torque reference input
прис	SG	CN1-10	Signal ground for torque reference input

Maximum input voltage: ±12 VDC


Example

Input Circuit Example

Pn400 (Torque Reference Input Gain) is set to 3 (setting unit: V) by default.

Torque Reference Input	Rotation Direction	Torque
+3 V	Forward	Rated torque
+1 V	Forward	1/3 rated torque
-1.5 V	Reverse	1/2 rated torque

If you will use a host controller, such as a programmable controller, for torque control, connect the above output pins to the analog reference output terminals on the host controller . Always use twisted-pair cables to control noise.

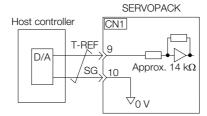


Setting the Torque Reference Input Gain (Pn400)

The torque of the Servomotor is controlled in proportion to an analog voltage reference.

The reference voltage for the rated motor torque is set in Pn400 (Torque Reference Input Gain) to define the relationship between the analog voltage reference and the motor output torque.

	Torque Reference I	nput Gain		Speed Positio	n Torque
Pn400	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	10 to 100	0.1 V	30 (rated torque at 3.0 V)	Immediately	Setup

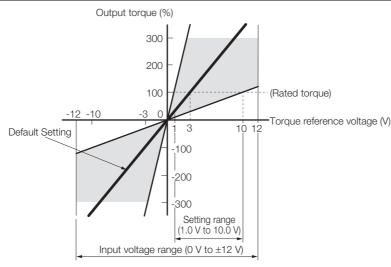

Note: You can input a torque reference that exceeds the rated torque, but A.710 (Instantaneous Overload) or A.720 (Continuous Overload) alarms may occur if the reference is maintained for a long time or the motor outputs a torque that exceeds the rated torque. Refer to the following section for details.


12.2.2 Troubleshooting Alarms on page 12-12

6.7.2 Adjusting the Torque Reference Offset

With torque control, the Servomotor may sometimes operate at a very low speed for a torque reference of 0 V. This occurs because the internal reference in the SERVOPACK has a slight offset of a few millivolts.

If the Servomotor moves at a very low speed, the offset needs to be eliminated by adjusting the offset.

You can adjust the torque reference offset either automatically or manually.

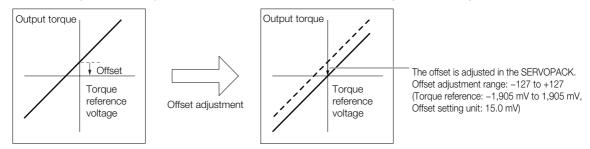

Automatically Adjusting the Torque Reference Offset

To automatically adjust the torque reference offset, the amount of offset is measured and the torque reference voltage is adjusted automatically.

The measured offset is saved in the SERVOPACK.

Information

The offset does not use a parameter, so it will not change even if the parameter settings are initialized.

6.7.2 Adjusting the Torque Reference Offset

Preparations

The following conditions must be met to automatically adjust the reference offset.

- The parameters must not be write prohibited.
- The servo must be OFF.
- There must not be a position loop or speed loop in the host controller.

◆ Applicable Tools


The following table lists the tools that you can use to automatically adjust the torque reference offset.

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	Fn009	13.4.8 Autotune Analog (Speed/Torque) Reference Offset (Fn009) on page 13-18
Digital Operator	Fn009	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Others – Adjust the Speed and Torque Reference Offset	

Operating Procedure


Use the following procedure to automatically adjust the torque reference offset.

- 1. Confirm that the servo is OFF in the SERVOPACK.
- 2. Input a 0-V reference voltage from the host controller or an external circuit.

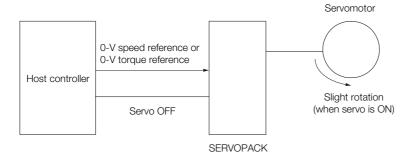


- 3. Click the P Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **4.** Select Adjust the Speed and Torque Reference Offset in the Menu Dialog Box. The Adjust the Speed and Torque Reference Offset Dialog Box will be displayed.
- 5. Click the Automatic Adjustment Tab.

6. Click the Adjust Button.

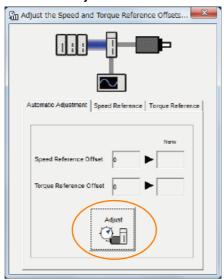

The value that results from automatic adjustment will be displayed in the **New** Box.

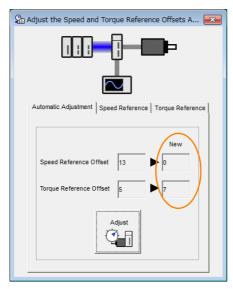

Note: You cannot automatically adjust the reference offset if a position loop is created with the host controller. Manually adjust the torque reference offset.

This concludes the procedure to automatically adjust the torque reference offset.

Manually Adjusting the Torque Reference Offset

You can directly input a torque reference offset to adjust the torque reference. The offset is adjusted manually in the following cases.

- To intentionally set the offset to a desired value
- To check an offset that was set automatically

Information The offset does not use a parameter, so it will not change even if the parameter settings are initialized.

Preparations

The following conditions must be met to manually adjust the reference offset.

• The parameters must not be write prohibited.

6.7.2 Adjusting the Torque Reference Offset

Applicable Tools


The following table lists the tools that you can use to manually adjust the torque reference offset.

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	Fn009	13.4.10 Manually Adjust Torque Reference Offset (Fn00B) on page 13-19
Digital Operator	Fn009	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Others – Adjust the Speed and Torque Reference Offset	◆ Operating Procedure on page 6-44


Operating Procedure


Use the following procedure to manually adjust the torque reference offset.


1. Input a 0-V reference voltage from the host controller or an external circuit.

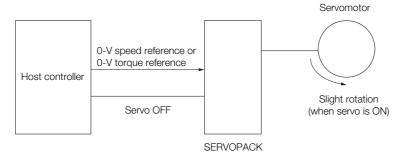

- 2. Click the P Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **3.** Select Adjust the Speed and Torque Reference Offset in the Menu Dialog Box. The Adjust the Speed and Torque Reference Offset Dialog Box will be displayed.
- 4. Click the Torque Reference Tab.

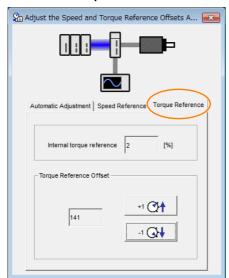

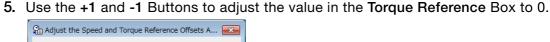

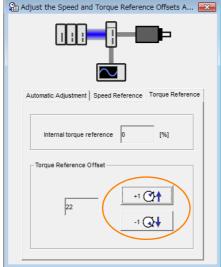

This concludes the procedure to manually adjust the torque reference offset.

6.7.3 Torque Reference Filter Settings

The torque reference filter is a first order lag filter that is applied to the T-REF (Torque Reference Input) signal. The torque reference input filter is set in Pn415 (T-REF Filter Time Constant).

If the setting is too high, the response to the torque reference may be slowed down. Monitor the response as you set this parameter.


	T-REF Filter Time Co	onstant	Speed Position	n Torque	
Pn415	Setting Range Setting Unit		Default Setting	When Enabled	Classification
	0 to 65,535	0.01 ms	0	Immediately	Setup

6.7.4 Speed Limit during Torque Control

You can limit the speed of the Servomotor to protect the machine.

When you use a Servomotor for torque control, the Servomotor is controlled to output the specified torque, but the motor speed is not controlled. Therefore, if a reference torque is input that is larger than the machine torque, the speed of the Servomotor may increase greatly. If that may occur, use this function to limit the speed.

Note: The actual limit of Servomotor speed depends on the load conditions on the Servomotor.

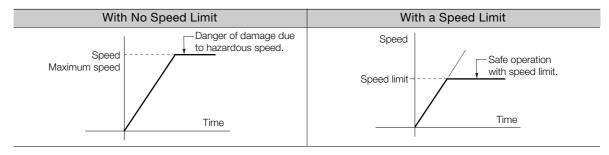

6.7.4 Speed Limit during Torque Control

/VLT (Speed Limit Detection) Signal

The signal that is output when the motor speed is being limited by the speed limit is described in the following table.

Туре	Signal	Connector Pin No.	Signal Status	Meaning
		ON (closed)	The Servomotor speed is being limited.	
Output	/VLT	Must be allocated.	OFF (open)	The Servomotor speed is not being limited.

Note: You must allocate the /VLT signal to use it. Use Pn50F = n. \(\sigma X\) (/VLT (Speed Limit Detection) Signal Allocation) to allocate the signal to a connector pin. Refer to the following section for details.

Selecting the Speed Limit

You set the speed limit to use in $Pn002 = n. \square \square X \square$ (Torque Control Option). If you set Pn.002 to $n. \square \square 1 \square$ (Use V-REF as an external speed limit input), the smaller of the external speed limit and the internal speed limit will be used.

	Parameter		Meaning	When Enabled	Classification
n.□□0□ Use Pn407 or Pn480 as the speed limit. (Use internal speed limiting.)					
	Pn002	n.□□1□	Use V-REF (CN1-5 and CN1-6) as an external speed limit input signal and limit the speed with the V-REF input voltage and the setting of Pn300. (Use external speed limiting.)	After restart	Setup

Note: If you are using a Rotary Servomotor, set Pn407 (Speed Limit during Torque Control). If you are using a Linear Servomotor, set Pn480 (Speed Limit during Force Control).

◆ Internal Speed Limiting

If you select internal speed limiting for the torque control option ($Pn002 = n.\square\square0\square$), set the speed limit for the motor in Pn407 (Speed Limit during Torque Control) or Pn480 (Speed Limit during Force Control).

Also set $Pn408 = n.\square\squareX\square$ (Speed Limit Selection) to specify using the maximum motor speed or the overspeed alarm detection speed as the speed limit. Select the overspeed alarm detection speed to limit the speed to the equivalent of the maximum motor speed.

Parameter		Meaning	When Enabled	Classification
Pn408	n.□□0□ (default setting)	Use the smaller of the maximum motor speed and the setting of Pn407 or Pn480 as the speed limit.	After restart	Catura
1 11400	n.0010	Use the smaller of the overspeed alarm detection speed and the setting of Pn407 or Pn480 as the speed limit.	Alter restart	Setup

Note: If you are using a Rotary Servomotor, set Pn407 (Speed Limit during Torque Control). If you are using a Linear Servomotor, set Pn480 (Speed Limit during Force Control).

Rotary Servomotors

	Speed Limit during	Torque				
Pn407	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 10,000	1 min ⁻¹	10000	Immediately	Setup	

Linear Servomotors

	Speed Limit during		Force		
Pn480	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 mm/s	10000	Immediately	Setup

Note: If the parameter setting exceeds the maximum speed of the Servomotor, the Servomotor's maximum speed or the overspeed alarm detection speed will be used.

^{6.1.2} Output Signal Allocations on page 6-8

◆ External Speed Limiting

If you select external speed limiting for the torque control option ($Pn002 = n.\Box\Box1\Box$), set the V-REF (Speed Reference Input) signal and the speed reference input gain (Pn300).

Туре	Signal	Connector Pin No.	Name	
Input	V-REF CN1-5		External speed limit input	
	SG	CN1-6	Signal ground for external speed limit input	

During torque control, the motor speed limit is controlled by the analog voltage reference.

Information

- 1. If you set Pn002 to n.□□1□, the smaller of the speed limit input with the V-REF signal and the value of Pn407 or Pn480 is used.
- 2. The setting of Pn300 determines the voltage level to be input as the speed limit. The polarity has no effect.
- 3. If you set Pn300 to 6.00 (default setting) and 6 V is input to the V-REF (CN1-5 and CN1-6) signal, the speed is limited to the rated speed of the Servomotor.

	Speed Reference In	put Gain	Speed Position	n Torque	
Pn300	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	150 to 3,000	0.01 V	600	Immediately	Setup

6.8.1 Encoder Divided Pulse Output Signals

6.8 Encoder Divided Pulse Output

The encoder divided pulse output is a signal that is output from the encoder and processed inside the SERVOPACK. It is then output externally in the form of two phase pulse signals (phases A and B) with a 90° phase differential. At the host controller, it is used as the position feedback.

The following table describes the signals and output phase forms.


6.8.1 Encoder Divided Pulse Output Signals

Туре	Signal	Connector Pin No.	Name	Remarks	
Output	PAO	CN1-33	Encoder Divided Pulse Output,	Rotary Servomotors These encoder divided pulse output pins output the number	
	/PAO	CN1-34	Phase A	of pulses per Servomotor reso- lution that is set in Pn212 (Number of Encoder Output	
	РВО	CN1-35		Pulses). The phase difference between phase A and phase B is an electric angle of 90°.	
	/PBO	CN1-36	Encoder Divided Pulse Output, Phase B	Linear Servomotors These encoder divided pulse output pins output pulses at the resolution that is set in Pn281 (Encoder Output Resolution). The phase difference between phase A and phase B is an electric angle of 90°.	
	PCO	CN1-19	Encoder Divided Pulse Output,	These pins output one pulse every Servomotor rotation.	
	/PCO	CN1-20	Phase C*		


^{*} Refer to the following section for information on the origin within one encoder rotation.

Relation between Renishaw PLC Incremental Linear Encoders and Encoder Output Pulse Signal from the SER-VOPACK When Using a RGS20 Scale and RGH22B Sensor Head on page 6-49

Rotary Servomotor

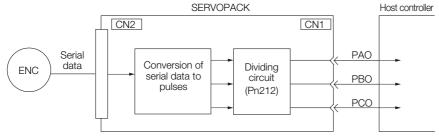

• Linear Servomotors

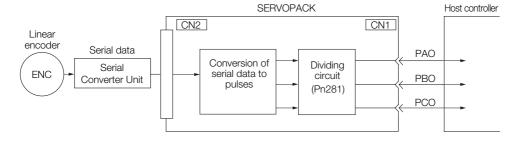

Output Phase Forms

Forward rotation or movement (phase B leads by 90°)	Reverse rotation or movement (phase A leads by 90°)
Phase A Phase B Phase C	Phase A Phase B Phase C

Note: The pulse width of the origin within one encoder rotation depends on the setting of number of encoder output pulses (Pn212) or the encoder output resolution (Pn281). It is the same as the width of phase A. Even for reverse operation (Pn000 = n.□□□1), the output phase form is the same as shown above.



If you use the SERVOPACK's phase-C pulse output for an origin return, rotate the Servomotor two or more rotations before you start an origin return. If the Servomotor cannot be rotated two or more times, perform an origin return operation at a motor speed of 600 min⁻¹ or lower. If the motor speed is higher than 600 min⁻¹, the phase-C pulse may not be output correctly.

Linear Encoder Application Precautions

The following precautions apply to the encoder output pulses when an external linear encoder is used.


 Relation between Renishaw PLC Incremental Linear Encoders and Encoder Output Pulse Signal from the SERVOPACK When Using a RGS20 Scale and RGH22B Sensor Head

The output position of the origin signal (Ref) will depend on the direction of movement for some models of incremental linear encoders from Renishaw PLC.

In that case, the phase-C pulse of the SERVOPACK is output at two positions.


For detailed specifications on the origin signal, refer to the manual for the Renishaw PLC incremental linear encoder.

■ When Passing the First Origin Signal (Ref) in the Forward Direction and Returning after Turning ON the Power Supply

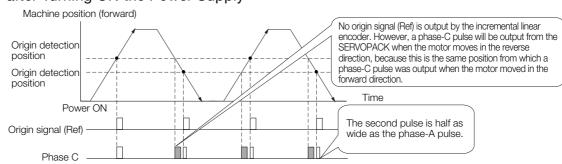

6.8.1 Encoder Divided Pulse Output Signals

■ When Passing the First Origin Signal (Ref) in the Reverse Direction and Returning after Turning ON the Power Supply

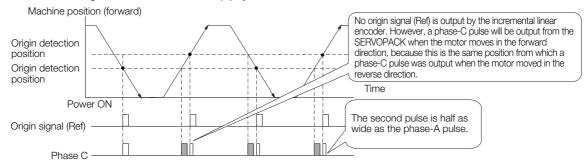

Precautions When Using a Linear Incremental Encoder from Magnescale Co., Ltd.

■ Encoder Divided Phase-C Pulse Output Selection


You can also output the encoder's phase-C pulse for reverse movement. To do so, set Pn081 to n. \$\square\$ 1.

Parameter		Meaning	When Enabled	Classification
Pn081	n.□□□0 (default setting)	Output phase-C pulses only in the forward direction.	After restart	Setup
111001	n.□□□1	Output phase-C pulses in both the forward and reverse directions.	Alter restait	Setup



Precautions on Setting the Phase-C Pulse Output Selection (Pn081 = n.□□□X)

- If you set Pn081 to n. □□□1 (Output phase-C pulses in both the forward and reverse directions), the width of the phase-C pulse output may be narrower than the width of the phase-A pulse.
- There is a difference of 1/8th of the scale pitch in the phase-C detection position for the encoder's phase-C pulse output position between when Pn081 = n. \(\subseteq \subseteq \text{X}\) is set to 0 (Output phase-C pulses only in the forward direction) and when it is set to 1 (Output phase-C pulses in both the forward and reverse directions).

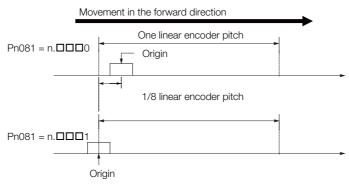

Observe the following precaution if you set Pn081 to n. \$\square\$ Output phase-C pulses only in the forward direction).


When a linear incremental encoder from Magnescale Co., Ltd. is used, the count direction of the encoder determines how the phase-C pulse (CN1-19 and CN1-20) is output.

Note: The count direction (up or down) of the linear encoder determines whether a phase-C pulse is output. The output of the pulse does not depend on the setting of the movement direction (Pn000 = n.□□□1).

Encoder Model	Interpolator	Linear Encoder Pitch [μm]
SL710	DI 101 DV	800
SL720	PL101-RY MJ620-T13	800
SL730	1416626 1 16	800
	SR75	80
SR85		80
SQ10	MQ10-FLA	400
	MQ10-GLA	400

■ When First Passing the Origin Signal in the Forward Direction and Returning after Turning ON the Power Supply


The encoder's phase-C pulse (CN1-19 and CN1-20) is output when the origin detection position is passed for the first time in the forward direction after the power supply is turned ON. After that, the phase-C pulse is output whenever the origin detection position is passed in the forward or reverse direction.

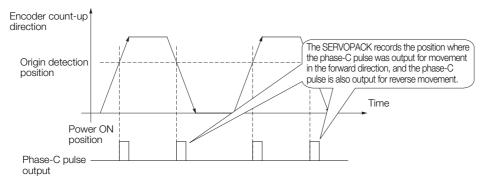

■ When First Passing the Origin Signal in the Reverse Direction and Returning after Turning ON the Power Supply

The encoder's phase-C pulse (CN1-19 and CN1-20) is not output when the origin detection position is passed for the first time in the reverse direction after the power supply is turned ON.


However, after the origin detection position is passed in the forward direction and the encoder's phase-C pulse is output, it will then also be output when the origin detection point is passed in the reverse direction.

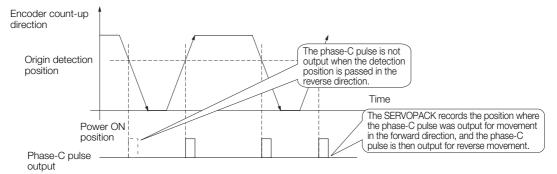

6.8.1 Encoder Divided Pulse Output Signals

■ When Using a Linear Encoder with Multiple Origins and First Passing the Origin Position in the Forward Direction and Returning after Turning ON the Power Supply


The encoder's phase-C pulse is output when the origin detection position is passed for the first time in the forward direction after the power supply is turned ON. After that, the phase-C pulse is output whenever the origin detection position is passed in the forward or reverse direction.

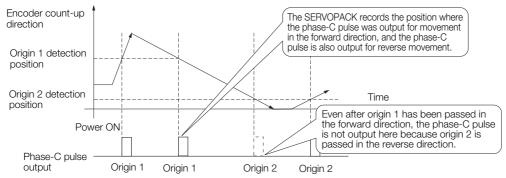

When Using a Linear Encoder with Multiple Origins and First Passing the Origin Position in the Reverse Direction after Turning ON the Power Supply

The encoder's phase-C pulse is not output when the origin detection position is passed for the first time in the reverse direction after the power supply is turned ON.

However, after the origin detection position is passed in the forward direction and the encoder's phase-C pulse it output, it will then also be output when the origin detection point is passed in the reverse direction.

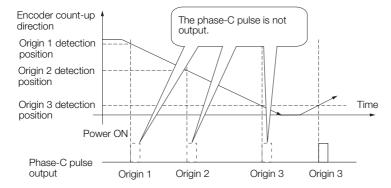

Setting for the Encoder Divided Pulse Output 6.8.2

This section describes the setting for the encoder divided pulse output for a Rotary Servomotor or Linear Servomotor.

Encoder Divided Pulse Output When Using a Rotary Servomotor

If you will use a Rotary Servomotor, set the number of encoder output pulses (Pn212).

	Number of Encoder C	output Pulses	Speed Position	on Torque	
Pn212	Setting Range Setting Unit		Default Setting	When Enabled	Classification
	16 to 1,073,741,824	1 P/Rev	2,048	After restart	Setup

The number of pulses from the encoder per rotation are processed inside the SERVOPACK, divided by the setting of Pn212, and then output.

Set the number of encoder divided output pulses according to the system specifications of the machine or host controller.

The setting of the number of encoder output pulses is limited by the resolution of the encoder.


Setting of the Number		En	coder Resoluti	Upper Limit of Servo-	
of Encoder Output Pulses [P/Rev]	Setting Increment	20 bits (1,048,576 pulses)	22 bits (4,194,304 pulses)	24 bits (16,777,216 pulses)	motor Speed for Set Number of Encoder Output Pulses [min ⁻¹]
16 to 16,384	1	0	0	0	6,000
16,386 to 32,768	2	0	0	0	3,000
32,772 to 65,536	4	0	0	0	1,500
65,544 to 131,072	8	0	0	0	750
131,088 to 262,144	16	0	0	0	375
262,176 to 524,288	32	_	0	0	187
524,352 to 1,048,576	64	_	0	0	93
1,048,704 to 2,097,152	128	_	_	0*	46
2,097,408 to 4,194,304	256	-	-	0*	23

^{*} Available only for incremental encoder

- Note: 1. The setting range of the number of encoder output pulses (Pn212) depends on the resolution of the Servomotor encoder. An A.041 alarm (Encoder Output Pulse Setting Error) will occur if the above setting conditions are not met.

 - Correct setting example: Pn212 can be set to 25,000 [P/Rev]. Incorrect setting example: Pn212 cannot be set to 25,001 (P/Rev) because the setting increment in the above table is not used.
 - 2. The upper limit of the pulse frequency is approximately 1.6 Mpps. The Servomotor speed will be limited if the setting of the number of encoder output pulses is too high. An A.511 alarm (Encoder Output Pulse Overspeed) will occur if the upper limit of the motor speed is exceeded

Output example: An output example is given below for the PAO (Encoder Pulse Output Phase A) signal and the PBO (Encoder Pulse Output Phase B) signal when Pn212 is set to 16 (16 pulses output per revolution).

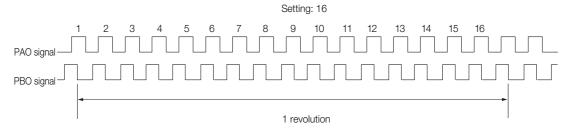

6.8.2 Setting for the Encoder Divided Pulse Output

Encoder Divided Pulse Output When Using a Linear Servomotor

If you will use a Linear Servomotor, set the encoder output resolution (Pn281).

	Encoder Output Re	solution	Speed Posit	ion Force	
Pn281	Setting Range Setting Unit		Default Setting	When Enabled	Classification
	1 to 4,096	1 edge/pitch	20	After restart	Setup

Note: 1. The maximum setting for the encoder output resolution is 4,096.

If the resolution of the external encoder exceeds 4,096, pulse output will no longer be possible at the resolution given in ■ Feedback Resolution of Linear Encoder on page 5-49.

2. If the setting of Pn281 exceeds the resolution of the external encoder, the A.041 alarm (Encoder Output Pulse Setting Error) will be output.

Set the encoder output resolution for the encoder pulse output signals (PAO, /PAO, PBO, and /PBO) from the SERVOPACK to the host controller.

The number of feedback pulses per linear encoder pitch is divided by the setting of Pn281 (after multiplication by 4) inside the SERVOPACK and then the resulting number of pulses is output. Set the parameter according to the system specifications of the machine or host controller.

The setting range depends on the Servomotor's maximum speed (Pn385) and the Linear Encoder Scale Pitch (Pn282).* You can calculate the upper limit of the setting of Pn281 with the following formula.

Upper limit of Pn281 =
$$\frac{\text{Linear Encoder Pitch*/100}}{\text{Pn385}} \times 72$$

* The value depends on whether a Serial Converter Unit is used.

Using a Serial Converter Unit	Setting of Pn282
Not Using a Serial Converter Unit (when the linear encoder and SERVOPACK are connected directly or when a linear encoder that does not require a Serial Converter Unit is used)	The linear encoder pitch is automatically detected by the SERVO-PACK, so the setting of Pn282 is disabled.

Information

When the linear encoder pitch is 4 μ m, the maximum motor speed is limited to 1 m/s because of the maximum response frequency of the Serial Converter Unit. If the setting is out of range or does not satisfy the setting conditions, an A.041 alarm (Encoder Output Pulse Setting Error) will be output. If the motor speed exceeds the upper limit for the set encoder output resolution, an A.511 alarm (Encoder Output Pulse Overspeed) will be output.

The upper limit of the encoder output resolution is restricted by the dividing specifications of the Serial Converter Unit.

Example

Setting Example


Correct setting for a linear encoder pitch of 20 μm and a maximum motor speed of 5 m/s (Pn385 = 50): Pn281 = 28 (edges/pitch)

Incorrect setting: Pn281 = 29 (edges/pitch) (An A.041 alarm would be output.)

Example

Pulse Output Example


When Pn281 = 20 (20-edge output (5-pulse output) per linear encoder pitch)

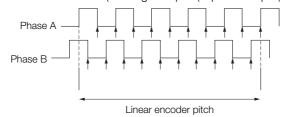


6.9 Internal Set Speed Control

You can set motor speeds in three parameters in the SERVOPACK and then perform speed control by using external input signals to select the motor speed and direction. Because the speed is controlled with parameters in the SERVOPACK, an external pulse generator or a reference generator is not required to control the speed.

· Rotary Servomotors

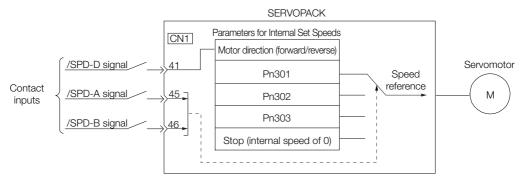

Linear Servomotors

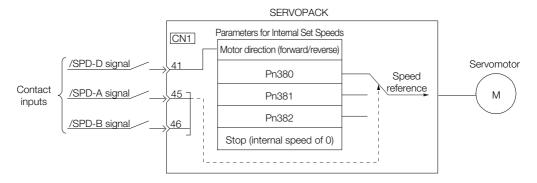

6.9.1 Input Signals for Internal Set Speed Control

The following input signals are used to change the speed.

When Using the Default Input Signal Allocations (Pn50A = $n.\Box\Box\Box\Box$ 0)

Type	Signal	Connector Pin No.	Meaning
	/SPD-D	CN1-41	Changes the Servomotor direction.
Input	/SPD-A	CN1-45	Used to select the internal set speed.
	/SPD-B	CN1-46	Used to select the internal set speed.

When Changing Input Signal Allocations (Pn50A = n.□□□1)

Type	Signal	Connector Pin No.	Meaning
	/SPD-D		Changes the Servomotor direction.
Input	/SPD-A	Must be allocated.	Used to select the internal set speed.
/SPD-B	Used to select the internal set speed.		

Note: You must allocate the /SPD-D, /SPD-A, and /SPD-B signals to use them. You can use the following parameters to allocate the signal to a terminal.

- Pn50C = n.□□□X (/SPD-D (Motor Direction) Signal Allocation)
- Pn50C = n.□□X□ (/SPD-A (Internal Set Speed Selection Input) Signal Allocation)
- Pn50C = n.□X□□ (/SPD-B (Internal Set Speed Selection Input) Signal Allocation)

Refer to the following section for details.

6.1.1 Input Signal Allocations on page 6-5

6.9.2 Setting the Control Method to Internal Set Speed Control

6.9.2 Setting the Control Method to Internal Set Speed Control

Set Pn000 to n.□□X□ (Control Method Selection) to 3 to specify internal set speed control.

Parameter Meaning		Meaning	When Enabled	Classification
Pn000	n.□□3□	Internal set speed control with contact commands	After restart	Setup

6.9.3 Settings for Internal Set Speed Control

The parameters that you set depend on the type of Servomotor.

Rotary Servomotors

	Internal Set Speed 1		Speed		
Pn301	Setting Range	Setting Unit*	Default Setting	When Enabled	Classification
	0 to 10,000	1 min ⁻¹	100	Immediately	Setup
	Internal Set Speed 2	2	Speed		
Pn302	Setting Range	Setting Unit*	Default Setting	When Enabled	Classification
	0 to 10,000	1 min ⁻¹	200	Immediately	Setup
	Internal Set Speed 3	3		Speed	
Pn303	Setting Range	Setting Unit*	Default Setting	When Enabled	Classification
	0 to 10,000	1 min ⁻¹	300	Immediately	Setup

^{*} When a Direct Drive Servomotor is connected, the setting unit will automatically be 0.1 min⁻¹.

Note: If you set a value that exceeds the maximum speed of the Servomotor, the actual speed will be limited to the maximum speed of the Servomotor.

• Linear Servomotors

	Internal Set Speed 1			Speed	
Pn380	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 mm/s	10	Immediately	Setup
	Internal Set Speed 2			Speed	
Pn381	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 mm/s	20	Immediately	Setup
	Internal Set Speed 3	3		Speed	
Pn382	Setting Range Setting Unit		Default Setting	When Enabled	Classification
	0 to 10,000	1 mm/s	30	Immediately	Setup

Note: If you set a value that exceeds the maximum speed of the Servomotor, the actual speed will be limited to the maximum speed of the Servomotor.

6.9.4 Changing Internal Set Speeds with Input Signals

You can select the internal set speed and direction with the ON/OFF combinations of the /SPD-D (Motor Direction) signal and the /SPD-A and /SPD-B (Internal Set Speed Selection) signals.

• Rotary Servomotors


Input Signals		Motor	Motor Speed	
/SPD-D	/SPD-A	/SPD-B	Direction	Motor Speed
	OFF	OFF		Stops the motor with an internal speed of 0.
OFF	OFF	ON	Forward	Operates the motor with internal set speed 1, which is set in Pn301.
	ON	ON		Operates the motor with internal set speed 2, which is set in Pn302.
	ON	OFF		Operates the motor with internal set speed 3, which is set in Pn303.
	OFF	OFF	Reverse	Stops the motor with an internal speed of 0.
	OFF	ON		Operates the motor with internal set speed 1, which is set in Pn301.
ON	ON	ON		Operates the motor with internal set speed 2, which is set in Pn302.
	ON	OFF		Operates the motor with internal set speed 3, which is set in Pn303.

• Linear Servomotors

Input Signals		Motor	Motor Speed	
/SPD-D	/SPD-A	/SPD-B	Direction	Motor Speed
	OFF	OFF		Stops the motor with an internal speed of 0.
OFF	OFF	ON		Operates the motor with internal set speed 1, which is set in Pn380.
	ON	ON	Forward	Operates the motor with internal set speed 2, which is set in Pn381.
	ON	OFF		Operates the motor with internal set speed 3, which is set in Pn382.
	OFF	OFF		Stops the motor with an internal speed of 0.
	OFF	ON		Operates the motor with internal set speed 1, which is set in Pn380.
ON	ON	ON	Reverse	Operates the motor with internal set speed 2, which is set in Pn381.
	ON	OFF		Operates the motor with internal set speed 3, which is set in Pn382.

6.9.4 Changing Internal Set Speeds with Input Signals

An operating example of speed control with the internal set speeds is given below. This example combines speed control with the internal set speeds with the soft start function. The shock that results from speed changes is reduced by using the soft start function.

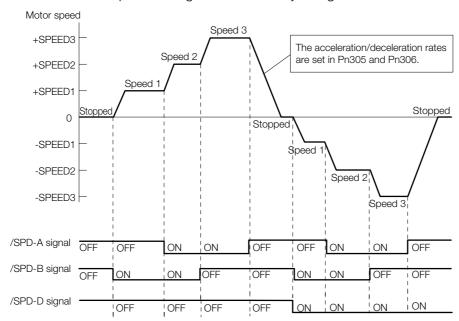

6.10 Selecting Combined Control Methods

You can specify switching the SERVOPACK between two control methods. To combine control methods, set $Pn000 = n.\square\square X\square$ (Control Method Selection) to between 4 and B. This section describes how to switch between the methods and the switching conditions.

Parameter		Combined	Cont	rol Methods	When Enabled	Classification
	n.□□4□	Internal set speed control	\Leftrightarrow	Speed control with external references		Setup
	n.□□5□	Internal set speed control	\Leftrightarrow	Position control		
Pn000	n.□□6□	Internal set speed control	\Leftrightarrow	Torque control		
	n.□□7□	Position control	\Leftrightarrow	Speed control with external references	After restart	
FIIUUU	n.□□8□	Position control	\Leftrightarrow	Torque control	Aller restart	
	n.□□9□	Torque control	\Leftrightarrow	Speed control with external references		
	п.□□А□	Speed control with external references	\Leftrightarrow	Speed control with zero clamping		
	n.□□B□	Normal position control	\Leftrightarrow	Position control with reference pulse inhibition		

6.10.1 Setting Pn000 = n.□□X□ (Control Method Selection) to 4, 5, or 6

The conditions for switching between internal set speed control and another control method are given below.

When Using the Default Input Signal Allocations (Pn50A = $n.\Box\Box\Box$ 0)

You can use the /SPD-A and /SPD-B (Internal Set Speed Selection) signals to change the control method and select the internal set speed.

You can switch between speed control, position control, or torque control and internal set speed control even while the Servomotor is operating.

· Rotary Servomotors


Input Pins		Motor	Operation for Setting of Pn000 = n.□□X□					
/SPD-D (CN1-41)	/SPD-A (CN1-45)	/SPD-B (CN1-46)	Direction	n.□□4□	n.□□5□	n.□□6□		
	OFF	OFF		Speed control	Position control	Torque control		
	OFF	ON		Operates the motor with internal set speed 1, which is set in Pn301.				
OFF	ON	ON	Forward	Operates the motor with internal set speed 2, which is set in Pn302.				
	ON	OFF		Operates the motor with internal set speed 3, which is set in Pn303.				
	OFF	OFF		Speed control	Position control	Torque control		
	OFF	ON		Operates the moto in Pn301.	r with internal set sp	eed 1, which is set		
ON	ON	ON	Reverse	Operates the motor with internal set speed 2, which is set in Pn302.				
	ON	OFF		Operates the motor with internal set speed 3, which is set in Pn303.				

6.10.1 Setting Pn000 = $n.\Box\Box X\Box$ (Control Method Selection) to 4, 5, or 6

Linear Servomotors

	Input Pins		Motor	Operation for	or Setting of Pn000	= n.□□X□	
/SPD-D (CN1-41)	/SPD-A (CN1-45)	/SPD-B (CN1-46)	Direction	n.□□4□	n.□□5□	n.□□6□	
	OFF	OFF		Speed control	Position control	Force control	
	OFF	ON		Operates the motor with internal set speed 1, which is set in Pn380.			
OFF	ON	ON	Forward	Operates the motor with internal set speed 2, which is set in Pn381.			
	ON	OFF		Operates the moto in Pn382.	r with internal set sp	eed 3, which is set	
	OFF	OFF		Speed control	Position control	Force control	
	OFF	ON		Operates the moto in Pn380.	r with internal set sp	eed 1, which is set	
ON	ON	ON	Reverse	Operates the moto in Pn381.	r with internal set sp	eed 2, which is set	
	ON	OFF		Operates the moto in Pn382.	r with internal set sp	eed 3, which is set	

An example of operation for $Pn000 = n. \square \square 5 \square$ (Switching between internal set speed control and position control) is given below. This example combines speed control with the internal set speeds with the soft start function. The shock that results from speed changes is reduced by using the soft start function.

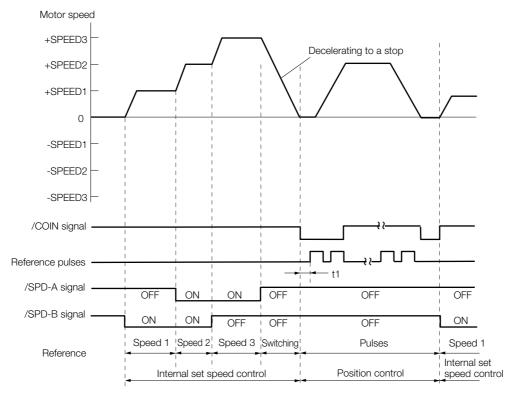

Note: 1. Set t1 so that it is greater than 2 ms. The value of t1 is not affected by whether the soft start function is used.

- 2. A maximum delay of 2 ms occurs in reading the /SPD-A and /SPD-B signals.
- 3. The speed is decelerated with the deceleration time set in Pn306 (Soft Start Deceleration Time), and internal set speed control is changed to position control after the Servomotor comes to a stop. The pulse train reference is received after the switch to position control. Always wait until after position control is started before you input the pulse train reference from the host computer. After position control is started, the /COIN (Positioning Completion) signal is output. Use the /COIN signal to confirm that the control method has changed.

6.10.1 Setting Pn000 = $n.\Box\Box X\Box$ (Control Method Selection) to 4, 5, or 6

When Changing Input Signal Allocations (Pn50A = $n.\Box\Box\Box$ 1)

The following four signals are assigned to CN1-40 to CN1-46 on the I/O signal connector: /C-SEL (Control Selection), /SPD-A and /SPD-B (Internal Set Speed Selection) signals, and /SPD-D (Motor Direction) signal.

The control method is switched by turning the /C-SEL signal ON and OFF.

Type Signal	Signal	Connector Pin No.	Setting	Control Method for Setting of Pn000 = n.□□X□			
	Connector i ii ivo.	Setting	n.□□4□	n.□□5□	n.□□6□		
Input /C-SEL	Must be allocated.	ON (closed)	Speed control	Position control	Torque control		
	_ Iviust be allocated.	OFF (open)	Internal set speed control	Internal set speed control	Internal set speed control		

Note: You must allocate the /C-SEL signal to use it. Use Pn50C = n.X DD (/C-SEL (Control Selection Input) Signal Allocation) to allocate the signal to a connector pin. Refer to the following section for details.

6.1.1 Input Signal Allocations on page 6-5

The operating method for internal set speed control (i.e., the /C-SEL signal is OFF) is given below.

Rotary Servomotors

Input Signals		Motor	Motor Speed	
/SPD-D	/SPD-A	/SPD-B	Direction	Motor Speed
	OFF	OFF		Stops the motor with an internal speed of 0.
OFF ON ON Forward Which is set in Pn301. OPF ON ON ON Forward Operates the motor with interwhich is set in Pn302.	OFF	ON		Operates the motor with internal set speed 1, which is set in Pn301.
	Operates the motor with internal set speed			
	ON	OFF		Operates the motor with internal set speed 3, which is set in Pn303.
	OFF	OFF		Stops the motor with an internal speed of 0.
	OFF	ON		Operates the motor with internal set speed 1, which is set in Pn301.
ON	ON	ON	Reverse	Operates the motor with internal set speed 2, which is set in Pn302.
	ON	OFF		Operates the motor with internal set speed 3, which is set in Pn303.

Linear Servomotors

Input Signals		Motor	Motor Speed	
/SPD-D	/SPD-A	/SPD-B	Direction	Motor Speed
	OFF	OFF		Stops the motor with an internal speed of 0.
OFF	OFF	ON		Operates the motor with internal set speed 1, which is set in Pn380.
	ON	ON	Forward	Operates the motor with internal set speed 2, which is set in Pn381.
	ON	OFF		Operates the motor with internal set speed 3, which is set in Pn382.
	OFF	OFF		Stops the motor with an internal speed of 0.
	OFF	ON		Operates the motor with internal set speed 1, which is set in Pn380.
ON	ON	ON	Reverse	Operates the motor with internal set speed 2, which is set in Pn381.
	ON	OFF		Operates the motor with internal set speed 3, which is set in Pn382.

Note: You must allocate the /SPD-D, /SPD-A, and /SPD-B signals to use them. You can use the following parameters to allocate the signal to a terminal.

• Pn50C = n.□□□X (/SPD-D (Motor Direction) Signal Allocation)

Pn50C = n.□□□□□□□□□ (/SPD-A (Internal Set Speed Selection Input) Signal Allocation)
 Pn50C = n.□□□□□ (/SPD-B (Internal Set Speed Selection Input) Signal Allocation)

Refer to the following section for details.

6.1.1 Input Signal Allocations on page 6-5

6.10.2 Setting Pn000 = $n.\Box\Box X\Box$ (Control Method Selection) to 7, 8, or 9

6.10.2 Setting Pn000 = $n.\Box\Box X\Box$ (Control Method Selection) to 7, 8, or 9

You can set $Pn000 = n.\square\square X\square$ (Control Method Selection) to switch between the following control methods.

- Switching between position control and speed control
- Switching between position control and torque control
- Switching between torque control and speed control

When Using the Default Input Signal Allocations (Pn50A = $n.\Box\Box\Box$ 0)

Type Signal	Connector	Signal Status	Control Method for Setting of Pn000 = n.□□X□		
	Pin No.	Signal Status	n.□□7□	n.□□8□	n.□□9□
Input /C-SEL	SEL CNII 41	ON (closed)	Speed control	Torque control	Speed control
	it /C-SEL CN1-41		OFF (open)	Position control	Position control

When Changing Input Signal Allocations (Pn50A = $n.\Box\Box\Box$ 1)

Type Signal	Signal	Connector	Signal Status	Control Method for Setting of Pn000 = n.□□X□		
	Pin No.	Signal Status	n.□□7□	n.□□8□	n.□□9□	
Input /C-SEL	Must be	ON (closed)	Speed control	Torque control	Speed control	
	70-3LL	allocated.	OFF (open)	Position control	Position control	Torque control

Note: You must allocate the /C-SEL signal to use it. Use Pn50C = n.X (Control Selection Input) Signal Allocation) to allocate the signal to a connector pin.

6.10.3 Setting Pn000 = n.□□X□ (Control Method Selection) to A or B

You can set $Pn000 = n.\square\square X\square$ (Control Method Selection) to switch between the following control methods.

- Switching between speed control with analog references and speed control with zero clamping
- Switching between normal position control and position control with reference pulse inhibition

When Using the Default Input Signal Allocations (Pn50A = $n.\Box\Box\Box0$)

Type Signal	Signal	Connector	Signal Status	Control Method for Setting of Pn000 = n.□□X□		
	Signai	Pin No.	Signal Status	n.□□A□	n.□□B□	
/ZCLAMF	/ZCLAMP		ON (closed)	Speed control with zero clamping	_	
lnnut		CN1-41	OFF (open)	Speed control	_	
Input –	/INHIBIT	GINT-41	ON (closed)	-	Position control with reference pulse inhibition	
			OFF (open)	-	Position control	

^{6.1.1} Input Signal Allocations on page 6-5

6.10.3 Setting Pn000 = n.□□X□ (Control Method Selection) to A or B

When Changing Input Signal Allocations (Pn50A = n.□□□1)

Type	Signal	Connector	Signal Status	Control Method for Setting of Pn000 = n.□□X□		
Type	Signal	Pin No.	Signal Status	n.□□A□	n.□□B□	
/ZCLAM	/ZCLAMP		ON (closed)	Speed control with zero clamping	_	
Input	Must be		OFF (open)	Speed control	_	
Input //I	/INHIBIT	allocated.	ON (closed)	-	Position control with reference pulse inhibition	
			OFF (open)	-	Position control	

Note: You must allocate the /ZCLAMP and /INHIBIT signals to use them. You can use the following parameters to

- allocate the signal to a terminal.

 Pn50D = n.□□□X (/ZCLAMP (Zero Clamping Input) Signal Allocation)

 Pn50D = n.□□X□ (/INHIBIT (Reference Pulse Inhibit Input) Signal Allocation)

Refer to the following section for details.

6.1.1 Input Signal Allocations on page 6-5

6.11 Selecting Torque Limits

You can limit the torque that is output by the Servomotor.

There are four different ways to limit the torque. These are described in the following table.

Limit Method	Outline	Control Method	Reference
Internal Torque Limits	The torque is always limited with the setting of a parameter.	Speed control, position control, or	6.11.1
External Torque Limits	The torque is limited with an input signal from the host computer.	torque control	6.11.2
Limiting Torque with an Analog Reference	An analog reference is used to set the required torque limits.	Speed control or position control	6.11.3
Limiting Torque with an External Torque Limit and an Analog Reference	The torque is limited by combining torque limits for an external input signal and torque limits for an analog reference.	Speed control or position control	6.11.4

Note: If you set a value that exceeds the maximum torque of the Servomotor, the torque will be limited to the maximum torque of the Servomotor.

6.11.1 Internal Torque Limits


If you use internal torque limits, the maximum output torque will always be limited to the specified forward torque limit (Pn402) and reverse torque limit (Pn403).

· Rotary Servomotors

	Forward Torque Lim	it		Speed Positio	n Torque
Pn402	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	800	Immediately	Setup
	Reverse Torque Lim	it		Speed Positio	n Torque
Pn403	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	800	Immediately	Setup

^{*} Set a percentage of the rated motor torque.

Note: If the setting of Pn402 or Pn403 is too low, the torque may be insufficient for acceleration or deceleration of the Servomotor.

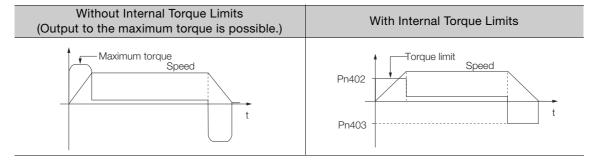


Linear Servomotors

	Forward Force Limit			Speed Position	n Force
Pn483	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	30	Immediately	Setup
	Reverse Force Limit			Speed Position	n Force
Pn484	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	30	Immediately	Setup

^{*} Set a percentage of the rated motor force.

Note: If the setting of Pn483 or Pn484 is too low, the force may be insufficient for acceleration or deceleration of the Servomotor.

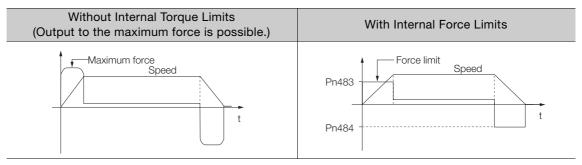

6.11.2 **External Torque Limits**

You can limit the torque only when required by the operating conditions of the machine by turning a signal ON and OFF.

You can use this for applications such as stopping on physical contact, or holding a workpiece with a robot.

External Torque Limit Reference Signals

The /P-CL (Forward External Torque Limit) and /N-CL (Reverse External Torque Limit) signals are used as the external torque limit reference signals. The /P-CL signal is used for the forward torque limit and the /N-CL signal is used for the reverse torque limit.

Type	Signal	Connector Pin No.	Signal Status	Meaning
Input /P-CL	/P-CL	CN1-45	ON (closed)	Applies the forward external torque limit. The torque is limited to the smaller of the settings of Pn402*1 and Pn404.
	·	(default setting)	OFF (open)	Cancels the forward external torque limit. The torque is limited to the setting of Pn402*1.
Input /N-Cl	/N-CL	CN1-46 (default setting)	ON (closed)	Applies the reverse external torque limit. The torque is limited to the smaller of the settings of Pn403*2 and Pn405.
		(derauit setting)	OFF (open)	Cancels the reverse external torque limit. The torque is limited to the setting of Pn403*2.

^{*1.} Pn483 is used for a Linear Servomotor.

Note: You can use the following parameters to allocate the /P-CL and /N-CL signals to other terminals.

Refer to the following section for details.

6.1.1 Input Signal Allocations on page 6-5

^{*2.} Pn484 is used for a Linear Servomotor.

Pn50B = n.□X□□ (/P-CL (Forward External Torque Limit Input) Signal Allocation)
 Pn50B = n.X□□□ (/N-CL (Reverse External Torque Limit Input) Signal Allocation)

6.11.2 External Torque Limits

Setting the Torque Limits

The parameters that are related to setting the torque limits are given below.

Rotary Servomotors

If the setting of Pn402 (Forward Torque Limit), Pn403 (Reverse Torque Limit), Pn404 (Forward External Torque Limit), or Pn405 (Reverse External Torque Limit) is too low, the torque may be insufficient for acceleration or deceleration of the Servomotor.

	Forward Torque Lim	it	Speed Position	Torque	
Pn402	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	800	Immediately	Setup
	Reverse Torque Lim	it		Speed Position	Torque
Pn403	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	800	Immediately	Setup
	Forward External To	rque Limit		Speed Position	on Torque
Pn404	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	100	Immediately	Setup
	Reverse External To	rque Limit		Speed Position	on Torque
Pn405	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	100	Immediately	Setup

^{*} Set a percentage of the rated motor torque.

· Linear Servomotors

If the setting of Pn483 (Forward Force Limit), Pn484 (Reverse Force Limit), Pn404 (Forward External Force Limit), or Pn405 (Reverse External Force Limit) is too low, the force may be insufficient for acceleration or deceleration of the Servomotor.

	Forward Force Limit	t	Speed Position	n Force	
Pn483	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	30	Immediately	Setup
	Reverse Force Limit	t		Speed Position	Force
Pn484	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	30	Immediately	Setup
	Forward External For	orce Limit	Speed Position	Force	
Pn404	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	100	Immediately	Setup
	Reverse External Fo	Reverse External Force Limit			Force
Pn405	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	100	Immediately	Setup


^{*} Set a percentage of the rated motor force.

Changes in the Output Torque for External Torque Limits

The following table shows the changes in the output torque when the internal torque limit is set to 800%.


· Rotary Servomotors

In this example, the Servomotor direction is set to $Pn000 = n.\square\square\square\square0$ (Use CCW as the forward direction).

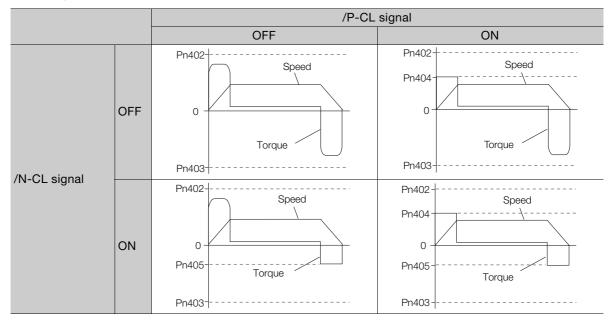

· Linear Servomotors

In this example, the Servomotor direction is set to $Pn000 = n.\Box\Box\Box\Box$ (Use the direction in which the linear encoder counts up as the forward direction).

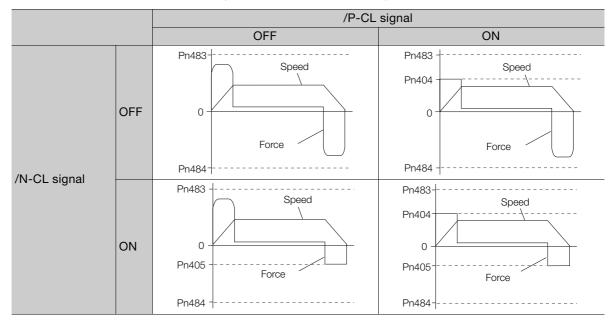

6.11.3 Limiting Torque with an Analog Reference


The analog voltage on the T-REF terminals (CN1-9 and CN1-10) is used to limit the torque with an analog reference.

The smallest of the analog reference torque reference and the torque limits for Pn402*1 and Pn403*2 is used.

- *1. Pn483 is used for a Linear Servomotor.
- *2. Pn484 is used for a Linear Servomotor.

The block diagrams for limiting the torque during speed control are provided below.


· Rotary Servomotors

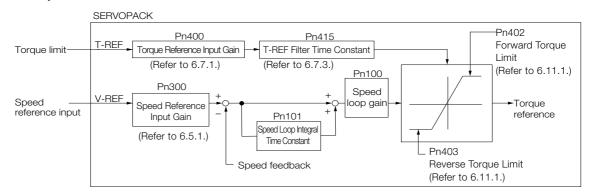

Information

There is no polarity for the input voltage of the analog voltage reference for the torque limit. The absolute value of a voltage is input, and a torque limit that corresponds to that absolute value is applied in the forward and reverse directions.

· Linear Servomotors

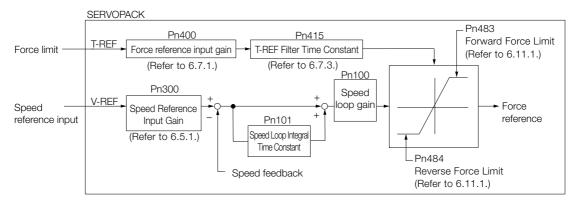

Information

There is no polarity for the input voltage of the analog voltage reference for the force limit. The absolute value of a voltage is input, and a force limit that corresponds to the absolute value of the input voltage is applied in the forward and reverse directions.

T-REF (Torque Reference Input) Signal

The input signal that is used for torque limits with an analog voltage reference is described below.

Туре	Signal	Connector Pin No.	Name	
Input	T-REF	CN1-9	Torque reference input	
	SG	CN1-10	Signal ground for torque reference input	

Setting the External Torque Limit

You must set Pn002 to n. □□□1 (Use T-REF as an external torque limit input) to use T-REF (CN1-9 and CN1-10) as the torque limit input.

Pai	ameter	Meaning	When Enabled	Classification
Pn002	n.0001	Use T-REF as an external torque limit input.	After restart	Setup

Settings Related to Limiting Torque with an Analog Voltage Reference

The parameters that are related to limiting torque with an analog voltage reference include parameters to set the input gain of the analog voltage reference, a reference filter time constant, and the internal torque limits.

Rotary Servomotors

	Torque Reference I	nput Gain	Speed Positio	n Torque	
Pn400	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
111100	10 to 100 0.1 V (ra		30 (rated torque at 3.0 V)	Immediately	Setup
	Forward Torque Lir	nit	Speed Positio	n Torque	
Pn402	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800 1%*		800	Immediately	Setup
	Reverse Torque Lir	nit		Speed Positio	n Torque
Pn403	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	800	Immediately	Setup
	T-REF Filter Time (Constant		Speed Positio	n Torque
Pn415	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	0.01 ms	0	Immediately	Setup

^{*} Set a percentage of the motor rated torque.

• Linear Servomotors

	Force Reference In	put Gain	Speed Positio	n Force	
Pn400	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
111400	10 to 100	0.1 V	30 (rated force at 3.0 V)	Immediately	Setup
	Forward Force Lim	it		Speed Positio	n Force
Pn483	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	30	Immediately	Setup
	Reverse Force Lim	it		Speed Positio	n Force
Pn484	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	30	Immediately	Setup
	T-REF Filter Time (Constant		Speed Positio	n Force
Pn415	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	0.01 ms	0	Immediately	Setup

^{*} Set a percentage of the rated motor force.

6.11.4 Limiting Torque with an External Torque Limit and an Analog Voltage Reference


6.11.4 Limiting Torque with an External Torque Limit and an Analog Voltage Reference

The torque is limited by combining torque limits for an external input signal and torque limits for an analog voltage reference.

When the /P-CL (Forward External Torque Limit) or /N-CL (Reverse External Torque Limit) signal is ON, the torque will be limited by the smaller of the torque limit for the analog voltage reference or the setting of Pn404 or Pn405.


The following block diagram shows limiting the torque with an external torque limit and an analog voltage reference.

· Rotary Servomotors

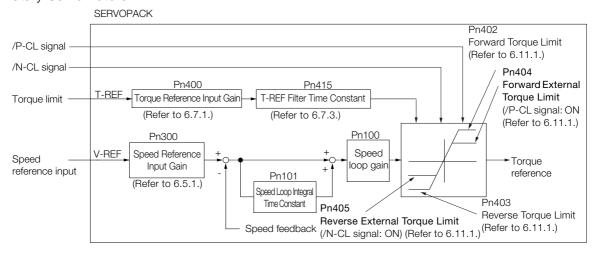

Note: You cannot use the torque limit of the analog voltage reference during torque control because the analog voltage is input with the T-REF (Torque Reference Input) signal.

Linear Servomotors

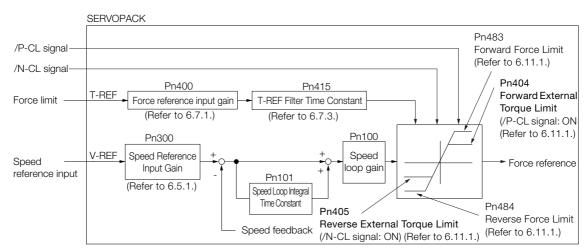

Note: You cannot use the force limit of the analog voltage reference during force control because the analog voltage is input with the T-REF (Torque Reference Input) signal.

6.11.4 Limiting Torque with an External Torque Limit and an Analog Voltage Reference

/P-CL (Forward External Torque Limit) Signal, /N-CL (Reverse External Torque Limit) Signal, and T-REF (Torque Reference Input) Signal

The input signals that are used for torque limits with an external torque limit and an analog voltage reference are described below.

◆ T-REF (Torque Reference Input) Signal

Type	Signal	Connector Pin No.	Name	
Input	T-REF	CN1-9	Torque reference input	
	SG	CN1-10	Signal ground for torque reference input	

◆ /P-CL (Forward External Torque Limit) Signal and /N-CL (Reverse External Torque Limit) Signal

Туре	Signal	Connector Pin No.	Signal Status	Meaning
Input /P-CL	/P-CL	CN1-45 (default setting)	ON (closed)	Applies the forward external torque limit. The torque is limited to the smallest of the analog reference or the setting of Pn402 or Pn404.
			OFF (open)	Cancels the forward external torque limit. The torque is limited to the setting of Pn402.
Input /N-C	/N-CL	CN1-46 (default setting)	ON (closed)	Applies the reverse external torque limit. The torque is limited to the smallest of the analog reference or the setting of Pn403 or Pn405.
			OFF (open)	Cancels the reverse external torque limit. The torque is limited to the setting of Pn403.

/P-CL (Forward External Force Limit) Signal and /N-CL (Reverse External Force Limit) Signal

Type	Signal	Connector Pin No.	Signal Status	Meaning
Input /P-CL	/P-CL	CN1-45 (default setting)	ON (closed)	Applies the forward external force limit. The force is limited to the smallest of the analog reference or the setting of Pn483 or Pn404.
			OFF (open)	Cancels the forward external force limit. The force is limited to the setting of Pn483.
Input /N-CL	/N-CL	CN1-46 (default setting)	ON (closed)	Applies the reverse external force limit. The force is limited to the smallest of the analog reference or the setting of Pn484 or Pn405.
			OFF (open)	Cancels the reverse external force limit. The force is limited to the setting of Pn484.

Setting the Torque Limit with the External Torque Limit and an Analog Voltage Reference

To limit the torque with an external input signal and an analog voltage reference, you must set Pn002 to n. \$\square\$D\$ (Use T-REF or /N_CL as the torque limit when /P_CL or /N_CL is active).

Parameter		Description	When Enabled	Classification
Pn002	n.□□□3	Use T-REF as the torque limit when /P_CL or /N_CL is active.	After restart	Setup

6.11.4 Limiting Torque with an External Torque Limit and an Analog Voltage Reference

Related Parameters

The parameters that are related to torque limits with an external torque limit and an analog voltage reference are described below.

With the internal torque limits, the torque is always limited. To disable to internal torque limits, you must set the related parameters (Pn402, Pn403, Pn483, and Pn484) to the maximum values.

Rotary Servomotors

	Torque Reference I	nput Gain	Speed Positio	Speed Position Torque	
Pn400	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
111100	10 to 100	0.1 V	30 (rated torque at 3.0 V)	Immediately	Setup
	Forward Torque Lir	nit		Speed Position	n Torque
Pn402	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	800	Immediately	Setup
	Reverse Torque Lir	nit	Speed Position	n Torque	
Pn403	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	800	Immediately	Setup
	Forward External T	orque Limit	Speed Position Torque		
Pn404	Setting Range	ge Setting Unit Default Setting		When Enabled	Classification
	0 to 800	1%*	100	Immediately	Setup
	Reverse External T	orque Limit	1	Speed Position	n Torque
Pn405	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	100	Immediately	Setup
	T-REF Filter Time (Constant		Speed Position	n Torque
Pn415	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	0.01 ms	0	Immediately	Setup

^{*} Set a percentage of the motor rated torque.

[•] Linear Servomotors

	Force Reference In	put Gain		Speed Position Force	
Pn400	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	10 to 100	0.1 V	30 (rated force at 3.0 V)	Immediately	Setup
	Forward Force Lim	it		Speed Positio	n Force
Pn483	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	30	Immediately	Setup
	Reverse Force Lim	it		Speed Positio	n Force
Pn484	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	30	Immediately	Setup
	Forward External F	orce Limit		Speed Positio	n Force
Pn404	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	100	Immediately	Setup
	Reverse External F	orce Limit		Speed Positio	n Force
Pn405	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 800	1%*	100	Immediately	Setup
	T-REF Filter Time (Constant		Speed Positio	n Force
Pn415	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	0.01 ms	0	Immediately	Setup

 $[\]boldsymbol{\ast}$ Set a percentage of the rated motor force.

6.11.5 /CLT (Torque Limit Detection) Signal

This section describes the /CLT signal, which indicates the status of limiting the motor output torque.

Type	Signal	Connector Pin No.	Signal Status	Meaning
Output /CLT	Must be allegated	ON (closed)	The motor output torque is being limited.	
Output	/GLI	Must be allocated.	OFF (open)	The motor output torque is not being limited.

Note: You must allocate the /CLT signal to use it. Use Pn50F = n. \(\sigma\) \(\sigma\) (/CLT (Torque Limit Detection Output) Signal Allocation) to allocate the signal to a connector pin. Refer to the following section for details.

6.1.2 Output Signal Allocations on page 6-8

6.12

Absolute Encoders

The absolute encoder records the current position of the stop position even when the power supply is OFF.

With a system that uses an absolute encoder, the host controller can monitor the current position. Therefore, it is not necessary to perform an origin return operation when the power supply to the system is turned ON.

There are four types of encoders for Rotary Servomotors. The usage of the encoder is specified in $Pn002 = n.\Box X \Box \Box$.

SERVOPACKs with software version 0023 or higher support batteryless absolute encoders.

Refer to the following section for encoder models.

■ Encoder Resolution on page 5-48

· Parameter Settings When Using an Incremental Encoder

Parameter		Meaning	When Enabled	Classification
	n.□0□□ (default setting)	Use the encoder as an incremental encoder. A battery is not required.		
Pn002 n.□1□□		Use the encoder as an incremental encoder. A battery is not required.	After restart	Setup
	n.□2□□	Use the encoder as a single-turn absolute encoder. A battery is not required.		

· Parameter Settings When Using a Single-Turn Absolute Encoder

Parameter		Meaning	When Enabled	Classification
	n.□0□□ (default setting)	Use the encoder as a single-turn absolute encoder. A battery is not required.		
Pn002 n.□1□□		Use the encoder as an incremental encoder. A battery is not required.	After restart	Setup
	n.□2□□	Use the encoder as a single-turn absolute encoder. A battery is not required.		

· Parameter Settings When Using a Multiturn Absolute Encoder

F	Parameter	Meaning	When Enabled	Classification
	n.□0□□ (default setting)	Use the encoder as a multiturn absolute encoder. A battery is required.		
Pn002 n.□1□□		Use the encoder as an incremental encoder. A battery is not required.	After restart	Setup
	n.□2□□	Use the encoder as a single-turn absolute encoder. A battery is not required.		

· Parameter Settings When Using a Batteryless Multiturn Absolute Encoder

Parameter		Meaning	When Enabled	Classification
	n.□0□□ (default setting)	Use the encoder as a batteryless multiturn absolute encoder. A battery is not required.		
Pn002	n.□1□□	Use the encoder as an incremental encoder. A battery is not required.	After restart	Setup
n.□2□□		Use the encoder as a single-turn absolute encoder. A battery is not required.		


NOTICE

• Install a battery at either the host controller or on the Encoder Cable.

If you install batteries both at the host controller and on the Encoder Cable at the same time, you will create a loop circuit between the batteries, resulting in a risk of damage or burning.

6.12.1 Connecting an Absolute Encoder

The following diagram shows the typical connections between a Servomotor with an absolute encoder, the SERVOPACK, and the host controller.

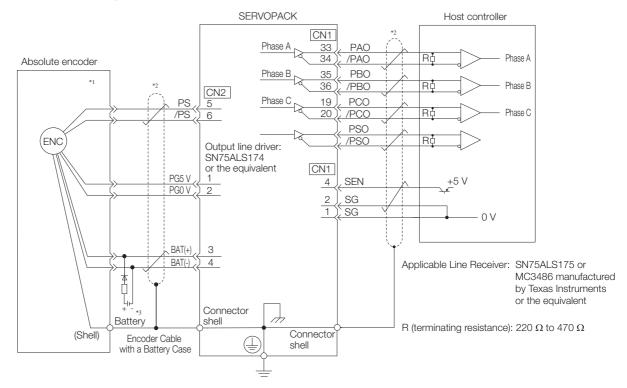

- *1. The absolute encoder pin numbers for wiring the connector depend on the Servomotor that you use.
- *2. represents a shielded twisted-pair cable.
- *3. If you use an Encoder Cable with a Battery Case, do not install a battery at the host controller.

Refer to the following section for details on other connections.

4.4.3 Wiring the SERVOPACK to the Encoder on page 4-26

6.12.2 Structure of the Position Data of the Absolute Encoder

The position data of the absolute encoder is the position coordinate from the origin of the absolute encoder.

The position data from the absolute encoder contains the following two items.

- The number of rotations from the origin of the encoder coordinate system (called the multiturn data)
- The position (number of pulses) within one rotation

The position data of the absolute encoder is as follows:

Position data of absolute encoder = Multiturn data × Number of pulses within one encoder rotation (setting of Pn212)+ Position (number of pulses) within one rotation.

For a single-turn absolute encoder, the multiturn data is 0.

6.12.3 Output Ports for the Position Data from the Absolute Encoder


6.12.3 Output Ports for the Position Data from the Absolute Encoder

You can read the position data of the absolute encoder from the PAO, PBO, and PCO (Encoder Divided Pulse Output) signals and the PSO (Absolute Encoder Position Output) signal.

The output method and timing for the position data of the absolute encoder are different in each case.

Encoder Divided Pulse Output Port

A conceptual diagram of the connections of the PAO, PBO, and PCO (Encoder Divided Pulse Output) signals to the host controller is provided below.

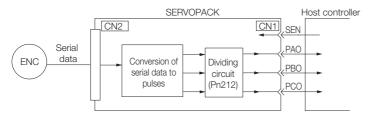

Signal	Status	Signal Contents	
Signal	Status	When Using an Absolute Encoder	
PAO	First signal	Multiturn data position within one rotation (pulse train)	
	During normal operation	Incremental pulses	
PBO	First signal	Position within one rotation (pulse train)	
1 00	During normal operation	Incremental pulses	
PCO	Always	Origin pulse	

The PAO (Encoder Divided Pulse Output) signal outputs the position data from the absolute encoder after the control power supply is turned ON. There are two methods that you can use to output the position data from the absolute encoder: Using the SEN (Absolute Data Request) signal and not using the SEN signal.

The position data of the absolute encoder is the current stop position. The absolute encoder outputs the multiturn data with the specified protocol. The absolute encoder outputs the position within one rotation as a pulse train. It then outputs pulses as an incremental encoder (incremental operation status).

The host controller must have a reception circuit (e.g., UART) for the position data from the absolute encoder. The pulse counter at the host controller will not count pulses when the multiturn data (communications message) is input because only phase A is input. Counting starts from the position of the absolute encoder within one rotation.

The output circuits for the PAO, PBO, and PCO signals use line drivers. Refer to the following section for details on line drivers.

4.5.4 I/O Circuits on page 4-45

PSO (Absolute Encoder Position Output) Port

The PSO (Absolute Encoder Position Output) signal periodically outputs the position data from the absolute encoder according to the specified protocol after outputting the position data from the absolute encoder with the PAO and PBO signals has been completed. There are two methods that you can use to output the position data from the absolute encoder: Using the SEN (Absolute Data Request) signal and not using the SEN signal.

The host controller must have a reception circuit (e.g., UART) for the position data from the absolute encoder.

The output circuit for the PSO signal uses a line driver. Refer to the following section for details on line drivers.

(a) 4.5.4 I/O Circuits on page 4-45

There are two methods that you can use to read the position data from the absolute encoder: Using the SEN (Absolute Data Request) signal and not using the SEN signal.

Setting the Parameter to Specify Using or Not Using the SEN (Absolute Data Request) Signal

- Using the SEN Signal to Read the Position Data from the Absolute Encoder
- When Using the Default I/O Signals (Pn50A = n.□□□0)
 The setting of Pn515 = n.□□□X (SEN (Absolute Data Request Input) Signal Allocation) is ignored.
- Allocating the SEN Signal to CN1-40 to CN1-46 on the I/O Signal Connector (Pn50A = n.□□□1) Set Pn515 = n.□□□X (SEN (Absolute Data Request Input) Signal Allocation) to 0 to 6 or 9 to F.

Refer to the following section for the procedure to allocate input signals.

6.1.1 Input Signal Allocations on page 6-5

Information

To use the default allocation of the SEN signal and to change the default settings of other I/O signals ($Pn50A = n.\Box\Box\Box1$), set Pn515 to $n.\Box\Box\Box8$ (Active when 5 V is input to CN1-4).

Reading the Position Data from the Absolute Encoder without Using the SEN Signal

Set Pn50A to n. DDD1 and set Pn515 to n. DDD7 (The signal is always active).

Refer to the following sections for details on the parameters.


14.1 List of Parameters on page 14-2

Connecting the SEN (Absolute Data Request) Signal

◆ Allocating the SEN Signal to CN1-4

Type	Signal	Connector Pin No.	Signal Status	Meaning
Input	SEN	CN1-4	OFF (open)	Does not request the position data from the absolute encoder. (This is the status after the power supply is turned ON.)
			ON (closed)	Requests the position data from the absolute encoder.

Circuit Example When the SEN Signal Is Allocated to CN1-4

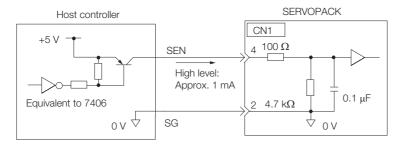

We recommend a PNP transistor.

◆ Allocating the SEN Signal to a General-Purpose Input

Туре	Signal	Connector Pin No.	Signal Status	Meaning
Input	SEN	CN1-40 to CN1-46	OFF (open)	Does not request the position data from the absolute encoder. (This is the status after the power supply is turned ON.)
			ON (closed)	Requests the position data from the absolute encoder.

Refer to the following section for a circuit example for when the SEN signal is allocated to CN1-40 to CN1-46 on the I/O signal connector.

Sequence Input Circuits on page 4-47

Refer to the following section for the procedure to allocate input signals.


6.1.1 Input Signal Allocations on page 6-5

Sequence for Reading the Position Data from the Absolute Encoder Using the SEN (Absolute Data Request) Signal

The sequence for using the SEN signal to read the position data from the absolute encoder of a Rotary Servomotor is given below.


The multiturn data is sent according to the transmission specifications.

The position of the absolute encoder within one rotation is output as a pulse train.

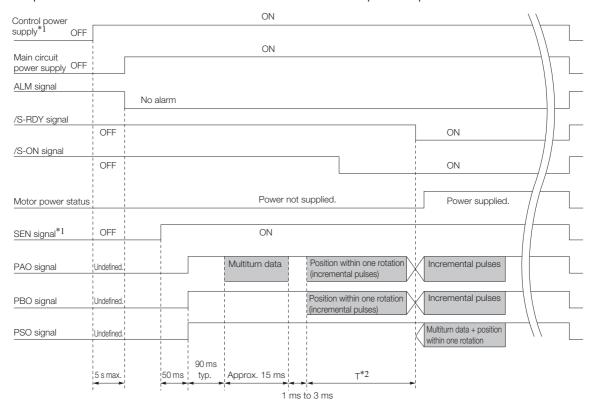

- *1. When you turn OFF the control power supply, turn OFF the SEN signal.
- The pulse output time T for the position of the absolute encoder within one rotation depends on the setting of Pn212 (Number of Encoder Output Pulses). Refer to the following table.

Setting of Pn212	Calculation of the Pulse Output Speed for the Position of the Absolute Encoder within One Rotation	Calculation of the Pulse Output Time T for the Position of the Absolute Encoder within One Rotation
16 to 16,384	680 × Pn212/16,384 [kpps]	25 ms max.
16,386 to 32,768	680 × Pn212/32,768 [kpps]	50 ms max.
32,722 to 65,536	680 × Pn212/65,536 [kpps]	100 ms max.
65,544 to 131,072	680 × Pn212/131,072 [kpps]	200 ms max.
131,088 to 262,144	680 × Pn212/262,144 [kpps]	400 ms max.
262,176 to 524,288	680 × Pn212/524,288 [kpps]	800 ms max.
524,352 to 1,048,576	680 × Pn212/1,048,576 [kpps]	1,600 ms max.

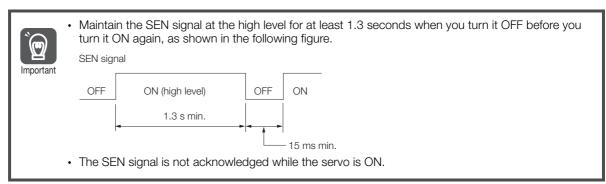


Sequence for Reading the Position Data from the Absolute Encoder without Using the SEN (Absolute Data Request) Signal

The sequence for reading the position data from the absolute encoder of a Rotary Servomotor without using the SEN signal is given below.

When the specified time has elapsed after the control power supply to the SERVOPACK is turned ON, the SERVOPACK will automatically read the position data from the absolute encoder.

The position data from the absolute encoder is sent according to the transmission specifications.

The position of the absolute encoder within one rotation is output as a pulse train.

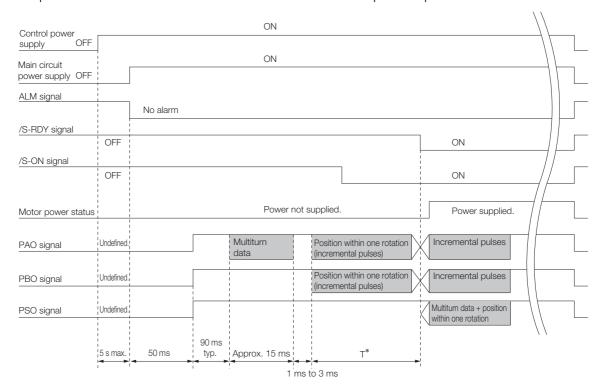

* The pulse output time T for the position of the absolute encoder within one rotation depends on the setting of Pn212 (Number of Encoder Output Pulses). Refer to the following table.

Setting of Pn212	Calculation of the Pulse Output Speed for the Position of the Absolute Encoder within One Rotation	Calculation of the Pulse Output Time T for the Position of the Absolute Encoder within One Rotation
16 to 16,384	680 × Pn212/16,384 [kpps]	25 ms max.
16,386 to 32,768	680 × Pn212/32,768 [kpps]	50 ms max.
32,722 to 65,536	680 × Pn212/65,536 [kpps]	100 ms max.
65,544 to 131,072	680 × Pn212/131,072 [kpps]	200 ms max.
131,088 to 262,144	680 × Pn212/262,144 [kpps]	400 ms max.
262,176 to 524,288	680 × Pn212/524,288 [kpps]	800 ms max.
524,352 to 1,048,576	680 × Pn212/1,048,576 [kpps]	1,600 ms max.

6.12.5 Transmission Specifications

The position data transmission specifications for the PAO (Encoder Divided Pulse Output) signal and the PSO (Absolute Encoder Position Output) signal are given in the following table.

The PAO signal sends only the multiturn data. The PSO signal sends the multiturn data plus the position of the absolute encoder within one rotation.


Refer to the following section for the timing of sending the position data from the absolute encoder.

- Sequence for Reading the Position Data from the Absolute Encoder Using the SEN (Absolute Data Request) Signal on page 6-79
- Sequence for Reading the Position Data from the Absolute Encoder without Using the SEN (Absolute Data Request) Signal on page 6-80

Item	PAO signal	PSO signal		
Synchronization Method	Start-stop synchronization (ASYNC)			
Transmission Speed	9,600 bps			
Start Bits	1 bit			
Stop Bits	1 bit			
Parity	Even			
Character Code	ASCII, 7 bits			
Data Format	Refer to Data Format of PAO Signal. Refer to Data Format of PSO Signal.			
Data Output Period	Using the SEN Signal Each time the SEN signal is input after the control power supply is turned ON	40 ms		
	Not Using the SEN Signal Only once after the control power supply is turned ON			


Data Format of PAO Signal

As shown below, the message format consists of eight characters: "P," the sign, the 5-digit multiturn data, and "CR" (which indicates the end of the message).

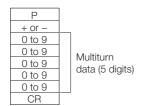

Data Format of PSO Signal

As shown below, the message format for a Rotary Servomotor consists of 17 characters: "P," the sign, the 5-digit multiturn data, a comma delineator, the 8-digit position within one rotation, and "CR" (which indicates the end of the message).

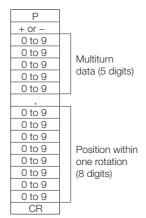

6.12.6 Calculating the Current Position in Machine Coordinates


6.12.6 Calculating the Current Position in Machine Coordinates

When you reset the absolute encoder, the reset position becomes the reference position.

The host controller reads the coordinate Ps from the origin of the encoder coordinate system. The host controller must record the value of coordinate Ps.

This section describes the reference position in the machine coordinate system.

The method to calculate the coordinate value of the present position from the origin of the machine coordinate system is given below.

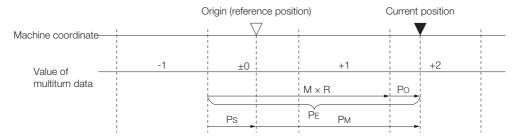

The current position P_{M} in the machine coordinate system is calculated as follows:

$$P_M = P_E - P_S$$

$$P_F = M \times R + P_O$$

$$P_S = M_S \times R + P_S$$

		Setting or Unit		
Symbol	Meaning	Encoder Divided Pulse Output (PAO and PBO) Signals	Absolute Encoder Position Output (PSO) Signal	
P_{E}	Position data for the current position of the absolute encoder	Encoder output pulses (encoder pulses x setting of Pn212)	Encoder pulses	
М	Current position of the multiturn data of the absolute encoder	_	_	
Po	Position of the current position within one rotation	Encoder output pulses		
P _S	Position data of the absolute encoder when absolute encoder was reset	(encoder pulses x setting of Pn212)	Encoder pulses	
M _S	Multiturn data of the absolute encoder when absolute encoder was reset	-	_	
P _S '	Position of the absolute encoder within one rotation when absolute encoder was reset	Encoder output pulses (encoder pulses x setting	Encoder pulses	
P_{M}	Current position in machine coordinate system	of Pn212)		
R	Number of encoder pulses per revolution	Setting of Pn212	Encoder resolution	
Calculations for Reverse Rotation Mode (Pn000 = n.□□□1)		PM = PE - PS PE = -M × R + PO PS = MS × R + PS	PM = PE - PS PE = -M × R - PO PS = MS × R - PS'	


Information

If you are using a Rotary Servomotor, you must reset the absolute encoder. Refer to the following section for information on resetting the absolute encoder.

5.17 Resetting the Absolute Encoder on page 5-52

6.12.7 Alarm Output from Output Ports for the Position Data from the Absolute Encoder

Any alarm detected by the SERVOPACK is transmitted as alarm information to the host controller with the PAO (Encoder Divided Pulse Output) signal when the SEN (Absolute Data Request) signal turns OFF.

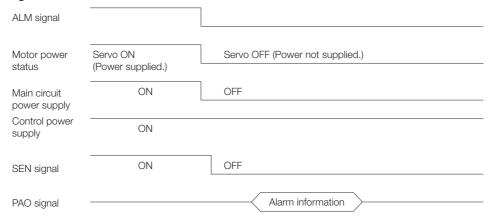


The data format of the alarm information is shown below.

A L M 0 to 9 0 to 9	Upper two digits of alarm code
---------------------------------	--------------------------------

6.12.8 Multiturn Limit Setting

The multiturn limit is used in position control for a turntable or other rotating body. For example, consider a machine that moves the turntable shown in the following diagram in only one direction.

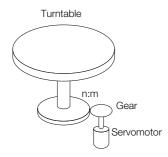

Because the turntable moves in only one direction, the upper limit to the number of rotations that can be counted by an absolute encoder will eventually be exceeded.


The multiturn limit is used in cases like this to prevent fractions from being produced by the integer ratio of the number of Servomotor rotations and the number of turntable rotations.

For a machine with a ratio of n:m between the number of Servomotor rotations and the number of turntable rotations, as shown above, the value of m minus 1 will be the setting for the multiturn limit setting (Pn205).

Multiturn limit (Pn205) = m - 1

If m = 100 and n = 3 (i.e., the turntable rotates three times for each 100 Servomotor rotations), the relationship between the number of Servomotor rotations and the number of turntable rotations would be as shown below.

6.12.8 Multiturn Limit Setting

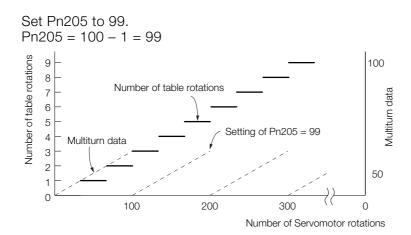

	Multiturn Limit			Speed Position Torque	
Pn205	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	1 Rev	65,535	After restart	Setup

Note: This parameter is enabled when you use an absolute encoder.


The data will change as shown below when this parameter is set to anything other than the default setting.

- If the Servomotor operates in the reverse direction when the multiturn data is 0, the multiturn data will change to the value set in Pn205.
- If the motor operates in the forward direction when the multiturn data is at the value set in Pn205, the multiturn data will change to 0.

Set Pn205 to one less than the desired multiturn data.

If you change the multiturn limit in Pn205, an A.CCO alarm (Multiturn Limit Disagreement) will be displayed because the setting disagrees with the value in the encoder. Refer to the following section for the procedure to change the multiturn limit settings in the encoder.

6.12.9 Multiturn Limit Disagreement Alarm (A.CC0) on page 6-85

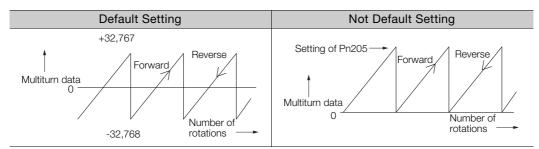

Information

The multiturn data will always be 0 in the following cases. It is not necessary to reset the absolute encoder in these cases.

- · When you use a single-turn absolute encoder
- When the encoder is set to be used as a single-turn absolute encoder (Pn002 = n.□2□□) Absolute encoder-related alarms (A.810 and A.820) will not occur.

6.12.9 Multiturn Limit Disagreement Alarm (A.CC0)

If you change the multiturn limit in Pn205 (Multiturn Limit), an A.CCO alarm (Multiturn Limit Disagreement) will be displayed because the setting disagrees with the value in the encoder.

Display	Name	Alarm Code Output		tput	Meaning
Δ (:(:()	Multiturn Limit Disagreement	ALO1	ALO2	ALO3	Different multiturn limits are set in the
		ON (low)	OFF (high)	ON (low)	encoder and SERVOPACK.

If this alarm is displayed, use the following procedure to change the multiturn limit in the encoder to the same value as the setting of Pn205.

Applicable Tools

The following table lists the tools that you can use to set the multiturn limit.

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	Fn013	13.4.18 Multiturn Limit Setting after Multiturn Limit Disagreement Alarm (Fn013) on page 13-26
Digital Operator	Fn013	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Encoder Setting – Multi-turn Limit Setting	Operating Procedure on page 6-85

Operating Procedure

Use the following procedure to adjust the multiturn limit setting.

- 1. Click the 🔎 Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Multi-turn Limit Setting in the Menu Dialog Box. The Multiturn Limit Setting Dialog Box will be displayed.
- 3. Click the Continue Button.



Click the **Cancel** Button to cancel setting the multiturn limit.


The Main Window will return.

6.12.9 Multiturn Limit Disagreement Alarm (A.CC0)

4. Change the setting.




- 5. Click the Writing into the Servopack Button.
- 6. Click the OK Button.

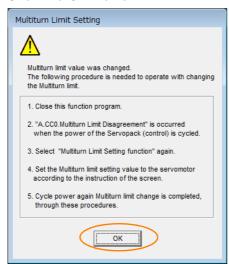


- 7. Turn the power supply to the SERVOPACK OFF and ON again.

 An A.CC0 alarm (Multiturn Limit Disagreement) will occur because setting the multiturn limit in the Servomotor is not yet completed even though the setting has been changed in the SERVOPACK.
- 8. Display the Multi-turn Limit Setting in the Menu Dialog Box.
- 9. Click the Continue Button.

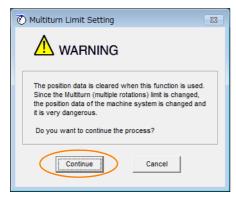

6.12.9 Multiturn Limit Disagreement Alarm (A.CC0)

10. Click the Writing into the servomotor Button.

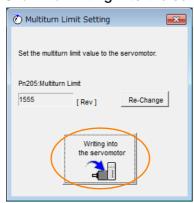

Click the **Re-change** Button to change the setting.

11. Click the OK Button.



This concludes the procedure to set the multiturn limit.

6.13.1 Connecting an Absolute Linear Encoder

6.13 Absolute Linear Encoders

The absolute linear encoder records the current position of the stop position even when the power supply is OFF.

With a system that uses an absolute linear encoder, the host controller can monitor the current position. Therefore, it is not necessary to perform an origin return operation when the power supply to the system is turned ON.

There are three types of linear encoders for Linear Servomotors. The usage of the linear encoder is specified in $Pn002 = n. \square X \square \square$.

Refer to the following section for linear encoder models.

Feedback Resolution of Linear Encoder on page 5-49

· Parameter Settings When Using an Incremental Linear Encoder

Parameter		Meaning	When Enabled	Classification
n.□0□□ Pn002 (default setting)		Use the encoder as an incremental linear encoder.	After restart	Setup
	n.🗆1🗆 🗆	Use the encoder as an incremental linear encoder.		-

Parameter Settings When Using an Absolute Linear Encoder

Parameter		Meaning	When Enabled	Classification
Pn002	n.□0□□ Use the encoder as an absolute linear end (default setting)		After restart	Setup
	n.🗆1 🗆 🗆	Use the encoder as an incremental linear encoder.		

6.13.1 Connecting an Absolute Linear Encoder

Refer to the following sections for information on the connections between an absolute linear encoder, the SERVOPACK, and the host controller.


 $\[\[\] \]$ 4.4.3 Wiring the SERVOPACK to the Encoder on page 4-26

4.5.3 I/O Signal Wiring Examples on page 4-39

6.13.2 Structure of the Position Data of the Absolute Linear Encoder

The position data of the absolute linear encoder is the distance (number of pulses) from the origin of the absolute linear encoder.

The position data is signed 36-bit data.

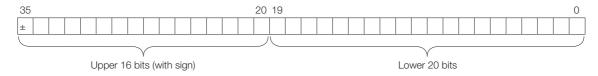

When the SERVOPACK sends the position data, it sends the upper 16-bit data (with sign) separately from the lower 20-bit data.


6.13.3 Output Ports for the Position Data from the Absolute Linear Encoder

You can read the position data of the absolute linear encoder from the PAO, PBO, and PCO (Encoder Divided Pulse Output) signals and the PSO (Absolute Encoder Position Output) signal.

The output method and timing for the position data of the absolute linear encoder are different in each case

Encoder Divided Pulse Output (PAO, PBO, and PCO) Ports

A conceptual diagram of the connections of the PAO, PBO, and PCO (Encoder Divided Pulse Output) ports to the host controller is provided below.

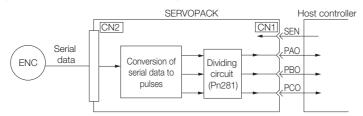

Signal	Status	Signal Contents	
Signal	Status	When Using an Absolute Linear Encoder	
	First signal	Upper 16-bit data (with sign)	
PAO	Tilot signal	Lower 20-bit data (pulse train)	
	During normal operation	Incremental pulses	
PBO	First signal	Lower 20-bit data (pulse train)	
1 00	During normal operation	Incremental pulses	
PCO	Always	Origin pulse	

The PAO (Encoder Divided Pulse Output) signal outputs the position data from the absolute linear encoder after the control power supply is turned ON. The SENS_ON (Turn ON Encoder) command is used to output the position data from the absolute linear encoder.

The position data of the absolute linear encoder is the current stop position. The absolute linear encoder outputs the upper 16-bit data (with sign) according to the specified protocol. The absolute encoder outputs the lower 20-bit data as a pulse train. It then outputs pulses as an incremental linear encoder (incremental operation status).

The host controller must have a reception circuit (e.g., UART) for the position data from the absolute linear encoder. The pulse counter at the host controller will not count pulses when the upper 16-bit data (with sign) (communications message) is input because only phase A is input.

The output circuits for the PAO, PBO, and PCO signals use line drivers. Refer to the following section for details on line drivers.

(a) 4.5.4 I/O Circuits on page 4-45

PSO (Absolute Encoder Position Output) Port

The PSO (Absolute Encoder Position Output) signal periodically outputs the position data from the absolute encoder according to the specified protocol after outputting the position data from the absolute encoder with the PAO and PBO signals has been completed. There are two methods that you can use to output the position data from the absolute encoder: Using the SEN (Absolute Data Request) signal and not using the SEN signal.

The host controller must have a reception circuit (e.g., UART) for the position data from the absolute encoder.

The output circuit for the PSO signal uses a line driver. Refer to the following section for details on line drivers.

4.5.4 I/O Circuits on page 4-45

6.13.4 Reading the Position Data from the Absolute Linear Encoder

6.13.4 Reading the Position Data from the Absolute Linear Encoder

There are two methods that you can use to read the position data from the absolute linear encoder: Using the SEN (Absolute Data Request) signal and not using the SEN signal.

Setting the Parameter to Specify Using or Not Using the SEN (Absolute Data Request) Signal

- Using the SEN Signal to Read the Position Data from the Absolute Linear Encoder
- When Using the Default I/O Signals (Pn50A = n.□□□0)
 Set Pn515 = n.□□□X (SEN (Absolute Data Request Input) Signal Allocation) to 0 to 6 or 9 to F.
- Allocating the SEN Signal to CN1-40 to CN1-46 on the I/O Signal Connector (Pn50A = n.□□□1) Set Pn515 = n.□□□X (SEN (Absolute Data Request Input) Signal Allocation) to 0 to 6 or 9 to F.

Refer to the following section for the procedure to allocate input signals.

6.1.1 Input Signal Allocations on page 6-5

Information

To use the default allocation of the SEN signal and to change the default settings of other I/O signals ($Pn50A = n.\Box\Box\Box1$), set Pn515 to $n.\Box\Box\Box8$ (Active when 5 V is input to CN1-4).

Reading the Position Data from the Absolute Linear Encoder without Using the SEN Signal

Set Pn50A to n. DDD1 and set Pn515 to n. DDD7 (The signal is always active).

Refer to the following sections for details on the parameters.


[3] 14.1 List of Parameters on page 14-2

Connecting the SEN (Absolute Data Request) Signal

Allocating the SEN Signal to CN1-4

Type	Signal	Connector Pin No.	Signal Status	Meaning
Input S	SEN	CN1-4	OFF (open)	Does not request the position data from the absolute linear encoder. (This is the status after the power supply is turned ON.)
			ON (closed)	Requests the position data from the absolute linear encoder.

Circuit Example When the SEN Signal Is Allocated to CN1-4

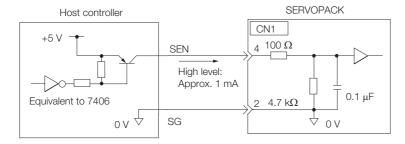

We recommend a PNP transistor.

◆ Allocating the SEN Signal to a General-Purpose Input

Type	Signal	Connector Pin No.	Signal Status	Meaning
Input SEN	SEN	CN1-40 to CN1-46	OFF (open)	Does not request the position data from the absolute linear encoder. (This is the status after the power supply is turned ON.)
			ON (closed)	Requests the position data from the absolute linear encoder.

Refer to the following section for a circuit example for when the SEN signal is allocated to CN1-40 to CN1-46 on the I/O signal connector.

Sequence Input Circuits on page 4-47

Refer to the following section for the procedure to allocate input signals.

6.1.1 Input Signal Allocations on page 6-5


6.13.4 Reading the Position Data from the Absolute Linear Encoder

Sequence for Reading the Position Data from the Absolute Linear Encoder Using the SEN (Absolute Data Request) Signal


The sequence for using the SEN signal to read the position data from the absolute linear encoder of a Linear Servomotor is given below.

The upper 16-bit position data (with sign) are sent according to the transmission specifications.

The lower 20-bit data is output as a pulse train.

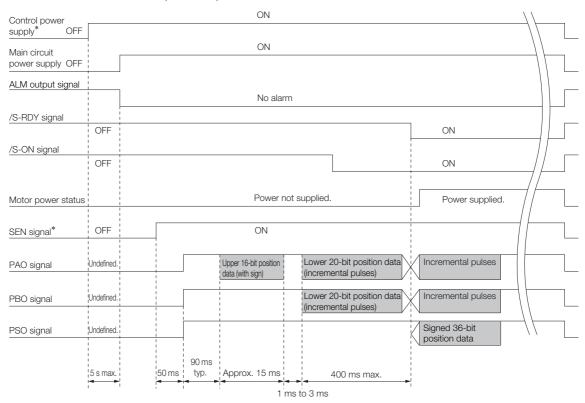

* When you turn OFF the control power supply, turn OFF the SEN signal.

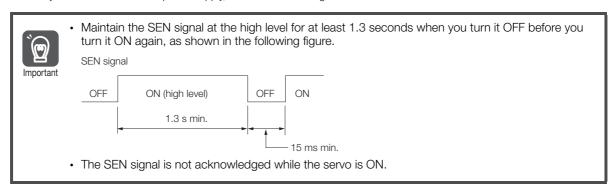


Sequence for Reading the Position Data from the Absolute Encoder without Using the SEN (Absolute Data Request) Signal

The sequence for reading the position data from the absolute linear encoder of a Linear Servomotor without using the SEN signal is given below.

When the specified time has elapsed after the control power supply to the SERVOPACK is turned ON, the SERVOPACK will automatically read the position data from the absolute linear encoder.

The upper 16-bit position data (with sign) are sent according to the transmission specifications.

The lower 20-bit data is output as a pulse train.

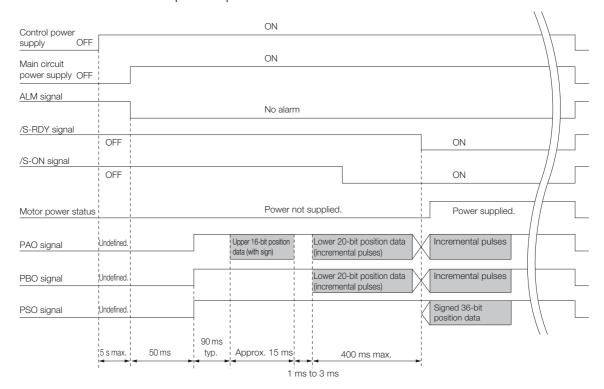

6.13.5 Transmission Specifications

The position data transmission specifications for the PAO (Encoder Divided Pulse Output) signal and the PSO (Absolute Encoder Position Output) signal are given in the following table.

The PAO signal sends only the 16-bit data (with sign). The PSO signal sends the signed 36-bit data.


Refer to the following section for the timing of sending the position data from the absolute encoder.

- Sequence for Reading the Position Data from the Absolute Linear Encoder Using the SEN (Absolute Data Request) Signal on page 6-92
- Sequence for Reading the Position Data from the Absolute Encoder without Using the SEN (Absolute Data Request) Signal on page 6-93

Item PAO signal		PSO signal	
Synchronization Method	Start-stop synchronization (ASYNC)		
Transmission Speed	9,600 bps		
Start Bits	1 bit		
Stop Bits	1 bit		
Parity	Even		
Character Code	ASCII, 7 bits		
Data Format	Refer to Data Format of PAO Signal on page 6-94.	Refer to Data Format of PSO Signal on page 6-94.	
Data Output Period	Using the SEN Signal Each time the SEN signal is input after the control power supply is turned ON Not Using the SEN Signal Only once after the control power supply is turned ON	40 ms	


Data Format of PAO Signal

As shown below, the message format consists of eight characters: "P," the sign, the 5-digit upper 15-bit position data, and "CR" (which indicates the end of the message).

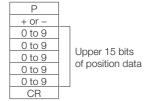

Data Format of PSO Signal

The data format for a Linear Servomotor consists of 17 characters: "P," the sign, the 11-digit 35-bit data, and "CR" (which indicates the end of the message).

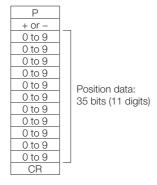

6.13.6 Calculating the Current Position in Machine Coordinates

With an absolute linear encoder, you must set the position of the origin (i.e., the origin of the machine coordinate system).


The host controller reads the coordinate from the origin of the encoder coordinate system. The host controller must record the value of this coordinate.

The method to calculate the coordinate value of the present position from the origin of the machine coordinate system is given below.

The position data from the absolute linear encoder is signed 36-bit data, but the upper 16 bits (with sign) and the lower 20 bits are output separately.

For the upper 16-bit data (with sign), the upper bits (16 bits, including the sign) of the current position after dividing by the setting of Pn281 are output with serial communications according to the transmission specifications.

For the lower 20-bit data, the lower bits (20 bits) of the current position after dividing by the setting of Pn281 are output as a pulse train.

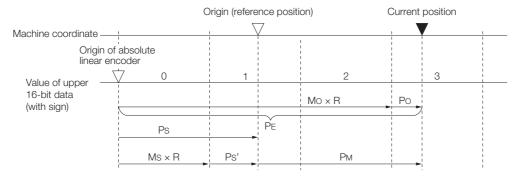

The current position P_{M} in the machine coordinate system is calculated as follows:

$$P_M = P_E - P_S$$

 $P_E = M_O \times R + P_O$

$$P_S = M_S \times R + P_S$$

		Setting or Unit		
Symbol	Meaning	Encoder Divided Pulse Output (PAO and PBO) Signals	Absolute Encoder Position Output (PSO) Signal	
PE	Position data for the current position of the absolute linear encoder	Encoder Output Resolution (Pn281)	Encoder pulses	
M _O	Upper 16 bits (with sign) of the position data for the current position of the absolute linear encoder	_	_	
P _O	Lower 20 bits of the position data for the current position of the absolute linear encoder	Encoder Output Resolu- tion (Pn281)	Encoder pulses	
P _S	Position data of the origin	11011 (1 11201)		
M _S	Upper 16 bits (with sign) of the position data of the origin	-	_	
P _S '	Lower 20 bits of the position data of the origin			
P _M	Current position in machine coordinate system	Encoder Output Resolu- tion (Pn281)	Encoder pulses	
R 1048576 (=220)		1		


Note: The above formulas also apply in reverse movement mode ($Pn000 = n.\square\square\square1$).

Information If you are using a Linear Servomotor, you do not need to reset the absolute linear encoder to define the origin. (Some absolute linear encoders also allow you to set any position as the origin.)

6.13.7 Alarm Output from the Output Ports for the Position Data from the Absolute Linear Encoder

6.13.7 Alarm Output from the Output Ports for the Position Data from the Absolute Linear Encoder

Any alarm detected by the SERVOPACK is transmitted as alarm information to the host controller with the PAO (Encoder Divided Pulse Output) signal when the SEN (Absolute Data Request) signal turns OFF.

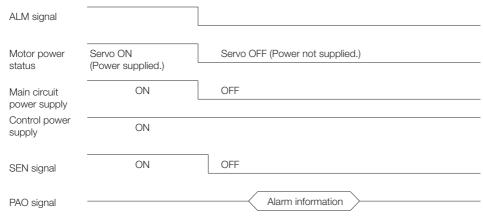

The data format of the alarm information is shown below.

Α	
L	
М	
0 to 9	Upper two digits
0 to 9	of alarm code
CR	

6.14 Software Reset

You can reset the SERVOPACK internally with the software. A software reset is used when resetting alarms and changing the settings of parameters that normally require turning the power supply to the SERVOPACK OFF and ON again. This can be used to change those parameters without turning the power supply to the SERVOPACK OFF and ON again.

Information

- 1. Always confirm that the servo is OFF and that the Servomotor is stopped before you start a software reset.
- This function resets the SERVOPACK independently of the host controller. The SERVO-PACK carries out the same processing as when the power supply is turned ON and outputs the ALM (Servo Alarm) signal. The status of other output signals may be forcibly changed.
- 3. When you execute a software reset, the SERVOPACK will not respond for approximately five seconds.
 - Before you execute a software reset, check the status of the SERVOPACK and Servomotor and make sure that no problems will occur.

6.14.1 Preparations

Always check the following before you perform a software reset.

- The servo must be OFF.
- The motor must be stopped.

6.14.2 Applicable Tools

The following table lists the tools that you can use to perform a software reset.

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	Fn030	13.4.25 Software Reset (Fn030) on page 13-29
Digital Operator	Fn030	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Basic Functions – Software Reset	6.14.3 Operating Procedure on page 6-97

6.14.3 Operating Procedure

Use the following procedure to perform a software reset.

- 1. Click the 🔎 Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Software Reset in the Menu Dialog Box. The Software Reset Dialog Box will be displayed.


6.14.3 Operating Procedure

3. Click the Execute Button.



Click the Cancel Button to cancel the software reset. The Main Window will return.

4. Click the Execute Button.

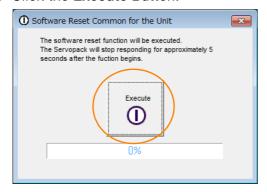

5. Click the **OK** Button to end the software reset operation.

All settings including parameters will have been re-calculated. When you finish this operation, disconnect the SigmaWin+ from the SERVOPACK, and then connect it again.



This concludes the procedure to reset the software.

6.15 Initializing the Vibration Detection Level

You can detect machine vibration during operation to automatically adjust the settings of Pn312 or Pn384 (Vibration Detection Level) to detect A.520 alarms (Vibration Alarm) and A.911 warnings (Vibration) more precisely.

This function detects specific vibration components in the Servomotor speed.

Parameter		Meaning	When Enabled	Classification
D-040	n.□□□0 (default setting)	Do not detect vibration.	lanca - Batala	Octor
Pn310	n.□□□1	Output a warning (A.911) if vibration is detected.	Immediately	Setup
	n.□□□2	Output an alarm (A.520) if vibration is detected.		

If the vibration exceeds the detection level calculated with the following formula, an alarm or warning occurs according to Pn310 (Vibration Detection Selection).

· Rotary Servomotors

Detection level = Vibration detection level (Pn312 [min-1]) × Vibration detection sensitivity (Pn311 [%])

Linear Servomotors

Detection level = Vibration detection level (Pn384 [mm/s]) × Vibration detection sensitivity (Pn311 [%])

Use this function only if A.520 or A.911 alarms are not output at the correct times when vibration is detected with the default vibration detection level (Pn312 or Pn384).

There will be discrepancies in the detection sensitivity for vibration alarms and warnings depending on the condition of your machine. If there is a discrepancy, use the above formula to adjust Pn311 (Vibration Detection Sensitivity).

	Vibration Detection	Sensitivity	sitivity Speed Position Torque		
Pn311	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	50 to 500	1%	100	Immediately	Tuning

Information

- 1. Vibration may not be detected because of unsuitable servo gains. Also, not all kinds of vibrations can be detected.
- 2. Set a suitable moment of inertia ratio (Pn103). An unsuitable setting may result in falsely detecting or not detecting vibration alarms or vibration warnings.
- To use this function, you must input the actual references that will be used to operate your system.
- 4. Execute this function under the operating conditions for which you want to set the vibration detection level.
- 5. Execute this function while the Servomotor is operating at 10% of its maximum speed or faster.

6.15.1 Preparations

Always check the following before you initialize the vibration detection level.

- The parameters must not be write prohibited.
- The test without a motor function must be disabled (Pn00C = n.□□□0).

6.15.2 Applicable Tools

6.15.2 Applicable Tools

The following table lists the tools that you can use to initialize the vibration detection level.


Tool Fn No./Function Name		Operating Procedure Reference	
Panel Operator	Fn01B	13.4.20 Initialize Vibration Detection Level (Fn01B) on page 13-27	
Digital Operator	Fn01B	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)	
SigmaWin+	Others – Initialize Vibration Detection Level	6.15.3 Operating Procedure on page 6-100	

6.15.3 Operating Procedure


Use the following procedure to initialize the vibration detection level.

- 1. Click the P Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Initialize Vibration Detection Level in the Menu Dialog Box. The Initialize Vibration Detection Level Dialog Box will be displayed.
- 3. Select Pn311: Vibration Detection Sensitivity and Pn310: Vibration Detection Selections and then click the Detection Start Button.


A setting execution standby mode will be entered.

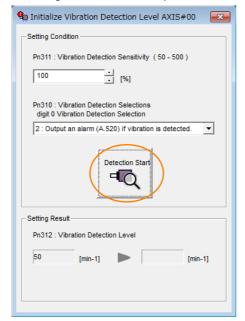

4. Click the Execute Button.

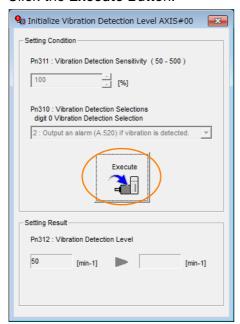

The newly set vibration detection level will be displayed and the value will be saved in the SERVO-PACK.

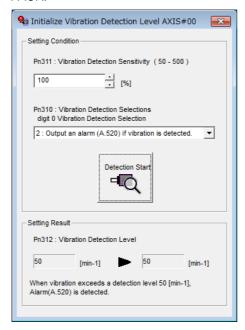

This concludes the procedure to initialize the vibration detection level.

6.15.4 Related Parameters

The following three items are given in the following table.

- Parameters Related to this Function

 These are the parameters that are used or referenced when this function is executed.
- Changes during Function Execution
 Not allowed: The parameter cannot be changed using the SigmaWin+ or other tool while this function is being executed.
 - Allowed: The parameter can be changed using the SigmaWin+ or other tool while this function is being executed.
- Automatic Changes after Function Execution
 Yes: The parameter is automatically set or adjusted after execution of this function.
 No: The parameter is not automatically set or adjusted after execution of this function.

Parameter	Name	Setting Changes	Automatic Changes
Pn311	Vibration Detection Sensitivity	Allowed	No
Pn312	Vibration Detection Level	Not allowed	Yes
Pn384	Vibration Detection Level	Not allowed	Yes

6.16 Adjusting the Motor Current Detection Signal Offset

The motor current detection signal offset is used to reduce ripple in the torque. You can adjust the motor current detection signal offset either automatically or manually.

6.16.1 Automatic Adjustment

Perform this adjustment only if highly accurate adjustment is required to reduce torque ripple. It is normally not necessary to adjust this offset.



Execute the automatic offset adjustment if the torque ripple is too large when compared with other SERVOPACKs.



The offset does not use a parameter, so it will not change even if the parameter settings are initialized

Preparations

Always check the following before you automatically adjust the motor current detection signal offset.

- The parameters must not be write prohibited.
- The servo must be in ready status.
- The servo must be OFF.

Applicable Tools

The following table lists the tools that you can use to automatically adjust the offset.

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	Fn00E	13.4.13 Autotune Motor Current Detection Signal Offset (Fn00E) on page 13-21
Digital Operator	Fn00E	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Others – Adjust the Motor Current Detection Offset	© Operating Procedure on page 6-103


Operating Procedure

Use the following procedure to automatically adjust the motor current detection signal offset.


- 1. Click the P Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Adjust the Motor Current Detection Offset in the Menu Dialog Box. The Adjust the Motor Current Detection Signal Offsets Dialog Box will be displayed.

6.16.1 Automatic Adjustment

3. Click the Continue Button.

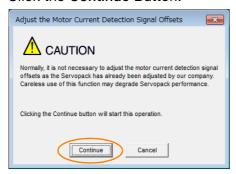


4. Click the **Automatic Adjustment** Tab in the Adjust the Motor Current Detection Signal Offsets Dialog Box.

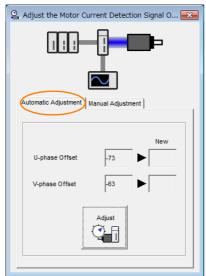

5. Click the Adjust Button.

The values that result from automatic adjustment will be displayed in the **New** Boxes.

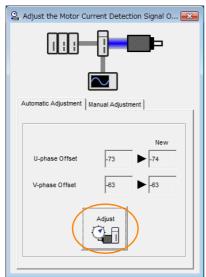

This concludes the procedure to automatically adjust the motor current detection signal offset.

6.16.2 Manual Adjustment

You can use this function if you automatically adjust the motor current detection signal offset and the torque ripple is still too large.



If the offset is incorrectly adjusted with this function, the Servomotor characteristics may be adversely affected.

Observe the following precautions when you manually adjust the offset.

- Operate the Servomotor at a speed of approximately 100 min⁻¹.
- Adjust the offset while monitoring the torque reference with the analog monitor until the ripple is minimized.
- Adjust the offsets for the phase-U current and phase-V current of the Servomotor so that they are balanced. Alternately adjust both offsets several times.



The offset does not use a parameter, so it will not change even if the parameter settings are initialized.

Preparations

Always check the following before you manually adjust the motor current detection signal offset.

• The parameters must not be write prohibited.

Applicable Tools


The following table lists the tools that you can use to manually adjust the offset.

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	Fn00F	3.4.14 Manually Adjust Motor Current Detection Signal Offset (Fn00F) on page 13-22
Digital Operator	Fn00F	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Others – Adjust the Motor Current Detection Offset	Operating Procedure on page 6-105

Operating Procedure


Use the following procedure to manually adjust the motor current detection signal offset.

- 1. Operate the Servomotor at approximately 100 min⁻¹.
- 2. Click the | Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **3.** Select Adjust the Motor Current Detection Offset in the Menu Dialog Box. The Adjust the Motor Current Detection Signal Offsets Dialog Box will be displayed.
- 4. Click the Continue Button.

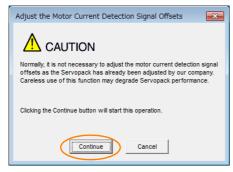

6.16.2 Manual Adjustment

5. Click the **Manual Adjustment** Tab in the Adjust the Motor Current Detection Signal Offsets Dialog Box.

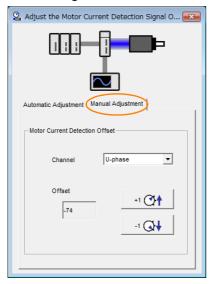

- 6. Set the Channel Box in the Motor Current Detection Offset Area to U-phase.
- 7. Use the +1 and -1 Buttons to adjust the offset for phase U.

 Change the offset by about 10 in the direction that reduces the torque ripple.

 Adjustment range: -512 to +511
- 8. Set the Channel Box in the Motor Current Detection Offset Area to V-phase.
- 9. Use the +1 and -1 Buttons to adjust the offset for phase V.

 Change the offset by about 10 in the direction that reduces the torque ripple.
- **10.** Repeat steps 6 to 9 until the torque ripple cannot be decreased any further regardless of whether you increase or decrease the offsets.
- 11. Reduce the amount by which you change the offsets each time and repeat steps 6 to 9.

This concludes the procedure to manually adjust the motor current detection signal offset.

6.17 Forcing the Motor to Stop

You can force the Servomotor to stop for a signal from the host controller or an external device.

To force the motor to stop, you must allocate the FSTP (Forced Stop Input) signal in Pn516 = $n.\Box\Box\Box$ X. You can specify one of the following stopping methods: dynamic brake (DB), coasting to a stop, or decelerating to a stop.

Note: Forcing the motor to stop is not designed to comply with any safety standard. In this respect, it is different from the hard wire base block (HWBB).

Information

Panel Display and Digital Operator Display

When a forced stop is performed, the panel display will display FST and the Digital Operator will display FSTP.

CAUTION

 To prevent accidents that may result from contact faults or disconnections, use a normally closed switch for the Forced Stop Input signal.

6.17.1 FSTP (Forced Stop Input) Signal

	Classifica- tion	Signal	Connector Pin No.	Signal Status	Description
Input	FSTP	Must be allocated.	ON (closed)	Drive is enabled (normal operation).	
	IIIput	ISIF	Must be allocated.	OFF (open)	The motor is stopped.

Note: You must allocate the FSTP signal to use it. Use Pn516 = n.□□□X (FSTP (Forced Stop Input) Signal Allocation) to allocate the FSTP signal to a connector pin. Refer to the following section for details.

6.1.1 Input Signal Allocations on page 6-5

6.17.2 Stopping Method Selection for Forced Stops

Use $Pn00A = n.\square\square X\square$ (Stopping Method for Forced Stops) to set the stopping method for forced stops.

Parameter		Description	When Enabled	Classifi- cation
	n. □□ 0 □	Apply the dynamic brake or coast the motor to a stop (use the stopping method set in $Pn001 = n.\square\square\square\square X$).		
Pn00A	n. (default set- ting)	Decelerate the motor to a stop using the torque set in Pn406 as the maximum torque. Use the setting of Pn001 = n.□□□X for the status after stopping.		
	n. □□ 2□	Decelerate the motor to a stop using the torque set in Pn406 as the maximum torque and then let the motor coast.	After restart	Setup
	n.□□3□	Decelerate the motor to a stop using the deceleration time set in Pn30A. Use the setting of Pn001 = n. \(\sigma\sigma\sigma\) for the status after stopping.		
	n. 00 40	Decelerate the motor to a stop using the deceleration time set in Pn30A and then let the motor coast.		

Note: You cannot decelerate a Servomotor to a stop during torque control. For torque control, the Servomotor will be stopped with the dynamic braking or coast to a stop according to the setting of Pn001 = n. \(\sim \subseteq \subseteq \text{N}\) (Motor Stopping Method for Servo OFF and Group 1 Alarms).

6.17.2 Stopping Method Selection for Forced Stops

Stopping the Servomotor by Setting Emergency Stop Torque (Pn406)

To stop the Servomotor by setting emergency stop torque, set Pn406 (Emergency Stop Torque).

If $Pn00A = n.\square\square X\square$ is set to 1 or 2, the Servomotor will be decelerated to a stop using the torque set in Pn406 as the maximum torque.

The default setting is 800%. This setting is large enough to allow you to operate the Servomotor at the maximum torque. However, the maximum emergency stop torque that you can actually use is the maximum torque of the Servomotor.

	Emergency Stop Torque			Speed Positio	n
Pn406	Setting Range Setting Unit		Default Setting	When Enabled	Classification
	0 to 800	1%*	800	Immediately	Setup

^{*} Set a percentage of the motor rated torque.


Stopping the Servomotor by Setting the Deceleration Time for Servo OFF and Forced Stops (Pn30A)

To specify the Servomotor deceleration time and use it to stop the Servomotor, set Pn30A (Deceleration Time for Servo OFF and Forced Stops).

	Deceleration Time for	or Servo OFF and Fo	Speed Position	า	
Pn30A	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 ms	0	Immediately	Setup

If you set Pn30A to 0, the Servomotor will be stopped with a zero speed.


The deceleration time that you set in Pn30A is the time to decelerate the Servomotor from the maximum motor speed.

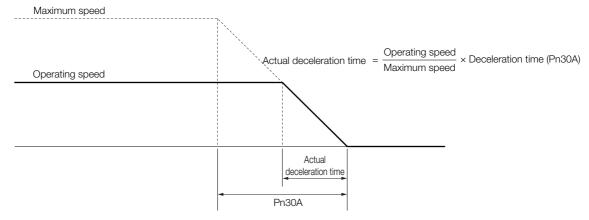

6.17.3 Resetting Method for Forced Stops

This section describes the reset methods that can be used after stopping operation for an FSTP (Forced Stop Input) signal.

If the FSTP (Forced Stop Input) signal is OFF and the /S-ON (Servo ON Input) signal is input, the forced stop state will be maintained even after the FSTP signal is turned ON. Turn OFF the /S-ON signal to place the SERVOPACK in the base block (BB) state and then turn ON the /S-ON signal again.

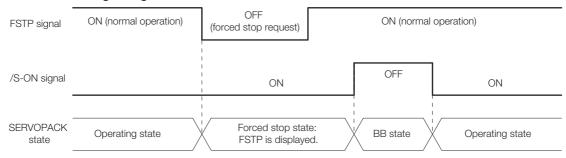

6.18.1 Connecting the Overheat Protection Input (TH) Signal

6.18 Overheat Protection

Overheat protection detects an A.93B warning (Overheat Warning) and an A.862 alarm (Overheat Alarm) by monitoring the overheat protection input signal from a Yaskawa SGLFW2 Linear Servomotor or from a sensor attached to the machine.

SERVOPACKs with software version 0023 or higher support overheat protection.

When you use overheat protection, you must wire the overheat protection input (TH) signal and select overheat protection ($Pn61A = n.\square\square\squareX$).


6.18.1 Connecting the Overheat Protection Input (TH) Signal

To use overheat protection, you must connect an overheat protection input (TH) signal to the SERVOPACK. This section describes the connection methods for the overheat protection input (TH) signal.

Using Overheat Protection in the Linear Servomotor


When Using a Serial Converter Unit

Connect the connector for the polarity sensor (hall sensor) and thermal protector of the linear servomotor to the serial converter unit.

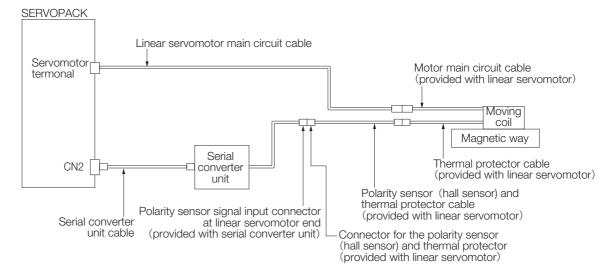

Using Overheat Protection for the Machine

To use overheat protection for the machine, connect the overheat protection input (an analog voltage input) from the sensor mounted to the machine to the CN1-50 on the SERVOPACK.

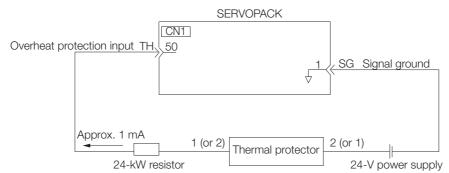

Closed when normal (low temperature) and open when activated (high temperature)



- The recommended length of the thermal protector cable is 15 m maximum.
- The 24-V power supply and 24-k Ω resistor are not provided by Yaskawa. Use a 0.3 W or greater 24-V power supply, and use a 0.2 W or greater 24-k Ω resistor.
- Be sure to connect the positive and negative sides of the power supply correctly. Otherwise there is a risk of SERVOPACK failure.

6.18.2 Overheat Protection Selection

The overheat protection function is selected with $Pn61A = n.\square\square\squareX$ (Overheat Protection Selections).

	Parameter	Meaning	When Enabled	Classification
	n.□□□0 (default setting)	Disable overheat protection.		
	n.□□□1	Use overheat protection in the Yaskawa Linear Servomotor.*		
Pn61A	n.□□□2	Monitor a negative voltage input from a sensor attached to the machine and use overheat protection.	After restart	Setup
	n.□□□3	Monitor a positive voltage input from a sensor attached to the machine and use overheat protection.		

^{*} The SGLFW2 is the only Yaskawa Linear Servomotor that supports this function.

6.18.2 Overheat Protection Selection

Using Overheat Protection in the Yaskawa Linear Servomotor

To use the overheat protection in the Yaskawa Linear Servomotor (SGLFW2), set Pn61A to n. $\Box\Box\Box$ 1.

An A.93B warning (Overheat Warning) will be detected if the overheat protection input (TH) signal from the Yaskawa SGLFW2 Linear Servomotor exceeds the warning temperature.

An A.862 alarm (Overheat Alarm) will be detected if the overheat protection input (TH) signal from the Yaskawa SGLFW2 Linear Servomotor exceeds the alarm temperature.



- If the overheat protection input signal line is disconnected or short-circuited, an A.862 alarm will occur.
- If you set Pn61A to n. \(\sigma \square\) (Use overheat protection in the Yaskawa Linear Servomotor), the parameters in the Servomotor are enabled and the following parameters are disabled.
 - Overheat Alarm Level (Pn61B)
 - Overheat Warning Level (Pn61C)
 - Overheat Alarm Filter Time (Pn61D)

Monitoring the Machine's Temperature and Using Overheat Protection

Set $Pn61A = n.\square\square\square\square X$ to 2 or 3 to use overheat protection for the machine.

Set the following parameters as required.

	Overheat Alarm Level			Speed Positi	on Torque
Pn61B	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 500	0.01 V	250	Immediately	Setup
	Overheat Warning Le	evel		Speed Positi	on Torque
Pn61C	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 100	1%	100	Immediately	Setup
	Overheat Alarm Filte	r Time		Speed Positi	on Torque
Pn61D	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	1 s	0	Immediately	Setup



- When Pn61A is set to n. \$\square\$ an A.862 alarm will occur if the overheat protection input signal line is disconnected or short-circuited.
- When Pn61A is set to n. \$\sim \sim \sim \alpha\$ an A862 alarm will not occur if the overheat protection input signal line is disconnected or short-circuited. To ensure safety, we recommend that you connect the external circuits so that you can use a negative voltage input for the overheat protection input (an analog voltage input).

Trial Operation and Actual Operation

7

This chapter provides information on the flow and procedures for trial operation and convenient functions to use during trial operation.

7.1	Flow	of Trial Operation7-2
	7.1.1 7.1.2	Flow of Trial Operation for Rotary Servomotors 7-2 Flow of Trial Operation for Linear Servomotors 7-4
7.2	Inspec	tions and Confirmations before Trial Operation7-6
7.3	Trial O	peration for the Servomotor without a Load 7-7
	7.3.1 7.3.2 7.3.3	Preparations
7.4	Trial Oper	ation from the Host Controller for the Servomotor without a Load 7-10
	7.4.1 7.4.2 7.4.3	Preparing the Servomotor for Trial Operation 7-11 Trial Operation for Speed Control
7.5	Trial Ope	eration with the Servomotor Connected to the Machine 7-17
	7.5.1 7.5.2 7.5.3	Precautions7-17Preparations7-18Operating Procedure7-18
7.6	Conve	nient Function to Use during Trial Operation7-20
	7.6.1 7.6.2 7.6.3	Program Jogging7-20Origin Search7-25Test without a Motor7-27

7.1

Flow of Trial Operation

7.1.1 Flow of Trial Operation for Rotary Servomotors

The procedure for trial operation is given below.

• Preparations for Trial Operation

Step	Meaning	Reference
1	Installation Install the Servomotor and SERVOPACK according to the installation conditions. First, operation is checked with no load. Do not connect the Servomotor to the machine.	Chapter 3 SERVOPACK Installation
2	Wiring and Connections Wire and connect the SERVOPACK. First, Servomotor operation is checked without a load. Do not connect the CN1 connector on the SERVOPACK.	Chapter 4 Wiring and Connecting SERVOPACKs
3	Confirmations before Trial Operation	7.2 Inspections and Confirmations before Trial Operation on page 7-6
4	Power ON	_
5	Resetting the Absolute Encoder This step is necessary only for a Servomotor with an Absolute Encoder.	5.17 Resetting the Absolute Encoder on page 5-52

7.1.1 Flow of Trial Operation for Rotary Servomotors

• Trial Operation

Step	Meaning	Reference
1	Trial Operation for the Servomotor without a Load To power supply Secure the motor flange to the machine. Do not connect the motor shaft to the load shaft.	7.3 Trial Operation for the Servomotor without a Load on page 7-7
2	Trial Operation from the Host Controller for the Servomotor without a Load To power Supply To host controller Secure the motor flange to the machine. Do not connect the motor shaft to the load shaft.	7.4 Trial Operation from the Host Controller for the Servomotor without a Load on page 7-10
3	Trial Operation with the Servomotor Connected to the Machine To power CN1 To host controller Secure the motor flange to the machine, and connect the motor shaft to the load shaft with a coupling or other means.	7.5 Trial Operation with the Servomotor Connected to the Machine on page 7-17

7.1.2 Flow of Trial Operation for Linear Servomotors

The procedure for trial operation is given below.

• Preparations for Trial Operation

Step	Meaning	Reference
1	Installation Install the Servomotor and SERVOPACK according to the installation conditions. First, operation is checked with no load. Do not connect the Servomotor to the machine.	Chapter 3 SERVOPACK Installation
2	Wiring and Connections Wire and connect the SERVOPACK. First, Servomotor operation is checked without a load. Do not connect the CN1 connector on the SERVOPACK.	Chapter 4 Wiring and Connecting SERVOPACKs
3	Confirmations before Trial Operation	7.2 Inspections and Confirmations before Trial Operation on page 7-6
4	Power ON	-

Setting Parameters in the SERVOPACK

		Step	No. of Parameter to Set	Description	Remarks	Reference
		5-1	Pn282	Linear Encoder Scale Pitch	Set this parameter only if you are using a Serial Converter Unit.	page 5-19
		5-2	_	Writing Parameters to the Linear Servomotor	Set this parameter only if you are not using a Serial Converter Unit.	page 5-20
5		5-3	Pn080 = n.□□X□	Motor Phase Sequence Selec- tion	_	page 5-24
		5-4	Pn080 = n.□□□X	Polarity Sensor Selection	-	page 5-26
	5-	5-5	_	Polarity Detection	This step is necessary only for a Linear Servomotor with a Polarity Sensor.	page 5-27
		5-6	Pn50A = n.X□□□ and Pn50B = n.□□□X	Overtravel Signal Allocations	_	page 5-31
		5-7	Pn483, Pn484	Force Control	_	page 6-64

7.1.2 Flow of Trial Operation for Linear Servomotors

• Trial Operation


S	tep	Meaning		Reference
	1	Trial Operation for the Servomotor without a Load To power supply	The state of the s	7.3 Trial Operation for the Servomotor without a Load on page 7-7
	2	Trial Operation from the Host Controller for the Servomotor without a Load To power supply To host controller	æ	7.4 Trial Operation from the Host Controller for the Servomotor without a Load on page 7-10
	3	Trial Operation with the Servomotor Connected to the Machine To power Supply To host controller	[the	7.5 Trial Operation with the Servomotor Connected to the Machine on page 7-17

7.2

Inspections and Confirmations before Trial Operation

To ensure safe and correct trial operation, check the following items before you start trial operation.

- Make sure that the SERVOPACK and Servomotor are installed, wired, and connected correctly.
- Make sure that the correct power supply voltage is supplied to the SERVOPACK.
- Make sure that there are no loose parts in the Servomotor mounting.
- If you are using a Servomotor with an Oil Seal, make sure that the oil seal is not damaged. Also make sure that oil has been applied.
- If you are performing trial operation on a Servomotor that has been stored for a long period of time, make sure that all Servomotor inspection and maintenance procedures have been completed.
 - Refer to the manual for your Servomotor for Servomotor maintenance and inspection information.
- If you are using a Servomotor with a Holding Brake, make sure that the brake is released in advance. To release the brake, you must apply the specified voltage of 24 VDC to the brake. A circuit example for trial operation is provided below.

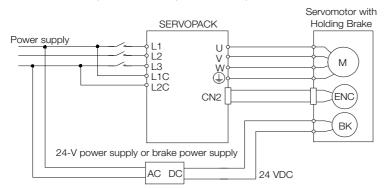

7.3 Trial Operation for the Servomotor without a Load

You use jogging for trial operation of the Servomotor without a load.

Jogging is used to check the operation of the Servomotor without connecting the SERVOPACK to the host controller. The Servomotor is moved at the preset jogging speed.

⚠ CAUTION

 During jogging, the overtravel function is disabled. Consider the range of motion of your machine when you jog the Servomotor.



The tuning-less function is enabled as the default setting. When the tuning-less function is enabled, gain will increase and vibration may occur if the Servomotor is operated with no load. If vibration occurs, disable the tuning-less function ($Pn170 = n.\square\square\square\square$).

7.3.1 Preparations

Always check the following before you execute jogging.

- The parameters must not be write prohibited.
- The main circuit power supply must be ON.
- There must be no alarms.
- There must be no hard wire base block (HWBB).
- The servo must be OFF.
- The jogging speed must be set considering the operating range of the machine. The jogging speed is set with the following parameters.
 - · Rotary Servomotors

	Jogging Speed			Speed	osition Torque
Pn304	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 min ⁻¹	500	Immediately	Setup
	Soft Start Acceler	ation Time		Speed	
Pn305	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 ms	0	Immediately	Setup
	Soft Start Deceler	ation Time		Speed	
Pn306	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 ms	0	Immediately	Setup

Direct Drive Servomotors

	Jogging Speed			Speed Position Torque	
Pn304	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	0.1 min ⁻¹	500	Immediately	Setup
	Soft Start Acceler	ation Time		Speed	
Pn305	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 ms	0	Immediately	Setup
	Soft Start Deceler	ation Time		Speed	
Pn306	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 ms	0	Immediately	Setup

7.3.2 Applicable Tools

Linear Servomotors

	Jogging Speed			Speed Position Force	
Pn383	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 mm/s	50	Immediately	Setup
	Soft Start Acceler	ation Time		Speed	
Pn305	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 ms	0	Immediately	Setup
	Soft Start Deceler	ation Time		Speed	
Pn306	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 ms	0	Immediately	Setup

Information

When an absolute encoder is used, you do not need to input the SEN signal. It is always active.

7.3.2 Applicable Tools

The following table lists the tools that you can use to perform jogging.

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	Fn002	13.4.2 Jog (Fn002) on page 13-13
Digital Operator	Fn002	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Operation - Jog	Operating Procedure on page 7-8


7.3.3 Operating Procedure

Use the following procedure to jog the motor.

- 1. Click the P Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select JOG in the Menu Dialog Box. The Jog Operation Dialog Box will be displayed.
- 3. Read the warnings and then click the OK Button.




4. Check the jogging speed and then click the Servo ON Button.

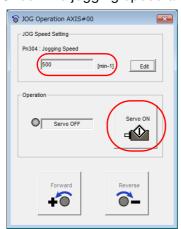

The display in the **Operation** Area will change to **Servo ON**.

Information To change the speed, click the Edit Button and enter the new speed.

5. Click the Forward Button or the Reverse Button. Jogging will be performed only while you hold down the mouse button.

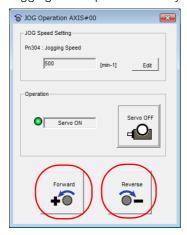

6. After you finish jogging, turn the power supply to the SERVOPACK OFF and ON again.

This concludes the jogging procedure.


7.4

Trial Operation from the Host Controller for the Servomotor without a Load

Conform the following items before you start trial operation from the host controller for the Servomotor without a load.


- Make sure that the Servomotor operation reference from the host controller to the SERVO-PACK and the I/O signals are set up properly.
- Make sure that the wiring between the host controller and SERVOPACK and the polarity of the wiring are correct.
- Make sure that all operation settings for the SERVOPACK are correct.

The operation sequence for trial operation from the host controller for the Servomotor without a load is given below.

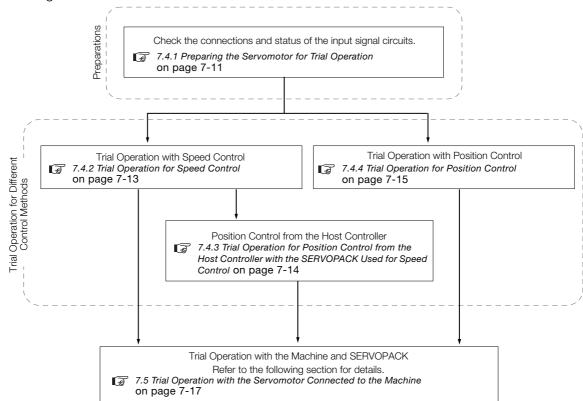

CAUTION

 Before you perform trial operation of the Servomotor without a load for references from the host controller, make sure that there is no load connected to the Servomotor (i.e., that all couplings and belts are removed from the Servomotor) to prevent unexpected accidents.

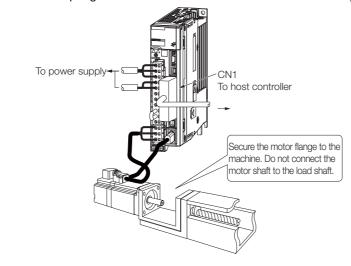

7.4.1 Preparing the Servomotor for Trial Operation

This section provides the procedure to prepare the Servomotor for trial operation.

Preparations

Always confirm the following before you perform the procedure to prepare the Servomotor for trial operation.

- Make sure that the preparations given in 7.1 Flow of Trial Operation on page 7-2 have been completed.
- Make sure that the trial operation described in 7.3 Trial Operation for the Servomotor without a Load on page 7-7 has been completed.

Operating Procedure

The following procedure assumes that the default settings are used for the I/O signals required for trial operation. Refer to the following section for information on the default I/O signal settings.

4.2 Basic Wiring Diagrams on page 4-9

1. Wire the I/O signals from the host controller. Refer to the following section for details.

4.2 Basic Wiring Diagrams on page 4-9

- 2. Check the following items.
 - ① Make sure that the /S-ON (Servo ON) signal can be input.
 - @Make sure that the P-OT (Forward Drive Prohibit) and N-OT (Reverse Drive Prohibit) signals are ON (closed).

Setting Procedure

- Input the signal to turn ON CN1-42 and CN1-43 (closed).
- Set Pn50A to n.8 \(\sigma\) (Set the signal to always enable forward drive) and Pn50B to n. \(\sigma\) \(\sigma\) (Set the signal to always enable reverse drive).
- 3Make sure that a reference is not being input.

7.4.1 Preparing the Servomotor for Trial Operation

If you are using a safety function, make sure that the safety function device is connected to CN8.


Refer to the following section for the safety function device connection method.

4.6 Connecting Safety Function Signals on page 4-50

Information

You can set Pn002 to n. \$\square\$1 1 \$\square\$ (Use the encoder as an incremental encoder) to temporarily use an absolute encoder as an incremental encoder. This makes it possible to perform trial operation without setting up the absolute encoder or setting the SEN signal.


3. Connect the I/O Signal Cable to the I/O signal connector (CN1).

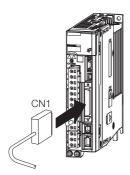

4. Turn ON the power supplies to the SERVOPACK.

The control power and main circuit power will be supplied.

5. Confirm that the Panel Operator display is as shown below.

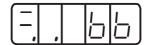

6. If you are using an absolute encoder, turn ON the SEN signal.

The current position will be read from the absolute encoder.

This step is not necessary if you are using an incremental encoder.


- 7. Check the status of the I/O signals.
 - Using the SigmaWin+: Monitor Wiring Check
 - Using the Panel Operator or Digital Operator: Un005 (Input Signal Monitor)

The correct states of the input signals are given in the following table. If the actual states do not agree with those given in the following table, correct the I/O signals.

Signal	Correct State
/S-ON (Servo ON) Signal	OFF
/P-CON (Proportional Control) Signal	OFF
P-OT (Forward Drive Prohibit) Signal	ON
N-OT (Reverse Drive Prohibit) Signal	ON
/ALM-RST (Alarm Reset) Signal	OFF
/P-CL (Forward External Torque Limit) Signal	OFF
/N-CL (Reverse External Torque Limit) Signal	OFF
SEN (Absolute Data Request) Signal	When using an absolute encoder: ON When not using an absolute encoder: OFF

8. Input the /S-ON (Servo ON) signal.

The servo will turn ON.

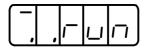

If the above display appears, power is being supplied to the Servomotor and the servo is ON. If an alarm is displayed, the servo is OFF and power is not being supplied to the Servomotor. Refer to the following section, clear the alarm, and repeat the procedure from step 4.

[12.2.3 Resetting Alarms on page 12-41

10. If you changed the settings of Pn50A or Pn50B in step 2, return the settings to their original values.

This concludes the procedure to prepare the Servomotor for trial operation.

Proceed to one of the following sections according to the control method.

7.4.2 Trial Operation for Speed Control on page 7-13

7.4.4 Trial Operation for Position Control on page 7-15

7.4.2 Trial Operation for Speed Control

This section describes trial operation with speed control.

Preparations

Always confirm the following before you perform the procedure for trial operation with speed control.

• Make sure that the procedure to prepare the Servomotor for trial operation described in 7.4.1 Preparing the Servomotor for Trial Operation on page 7-11 has been completed.

Operating Procedure

1. Adjust the speed reference input gain (Pn300).

The default setting of Pn300 is for the rated speed at 6 V. If you want to use this setting, do not adjust Pn300 and proceed to the next step.

To change the setting of Pn300, refer to the following section.

6.5 Speed Control on page 6-17

2. Set the speed reference (V-REF, SG voltage) to 0 V from the host controller and check the rotation of the Servomotor shaft.

If the Servomotor shaft is rotating slightly, refer to the following section and adjust the reference offset so that the shaft does not rotate.

Adjusting the Speed Reference Offset on page 6-19

- **3.** Input a low-speed, constant-speed reference from the host controller to operate the Servomotor and visually check the motor speed.
 - Rotary Servomotor example: For a speed reference of 60 min⁻¹, the shaft should rotate at 1 rotation per second.
 - Linear Servomotor example: For a speed reference of 60 mm/s, the Moving Coil should move at 60 mm/s
- 4. Gradually increase the speed reference input from the host controller starting from 0 V.
- 5. Confirm that the motor speed agrees with the speed reference value.
 - Using the SigmaWin+: *Monitor Monitor Status Monitor* and *Monitor Monitor Motion Monitor*
 - Using the Panel Operator or Digital Operator: Un001 (Speed Reference Monitor) and Un000 (Motor Speed Monitor)

7.4.3 Trial Operation for Position Control from the Host Controller with the SERVOPACK Used for Speed Control

6. Confirm that the Servomotor is operating in the correct direction.

If the Servomotor direction is not correct, refer to the following section and change the Servomotor direction.

5.6 Motor Direction Setting on page 5-18

- 7. Gradually reduce the speed reference input from the host controller back to 0 V.
- 8. Turn OFF the power supplies to the SERVOPACK.

This concludes the procedure for trial operation with speed control.

Proceed to the following section if you will perform position control on the host controller.

7.4.3 Trial Operation for Position Control from the Host Controller with the SERVOPACK Used for Speed Control on page 7-14

Proceed to the following section if you will not perform position control on the host controller.

7.5 Trial Operation with the Servomotor Connected to the Machine on page 7-17

7.4.3 Trial Operation for Position Control from the Host Controller with the SERVOPACK Used for Speed Control

This section describes the trial operation procedure to use the SERVOPACK for speed control and perform position control at the host controller.

Preparations

Always confirm the following before you perform the procedure to use the SERVOPACK for speed control and perform position control at the host controller.

• Make sure that the procedure described in 7.4.2 Trial Operation for Speed Control on page 7-13 has been completed.

Operating Procedure

- 1. Turn ON the power supplies to the SERVOPACK.
- 2. Set Pn212 (Number of Encoder Output Pulses) or Pn281 (Encoder Output Resolution). Refer to the following section for details.

6.8.2 Setting for the Encoder Divided Pulse Output on page 6-53

- **3.** Execute the following type of simple positioning from the host controller and confirm the motion of the Servomotor.
 - Rotary Servomotors: Input a reference to move the Servomotor one rotation and confirm that the motor shaft moves one rotation.
 - Linear Servomotors: Input a reference to move the Servomotor 100 mm and confirm that the Servomotor moves 100 mm either visually or with a monitor function. To use a monitor function, perform one of the following.

To use a monitor function, perform one of the following.

- Using the SigmaWin+: Monitor Monitor Motion Monitor
- Using the Panel Operator or Digital Operator: Un003 (Rotational Angle 1 [unit: encoder pulses]) If the amount of Servomotor rotation (pulses) is not correct, check the setting of Pn212 or Pn281.
- 4. Gradually reduce the speed reference input from the host controller back to 0 V.
- **5.** Turn OFF the power supplies to the SERVOPACK.

This concludes the trial operation procedure for position control from the host controller with the SERVOPACK used for speed control. Proceed to the following section.

7.5 Trial Operation with the Servomotor Connected to the Machine on page 7-17

7.4.4 Trial Operation for Position Control

This section describes the procedure for trial operation for position control.

Preparations

Always confirm the following before you perform the procedure for trial operation with position control.

• Make sure that the procedure to prepare the Servomotor for trial operation described in 7.4.1 Preparing the Servomotor for Trial Operation on page 7-11 has been completed.

Operating Procedure

In this procedure, the electronic gear is set in the SERVOPACK and not in the host controller.

- 1. Turn OFF the /S-ON (Servo ON) signal from the host controller. The servo will turn OFF.
- 2. Set Pn200 =n.□□□X (Reference Pulse Form) to the reference pulse form of the host controller.
- 3. Set the reference unit and set the electronic gear ratio (Pn20E and Pn210) according to the host controller.
- **4.** Turn the power supply to the SERVOPACK OFF and ON again. The new parameter settings will be enabled.
- 5. Input the /S-ON (Servo ON) signal from the host controller. The servo will turn ON.
- 6. Input a low-speed pulse reference from the host controller.

Use a travel distance (number of reference pulses) that is easy to check (for example, the number of pulses for one rotation).

For safety, set the number of references pulses for approximately the following motor speeds.

- Rotary Servomotors: 100 min⁻¹
- · Linear Servomotors: 100 mm/s
- 7. Check the number of reference pulses that are input to the SERVOPACK from the changes in the input reference pulse counter before and after the reference.
 - Using the SigmaWin+: Monitor Monitor Monitor, Reference Pulse Counter
 - Using the Panel Operator or Digital Operator: Un00C (Input Reference Pulse Counter Monitor)
- **8.** Check the actual number of Servomotor rotations from the changes in the feedback pulse counter before and after the reference.
 - Using the SigmaWin+: Monitor Monitor Motion Monitor, Feedback Pulse Counter
 - Using the Panel Operator or Digital Operator: Un00D (Feedback Pulse Counter Monitor)
- 9. Confirm that the changes in the input reference pulse counter and the feedback pulse counter (i.e., the values from steps 7 and 8) satisfy the following equation.

 Change in input reference pulse counter = Change in feedback pulse counter x (Pn210/Pn20E)
- **10.** Confirm that the Servomotor shaft is rotating in the direction specified by the reference. If the rotation direction does not agree with the reference direction, refer to the following section and change the rotation direction.
 - 5.6 Motor Direction Setting on page 5-18
- **11.** Input a pulse reference for a comparatively large number of Servomotor rotations from the host controller so that the Servomotor will operate at a constant speed.

7.4.4 Trial Operation for Position Control

- **12.** Check the reference pulse speed input to the SERVOPACK with the input reference pulse speed monitor.
 - Using the SigmaWin+: Monitor Monitor Motion Monitor, Input Reference Pulse Speed
 - Using the Panel Operator or Digital Operator: Un007 (Input Reference Pulse Speed Monitor)

The input reference pulse monitor uses the following formula.

• Rotary Servomotor with a 20-bit Encoder

Input reference pulse speed monitor = Input reference pulse speed [pulses/s]
$$\times$$
 60 \times $\frac{Pn20E}{Pn210}$ \times $\frac{1}{2^{20}(=1,048,576)}$

Reference input pulse speed/min Electronic gear ratio

· Linear Servomotors

Input reference pulse speed monitor = Input reference pulse speed [pulses/s]
$$\times \frac{\text{Pn20E}}{\text{Pn210}} \times \frac{\text{Linear encoder pitch } [\mu\text{m}]}{\text{Resolution}} \times \frac{1}{1,000}$$

Electronic gear ratio

- **13.** Check the motor speed monitor.
 - Using the SigmaWin+: Monitor Monitor Motion Monitor, Motor Speed
 - Using the Panel Operator or Digital Operator: Un000 (Motor Speed Monitor)
- **14.** Confirm that the input reference pulse speed and the motor speed (i.e., the values from steps 12 and 13) are the same.
- **15.** Stop the pulse reference from the host controller.
- **16.** Turn OFF the /S-ON (Servo ON) signal from the host controller. The servo will turn OFF.

This concludes the procedure for trial operation with position control. Proceed to the following section.

7.5 Trial Operation with the Servomotor Connected to the Machine on page 7-17

7.5 Trial Operation with the Servomotor Connected to the Machine

This section provides the procedure for trial operation with both the machine and Servomotor.

7.5.1 Precautions

MARNING

 Operating mistakes that occur after the Servomotor is connected to the machine may not only damage the machine, but they may also cause accidents resulting in personal injury.



If you disabled the overtravel function for trial operation of the Servomotor without a load, enable the overtravel function (P-OT and N-OT signal) before you preform trial operation with the Servomotor connected to the machine in order to provide protection.

If you will use a holding brake, observe the following precautions during trial operation.

- Before you check the operation of the brake, implement measures to prevent the machine from falling due to gravity and to prevent vibration from being caused by an external force.
- First check the Servomotor operation and brake operation with the Servomotor uncoupled from the machine. If no problems are found, connect the Servomotor to the machine and perform trial operation again.

Control the operation of the brake with the /BK (Brake) signal output from the SERVOPACK.

Refer to the following sections for information on wiring and the related parameter settings.

A4.4 Wiring the SERVOPACK to the Holding Brake on page 4-34

5.13 Holding Brake on page 5-36



Failures caused by incorrect wiring or incorrect voltage application in the brake circuit may cause the SERVOPACK to fail, damage the SERVOPACK, damage the equipment, or cause an accident resulting in death or injury.

Observe the precautions and instructions for wiring and trial operation precisely as described in this manual.

7.5.2 Preparations

7.5.2 Preparations

Always confirm the following before you perform the trial operation procedure for both the machine and Servomotor.

- Make sure that the procedure described in 7.4 Trial Operation from the Host Controller for the Servomotor without a Load on page 7-10 has been completed.
- Make sure that the SERVOPACK is connected correctly to both the host controller and the peripheral devices.
 - Safety Function Wiring
 - If you are not using the safety function, leave the Safety Jumper Connector (provided as an accessory with the SERVOPACK) connected to CN8.
 - If you are using the safety function, remove the Safety Jumper Connector from CN8 and connect the safety function device.
 - Overtravel wiring
 - Brake wiring
 - Allocation of the /BK (Brake) signal to a pin on the I/O signal connector (CN1)
 - Emergency stop circuit wiring
 - Host controller wiring
 Refer to the following section and change the wiring to match the system configuration.
 15.1 Examples of Connections to Host Controllers on page 15-2

7.5.3 Operating Procedure


1. Enable the overtravel signals.

5.12.2 Setting to Enable/Disable Overtravel on page 5-32

- 2. Make the settings for the protective functions, such as the safety function, overtravel, and the brake.
 - 4.6 Connecting Safety Function Signals on page 4-50
 - 5.12 Overtravel and Related Settings on page 5-31
 - 5.13 Holding Brake on page 5-36
- 3. Set the parameters that are required for the control method you will use.
 - 6.5 Speed Control on page 6-17
 - 6.6 Position Control on page 6-30
 - € 6.7 Torque Control on page 6-40
- 4. Turn OFF the power supplies to the SERVOPACK.

The control power supply and main circuit power supply will turn OFF.

5. Couple the Servomotor to the machine.

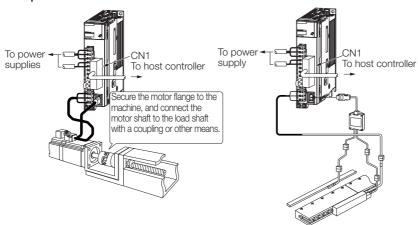

6. Turn ON the power supplies to the machine and host controller and turn ON the control power supply and main circuit power supply to the SERVOPACK.

- 7. Check the protective functions, such as overtravel and the brake, to confirm that they operate correctly.
 - Note: Enable activating an emergency stop so that the Servomotor can be stopped safely should an error occur during the remainder of the procedure.
- **8.** Perform trial operation according to 7.4 Trial Operation from the Host Controller for the Servomotor without a Load on page 7-10 and confirm that the same results are obtained as when trial operation was performed on the Servomotor without a load.
- **9.** Check the settings of the parameters for the control method and confirm that the Servomotor operates according to machine operating specifications.
- **10.** If necessary, adjust the servo gain to improve the Servomotor response characteristics. The Servomotor and machine may not be broken in completely for the trial operation. Therefore, let the system run for a sufficient amount of time to ensure that it is properly broken in.
- 11. For future maintenance, save the parameter settings with one of the following methods.
 - Use the SigmaWin+ to save the parameters as a file.
 - Use the Parameter Copy Mode of the Digital Operator.
 - · Record the settings manually.

This concludes the procedure for trial operation with both the machine and Servomotor.

7.6.1 Program Jogging

7.6

Convenient Function to Use during Trial Operation

This section describes some convenient operations that you can use during trial operation. Use them as required.

7.6.1 Program Jogging

You can use program jogging to perform continuous operation with a preset operation pattern, travel distance, movement speed, acceleration/deceleration time, waiting time, and number of movements.

You can use this operation when you set up the system in the same way as for normal jogging to move the Servomotor without connecting it to the host controller in order to check Servomotor operation and execute simple positioning operations.

Preparations

Always check the following before you execute program jogging.


- The parameters must not be write prohibited.
- The main circuit power supply must be ON.
- There must be no alarms.
- There must be no hard wire base block (HWBB).
- The servo must be OFF.
- The range of machine motion and the safe movement speed of your machine must be considered when you set the travel distance and movement speed.
- There must be no overtravel.

Additional Information

- The program jogging operation is performed with position control, but a pulse reference is not input to the SERVOPACK.
- You can use the functions that are applicable to position control.
- The overtravel function is enabled.
- When an absolute encoder is used, you do not need to input the SEN signal. It is always
 active
- You cannot use reference pulse input multiplication switching.


Program Jogging Operation Pattern

An example of a program jogging operation pattern is given below. In this example, the Servo-motor direction is set to $Pn000 = n.\square\square\square\square\square$ (Use CCW as the forward direction).

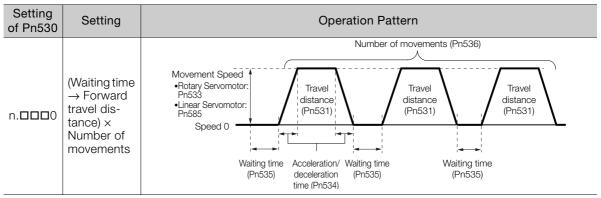

Continued on next page.

Continued from previous page.

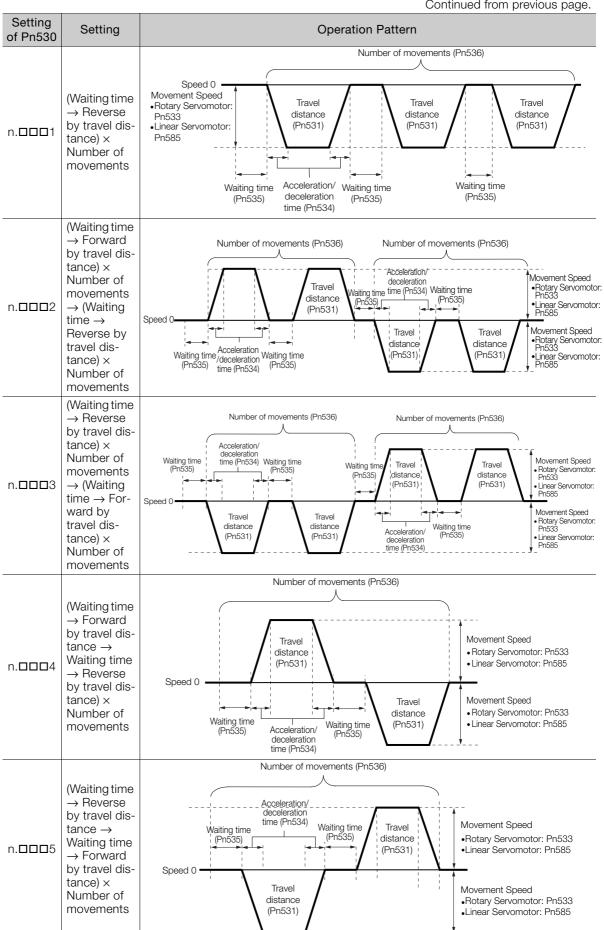

7.6.1 Program Jogging

Information

If Pn530 is set to n. \(\sigma\) \(\sigma\), n. \(\sigma\) \(\sigma\), or n. \(\sigma\) \(\sigma\), you can set Pn536 (Program Jogging Number of Movements) to 0 to perform infinite time operation.

You cannot use infinite time operation if Pn530 is set to n. \(\sigma\) \(\sigma\) or n. \(\sigma\) \(\sigma\).

If you perform infinite time operation from the Panel Operator or Digital Operator, press the MODE/SET Key or JOG/SVON Key to turn OFF the servo to end infinite time operation.

Related Parameters

Use the following parameters to set the program jogging operation pattern. Do not change the settings while the program jogging operation is being executed.

Rotary Servomotors

	Program Jogging-R	elated Selections		Speed Posit	ion Torque	
Pn530	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0000 to 0005	-	0000	Immediately	Setup	
	Program Jogging Tr	avel Distance		Speed Posit	ion Torque	
Pn531	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	1 to 1,073,741,824	1 reference unit	32,768	Immediately	Setup	
	Program Jogging M	lovement Speed		Speed Po	sition Torque	
Pn533	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	1 to 10,000	1 min ⁻¹	500	Immediately	Setup	
	Program Jogging A	cceleration/Decele	eration Time Speed		osition Torque	
Pn534	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	2 to 10,000	1 ms	100	Immediately	Setup	
	Program Jogging W	aiting Time		Speed Posit	ion Torque	
Pn535	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 10,000	1 ms	100	Immediately	Setup	
	Program Jogging N	umber of Movemer	nts	Speed Po	sition Torque	
Pn536	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 1,000	1 time	1	Immediately	Setup	

• Direct Drive Servomotors

	Program Jogging-R	elated Selections		Speed Po	sition Torque
Pn530	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0000 to 0005	-	0000	Immediately	Setup
	Program Jogging Tr	avel Distance		Speed Po	sition Torque
Pn531	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	1 to 1,073,741,824	1 reference unit	32,768	Immediately	Setup
	Program Jogging M	ovement Speed		Speed Po	sition Torque
Pn533	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	1 to 10,000	0.1 min ⁻¹	500	Immediately	Setup
	Program Jogging Ad	cceleration/Deceleration Time		Speed Po	sition Torque
Pn534	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	2 to 10,000	1 ms	100	Immediately	Setup
	Program Jogging W	aiting Time		Speed Po	sition Torque
Pn535	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 ms	100	Immediately	Setup
	Program Jogging No	umber of Movemen	its	Speed Po	sition Torque
Pn536	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 1,000	1 time	1	Immediately	Setup

Linear Servomotors

	Program Jogging-R	elated Selections		Speed	sition Force		
Pn530	Setting Range	Setting Unit	Default Setting	When Enabled	Classification		
	0000 to 0005	-	0000	Immediately	Setup		
	Program Jogging Tr	avel Distance		Speed Po	sition Force		
Pn531	Setting Range	Setting Unit	Default Setting	When Enabled	Classification		
	1 to 1,073,741,824	1 reference unit	32,768	Immediately	Setup		
	Program Jogging M	ovement Speed		Speed	sition Force		
Pn585	Setting Range	Setting Unit	Default Setting	When Enabled	Classification		
	1 to 10,000	1 mm/s	50	Immediately	Setup		
	Program Jogging Acceleration/Deceleration Time		ration Time	Speed Position Force			
Pn534	Setting Range	Setting Unit	Default Setting	When Enabled	Classification		
	2 to 10,000	1 ms	100	Immediately	Setup		
	Program Jogging W	aiting Time		Speed	sition Force		
Pn535	Setting Range	Setting Unit	Default Setting	When Enabled	Classification		
	0 to 10,000	1 ms	100	Immediately	Setup		
	Program Jogging N	Jogging Number of Movements		Speed	sition Force		
Pn536	Setting Range	Setting Unit	Default Setting	When Enabled	Classification		
	0 to 1,000	1 time	1	Immediately	Setup		

Applicable Tools

The following table lists the tools that you can use to perform program jogging.


Tool	Fn No./Function Name	Reference
Panel Operator	Fn004	13.4.4 Jog Program (Fn004) on page 13-15
Digital Operator	Fn004	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Operation - Program JOG Operation	© Operating Procedure on page 7-24

7.6.1 Program Jogging


Operating Procedure

Use the following procedure for a program jog operation.


- 1. Click the P Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Program JOG Operation in the Menu Dialog Box. The Jog Program Dialog Box will be displayed.
- 3. Read the warnings and then click the OK Button.

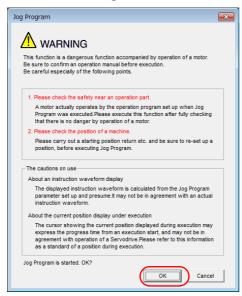

4. Set the operating conditions, click the **Apply** Button, and then click the **Run** Button. A graph of the operation pattern will be displayed.

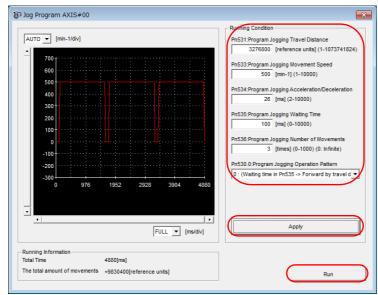

5. Click the Servo ON Button and then the Execute Button. The program jogging operation will be executed.

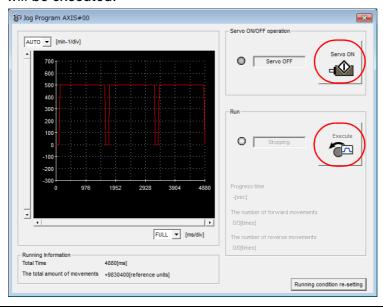

M CAUTION

- Be aware of the following points if you cancel the program jogging operation while the Servomotor is operating.
 - If you cancel operation with the **Servo OFF** Button, the Servomotor will stop according to setting of the Servo OFF stopping method (Pn001 = n.□□□X).
 - If you cancel operation with the **Cancel** Button, the Servomotor will decelerate to a stop and then enter a zero-clamped state.

This concludes the program jogging procedure.

7.6.2 Origin Search


The origin search operation positions the motor to the origin within one rotation and then clamps it there.

CAUTION

Make sure that the load is not coupled when you execute an origin search.
 The Forward Drive Prohibit (P-OT) signal and Reverse Drive Prohibit (N-OT) signal are disabled during an origin search.

Use an origin search when it is necessary to align the origin within one rotation with the machine origin. The following speeds are used for origin searches.

- Rotary Servomotors: 60 min⁻¹
- Direct Drive Servomotors: 6 min⁻¹
- Linear Servomotors: 15 mm/s

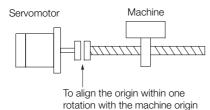

7.6.2 Origin Search

Preparations

Always check the following before you execute an origin search.

- The parameters must not be write prohibited.
- The main circuit power supply must be ON.
- There must be no alarms.
- There must be no hard wire base block (HWBB).
- The servo must be OFF.

Applicable Tools

The following table lists the tools that you can use to perform an origin search.

Tool	Fn No./Function Name	Reference
Panel Operator	Fn003	13.4.3 Origin Search (Fn003) on page 13-14
Digital Operator	Fn003	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+*	Encoder Setting - Origin Search	Operating Procedure on page 7-26

^{*} Cannot be used when connecting a Linear Servomotor.


Operating Procedure

Use the following procedure to perform an origin search.

- 1. Click the 🏴 Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Origin Search in the Menu Dialog Box. The Origin Search Dialog Box will be displayed.
- 3. Read the warnings and then click the OK Button.




4. Click the Servo ON Button.

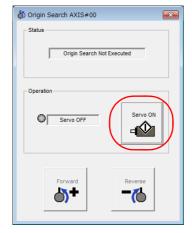

5. Click the Forward Button or the Reverse Button.


An origin search will be performed only while you hold down the mouse button. The motor will stop when the origin search has been completed.

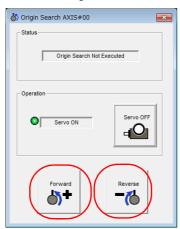

This concludes the origin search procedure.

7.6.3 Test without a Motor

A test without a motor is used to check the operation of the host controller and peripheral devices by simulating the operation of the Servomotor in the SERVOPACK, i.e., without actually operating a Servomotor. This test allows you to check wiring, debug the system, and verify parameters to shorten the time required for setup work and to prevent damage to the machine that may result from possible malfunctions. The operation of the Servomotor can be checked with this test regardless of whether the Servomotor is actually connected or not.

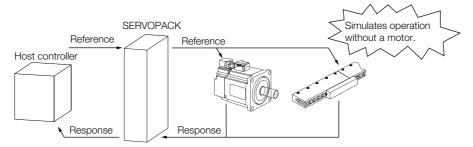

Use $Pn00C = n \square \square \square \square X$ to enable or disable the test without a motor.

Parameter		Meaning	When Enabled	Classification
Pn00C	n.□□□0 (default setting)	Disable tests without a motor.	After restart	Setup
	n.□□□1	Enable tests without a motor.		

Information

- While the test without a motor is being executed, the display on the Panel Operate will alternate between tSt and the status of the SERVOPACK.
 Refer to the following section for information SERVOPACK status displays.
 13.1.3 Status Displays on page 13-4
- An asterisk is displayed on the status display of the Digital Operator while a test without a motor is being executed.

7.6.3 Test without a Motor

Motor Information and Encoder Information

The motor and encoder information is used during tests without a motor. The source of the information depends on the device connection status.

· Rotary Servomotor

Motor Connection Status	Information That Is Used	Source of Information
Connected	Motor information • Rated motor speed • Maximum motor speed	Information in the Servomotor that is connected
Connected	Encoder informationEncoder resolutionEncoder type	Thiornation in the Servomotor that is connected
Not connected	Motor information • Rated motor speed • Maximum motor speed	 Setting of Pn000 = n.X□□□ (Rotary/Linear Servomotor Startup Selection When Encoder Is Not Connected) Rated motor speed and maximum motor speed The values previously saved in the SERVOPACK will be used for the rated motor speed and maximum motor speed. Use the motor displays (Un020: Rated Motor Speed and Un021: Maximum Motor Speed) to check the values.
	Encoder information • Encoder resolution • Encoder type	 Encoder resolution: Setting of Pn00C = n.□□X□ (Encoder Resolution for Tests without a Motor) Encoder type: Setting of Pn00C = n.□X□□ (Encoder Type Selection for Tests without a Motor)

If you use fully-closed loop control, the external encoder information is also used.

External Encoder Connection Status	Information That Is Used	Source of Information
Connected	External encoder information	Information in the external encoder that is connected
Not connected	ResolutionEncoder type	Resolution: 256 Encoder type: Incremental encoder

· Linear Servomotors

Motor Connection Status	Information That Is Used	Source of Information
	Motor information	Information in the motor that is connected
Connected	Linear encoder information Resolution Encoder pitch Encoder type	Information in the linear encoder that is connected
	Motor information	Setting of Pn000 = n.X□□□ (Rotary/Linear Servomotor Startup Selection When Encoder Is Not Connected)
Not connected	Linear encoder information Resolution Encoder pitch Encoder type	 Resolution: 256 Encoder pitch: Setting of Pn282 (Linear Encoder Scale Pitch) Encoder type: Setting of Pn00C = n.□X□□ (Encoder Type Selection for Tests without a Motor)

After restart

Setup

Related Parameters

0 to 6,553,600

Parameter		Meaning			When Enabl	ed	Classification
Pn000	n.0□□□ (default setting)	When an encoder is not connected, start as SERVOPACK for Rotary Servomotor.			After restart Setup		
n.1□□□ When an encoder is not connected, SERVOPACK for Linear Servomotor.				rt as	Alter restar	ι	Setup
	Linear Encoder S	ear Encoder Scale Pitch			Speed	osi	tion Force
Pn282	Setting Range	Setting Unit	Default Setting	Whe	en Enabled	(Classification

0

0.01 μm

Parameter		Meaning	When Enabled	Classification
Pn00C	n.□□0□ (default setting)	Use 13 bits as encoder resolution for tests without a motor.		Setup
	n.□□1□	Use 20 bits as encoder resolution for tests without a motor.		
	n.□□2□	Use 22 bits as encoder resolution for tests without a motor.	After restart	
	n.□□3□	Use 24 bits as encoder resolution for tests without a motor.	Alter restart	
	n.□0□□ (default setting)	Use an incremental encoder for tests without a motor.		
	n.□1□□	Use an absolute encoder for tests without a motor.		

Motor Position and Speed Responses

For a test without a motor, the following responses are simulated for references from the host controller according to the gain settings for position or speed control.

- Servomotor position
- Motor speed
- External encoder position

The load model will be for a rigid system with the moment of inertia ratio that is set in Pn103.

7.6.3 Test without a Motor

Restrictions

The following functions cannot be used during the test without a motor.

- Regeneration and dynamic brake operation
- Brake output signal
- Items marked with "x" in the following utility function table

SigmaWin+		Panel O	perator or Digital Operator	Execu	table?	
Button in Menu Dialog Box	SigmaWin+ Function Name	Fn No.	Utility Function Name	Motor Not Connected	Motor Connected	Reference
	Initialize *1	Fn005	Initializing Parameters	0	0	page 5-11
	Software Reset	Fn030	Software Reset	0	0	page 6-97
		Fn011	Display Servomotor Model	0	0	
Basic Functions		Fn012	Display Software Version	0	0	
	Product Information	Fn01E	Display SERVOPACK and Servomotor IDs	0	0	page 9-2
		Fn01F	Display Servomotor ID from Feedback Option Module	0	0	
	Reset Absolute Encoder	Fn008	Reset Absolute Encoder	×	0	page 5-52
Encoder	Multi-turn Limit Setup	Fn013	Multiturn Limit Setting after Multiturn Limit Disagreement Alarm	×	0	page 6-85
Setting	Search Origin*2	Fn003	Origin Search	0	0	page 7-25
	Zero Point Position Setting	Fn020	Set Absolute Linear Encoder Origin	×	0	page 5-55
	Polarity Detection	Fn080	Polarity Detection	×	×	page 5-30
	Display Alarm	Fn000	Display Alarm History	0	0	page 12-42
T		Fn006	Clear Alarm History	0	0	page 12-43
Trouble- shooting		Fn014	Reset Option Module Configuration Error	0	0	page 12-44
	Reset Motor Type Alarm	Fn021	Reset Motor Type Alarm	0	0	page 12-46
	Jog	Fn002	Jog	0	0	page 7-7
Operation	Program JOG Operation	Fn004	Jog Program	0	0	page 7-20
	Tuning - Autotuning without Host Reference	Fn201	Advanced Autotuning without Reference	×	×	page 8-24
	Tuning - Autotuning with Host Reference	Fn202	Advanced Autotuning with Reference	×	×	page 8-35
	Tuning - Custom Tuning	Fn203	One-Parameter Tuning	×	×	page 8-42
Tuning	Tuning - Custom Tuning - Adjust Anti-reso- nance Control	Fn204	Adjust Anti-resonance Control	×	×	page 8-51
	Tuning - Custom Tuning - Vibration Suppres- sion	Fn205	Vibration Suppression	×	×	page 8-56
	Response Level Set- ting	Fn200	Tuning-less Level Set- ting	×	×	page 8-12
Diagnostic	Easy FFT	Fn206	Easy FFT	×	X Continued or	page 8-95

Continued on next page.

Continued from previous page.

(SigmaWin+		perator or Digital Operator	Execu	table?	
Button in Menu Dialog Box	SigmaWin+ Function Name	Fn No.	Utility Function Name	Motor Not Connected	Motor Connected	Reference
	Adjust the Speed and Torque Reference Offset	Fn009	Autotune Analog (Speed/ Torque) Refer- ence Offset	0	0	page 6-20, page 6-41
		Fn00A	Manually Adjust Speed Reference Offset	0	0	page 6-22
		Fn00B	Manually Adjust Torque Reference Offset	0	0	page 6-43
	Adjust the Analog Monitor Output	Fn00C	Adjust Analog Monitor Output Offset	0	0	page 9-10
Others		Fn00D	Adjust Analog Monitor Output Gain	0	0	page 9-10
	Adjust the Motor Current Detection Offsets	Fn00E	Autotune Motor Cur- rent Detection Signal	×	0	
		Fn00F	Manually Adjust Motor Current Detection Sig- nal Offset	×	0	page 6-103
	Initialize Vibration Detection Level	Fn01B	Initialize Vibration Detection Level	×	×	page 6-99
	Write Prohibited Set- ting	Fn010	Write Prohibition Set- ting	0	0	page 5-8

^{*1.} An Initialize Button will be displayed in the Parameter Editing Dialog Box.

^{*2.} Cannot be used when connecting a Linear Servomotor.

This chapter provides information on the flow of tuning, details on tuning functions, and related operating procedures.

8.1	Overv	view and Flow of Tuning8-4
	8.1.1 8.1.2	Tuning Functions 8-5 Diagnostic Tool
8.2	Monit	toring Methods8-7
8.3	Preca	autions to Ensure Safe Tuning8-8
	8.3.1 8.3.2 8.3.3	Overtravel Settings
	8.3.5	Setting the Position Deviation Overflow Alarm Level at Servo ON 8-10
8.4	Tunin	g-less Function8-12
	8.4.1 8.4.2 8.4.3 8.4.4 8.4.5 8.4.6	Application Restrictions
8.5	Estim	ating the Moment of Inertia8-16
	8.5.1 8.5.2 8.5.3 8.5.4	Outline 8-16 Restrictions 8-17 Applicable Tools 8-17 Operating Procedure 8-18

8.6	Autot	uning without Host Reference8-24
	8.6.1 8.6.2 8.6.3 8.6.4 8.6.5	Outline
	8.6.6 8.6.7	without a Host Reference
8.7	Autot	uning with a Host Reference 8-35
	8.7.1 8.7.2 8.7.3 8.7.4 8.7.5 8.7.6 8.7.7	Outline
8.8	Custo	om Tuning
	8.8.1 8.8.2 8.8.3 8.8.4 8.8.5 8.8.6 8.8.7	Outline
8.9	Anti-F	Resonance Control Adjustment 8-51
	8.9.1 8.9.2 8.9.3 8.9.4 8.9.5 8.9.6	Outline
8.10	Vibrat	tion Suppression8-56
	8.10.1 8.10.2 8.10.3 8.10.4 8.10.5 8.10.6	Outline8-56Preparations8-57Applicable Tools8-57Operating Procedure8-57Setting Combined Functions8-59Related Parameters8-59
8.11	Speed	d Ripple Compensation 8-60
	8.11.1 8.11.2 8.11.3	Outline

8.12	Addit	ional Adjustment Functions8-66
	8.12.1 8.12.2 8.12.3 8.12.4 8.12.5 8.12.6 8.12.7 8.12.8	Gain Switching8-66Friction Compensation8-70Gravity Compensation8-71Current Control Mode Selection8-73Current Gain Level Setting8-73Speed Detection Method Selection8-74Speed Feedback Filter8-74Proportional Control (P Control)8-74
8.13	Manu	al Tuning8-76
	8.13.1 8.13.2	Tuning the Servo Gains
8.14	Diagn	ostic Tools8-93
	8.14.1 8.14.2	Mechanical Analysis 8-93 Easy FFT

8.1


Overview and Flow of Tuning

Tuning is performed to optimize response by adjusting the servo gains in the SERVOPACK.

The servo gains are set using a combination of parameters, such as parameters for the speed loop gain, position loop gain, filters, friction compensation, and moment of inertia ratio. These parameters influence each other, so you must consider the balance between them.

The servo gains are set to stable settings by default. Use the various tuning functions to increase the response even further for the conditions of your machine.

The basic tuning procedure is shown in the following flowchart. Make suitable adjustments considering the conditions and operating requirements of your machine.

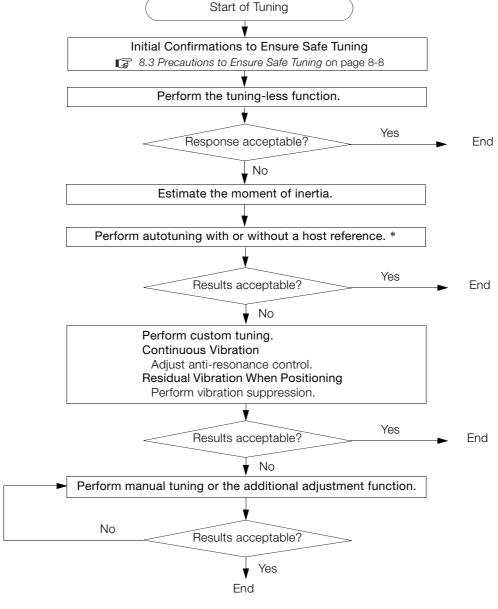

^{*} If possible, perform autotuning with a host reference.

If a host controller is not available, set an operation pattern that is as close as possible to the host reference and perform autotuning without a host reference.

If an operation pattern that is close to the host reference is not possible, perform autotuning with a host reference while performing program jogging.

8.1.1 Tuning Functions

The following table provides an overview of the tuning functions.

Tuning Function	Outline	Applicable Control Methods	Reference
Tuning-less Function	This automatic adjustment function is designed to enable stable operation without servo tuning. This function can be used to obtain a stable response regardless of the type of machine or changes in the load. You can use it with the default settings.	Speed control or position control	page 8-12
Moment of Inertia Estimation	The moment of inertia ratio is calculated by operating the Servomotor a few times. The moment of inertia ratio that is calculated here is used in other tuning functions.	Speed control, position control, or torque control	page 8-16
Autotuning without Host Reference	The following parameters are automatically adjusted in the internal references in the SERVO-PACK during automatic operation. • Gains (e.g., position loop gain and speed loop gain) • Filters (torque reference filter and notch filters) • Friction compensation • Anti-resonance control • Vibration suppression	Speed control or position control	page 8-24
Autotuning with Host Reference	The following parameters are automatically adjusted with the position reference input from the host controller while the machine is in operation. You can use this function for fine-tuning after you perform autotuning without a host reference. • Gains (e.g., position loop gain and speed loop gain) • Filters (torque reference filter and notch filters) • Friction compensation • Anti-resonance control • Vibration suppression	Position control	page 8-35
Custom Tuning	The following parameters are adjusted with the position reference or speed reference input from the host controller while the machine is in operation. • Gains (e.g., position loop gain and speed loop gain) • Filters (torque reference filter and notch filters) • Friction compensation • Anti-resonance control	Speed control or position control	page 8-42
Anti-resonance Control Adjustment	This function effectively suppresses continuous vibration.	Speed control or position control	page 8-51
Vibration Suppression	This function effectively suppresses residual vibration if it occurs when positioning.	Position control	page 8-56
Speed Ripple Compensation	This function reduces the ripple in the motor speed.	Speed control, position control, or torque control	page 8-60
Additional Adjustment Function	This function combines autotuning with custom tuning. You can use it to improve adjustment results.		page 8-66
Manual Tuning	You can manually adjust the servo gains to adjust the response.	Speed control, position control, or torque control	page 8-76

8.1.2 Diagnostic Tool

8.1.2 Diagnostic Tool

You can use the following tools to measure the frequency characteristics of the machine and set notch filters.

Diagnostic Tool	Outline	Applicable Control Methods	Reference
Mechanical Analysis	The machine is subjected to vibration to detect resonance frequencies. The measurement results are displayed as waveforms or numeric data.	Speed control, position control, or torque control	page 8-93
Easy FFT	The machine is subjected to vibration to detect resonance frequencies. The measurement results are displayed only as numeric data.	Speed control, position control, or torque control	page 8-95

8.2

Monitoring Methods

You can use the data tracing function of the SigmaWin+ or the analog monitor signals of the SERVOPACK for monitoring. If you perform custom tuning or manual tuning, always use the above functions to monitor the machine operating status and SERVOPACK signal waveform while you adjust the servo gains.

Check the adjustment results with the following response waveforms.

• Position Control

Item	Unit		
iteiii	Rotary Servomotor	Linear Servomotor	
Torque reference	%		
Feedback speed	min ⁻¹	mm/s	
Position reference speed	min ⁻¹	mm/s	
Position deviation	Reference units		

• Speed Control

Item	Unit		
Item	Rotary Servomotor	Linear Servomotor	
Torque reference	%		
Feedback speed	min ⁻¹	mm/s	
Reference speed	min ⁻¹	mm/s	

• Torque Control

Item	Unit		
	Rotary Servomotor	Linear Servomotor	
Torque reference	%		
Feedback speed	min ⁻¹ mm/s		

8.3.1 Overtravel Settings

8.3

Precautions to Ensure Safe Tuning

CAUTION

- Observe the following precautions when you perform tuning.
 - Do not touch the rotating parts of the motor when the servo is ON.
 - Before starting the Servomotor, make sure that an emergency stop can be performed at any time.
 - Make sure that trial operation has been successfully performed without any problems.
 - Provide an appropriate stopping device on the machine to ensure safety.

Perform the following settings in a way that is suitable for tuning.

8.3.1 Overtravel Settings

Overtravel settings are made to force the Servomotor to stop for a signal input from a limit switch when a moving part of the machine exceeds the safe movement range.

Refer to the following section for details.

5.12 Overtravel and Related Settings on page 5-31

8.3.2 Torque Limit Settings

You can limit the torque that is output by the Servomotor based on calculations of the torque required for machine operation. You can use torque limits to reduce the amount of shock applied to the machine when problems occur, such as collisions or interference. If the torque limit is lower than the torque that is required for operation, overshooting or vibration may occur.

Refer to the following section for details.

6.11 Selecting Torque Limits on page 6-64

8.3.3 Setting the Position Deviation Overflow Alarm Level

The position deviation overflow alarm is a protective function that is enabled when the SERVO-PACK is used in position control.

If the alarm level is set to a suitable value, the SERVOPACK will detect excessive position deviation and will stop the Servomotor if the Servomotor operation does not agree with the reference

The position deviation is the difference between the position reference value and the actual position.

You can calculate the position deviation from the position loop gain (Pn102) and the motor speed with the following formula.

Rotary Servomotors

Position deviation [reference units] =
$$\frac{\text{Motor speed [min}^{-1}]}{60} \times \frac{\text{Encoder resolution}^{*1}}{\text{Pn102 [0.1/s]/10}^{*2,*3}} \times \frac{\text{Pn210 pn20E}}{\text{Pn20E}}$$

Linear Servomotors

$$\text{Position deviation [reference units]} = \frac{\text{Motor speed [mm/s]}}{\text{Pn102 [0.1/s]/10}^{*2, *3}} \times \frac{\text{Resolution}}{\text{Linear encoder pitch [μm]/1,000}} \times \frac{\text{Pn210}}{\text{Pn20E}}$$

Position Deviation Overflow Alarm Level (Pn520) [setting unit: reference units]

Rotary Servomotors

$$Pn520 > \frac{\text{Maximum motor speed [min^-1]}}{60} \times \frac{\text{Encoder resolution}^{*1}}{Pn102 [0.1/s]/10^{*2,*3}} \times \frac{Pn210}{Pn20E} \times \underbrace{\frac{(1.2 \text{ to } 2)^{*4}}{Pn20E}}$$

Linear Servomotors

$$Pn520 > \frac{\text{Maximum motor speed [mm/s]}}{Pn102 \ [0.1/s]/10^{*2, *3}} \times \frac{\text{Resolution}}{\text{Linear encoder pitch [µm]/1,000}} \times \frac{Pn210}{Pn20E} \times \frac{(1.2 \text{ to } 2)^{*4}}{Pn20E} \times \frac{(1.2 \text{ to } 2)^$$

*1. Refer to the following section for details.

5.16 Electronic Gear Settings on page 5-46

- *2. When model following control (Pn140 = n.□□□1) is enabled, use the setting of Pn141 (Model Following Control Gain) instead of the setting of Pn102 (Position Loop Gain).
- *3. To check the setting of Pn102 on the Digital Operator, change the parameter display setting to display all parameters (Pn00B = n.□□□1).
- *4. The underlined coefficient "× (1.2 to 2)" adds a margin to prevent an A.d00 alarm (Position Deviation Overflow) from occurring too frequently.

If you set a value that satisfies the formula, an A.d00 alarm (Position Deviation Overflow) should not occur during normal operation.

If the Servomotor operation does not agree with the reference, position deviation will occur, an error will be detected, and the Servomotor will stop.

The following calculation example uses a Rotary Servomotor with a maximum motor speed of

6,000 and an encoder resolution of 16,777,216 (24 bits). Pn102 is set to 400. $\frac{Pn210}{Pn20E} = \frac{1}{16}$

$$Pn520 = \frac{6,000}{60} \times \frac{16,777,216}{400/10} \times \frac{1}{16} \times 2$$
$$= 2,621,440 \times 2$$

= 5,242,880 (default setting of Pn520)

If the acceleration/deceleration rate required for the position reference exceeds the tracking capacity of the Servomotor, the tracking delay will increase and the position deviation will no longer satisfy the above formulas. If this occurs, lower the acceleration/deceleration rate so that the Servomotor can follow the position reference or increase the position deviation over-flow alarm level.

Related Parameters

	Position Deviation Overflow Alarm Level			Position		
Pn520	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	1 to 1,073,741,823	1 reference unit	5,242,880	Immediately	Setup	
	Position Deviation Overflow Warning Level			Position		
Pn51E	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 100	1%	100	Immediately	Setup	

Related Alarms

Alarm Number	Alarm Name	Alarm Meaning
A.d00	Position Deviation Overflow	This alarm is displayed when the position deviation exceeds the setting of Pn520 (Position Deviation Overflow Alarm Level).

Related Warnings

Warning Number	Warning Name	Warning Meaning
A.900	Position Deviation Overflow	This warning occurs if the position deviation exceeds the specified percentage (Pn520 \times Pn51E/100).

8.3.4 Vibration Detection Level Setting

You can set the vibration detection level (Pn312) to more accurately detect A.520 alarms (Vibration Alarm) and A.911 warnings (Vibration) when vibration is detected during machine operation.

Set the initial vibration detection level to an appropriate value. Refer to the following section for details.

6.15 Initializing the Vibration Detection Level on page 6-99

8.3.5 Setting the Position Deviation Overflow Alarm Level at Servo ON

If the servo is turned ON when there is a large position deviation, the Servomotor will attempt to return to the original position to bring the position deviation to 0, which may create a hazardous situation. To prevent this, you can set a position deviation overflow alarm level at servo ON to restrict operation.

The related parameters and alarms are given in the following tables.

Related Parameters

	Position Deviation Overflow Alarm Level at Servo ON			Position		
Pn526	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	1 to 1,073,741,823	1 reference unit	5,242,880	Immediately	Setup	
	Position Deviation Overflow Warning Level at Servo ON			Posit	ion	
Pn528	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 100	1%	100	Immediately	Setup	

· Rotary Servomotors

	Speed Limit Level a	at Servo ON	Position	on	
Pn529	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 min ⁻¹	10,000	Immediately	Setup

· Linear Servomotors

Speed Limit Level at Servo ON				Position	on
Pn584	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 mm/s	10,000	Immediately	Setup

Related Alarms

Alarm Number	Alarm Name	Alarm Meaning
A.d01 Overflow Alarm at		This alarm occurs if the servo is turned ON after the position deviation exceeded the setting of Pn526 (Position Deviation Overflow Alarm Level at Servo ON) while the servo was OFF.
A.d02	Position Deviation Overflow Alarm for Speed Limit at Servo ON	If position deviation remains in the deviation counter, the setting of Pn529 or Pn584 (Speed Limit Level at Servo ON) will limit the speed when the servo is turned ON. This alarm occurs if reference pulses are input and the setting of Pn520 (Position Deviation Overflow Alarm Level) is exceeded.

Refer to the following section for information on troubleshooting alarms.

12.2.3 Resetting Alarms on page 12-41

8.3.5 Setting the Position Deviation Overflow Alarm Level at Servo ON

Related Warnings

Warning Number	Warning Name	Warning Meaning	
A.901	Position Deviation Overflow Warning at Servo ON	This warning occurs if the servo is turned ON while the position deviation exceeds the specified percentage (Pn526 × Pn528/100).	

8.4.1 Application Restrictions

8.4

Tuning-less Function

The tuning-less function performs autotuning to obtain a stable response regardless of the type of machine or changes in the load. Autotuning is started when the servo is turned ON.

CAUTION

- The tuning-less function is disabled during torque control.
- The Servomotor may momentarily emit a sound or vibrate the first time the servo is turned ON after the Servomotor is connected to the machine.
 This sound is caused by setting the automatic notch filter. It does not indicate a problem.
 However, if this sound or vibration continues, manually set a function to suppress vibration (e.g., a notch filter).
- The Servomotor may vibrate if it exceeds the allowable load moment of inertia. If that occurs, set the tuning-less load level to 2 (Pn170 = n.2□□□) or reduce the tuning-less rigidity level (Pn170 = n.□X□□).
- To ensure safety, make sure that you can perform an emergency stop at any time when you execute the tuning-less function.

8.4.1 Application Restrictions

The following application restrictions apply to the tuning-less function.

Function	Executable?	Remarks
Vibration Detection Level Initialization	0	-
Moment of Inertia Estimation	×	Disable the tuning-less function (Pn170 = n.□□□0) before you execute moment of inertia estimation.
Autotuning without Host Reference	×	Disable the tuning-less function (Pn170 = n.□□□0) before you execute autotuning without a host reference.
Autotuning with Host Reference	×	-
Custom Tuning	×	-
Anti-Resonance Control Adjustment	×	-
Vibration Suppression	×	-
Easy FFT	0	The tuning-less function is disabled while you execute Easy FFT and then it is enabled when Easy FFT has been completed.
Friction Compensation	×	-
Gain Selection	×	-
Mechanical Analysis	0	The tuning-less function is disabled while you execute mechanical analysis and then it is enabled when mechanical analysis has been completed.

^{*} O: Yes x: No

8.4.2 Operating Procedure

The tuning-less function is enabled in the default settings. No specific procedure is required. You can use the following parameter to enable or disable the tuning-less function.

Parameter		Meaning	When Enabled	Classification
n.□□□1 (default s	n.□□□0	Disable tuning-less function.		
	n.□□□1 (default setting)	Enable tuning-less function.		
	n.□□0□ (default setting)	Use for speed control.	After restart	Setup
	n.0010	Use for speed control and use host controller for position control.		

When you enable the tuning-less function, you can select the tuning-less type. Normally, set Pn14F to $n.\Box\Box2\Box$ (Use tuning-less type 3) (default setting). If compatibility with previous models is required, set Pn14F to $n.\Box\Box0\Box$ (Use tuning-less type 1) or $n.\Box\Box1\Box$ (Use tuning-less type 2).

Parameter		Meaning	When Enabled	Classification
	n.□□0□	Use tuning-less type 1.		
Pn14F	n.□□1□	Use tuning-less type 2. (The noise level is improved more than with tuning-less type 1.)	After restart	Tuning
	n.□□2□ (default setting)	Use tuning-less type 3.		

Tuning-less Level Settings

If vibration or other problems occur, change the tuning-less levels. To change the tuning-less levels, use the SigmaWin+.

Preparations

Always check the following before you set the tuning-less levels.

- The tuning-less function must be enabled (Pn170 = n.□□□1).
- The test without a motor function must be disabled (Pn00C = n.□□□0).

Procedure

Use the following procedure to set the tuning-less levels.

In addition to the following procedure, you can also set the parameters directly. Refer to *Related Parameters*, below, for the parameters to set.

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- 2. Select Response Level Setting in the Menu Dialog Box. The Tuning-less Level Setting-Adj Dialog Box will be displayed.

8.4.3 Troubleshooting Alarms

3. Click the ▲ or ▼ Button to adjust the tuning-less level setting. Increase the tuning-less level setting to increase the response. Decrease the tuning-less level setting to suppress vibration.

The default response level setting is 4.

Tuning-less Level	Description	Remarks
7	Response level: High	V
6		Tyou cannot select these levels if tuning-less type 1 or 2
5		
4 (default setting)		
3		
2]-
1		
0	Response level: Low	

4. Click the Completed Button.

The adjustment results will be saved in the SERVOPACK.

Related Parameters

■ Tuning-less Rigidity Level

If you use tuning-less type 1 or 2 (Pn14F = n. $\square\square$ 0 \square 0 or n. \square 1 \square 1), set the tuning-less level to between 0 and 4 (Pn170 = n. \square 0 \square 1 to n. \square 4 \square 1). Do not set the tuning-less level to between 5 and 7 (Pn170 = n. \square 5 \square 1 to n. \square 7 \square 1).

Parameter		Description		When Enabled	Classification
	n.□0□□	Tuning-less rigidity level 0 (low rigi	dity)		
	n.🗆 1 🗆 🗆	Tuning-less rigidity level 1	7		
	n.□2□□	Tuning-less rigidity level 2	1		
	n.□3□□	Tuning-less rigidity level 3			
Pn170	n.□4□□ (default setting)	Tuning-less rigidity level 4		Immediately	Setup
	, , ,				
	n.□5□□	Tuning-less rigidity level 5			
	n.□6□□	Tuning-less rigidity level 6	1		
	n.0700	Tuning-less rigidity level 7 (high rig	jidity)		

■ Tuning-less Load Level

Parameter		Description	When Enabled	Classification
	n.0□□□	Tuning-less load level 0		
Pn170	n.1□□□ (default setting)	Tuning-less load level 1	Immediately	Setup
	n.2000	Tuning-less load level 2		

8.4.3 Troubleshooting Alarms

An A.521 alarm (Autotuning Alarm) will occur if a resonant sound occurs or if excessive vibration occurs during position control. If an alarm occurs, implement the following measures.

- · Resonant Sound
 - Decrease the setting of Pn170 = $n.X\square\square\square$ or the setting of Pn170 = $n.\square X\square\square$.
- Excessive Vibration during Position Control Increase the setting of Pn170 = n.X□□□ or decrease the setting of Pn170 = n.□X□□.

0

8.4.4 Parameters Disabled by Tuning-less Function

When the tuning-less function is enabled (Pn170 = $n.\Box\Box\Box$ 1) (default setting), the parameters in the following table are disabled.

Item	Parameter Name	Parameter Number
Gain-Related Parameters	Speed Loop Gain Second Speed Loop Gain	Pn100 Pn104
	Speed Loop Integral Time Constant Second Speed Loop Integral Time Constant	Pn101 Pn105
	Position Loop Gain Second Position Loop Gain	Pn102 Pn106
	Moment of Inertia Ratio	Pn103
Advanced Control-Related	Friction Compensation Function Selection	Pn408 = n.X□□□
Parameters	Anti-Resonance Control Selection	Pn160= n.□□□X
Gain Selection-Related Parameters	Gain Switching Selection	Pn139= n.□□□X

The tuning-less function is disabled during torque control, Easy FFT, and mechanical analysis for a vertical axis. The gain-related parameters in the above table are enabled for torque control, Easy FFT, and mechanical analysis. Of these, Pn100, Pn103, and Pn104 are enabled for torque control.

8.4.5 Automatically Adjusted Function Setting

You can also automatically adjust notch filters.

Normally, set Pn460 to n. \$\sim 1 \subseteq \text{ (Adjust automatically) (default setting). Vibration is automatically detected and a notch filter is set.

Set Pn460 to n. $\square 0 \square \square$ (Do not adjust automatically) only if you do not change the setting of the notch filter before you execute the tuning-less function.

Parameter		Meaning	When Enabled	Classification
n.□0□□	n.□0□□	Do not adjust the second stage notch filter automatically when the tuning-less function is enabled or during execution of autotuning without a host reference, autotuning with a host reference, and custom tuning.	Immediately	Tuning
111400	n.□1□□ (default setting)	Adjust the second stage notch filter automatically when the tuning-less function is enabled or during execution of autotuning without a host reference, autotuning with a host reference, and custom tuning.	immediately	Turning

8.4.6 Related Parameters

The following parameters are automatically adjusted when you execute the tuning-less function.

Do not manually change the settings of these parameters after you have enabled the tuningless function.

Parameter	Name
Pn401	First Stage First Torque Reference Filter Time Constant
Pn40A	First Stage Notch Filter Q Value
Pn40C	Second Stage Notch Filter Frequency
Pn40D	Second Stage Notch Filter Q Value

8.5.1 Outline

8.5

Estimating the Moment of Inertia

This section describes how the moment of inertia is calculated.

The moment of inertia ratio that is calculated here is used in other tuning functions. You can also estimate the moment of inertia during autotuning without a host reference. Refer to the following section for the procedure.

8.6.4 Operating Procedure on page 8-26

8.5.1 Outline


The moment of inertia during operation is automatically calculated by the SERVOPACK for round-trip (forward and reverse) operation. A reference from the host controller is not used.

The moment of inertia ratio (i.e., the ratio of the load moment of inertia to the motor moment of inertia) is a basic parameter for adjusting gains. It must be set as accurately as possible.

Although the load moment of inertia can be calculated from the weight and structure of the mechanisms, doing so is very troublesome and calculating it accurately can be very difficult with the complex mechanical structures that are used these days. With an estimate of the moment of inertia, you can obtain an accurate load moment of inertia simply by running the Servomotor in the actual system in a forward and reverse direction a few times.

The Servomotor is operated with the following specifications.

- Maximum speed: ±1,000 min⁻¹ (can be changed)
- Acceleration rate: ±20,000 min⁻¹/s (can be changed)
- Travel distance: ±2.5 rotations max. (can be changed)

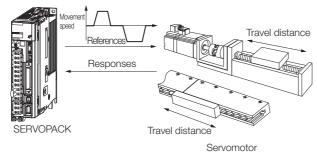

Note: Execute moment of inertia estimation after jogging to a position that ensures a suitable range of motion.

8.5.2 Restrictions

The following restrictions apply to estimating the moment of inertia.

Systems for which Execution Cannot Be Performed

- When the machine system can move only in one direction
- When the range of motion is 0.5 rotations or less

Systems for Which Adjustments Cannot Be Made Accurately

- When a suitable range of motion is not possible
- When the moment of inertia changes within the set operating range
- When the machine has high dynamic friction
- When the rigidity of the machine is low and vibration occurs when positioning is performed
- · When the position integration function is used
- When proportional control is used

Note: If you specify calculating the moment of inertia, an error will occur if the /P-CON (Proportional Control) signal changes to specify the proportional action during moment of inertia estimation.

When mode switching is used

Note:If you specify moment of inertia estimation, mode switching will be disabled and PI control will be used while the moment of inertia is being calculated. Mode switching will be enabled after moment of inertia estimation has been completed.

When speed feedforward or torque feedforward is input

Preparations

Always check the following before you execute moment of inertia estimation.

- The main circuit power supply must be ON.
- There must be no overtravel.
- The servo must be OFF.
- The control method must not be set to torque control.
- The gain selection switch must be set to manual gain selection (Pn139 = n.□□□□0).
- The first gains must be selected.
- The test without a motor function must be disabled (Pn00C = n.□□□□0).
- There must be no alarms or warnings.
- There must be no hard wire base block (HWBB).
- The parameters must not be write prohibited.
- The tuning-less function must be disabled (Pn170 = n.□□□0).

8.5.3 Applicable Tools

The following table lists the tools that you can use to estimate the moment of inertia.

Tool	Fn No./Function Name	Operating Procedure Reference	
Panel Operator	You cannot estimate the moment of inertia from the Panel Operator.		
Digital Operator	You cannot estimate the moment of inertia from the Digital Operator.		
SigmaWin+	Tuning - Tuning		

8.5.4 Operating Procedure


Use the following procedure to estimate the moment of inertia ratio.

MARNING

- Estimating the moment of inertia requires operating the Servomotor and therefore presents hazards. Observe the following precautions.
 - Confirm safety around moving parts.
 This function involves automatic operation with vibration. Make sure that you can perform an emergency stop (to turn OFF the power supply) at any time. There will be movement in both directions within the set range of movement. Check the range of movement and the directions and implement protective controls for safety, such as the overtravel functions.


A CAUTION

- Be aware of the following points if you cancel the moment of inertia estimation while the Servomotor is operating.
 - If you cancel operation with the Servo OFF Button, the Servomotor will stop according to setting
 of the Servo OFF stopping method (Pn001 = n.□□□□X).
 - If you cancel operation with the Cancel Button, the Servomotor will decelerate to a stop and then enter a zero-clamped state.
- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- 2. Select Tuning in the Menu Dialog Box. The Tuning Dialog Box will be displayed. Click the Cancel Button to cancel tuning.
- 3. Click the Execute Button.

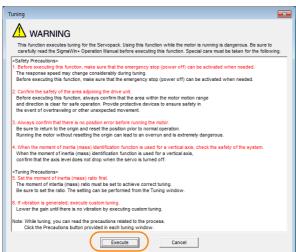


8

4. Click the Execute Button.

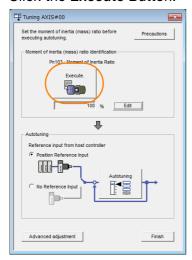

5. Set the conditions as required.

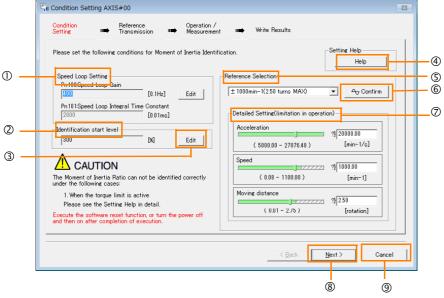

① Speed Loop Setting Area

Make the speed loop settings in this area.

If the speed loop response is too bad, it will not be possible to measure the moment of inertia ratio accurately.

The values for the speed loop response that are required for moment of inertia estimation are set for the default settings. It is normally not necessary to change these settings. If the default speed loop gain is too high for the machine (i.e., if vibration occurs), lower the setting. It is not necessary to increase the setting any farther.

2 Identification Start Level Group

This is the setting of the moment of inertia calculation starting level.

If the load is large or the machine has low rigidity, the torque limit may be applied, causing moment of inertia estimation to fail.

If that occurs, estimation may be possible if you double the setting of the start level.

3 Edit Buttons

Click the button to display a dialog box to change the settings related to the speed loop or estimation start level.

8.5.4 Operating Procedure

4 Help Button

Click this button to display guidelines for setting the reference conditions. Make the following settings as required.

- Operate the Servomotor to measure the load moment of inertia of the machine in comparison with the rotor moment of inertia.
- Set the operation mode, reference pattern (maximum acceleration rate, maximum speed, and maximum travel distance), and speed loop-related parameters.
- Correct measurement of the moment of inertia ratio may not be possible depending on the settings. Set suitable settings using the measurement results as reference.


S Reference Selection Area

Either select the reference pattern for estimation processing from the box, or set the values in the **Detailed Setting** Group. Generally speaking, the larger the maximum acceleration rate is, the more accurate the moment of inertia estimation will be.

Set the maximum acceleration range within the possible range of movement considering the gear ratio, e.g., the pulley diameters or ball screw pitch.

© Confirm Button

Click this button to display the Reference Confirmation Dialog Box.

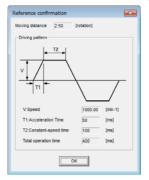

② Detailed Setting Area

You can change the settings by moving the bars or directly inputting the settings to create the required reference pattern.

® Next Button

Click this button to display the Reference Transmission Dialog Box.

Click this button to return to the Tuning Dialog Box.

CAUTION

- The travel distance is the distance for one operation in the forward or reverse direction.
 During multiple operations, the operation starting position may move in one direction or the other. Confirm the possible operating range for each measurement or operation.
- Depending on the parameter settings and the moment of inertia of the machine, overshooting may occur and may cause the maximum speed setting to be exceeded temporarily.
 Allow sufficient leeway in the settings.

Information


When Measurement Is Not Correct

Estimating the moment of inertia ratio cannot be performed correctly if the torque limit is activated. Adjust the limits or reduce the acceleration rate in the reference selection so that the torque limit is not activated.

6. Click the Next Button.

The Reference Transmission Dialog Box will be displayed.

7. Click the Start Button.

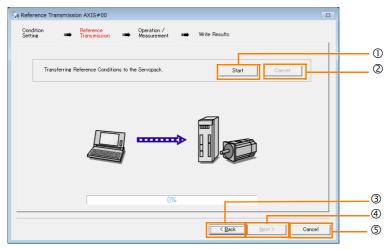

① Start Button

The reference conditions will be transferred to the SERVOPACK. A progress bar will show the progress of the transfer.

2 Cancel Button

The **Cancel** Button is enabled only while data is being transferred to the SERVOPACK. You cannot use it after the transfer has been completed.

3 Back Button

This button returns you to the Condition Setting Dialog Box. It is disabled while data is being transferred.

Mext Button

This button is enabled only when the data has been transferred correctly. You cannot use it if an error occurs or if you cancel the transfer before it is completed. Click the **Next** Button to display the Operation/Measurement Dialog Box.


S Cancel Button

This button cancels processing and returns you to the Tuning Dialog Box.

8. Click the Next Button.

The Operation/Measurement Dialog Box will be displayed.

9. Click the Servo On Button.

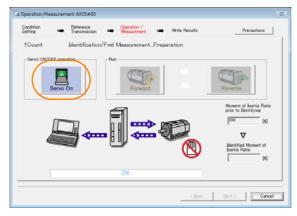

10. Click the Forward Button.

The Servomotor shaft will rotate in the forward direction and the measurement will start. After the measurement and data transfer have been completed, the **Reverse** Button will be displayed in color.

8.5.4 Operating Procedure

11. Click the Reverse Button.



The Servomotor shaft will rotate in the reverse direction and the measurement will start. After the measurement and data transfer have been completed, the **Forward** Button will be displayed in color.



12. Repeat steps 9 to 11 until the Next Button is enabled.

Measurements are performed from 2 to 7 times and then verified. The number of measurements is displayed in upper left corner of the dialog box. A progress bar at the bottom of the dialog box will show the progress of the transfer each time.


- **13.** When the measurements have been completed, click the **Servo On** Button to turn OFF the servo.
- 14. Click the Next Button.

The Write Results Dialog Box will be displayed.

Information If you click the **Next** Button before you turn OFF the servo, the following Dialog Box will be displayed. Click the **OK** Button to turn OFF the servo.



15. Click the Writing Results Button.

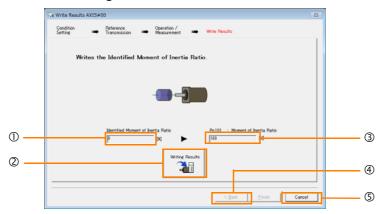

① Identified Moment of Inertia Ratio Box

The moment of inertia ratio that was found with operation and measurements is displayed here.

2 Writing Results Button

If you click this button, Pn103 (Moment of Inertia Ratio) in the SERVOPACK is set to the value that is displayed for the identified moment of inertia ratio.

3 Pn103: Moment of Inertia Ratio Box

The value that is set for the parameter is displayed here.

After you click the **Writing Results** Button, the value that was found with operation and measurements will be displayed as the new setting.


Back Button

This button is disabled.

S Cancel Button

This button will return you to the Tuning Dialog Box.

- **16.** Confirm that the **Identified Moment of Inertia Ratio** Box and the **Pn103: Moment of Inertia Ratio** Box show the same value and then click the **Finish** Button.
- 17. Click the OK Button.

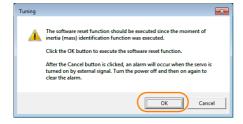

18. Click the Execute Button.



If the setting of the moment of inertia ratio (Pn103) was changed, the new value will be saved and the Tuning Dialog Box will be displayed again.

This concludes the procedure to estimate the moment of inertia ratio.

8.6.1 Outline

8.8

Autotuning without Host Reference

This section describes autotuning without a host reference.



- Autotuning without a host reference performs adjustments based on the setting of the speed loop gain (Pn100). Therefore, precise adjustments cannot be made if there is vibration when adjustments are started. Make adjustments after lowering the speed loop gain (Pn100) until vibration is eliminated.
- You cannot execute autotuning without a host reference if the tuning-less function is enabled (Pn170 = n.□□□1 (default setting)). Disable the tuning-less function (Pn170 = n.□□□0) before you execute autotuning without a host reference.
- If you change the machine load conditions or drive system after you execute autotuning without a host reference and then you execute autotuning without a host reference with moment of inertia estimation specified, use the following parameter settings. If you execute autotuning without a host reference for any other conditions, the machine may vibrate and may be damaged.

 $Pn140 = n.\Box\Box\Box$ 0 (Do not use model following control.)

 $Pn160 = n.\Box\Box\Box\Box$ (Do not use anti-resonance control.)

 $Pn408 = n.00 \square 0$ (Disable friction compensation, first stage notch filter, and second stage notch filter.)

Note: If you are using the Digital Operator and the above parameters are not displayed, change the parameter display setting to display all parameters (Pn00B = n.□□□1) and then turn the power supply OFF and ON again.

8.6.1 Outline

For autotuning without a host reference, operation is automatically performed by the SERVO-PACK for round-trip (forward and reverse) operation to adjust for machine characteristics during operation. A reference from the host controller is not used.

The following items are adjusted automatically.


- · Moment of inertia ratio
- Gains (e.g., speed loop gain and position loop gain)
- Filters (torque reference filter and notch filters)
- Friction compensation
- · Anti-resonance control
- Vibration suppression (only for mode 2 or 3)

Refer to the following section for details on the parameters that are adjusted.


8.6.7 Related Parameters on page 8-34

The Servomotor is operated with the following specifications.

Maximum speed	Rated motor speed $\times \frac{2}{3}$		
Acceleration Torque	Rated motor torque: Approx. 100% Note: The acceleration torque depends on the setting of the moment of inertia ratio (Pn103), and the influences of machine friction and external disturbance.		
Travel Distance	Rotary Servomotors	You can set the desired travel distance. The default setting is for a value equivalent to 3 Servomotor shaft rotations.	
	Direct Drive Servomotors	You can set the desired travel distance. The default setting is for a value equivalent to 0.3 rotations.	
	Linear Servomotors	You can set the desired travel distance in increments of 1,000 reference units. (The default setting is for 90 mm.)	

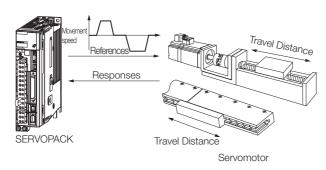

Note: Execute autotuning without a host reference after jogging to a position that ensures a suitable range of motion.

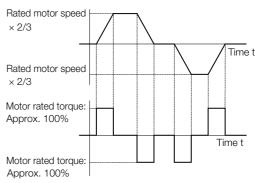

Example of Automatic Operation Pattern

WARNING

- Autotuning without a host reference requires operating the Servomotor and therefore presents hazards. Observe the following precaution.
 - Confirm safety around moving parts. This function involves automatic operation with vibration. Make sure that you can perform an emergency stop (to turn OFF the power supply) at any time. There will be movement in both directions within the set range of movement. Check the range of movement and the directions and implement protective controls for safety, such as the overtravel functions.

8.6.2 Restrictions

The following restrictions apply to autotuning without a host reference.

If you cannot use autotuning without a host reference because of these restrictions, use autotuning with a host reference or custom tuning. Refer to the following sections for details.

8.7 Autotuning with a Host Reference on page 8-35

8.8 Custom Tuning on page 8-42

Systems for Which Execution Cannot Be Performed

- When the machine system can move only in one direction
- When the range of motion is 0.5 rotations or less

Systems for Which Adjustments Cannot Be Made Accurately

- When a suitable range of motion is not possible
- · When the moment of inertia changes within the set operating range
- When the machine has high friction
- When the rigidity of the machine is low and vibration occurs when positioning is performed
- · When the position integration function is used
- When proportional control is used

Note: If you specify calculating the moment of inertia, an error will occur if the /P-CON (Proportional Control) signal changes to specify the proportional action during moment of inertia estimation.

When mode switching is used

Note: If you specify moment of inertia estimation, mode switching will be disabled and PI control will be used while the moment of inertia is being calculated. Mode switching will be enabled after moment of inertia estimation has been completed.

- When speed feedforward or torque feedforward is input
- When the positioning completed width (Pn522) is too narrow

8.6.3 Applicable Tools

Preparations

Always check the following before you execute autotuning without a host reference.

- The main circuit power supply must be ON.
- There must be no overtravel.
- The servo must be OFF.
- The control method must not be set to torque control.
- The gain selection switch must be set to manual gain selection (Pn139 = n.□□□0).
- The first gains must be selected.
- The test without a motor function must be disabled (Pn00C = n.□□□□0).
- There must be no alarms or warnings.
- There must be no hard wire base block (HWBB).
- The parameters must not be write prohibited.
- The tuning-less function must be disabled (Pn170 = n.□□□0), or the tuning-less function must be enabled (Pn170 = n.□□□1) (default setting) and moment of inertia estimation must be specified.
- If you execute autotuning without a host reference during speed control, set the mode to 1.



- If you start autotuning without a host reference while the SERVOPACK is in speed control
 for mode 2 or 3, the SERVOPACK will change to position control automatically to perform
 autotuning without a host reference. The SERVOPACK will return to speed control after
 autotuning has been completed.
- Reference pulse input multiplication switching is disabled during autotuning without a host reference.

8.6.3 Applicable Tools

The following table lists the tools that you can use to perform autotuning without a host reference.

Tool	Fn No./Function Name	Operating Procedure Reference		
Panel Operator	You cannot perform autotuning without a host reference from the Panel Operator.			
Digital Operator	Fn201	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)		
SigmaWin+	Tuning - Tuning	8.6.4 Operating Procedure on page 8-26		


8.6.4 Operating Procedure

Use the following procedure to perform autotuning without a host reference.


A CAUTION

- If you specify not estimating the moment of inertia, set the moment of inertia ratio (Pn103) correctly. If the setting greatly differs from the actual moment of inertia ratio, normal control of the machine may not be possible, and vibration may result.
- If you are using an MP3000-series Controller for phase control, set the mode selection to 1. If 2 or 3 is selected for the mode, correct phase control may not be possible.
- 1. Confirm that the moment of inertia ratio (Pn103) is set correctly.
- 2. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **3.** Select Tuning in the Menu Dialog Box. The Tuning Dialog Box will be displayed. Click the **Cancel** Button to cancel tuning.

4. Click the Execute Button.

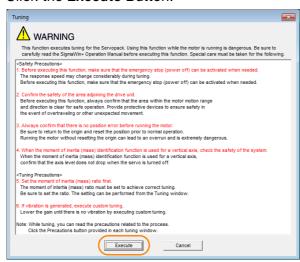

5. Select the No Reference Input Option in the Autotuning Area and then click the Autotuning Button.

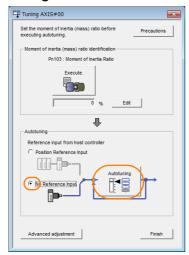


Unformation When the following dialog box is displayed, click the **OK** Button and then confirm that the correct moment of inertia ratio is set in Pn103 (Moment of Inertia Ratio).



8.6.4 Operating Procedure

6. Set the conditions in the Switching the load moment of inertia (load mass) identification Box, the Mode selection Box, the Mechanism selection Box, and the Distance Box, and then click the Next Button.

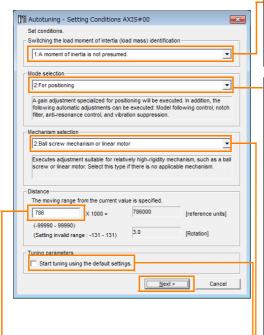

• Distance Box

Set the travel distance.

Movement range: -99,990,000 to
+99,990,000 [reference units]

Minimum setting increment for travel distance: 1,000 [reference units]

Negative values are for reverse operation and positive values are for forward operation from the current position.

Default settings:

Rotary Servomotors: Approx. 3 rotations Direct Drive Servomotors: Approx. 0.3 rotations

Linear Servomotors: Approx 90 mm Set the distance to the following values or higher. To ensure tuning precision, we recommend that you use approximately the default distance setting.

Rotary Servomotors: 0.5 rotations Direct Drive Servomotors: 0.05 rotations Linear Servomotors: 5 mm Switching the load moment of inertia (load mass) identification Box

Specify whether to estimate the moment of inertia.

0: A moment of inertia is presumed. (default setting)

1: A moment of inertia is not presumed.

• Mode selection Box

Set the mode.

Mode Selection	Description
1: Standard	Standard gain adjustment is per- formed. In addition to gain adjust- ment, notch filters and anti-resonance control are automatically adjusted.
2: For positioning	Tuning is performed for positioning applications. In addition to gain adjustment, model following control, notch filters, anti-resonance control, and vibration suppression are automatically adjusted.
3: For positioning especially to prevent overshooting	Tuning is performed for positioning applications with emphasis on eliminating overshooting. In addition to gain adjustment, notch filters, antiresonance control, and vibration suppression are automatically adjusted.

Mechanism selection Box

Select the type according to the machine element to drive.

If there is noise or if the gain does not increase, better results may be obtained by changing the rigidity type. Select the type according to the following guidelines.

Mechanism Selection	Description
1: Belt mechanism	Tuning is performed for a mechanism with relatively low rigidity, e.g., a belt.
2: Ball screw mech- anism or linear motor	Tuning is performed for a mechanism with relatively high rigidity, e.g., a ball screw or Linear Servomotor. Use this setting if there is no other appropriate setting.
3: Rigid model	Tuning is performed for a mechanism with high rigidity, e.g., a rigid body system.

• Tuning parameters Box

Specify the parameters to use for tuning. If you select the **Start tuning using the default settings** Check Box, the tuning parameters will be returned to the default settings before tuning is started.



8. Click the Start tuning Button.



8.6.4 Operating Procedure

9. Confirm safety around moving parts and click the Yes Button.



The Servomotor will start operating and tuning will be executed.

Vibration that occurs during tuning will be detected automatically and suitable settings will be made for that vibration. When the settings have been completed, the indicators for the functions that were used will light at the lower left of the dialog box.



10. When tuning has been completed, click the **Finish** Button.

The results of tuning will be set in the parameters and you will return to the Tuning Dialog Box.

This concludes the procedure to perform autotuning without a host reference.

8.6.5 Troubleshooting Problems in Autotuning without a Host Reference

The following tables give the causes of and corrections for problems that may occur in autotuning without a host reference.

◆ Autotuning without a Host Reference Was Not Performed

Possible Cause	Corrective Action
Main circuit power supply is OFF.	Turn ON the main circuit power supply.
An alarm or warning occurred.	Remove the cause of the alarm or warning.
Overtraveling occurred.	Remove the cause of overtraveling.
The second gains were selected with the gain selection.	Disable automatic gain switching.
The HWBB was activated.	Release the HWBB.
The setting of the travel distance is too small.	Set the travel distance again in step 6 of the procedure.
The settings for the tuning-less function are not correct.	 Disable the tuning-less function (Pn170 = n.□□□0). Enable the tuning-less function (Pn170 = n.□□□1) and specify moment of inertia estimation.

◆ When an Error Occurs during Execution of Autotuning without a Host Reference

Error	Possible Cause	Corrective Action	
The gain adjustments were not successfully completed.	Machine vibration occurs or the positioning completion signal is not stable when the Servomotor stops.	 Increase the setting of the positioning completed width (Pn522). Change the mode from 2 to 3. If machine vibration occurs, suppress the vibration with the anti-resonance control adjustment and the vibration suppression function. 	
An error occurred during calculation of the moment of inertia.	Refer to the following section for troubleshooting information.		
Positioning was not completed within approximately 10 seconds after position adjustment was completed.	The positioning completed width is too narrow or proportional control is being used.		

◆ When an Error Occurs during Calculation of Moment of Inertia

Possible Cause	Corrective Action
The SERVOPACK started calculating the moment of inertia but the calculation was not completed.	 Increase the setting of the speed loop gain (Pn100). Increase the stroke (travel distance).
The moment of inertia fluctuated greatly and did not converge within 10 tries.	Set Pn103 (Moment of Inertia Ratio) from the machine specifications and specify not estimating the moment of inertia.
Low-frequency vibration was detected.	Double the setting of moment of inertia calculation starting level (Pn324).
The torque limit was reached.	 If you are using the torque limit, increase the torque limit. Double the setting of moment of inertia calculation starting level (Pn324).
The speed control section changed to proportional control during calculation of the moment of inertia, e.g., the /P-CON (Proportional Control) signal was input.	Use PI control when calculating the moment of inertia.

8.6.6 Automatically Adjusted Function Settings

◆ Adjustment Results Are Not Satisfactory for Position Control

You may be able to improve the adjustment results by changing the settings of the positioning completed width (Pn522) and the electronic gear ratio (Pn20E/Pn210).

If satisfactory results are still not possible, adjust the overshoot detection level (Pn561). That may improve the adjustment results.

- Pn561 = 100% (default setting)
 This will allow tuning with overshooting that is equivalent to the positioning completed width.
- Pn561 = 0%
 This will allow tuning to be performed without overshooting within the positioning completed width, but the positioning completed width may be extended.

	Overshoot Detection Level		Speed Position Torque		
Pn561	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 100	1%	100	Immediately	Setup

8.6.6 Automatically Adjusted Function Settings

You can specify whether to automatically adjust the following functions during autotuning.

◆ Automatic Notch Filters

Normally, set Pn460 to n.□1□□ (Adjust automatically) (default setting).

Vibration will be detected during autotuning without a host reference and a notch filter will be adjusted.

Set Pn460 to n. $\square 0 \square \square$ (Do not adjust automatically) only if you do not change the setting of the notch filter before you execute this function.

ı	Parameter	Function	When Enabled	Classification
	n.□□□0	Do not adjust the first stage notch filter automatically during execution of autotuning without a host reference, autotuning with a host reference, and custom tuning.	_	
	n.□□□1 (default setting)	Adjust the first stage notch filter automatically during execution of autotuning without a host reference, autotuning with a host reference, and custom tuning.		
Pn460	n.□0□□	Do not adjust the second stage notch filter automatically when the tuning-less function is enabled or during execution of autotuning without a host reference, autotuning with a host reference, and custom tuning.	Immediately	Tuning
	n.□1□□ (default setting)	Adjust the second stage notch filter automatically when the tuning-less function is enabled or during execution of autotuning without a host reference, autotuning with a host reference, and custom tuning.		

◆ Anti-Resonance Control Adjustment

This function reduces low vibration frequencies, for which the notch filters cannot be used.

Normally, set Pn160 to n. D11 (Adjust automatically) (default setting).

Vibration will be detected during autotuning without a host reference and anti-resonance control will be automatically adjusted.

Parameter		Function	When Enabled	Classification
Pn160	n.□□0□	Do not adjust anti-resonance control automatically during execution of autotuning without a host reference, autotuning with a host reference, and custom tuning.	Immediately	Tuning
FIIIOO	n.□□1□ (default setting)	Adjust anti-resonance control automatically during execution of autotuning without a host reference, autotuning with a host reference, and custom tuning.	immediately	Turning

Vibration Suppression

You can use vibration suppression to suppress transitional vibration at a low frequency from 1 Hz to 100 Hz, which is generated mainly when the machine vibrates during positioning.

Normally, set Pn140 to n.□1□□ (Adjust automatically) (default setting).

Vibration will be detected during autotuning without a host reference and vibration suppression control will be automatically set.

Set $Pn140 = n.\Box 0\Box\Box$ (Do not adjust automatically) only if you do not change the settings for vibration suppression before you execute autotuning without a host reference.

Note: Autotuning without a host reference uses model following control. Therefore, it can be executed only if the mode is set to 2 or 3.

Parameter		Function	When Enabled	Classification
Dn140	n.□0□□	Do not adjust vibration suppression automatically during execution of autotuning without a host reference, autotuning with a host reference, and custom tuning.	Immediately	Tuning
n.□1□□ de (default setting)		Adjust vibration suppression automatically during execution of autotuning without a host reference, autotuning with a host reference, and custom tuning.	inimediately	Turning

Friction Compensation

Friction compensation compensates for changes in the following conditions.

- Changes in the viscous resistance of the lubricant, such as grease, on the sliding parts of the machine
- · Changes in the friction resistance resulting from variations in the machine assembly
- · Changes in the friction resistance due to aging

The conditions for applying friction compensation depend on the mode selection.

Mode Selection Settings	Friction Compensation	
1: Standard	Based on the setting of Pn408 = n.X□□□ (Friction Compensation Function Selection)*	
2: For position control	Adjusted with friction compensation.	
3: For position control (emphasis on overshooting)		

Parameter		Function	When Enabled	Classification
n. 0□□□ (default setting) Disable friction compensation.		Disable friction compensation.	Immediately	Setup
	n. 1□□□	Enable friction compensation.		

^{*} Refer to the following section for details.

◆ Feedforward

If Pn140 is set to n.0 \(\sigma\) (Do not use model following control and speed/torque feedforward together (default setting)) and tuning is performed with the mode selection set to 2 or 3, feedforward (Pn109), the speed feedforward input (V-REF), and the torque feedforward input (T-REF) will be disabled.

To use the speed feedforward input (V-REF), the torque feedforward input (T-REF), and model following control from the host controller in the system, set Pn140 to n.1 \(\sigma\sup \square\$ (Use model following control and speed/torque feedforward together).

Parameter		Function	When Enabled	Classification
n.0□□□ (default setting		Do not use model following control and speed/torque feedforward together.	- Immediately	Tuning
1 11114	n.1000	Use model following control and speed/torque feedforward together.	IIIIIIediately	runing

Refer to the following section for information on the torque feedforward input (T-REF) and the speed feedforward input (V-REF).

Torque Feedforward and Speed Feedforward on page 8-87, ■ Speed Feedforward on page 8-89

Required Parameter Settings on page 8-70

8.6.7 Related Parameters



When model following control is used with the feedforward function, it is used to make optimum feedforward settings in the SERVOPACK. Therefore, model following control is not normally used together with either the speed feedforward input (V-REF) or torque feedforward input (T-REF) from the host controller. However, model following control can be used with the speed feedforward input (V-REF) or torque feedforward input (T-REF) if required. An unsuitable feedforward input may result in overshooting.

8.6.7 Related Parameters

The following parameters are automatically adjusted or used as reference when you execute autotuning without a host reference.

Do not change the settings while autotuning without a host reference is being executed.

Parameter	Name	Automatic Changes
Pn100	Speed Loop Gain	Yes
Pn101	Speed Loop Integral Time Constant	Yes
Pn102	Position Loop Gain	Yes
Pn103	Moment of Inertia Ratio	Yes
Pn121	Friction Compensation Gain	Yes
Pn123	Friction Compensation Coefficient	Yes
Pn124	Friction Compensation Frequency Correction	No
Pn125	Friction Compensation Gain Correction	Yes
Pn401	First Stage First Torque Reference Filter Time Constant	Yes
Pn408	Torque-Related Function Selections	Yes
Pn409	First Stage Notch Filter Frequency	Yes
Pn40A	First Stage Notch Filter Q Value	Yes
Pn40C	Second Stage Notch Filter Frequency	Yes
Pn40D	Second Stage Notch Filter Q Value	Yes
Pn140	Model Following Control-Related Selections	Yes
Pn141	Model Following Control Gain	Yes
Pn142	Model Following Control Gain Correction	Yes
Pn143	Model Following Control Bias in the Forward Direction	Yes
Pn144	Model Following Control Bias in the Reverse Direction	Yes
Pn145	Vibration Suppression 1 Frequency A	Yes
Pn146	Vibration Suppression 1 Frequency B	Yes
Pn147	Model Following Control Speed Feedforward Compensation	Yes
Pn160	Anti-Resonance Control-Related Selections	Yes
Pn161	Anti-Resonance Frequency	Yes
Pn163	Anti-Resonance Damping Gain	Yes
Pn531	Program Jogging Travel Distance	No
Pn533	Program Jogging Movement Speed for Rotary Servomotor	No
Pn585	Program Jogging Movement Speed for Linear Servomotor	No
Pn534	Program Jogging Acceleration/Deceleration Time	No
Pn535	Program Jogging Waiting Time	No
Pn536	Program Jogging Number of Movements	No

Yes: The parameter is automatically set.

No: The parameter is not automatically set, but the setting is read during execution.

Autotuning with a Host Reference

This section describes autotuning with a host reference.



Autotuning with a host reference makes adjustments based on the set speed loop gain (Pn100). Therefore, precise adjustments cannot be made if there is vibration when adjustments are started. Make adjustments after lowering the speed loop gain (Pn100) until vibration is eliminated.

8.7.1 **Outline**


Autotuning with a host reference automatically makes optimum adjustments for operation references from the host controller.

The following items are adjusted automatically.

- Gains (e.g., speed loop gain and position loop gain)
- Filters (torque reference filter and notch filters)
- Friction compensation
- Anti-resonance control
- Vibration suppression

Refer to the following section for details on the parameters that are adjusted.

8.7.7 Related Parameters on page 8-41

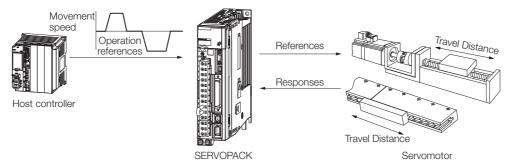

CAUTION

• Because autotuning with a host reference adjusts the SERVOPACK during automatic operation, vibration or overshooting may occur. To ensure safety, make sure that you can perform an emergency stop at any time.

8.7.2 Restrictions

Systems for Which Adjustments Cannot Be Made Accurately

Adjustments will not be made correctly for autotuning with a host reference in the following cases. Use custom tuning.

- When the travel distance for the reference from the host controller is equal to or lower than the setting of the positioning completed width (Pn522)
- Rotary Servomotors: When the movement speed for the reference from the host controller is equal to or lower than the setting of the rotation detection level (Pn502)
- Linear Servomotors: When the movement speed for the reference from the host controller is equal to or lower than the setting of the zero speed level (Pn581)
- When the time required to stop is 10 ms or less

8.7.3 Applicable Tools

- When the rigidity of the machine is low and vibration occurs when positioning is performed
- When the position integration function is used
- When proportional control is used
- When mode switching is used
- When the positioning completed width (Pn522) is too narrow

Refer to the following sections for details on custom tuning.

8.8 Custom Tuning on page 8-42

Preparations

Always check the following before you execute autotuning with a host reference.

- The servo must be in ready status.
- There must be no overtravel.
- The servo must be OFF.
- Position control must be selected if power is supplied to the motor (i.e., when the servo is ON).
- The gain selection switch must be set to manual gain selection (Pn139 = n.□□□0).
- The first gains must be selected.
- The test without a motor function must be disabled (Pn00C = n.□□□0).
- There must be no warnings.
- The tuning-less function must be disabled (Pn170 = n. □□□0).
- The parameters must not be write prohibited.

8.7.3 Applicable Tools

The following table lists the tools that you can use to perform autotuning with a host reference.

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	You cannot perform autotuning without a host reference from the Panel Operator.	
Digital Operator	Fn202	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Tuning - Tuning	8.7.4 Operating Procedure on page 8-36

8.7.4 Operating Procedure


Use the following procedure to perform autotuning with a host reference.




- If you are using an MP3000-Series Controller for phase control, set the mode selection to 1. If 2 or 3 is selected for the mode, correct phase control may not be possible.
- 1. Confirm that the moment of inertia ratio (Pn103) is set correctly.
- 2. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **3.** Select Tuning in the Menu Dialog Box. The Tuning Dialog Box will be displayed.

Click the Cancel Button to cancel tuning.

4. Click the Execute Button.

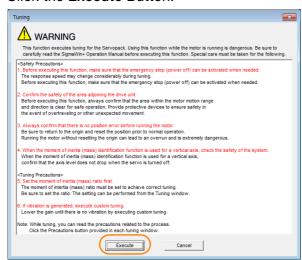

5. Select the Position reference input Option in the Autotuning Area and then click the Autotuning Button.

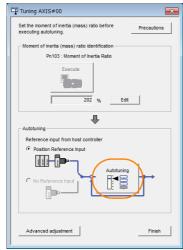


When the following dialog box is displayed, click the OK Button and then confirm that the Information correct moment of inertia ratio is set in Pn103 (Moment of Inertia Ratio).



8.7.4 Operating Procedure

6. Set the conditions in the **Mode selection** Box and the **Mechanism selection** Box, and then click the **Next** Button.

If you select the **Start tuning using the default settings** Check Box in the **Tuning parameters** Area, the tuning parameters will be returned to the default settings before tuning is started.

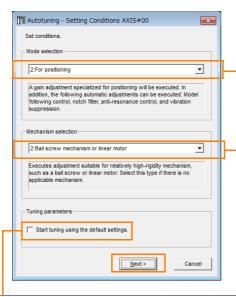

• Tuning parameters Box
Specify the parameters to use for tuning.
If you select the Start tuning using the
default settings Check Box, the tuning
parameters will be returned to the default
settings before tuning is started.

• Mode selection Box Set the mode.

Mode Selection	Description
1: Standard	Standard gain adjustment is performed. In addition to gain adjustment, notch filters and antiresonance control are automatically adjusted.
2: For positioning	Tuning is performed for positioning applications. In addition to gain adjustment, model following control, notch filters, anti-resonance control, and vibration suppression are automatically adjusted.
3: For positioning especially to prevent overshooting	Tuning is performed for positioning applications with emphasis on eliminating overshooting. In addition to gain adjustment, notch filters, antiresonance control, and vibration suppression are automatically adjusted.

Mechanism selection Box

Select the type according to the machine element to drive.

If there is noise or if the gain does not increase, better results may be obtained by changing the rigidity type. Select the type according to the following guidelines.

Mechanism Selection	Description
1: Belt mechanism	Tuning is performed for a mechanism with relatively low rigidity, e.g., a belt.
2: Ball screw mechanism or linear motor	Tuning is performed for a mechanism with relatively high rigidity, e.g., a ball screw or Linear Servomotor. Use this setting if there is no other appropriate setting.
3: Rigid model	Tuning is performed for a mechanism with high rigidity, e.g., a rigid body system.

7. Click the Yes Button.



8. Input the correct moment of inertia ratio and click the **Next** Button.



9. First confirm safety around moving parts. Then turn ON the servo, enter a reference from the host controller, and click the **Start tuning** Button.



10. Click the Yes Button.



Tuning will be executed.

Vibration that occurs during tuning will be detected automatically and suitable settings will be made for that vibration. When the settings have been completed, the indicators for the functions that were used will light at the lower left of the dialog box.



8-39

8.7.5 Troubleshooting Problems in Autotuning with a Host Reference

11. When tuning has been completed, click the **Finish** Button.

The results of tuning will be set in the parameters and you will return to the Tuning Dialog Box.

This concludes the procedure to perform autotuning with a host reference.

8.7.5 Troubleshooting Problems in Autotuning with a Host Reference

The following tables give the causes of and corrections for problems that may occur in autotuning with a host reference.

◆ Autotuning with a Host Reference Was Not Performed

Possible Cause	Corrective Action
Main circuit power supply is OFF.	Turn ON the main circuit power supply.
An alarm or warning occurred.	Remove the cause of the alarm or warning.
Overtraveling occurred.	Remove the cause of overtraveling.
The second gains were selected with the gain selection.	Disable automatic gain switching.
The HWBB was activated.	Release the HWBB.

◆ Troubleshooting Errors

Error	Possible Cause	Corrective Action
The gain adjustments were not successfully completed.	Machine vibration occurs or positioning completion is not stable when the Servomotor stops.	 Increase the setting of the positioning completed width (Pn522). Change the mode from 2 to 3. If machine vibration occurs, suppress the vibration with the anti-resonance control adjustment and the vibration suppression function.
Positioning was not completed within approximately 10 seconds after position adjustment was completed.	The positioning completed width is too narrow or proportional control is being used.	 Increase the setting of the positioning completed width (Pn522). Turn OFF the /P-CON (Proportional Control) signal.

◆ Adjustment Results Are Not Satisfactory for Position Control

You may be able to improve the adjustment results by changing the settings of the positioning completed width (Pn522) and the electronic gear ratio (Pn20E/Pn210).

If satisfactory results are still not possible, adjust the overshoot detection level (Pn561). That may improve the adjustment results.

- Pn561 = 100% (default setting)
 This will allow tuning with overshooting that is equivalent to the positioning completed width.
- This will allow tuning to be performed without overshooting within the positioning completed width, but the positioning completed width may be extended.

		Overshoot Detection Level			Speed Positi	Torque
Pr	า561	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
		0 to 100	1%	100	Immediately	Setup

F

8.7.6 Automatically Adjusted Function Settings

These function settings are the same as for autotuning without a host reference. Refer to the following section.

8.6.6 Automatically Adjusted Function Settings on page 8-32

8.7.7 Related Parameters

The following parameters are automatically adjusted or used as reference when you execute autotuning with a host reference.

Do not change the settings while autotuning with a host reference is being executed.

Parameter	Name	Automatic Changes
Pn100	Speed Loop Gain	Yes
Pn101	Speed Loop Integral Time Constant	Yes
Pn102	Position Loop Gain	Yes
Pn103	Moment of Inertia Ratio	No
Pn121	Friction Compensation Gain	Yes
Pn123	Friction Compensation Coefficient	Yes
Pn124	Friction Compensation Frequency Correction	No
Pn125	Friction Compensation Gain Correction	Yes
Pn401	First Stage First Torque Reference Filter Time Constant	Yes
Pn408	Torque-Related Function Selections	Yes
Pn409	First Stage Notch Filter Frequency	Yes
Pn40A	First Stage Notch Filter Q Value	Yes
Pn40C	Second Stage Notch Filter Frequency	Yes
Pn40D	Second Stage Notch Filter Q Value	Yes
Pn140	Model Following Control-Related Selections	Yes
Pn141	Model Following Control Gain	Yes
Pn142	Model Following Control Gain Correction	Yes
Pn143	Model Following Control Bias in the Forward Direction	Yes
Pn144	Model Following Control Bias in the Reverse Direction	Yes
Pn145	Vibration Suppression 1 Frequency A	Yes
Pn146	Vibration Suppression 1 Frequency B	Yes
Pn147	Model Following Control Speed Feedforward Compensation	Yes
Pn160	Anti-Resonance Control-Related Selections	Yes
Pn161	Anti-Resonance Frequency	Yes
Pn163	Anti-Resonance Damping Gain	Yes

Yes: The parameter is automatically set.

No: The parameter is not automatically set, but the setting is read during execution.

8.8.1 Outline

8.8

Custom Tuning

This section describes custom tuning.

8.8.1 Outline

You can use custom tuning to manually adjust the servo during operation using a speed or position reference input from the host controller. You can use it to fine-tune adjustments that were made with autotuning.

The following items are adjusted automatically.

- Gains (e.g., speed loop gain and position loop gain)
- Filters (torque reference filter and notch filters)
- Friction compensation
- Anti-resonance control

Refer to the following section for details on the parameters that are adjusted.

8.8.7 Related Parameters on page 8-50

There are two adjustment methods that you can use for custom tuning.

■ Tuning Mode 0 (Setting Servo Gains Giving Priority to Stability) or 1 (Setting Servo Gains Giving Priority to Good Response)

These modes allow you to set stable control conditions for multiple servo gains by manipulating only one tuning level. Automatic setting of notch filters and anti-resonance control is provided if vibration is detected. Manual anti-resonance control adjustment is also possible during custom tuning.

■ Tuning Mode 2 (Setting Servo Gains Giving Priority to Position Control Applications) or 3 (Setting Servo Gains Giving Priority to Preventing Overshooting in Position Control Applications)

Two tuning levels are manipulated to reduce positioning time even further and set multiple servo gains.

Model following control is used to reduce the positioning time. If vibration is detected, notch filters and anti-resonance control are automatically adjusted, and friction compensation is automatically set. Manual anti-resonance control adjustment and vibration suppression are also possible during custom tuning.

⚠ CAUTION

 Vibration or overshooting may occur during custom tuning. To ensure safety, make sure that you can perform an emergency stop at any time.

8.8.2 Preparations

Always check the following before you execute custom tuning.

- The test without a motor function must be disabled (Pn00C = n.□□□0).
- The tuning-less function must be disabled (Pn170 = n.□□□0).
- If speed control is used, tuning mode 0 or 1 must be set.
- The parameters must not be write prohibited.

8.8.3 Applicable Tools

The following table lists the tools that you can use to perform custom tuning.

Tool	Fn No./Function Name	Operating Procedure Reference	
Panel Operator	You cannot perform custom tuning from the Panel Operator.		
Digital Operator	Fn203	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)	
SigmaWin+	Tuning – Tuning	8.8.4 Operating Procedure on page 8-43	

8.8.4 Operating Procedure

Use the following procedure to perform custom tuning.

WARNING


- Before you execute custom tuning, check the information provided in the SigmaWin+ operating manual.
 - Observe the following precautions.
 - Make sure that you can perform an emergency stop at any time.
 When custom tuning is started, several parameters will be overwritten with the recommended settings, which may greatly affect the response before and after execution. Make sure that you can perform an emergency stop at any time.
 - Set the moment of inertia correctly before you execute custom tuning. If the setting greatly differs from the actual moment of inertia, vibration may occur.
 - If you change the feedforward level, the new setting will not be used immediately. It will be used after positioning is completed.

CAUTION


- If you are using an MP3000-series Controller for phase control, set the tuning mode to 0 or 1. If 2 or 3 is selected for the tuning mode, correct phase control may not be possible.
- 1. Confirm that the moment of inertia ratio (Pn103) is set correctly.
- 2. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **3.** Select Tuning in the Menu Dialog Box. The Tuning Dialog Box will be displayed. Click the **Cancel** Button to cancel tuning.

8.8.4 Operating Procedure

4. Click the Execute Button.

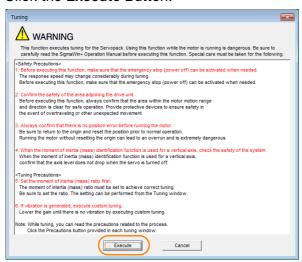

5. Click the Advanced adjustment Button.

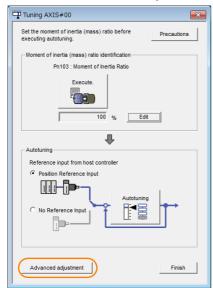


Information


When the following dialog box is displayed, click the $\bf OK$ Button and then confirm that the correct moment of inertia ratio is set in Pn103 (Moment of Inertia Ratio).



6. Click the Custom tuning Button.

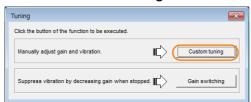

7. Set the Tuning mode Box and Mechanism selection Box, and then click the Next But-

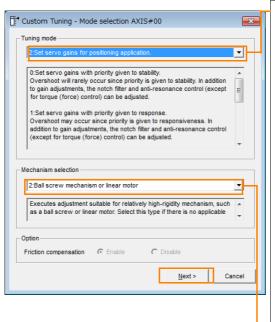

Tuning mode Box			
Mode Selection	Description		
0: Set servo gains with priority given to stability.	This setting gives priority to stability and preventing overshooting. In addition to gain adjustment, notch filters and anti-resonance control (except during torque control) are automatically adjusted.		
1: Set servo gains with priority given to response.	Overshooting may occur because priority is given to response. In addition to gain adjustment, notch filters and antiresonance control (except during torque control) are automatically adjusted.		
2: Set servo gains for positioning application.	Tuning is performed for positioning applications. In addition to gain adjustment, notch filters, anti-resonance control, and vibration suppression are adjusted.		
3: Set servo gains especially to prevent overshooting during positioning application.	Tuning is performed for positioning applications with emphasis on eliminating overshooting. In addition to gain adjustment, notch filters, anti-resonance control, and vibration suppression are adjusted.		

Mechanism Selection Box


Select the type according to the machine element to drive.

If there is noise or if the gain does not increase, better results may be obtained by changing the rigidity type. Select the type according to the following guidelines.

Mechanism Selection	Description
1: Belt mechanism	Tuning is performed for a mechanism with relatively low rigidity, e.g., a belt.
2: Ball screw mechanism or Linear motor	Tuning is performed for a mechanism with relatively high rigidity, e.g., a ball screw or Linear Servomotor. Use this setting if there is no other appropriate setting.
3: Rigid body system	Tuning is performed for a mechanism with high rigidity, e.g., a rigid body system.

Information The tuning modes that you can select depend on the SERVOPACK setting.


8. If the moment of inertia ratio is not set correctly, correct the setting and then click the Next Button.

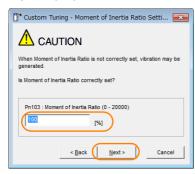


8.8.4 Operating Procedure

9. Turn ON the servo, enter a reference from the host controller, and then click the **Start tuning** Button.

Tuning Mode 0 or 1

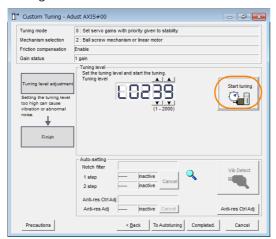

Tuning Mode 2 or 3

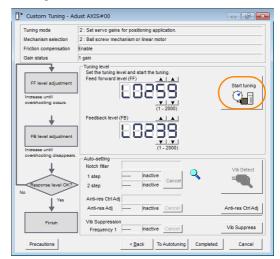


10. Use the ▲ and ▼ Buttons to change the tuning level.

Click the **Back** Button during tuning to restore the setting to its original value. The tuning level will return to the value from before when custom tuning was started.


Tuning Mode 0 or 1

Increase the tuning level until overshooting occurs.

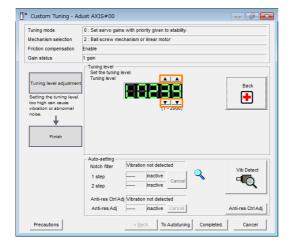

Tuning Mode 2 or 3

Increase the feedforward level until overshooting occurs and then increase the feedback level until overshooting is eliminated. Repeat these changes to make the adjustment.

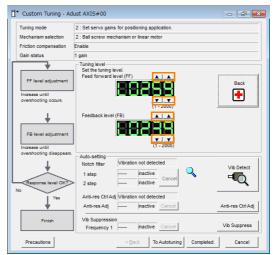

Information


The new feedforward level will not be used until the positioning completed signal is output.

11. You can set the functions to suppress vibration (notch filters, automatic anti-resonance control setting, anti-resonance control adjustment, and autotuning with a host reference) as required.

Refer to the following section for details.

Wibration Suppression Functions on page 8-48

12. When tuning has been completed, click the Completed Button. The values that were changed will be saved in the SERVOPACK and you will return to the Tuning Dialog Box.

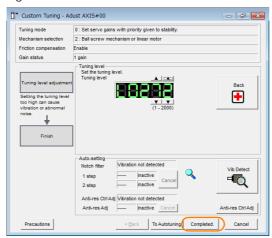

This concludes the procedure to set up custom tuning.

8.8.4 Operating Procedure

Vibration Suppression Functions


◆ Notch Filters and Automatic Anti-resonance Control Setting

If the vibration frequency that occurs when you increase the servo gains is at 1,000 Hz or higher, notch filters are effective to suppress vibration. If the vibration is between 100 Hz and 1,000 Hz, anti-resonance control is effective.

Automatic Setting

To set vibration suppression automatically, use the parameters to enable notch filters and automatic anti-resonance control setting.

The notch filter frequency (stage 1 or 2) or anti-resonance control frequency that is effective for the vibration that was detected during tuning will be automatically set.

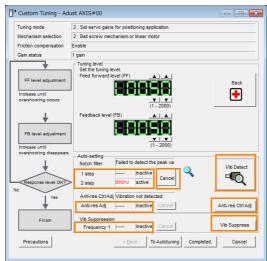

Auto-setting Cancel Buttons

The automatically set notch filter frequencies or the anti-resonance control frequencies may not always suppress vibration. Click the **Cancel** Button to reset the notch filter frequencies or the anti-resonance control frequencies to the values from just before these frequencies were set automatically.

When they are reset, vibration detection will start again.

• Vib Detect Button

While the notch filter or automatic anti-resonance control setting function is enabled, you can click the **Vib Detect** Button to manually detect vibration. When you click the **Vib Detect** Button, the SERVOPACK will detect vibration at that time, and set the notch filter frequency (stage 1 or 2) or anti-resonance control frequency that is effective for the detected vibration. You can also perform manual vibration detection even when the SERVOPACK does not detect vibration.

· Anti-res Ctrl Adj Button

You can use the **Anti-res Ctrl Adj** Button to execute the anti-resonance control adjustment if fine-tuning is required. Refer to the following section.

8.9 Anti-Resonance Control Adjustment on page 8-51

• Vib Suppress Button

Click the **Vib Suppress** Button to suppress low and transient vibration (oscillation) of approximately 1 Hz to 100 Hz that occurs during positioning. Refer to the following section.

8.10 Vibration Suppression on page 8-56

◆ Autotuning with a Host Reference

You can perform autotuning with a host reference. Refer to the following section for details. 8.7 Autotuning with a Host Reference on page 8-35

8.8.5 Automatically Adjusted Function Settings

You cannot use vibration suppression functions at the same time. Other automatic function settings are the same as for autotuning without a host reference. Refer to the following section.

8.6.6 Automatically Adjusted Function Settings on page 8-32

8.8.6 Tuning Example for Tuning Mode 2 or 3

Step	Measurement Display Examples	Operation
1	Position deviation Reference speed Positioning completion signal	The positioning time is measured after the moment of inertia ratio (Pn103) is set correctly. Tuning is completed if the specifications are met. The tuning results are saved in the SERVOPACK.
2		The positioning time will be reduced if the feedforward level is increased. Tuning is completed if the specifications are met. The tuning results are saved in the SERVOPACK. If overshooting occurs before the specifications are met, proceed to step 3.
3		Overshooting will be reduced if the feedback level is increased. If the overshooting is eliminated, proceed to step 4.
4		The graph shows overshooting that occurred when the feed-forward level was increased even more after step 3. In this state, overshooting occurs, but the positioning settling time is shorter. Tuning is completed if the specifications are met. The tuning results are saved in the SERVOPACK. If overshooting occurs before the specifications are met, repeat steps 3 and 4. If vibration occurs before the overshooting is eliminated, the vibration is suppressed with the notch filters and anti-resonance control.
5	_	The tuning results are saved in the SERVOPACK.

8.8.7 Related Parameters

The following parameters are automatically adjusted or used as reference when you execute custom tuning.

Do not change the settings while custom tuning is being executed.

Parameter	Name	Automatic Changes
Pn100	Speed Loop Gain	Yes
Pn101	Speed Loop Integral Time Constant	Yes
Pn102	Position Loop Gain	Yes
Pn103	Moment of Inertia Ratio	No
Pn121	Friction Compensation Gain	Yes
Pn123	Friction Compensation Coefficient	Yes
Pn124	Friction Compensation Frequency Correction	No
Pn125	Friction Compensation Gain Correction	Yes
Pn401	First Stage First Torque Reference Filter Time Constant	Yes
Pn408	Torque-Related Function Selections	Yes
Pn409	First Stage Notch Filter Frequency	Yes
Pn40A	First Stage Notch Filter Q Value	Yes
Pn40C	Second Stage Notch Filter Frequency	Yes
Pn40D	Second Stage Notch Filter Q Value	Yes
Pn140	Model Following Control-Related Selections	Yes
Pn141	Model Following Control Gain	Yes
Pn142	Model Following Control Gain Correction	Yes
Pn143	Model Following Control Bias in the Forward Direction	Yes
Pn144	Model Following Control Bias in the Reverse Direction	Yes
Pn145	Vibration Suppression 1 Frequency A	No
Pn146	Vibration Suppression 1 Frequency B	No
Pn147	Model Following Control Speed Feedforward Compensation	Yes
Pn160	Anti-Resonance Control-Related Selections	Yes
Pn161	Anti-Resonance Frequency	Yes
Pn163	Anti-Resonance Damping Gain	Yes

Yes: The parameter is automatically set.

No: The parameter is not automatically set, but the setting is read during execution.

0.9

Anti-Resonance Control Adjustment

This section describes anti-resonance control.

8.9.1 Outline

Anti-resonance control increases the effectiveness of vibration suppression after custom tuning.

Anti-resonance control is effective for suppression of continuous vibration frequencies from 100 to 1,000 Hz that occur when the control gain is increased. Vibration can be eliminated by setting vibration frequencies through automatic detection or by manually setting them to adjust the damping gain. Input an operation reference and execute this anti-resonance control adjustment when there is vibration.

Anti-resonance control is automatically set by autotuning without a host reference or autotuning with a host reference. Use anti-resonance control adjustment only if fine-tuning is required or readjustment is required as a result of a failure to detect vibration.

Perform custom tuning if required to increase the response after performing anti-resonance control adjustment. If the control gain is increased, e.g., when custom tuning is performed, vibration may occur again. If that occurs, perform anti-resonance control adjustment again to fine-tune the parameters.

A CAUTION

- Related parameters will be set automatically when anti-resonance control adjustment is executed. This may greatly affect the response before and after execution. Make sure that you can perform an emergency stop at any time.
- Before you execute anti-resonance control adjustment, set the correct moment of inertia ratio (Pn103). If the setting greatly differs from the actual moment of inertia ratio, normal control of the machine may not be possible, and vibration may occur.



- Anti-resonance control adjustment detects vibration frequencies between 100 Hz and 1,000 Hz. If the vibration frequency is not within this range, use custom tuning with tuning mode 2 selected to automatically set a notch filter or use vibration suppression.
- Vibration reduction can be made more effective by increasing the anti-resonance damping gain (Pn163), but the vibration may become larger if the damping gain is too high. Increase the damping gain by approximately 0% to 200% in 10% increments while checking the effect on vibration. If vibration reduction is still insufficient at a gain of 200%, cancel the setting, and lower the control gain by using a different method, such as custom tuning.

8.9.2 Preparations

Always check the following before you execute anti-resonance control adjustment.

- The tuning-less function must be disabled (Pn170 = $n.\Box\Box\Box$ 0).
- The test without a motor function must be disabled (Pn00C = n.□□□□0).
- The control method must not be set to torque control.
- The parameters must not be write prohibited.

8.9.3 Applicable Tools

The following table lists the tools that you can use to perform anti-resonance control adjustment.

Tool	Fn No./Function Name	Operating Procedure Reference	
Panel Operator	You cannot execute anti-resonance control adjustment from the Panel Operator.		
Digital Operator	Fn204	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)	
SigmaWin+	Tuning - Tuning	8.9.4 Operating Procedure on page 8-52	

8.9.4 Operating Procedure

To execute anti-resonance control adjustment, an operation reference is input, and the adjustment is executed while vibration is occurring.

The following methods can be used to execute anti-resonance control adjustment.

- To automatically detect the vibration frequency
- To manually set the vibration frequency

Use the following procedure to perform anti-resonance control.


A CAUTION

- Before you execute anti-resonance control adjustment, check the information provided in the SigmaWin+ operating manual.
 - Observe the following precautions.
 - Make sure that you can perform an emergency stop at any time. Parameters will be set automatically when anti-resonance control adjustment is executed. This may greatly affect the response before and after execution. Make sure that you can perform an emergency stop (to turn OFF the power supply) at any time.
 - Set the moment of inertia correctly before you execute anti-resonance control adjustment. If the setting greatly differs from the actual moment of inertia, effective vibration reduction may not be possible.
 - If you have already performed anti-resonance control adjustment and then you change the frequency, the current anti-resonance control effect may be lost. Caution is particularly required when automatically detecting the vibration frequency.
 - If effective vibration reduction is not achieved even after you execute anti-resonance control adjustment, cancel the function and lower the control gain by using a different method, such as custom tuning.
 - Perform custom tuning separately if required to increase the response after performing anti-resonance control adjustment.
 - If the servo gain is increased, e.g., when custom tuning is performed, vibration may occur again. If that occurs, perform anti-resonance control adjustment again to fine-tune the parameters.

8.8.4 Operating Procedure on page 8-43

2. Click the Anti-res Ctrl Adj Button.


The rest of the procedure depends on whether you know the vibration frequency.

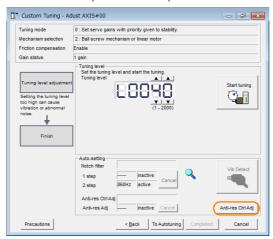


3. If you do not know the vibration frequency, click the **Auto Detect** Button. If you know the vibration frequency, click the **Manual Set** Button.

To Automatically Detect the Vibration Frequency

The frequency will be set.

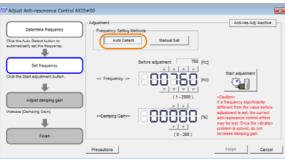

To Manually Set the Vibration Frequency

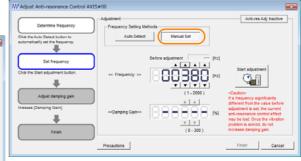

- 4. Click the Start adjustment Button.
- 5. Use the ▲ and ▼ Buttons in the Adjustment Area to change the settings.


 Click the Reset Button during tuning to restore the setting to its original value. The tuning level will return to the value from before when custom tuning was started.

To Automatically Detect the Vibration Frequency

Change the setting of the damping gain.

To Manually Set the Vibration Frequency Change the settings of the frequency and damping gain.




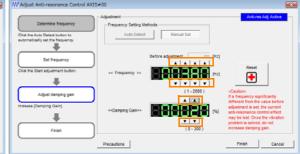

8.9.5 Related Parameters

6. When the adjustment has been completed, click the Finish Button.

The values that were changed will be saved in the SERVOPACK and you will return to the Tuning Dialog Box.

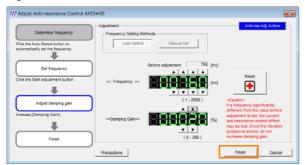

This concludes the procedure to set up anti-resonance control.

8.9.5 Related Parameters

The following parameters are automatically adjusted or used as reference when you execute anti-resonance control adjustment.

Do not change the settings while anti-resonance control adjustment is being executed.

Parameter	Name	Automatic Changes
Pn160	Anti-Resonance Control-Related Selections	Yes
Pn161	Anti-Resonance Frequency	Yes
Pn162	Anti-Resonance Gain Correction	No
Pn163	Anti-Resonance Damping Gain	Yes
Pn164	Anti-Resonance Filter Time Constant 1 Correction	No
Pn165	Anti-Resonance Filter Time Constant 2 Correction	No

Yes: The parameter is automatically set.

No: The parameter is not automatically set, but the setting is read during execution.

8.9.6 Suppressing Different Vibration Frequencies with Anti-resonance Control

When you use anti-resonance control and increase the control gain, for some mechanism, vibration can occur at a higher frequency than the frequency for which vibration was suppressed. If this occurs, you can suppress vibration for more than one frequency by adjusting Pn166 (Anti-Resonance Damping Gain 2).

Information

Guidelines for Vibration That Can Be Suppressed

Anti-resonance frequency (Pn161): fa [Hz], Another vibration frequency that occurs when the control gain is increased: fb [Hz]

- Vibration frequencies: 100 Hz to 1,000 Hz
- Range of different vibration frequencies: 1 < (fb/fa) ≤ 3 to 4

8.9.6 Suppressing Different Vibration Frequencies with Anti-resonance Control

Required Parameter Settings

The following parameter settings are required to use anti-resonance control for more than one vibration frequency.

Parameter		Description		When Enabled	Classification	
Pn160	n.□□□0 (default setting)	Do not use anti-resonance control.		After restart	Setup	
	n.□□□1	Use anti-resonance control.				
	Anti-Resonance Fr	requency		Speed Posi	tion Torque	
Pn161	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 20,000	0.1 Hz	1000	Immediately	Tuning	
	Anti-Resonance G	ain Correction		Speed Posi	tion Torque	
Pn162	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	1 to 1,000	1%	100	Immediately	Tuning	
	Anti-Resonance Damping Gain		Speed Posi	tion Torque		
Pn163	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 300	1%	0	Immediately	Tuning	
	Anti-Resonance Fi	Iter Time Constant 1 C	orrection	Speed Posi	tion Torque	
Pn164	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	-1,000 to 1,000	0.01 ms	0	Immediately	Tuning	
	Anti-Resonance Fi	Iter Time Constant 2 C	orrection	Speed Posi	tion Torque	
Pn165	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	-1,000 to 1,000	0.01 ms	0	Immediately	Tuning	
	Anti-Resonance D	amping Gain 2		Speed Posi	tion Torque	
Pn166	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 1,000	1%	0	Immediately	Tuning	

Adjustment Procedure for Suppressing Different Vibration Frequencies with Anti-resonance Control

Use the following procedure to make adjustments to suppress different vibration frequencies with anti-resonance control.

Step	Operation
1	Use the gain adjustment and anti-resonance control. Refer to the following section for details. 8.9.4 Operating Procedure on page 8-52
2	If there is vibration at a higher frequency than the vibration suppressed with anti-resonance control in step 1, adjust Pn166 (Anti-Resonance Damping Gain 2).
3	Adjust Pn166 (Anti-Resonance Damping Gain 2) while checking to see if vibration reduction is effective. To adjust Pn166 (Anti-Resonance Damping Gain 2), increase the setting by 10% at a time starting from the value that resulted in Pn163 (Anti-Resonance Damping Gain) from the adjustment in step 1.
4	If the vibration disappears, the adjustment is completed. However, if the vibration does not disappear even when you adjust Pn166 (Anti-Resonance Damping Gain 2), reduce the tuning level or feedback level until vibration does not occur.

8.10.1 Outline

8.10

Vibration Suppression

This section describes vibration suppression.

8.10.1 Outline

You can use vibration suppression to suppress transient vibration at a low frequency from 1 Hz to 100 Hz, which is generated mainly when the machine vibrates during positioning. This is effective for vibration frequencies for which notch filters and anti-resonance control adjustment are not effective.

Vibration suppression is automatically set by autotuning without a host reference or autotuning with a host reference. Use vibration suppression only if fine-tuning is required or readjustment is required as a result of a failure to detect vibration. To execute vibration suppression, input an operation reference and execute the function when there is vibration.

Perform custom tuning if required to increase the response after performing vibration suppression.

CAUTION

- Related parameters will be set automatically when vibration suppression is executed. This
 may greatly affect the response before and after execution. Make sure that you can perform
 an emergency stop at any time.
- Before you execute vibration suppression, set the correct moment of inertia ratio (Pn103)
 with autotuning without a host reference or another method. If the setting greatly differs
 from the actual moment of inertia ratio, normal control of the machine may not be possible,
 and vibration may occur.



- Vibration suppression detects vibration frequencies between 1 Hz and 100 Hz.
- Frequency detection will not be performed if there is no vibration in the position deviation or if
 the vibration frequency is outside the range of detectable frequencies. If that is a problem, use
 a device such as a displacement meter or vibration sensor to measure the vibration frequency.
- If an automatically detected vibration frequency is not suppressed, the actual frequency and the detected frequency may be different. Fine-tune the detected frequency if necessary.

Items That Influence Performance

If continuous vibration occurs while the Servomotor is stopping, vibration suppression cannot be used to suppress the vibration effectively. In this case, use anti-resonance control adjustment or custom tuning.

Detection of Vibration Frequencies

Frequency detection may not be possible if vibration does not appear in the position deviation or the vibration that results from the position deviation is too small. You can adjust the detection sensitivity by changing the setting of the residual vibration detection width (Pn560), which is set as a percentage of the positioning completed width (Pn522). Perform the detection of vibration frequencies again after adjusting the setting of Pn560.

	Residual Vibration Detection Width			Position	
Pn560	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	1 to 3,000	0.1%	400	Immediately	Setup

Note: As a guideline, change the setting 10% at a time. If the setting of this parameter is lowered, the detection sensitivity will be increased. Vibration may not be detected accurately if the setting is too small.

Information

The vibration frequencies that are automatically detected may vary somewhat with each positioning operation. Perform positioning several times and make adjustments while checking the effect of vibration suppression.

8.10.2 Preparations

Always check the following before you execute vibration suppression.

- Position control must be used.
- The tuning-less function must be disabled (Pn170 = $n.\Box\Box\Box$ 0).
- The test without a motor function must be disabled (Pn00C = n.□□□0).
- The parameters must not be write prohibited.

8.10.3 Applicable Tools


The following table lists the tools that you can use to perform vibration suppression.

Tool	Fn No./Function Name	Operating Procedure Reference	
Panel Operator	Operator You cannot execute vibration suppression from the Panel Operator.		
Digital Operator	Fn205	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)	
SigmaWin+	Tuning - Tuning	8.10.4 Operating Procedure on page 8-57	

8.10.4 Operating Procedure

Use the following procedure to perform vibration suppression.

- 1. Perform steps 1 to 8 of the procedure for custom tuning. Refer to the following section for details.
 - 8.8.4 Operating Procedure on page 8-43
- 2. Click the Vib Suppress Button.

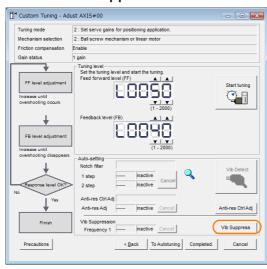


8.10.4 Operating Procedure

3. Click the Import Button or click ▲ and ▼ Button to manually adjust the set frequency. When you click the Import Button, the residual vibration frequency in the Servomotor is read as the set frequency. (The frequency can be read only when the residual vibration frequency is between 1.0 and 100.0.)




Frequency detection will not be performed if there is no vibration or if the vibration frequency is outside the range of detectable frequencies. If a vibration frequency is not detected, provide a means of measuring the vibration frequency.

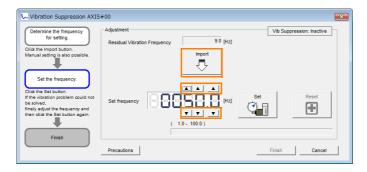


4. Click the Set Button.



No settings related to vibration suppression are changed during operation. If the Servomotor does not stop within approximately 10 seconds after changing the setting, an update timeout will occur. The setting will be automatically returned to the previous value.

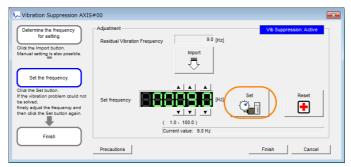

If the vibration is not eliminated, use the \triangle and \blacktriangledown Buttons for the set frequency to fine-tune the value and click the **Set** Button again.

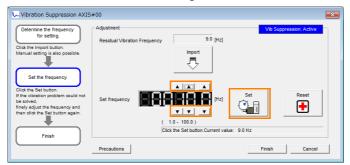

Click the **Reset** Button during adjustment to restore the setting to its original value. The status from before when adjustment was started will be restored.

5. When the vibration has been eliminated, click the Finish Button.

The updated value will be saved in the SERVOPACK.



Vibration suppression will be enabled in step 5. The Servomotor response, however, will change when the Servomotor comes to a stop with no reference input.

This concludes the procedure to set up vibration suppression.

8.10.5 Setting Combined Functions

You can also use the feedforward function when you execute vibration suppression.

In the default settings, feedforward (Pn109), the speed feedforward input (V-REF), and the torque feedforward input (T-REF) are disabled.

To use the speed feedforward input (V-REF), the torque feedforward input (T-REF), and model following control from the host controller in the system, set Pn140 to n.1 \(\sigma\sup \square\$ (Use model following control and speed/torque feedforward together).

Parameter		Function	When Enabled	Classification
Pn140	n.0□□□ (default setting)	Do not use model following control and speed/torque feedforward together.	Immediately	Tuning
111140	n.1□□□	Use model following control and speed/torque feedforward together.	irrirriediately	ruring

Refer to the following section for information on the torque feedforward input (T-REF) and the speed feedforward input (V-REF).

Torque Feedforward and Speed Feedforward on page 8-87, ■ Speed Feedforward on page 8-89



When model following control is used with the feedforward function, it is used to make optimum feedforward settings in the SERVOPACK. Therefore, model following control is not normally used together with either the speed feedforward input (V-REF) or torque feedforward input (T-REF) from the host controller. However, model following control can be used with the speed feedforward input (V-REF) or torque feedforward input (T-REF) if required. An unsuitable feedforward input may result in overshooting.

8.10.6 Related Parameters

The following parameters are automatically adjusted or used as reference when you execute vibration suppression.

Do not change the settings while vibration suppression is being executed.

Parameter	Name	Automatic Changes
Pn140	Model Following Control-Related Selections	Yes
Pn141	Model Following Control Gain	Yes
Pn142	Model Following Control Correction	No
Pn143	Model Following Control Bias in the Forward Direction	No
Pn144	Model Following Control Bias in the Reverse Direction	No
Pn145	Vibration Suppression 1 Frequency A	Yes
Pn146	Vibration Suppression 1 Frequency B	Yes
Pn147	Model Following Control Speed Feedforward Compensation	No
Pn14A	Vibration Suppression 2 Frequency	No
Pn14B	Vibration Suppression 2 Correction	No

Yes: The parameter is automatically set.

No: The parameter is not automatically set, but the setting is read during execution.

8.11.1 Outline

8.11

Speed Ripple Compensation

This section describes speed ripple compensation.

8.11.1 Outline

Speed ripple compensation reduces the amount of ripple in the motor speed due to torque ripple or cogging torque. You can enable speed ripple compensation to achieve smoother operation. To enable it, you must set up ripple compensation on the SigmaWin+.

WARNING

• Speed ripple compensation requires operating the Servomotor and therefore presents hazards. Observe the following precautions.

Confirm safety around moving parts.

This function involves automatic operation. Make sure that you can perform an emergency stop (to turn OFF the power supply) at any time.



Execute speed ripple compensation only after adjusting the gains.

- Reset speed ripple compensation after you replace the Servomotor or SERVOPACK.
- Execute speed ripple compensation after jogging to a position that ensures a suitable range of motion.

8.11.2 Setting Up Speed Ripple Compensation

Restrictions

The following restrictions apply to the setup for speed ripple compensation.

Systems for Which Execution Cannot Be Performed

There are no restrictions.

◆ Systems for Which Adjustments Cannot Be Made Accurately

Systems for which there is not a suitable range of motion

Preparations

Always check the following before you set up speed ripple compensation.

- The main circuit power supply must be ON.
- · The servo must be OFF.
- There must be no alarms or warnings.
- There must be no hard wire base block (HWBB).
- The parameters must not be write prohibited.

8

Applicable Tools

The following table lists the tools that you can use to set up speed ripple compensation.

Tool	Fn No./Function Name	Reference	
Panel Operator	You cannot set up speed ripple compensation from the Panel Operator.		
Digital Operator	You cannot set up speed ripple compensation from the Digital Operator.		
SigmaWin+	SigmaWin+ Diagnostic - Ripple Compensation		

Operating Procedure


Use the following procedure to set up speed ripple compensation.

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Ripple Compensation in the Menu Dialog Box. The Ripple Compensation Dialog Box will be displayed.
- 3. Click the OK Button.



Information


- 1. Click the **Cancel** Button to cancel ripple compensation. The Main Window will return.
- 2. If write protection is set, the following dialog box will be displayed.

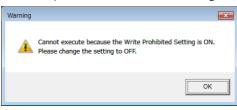


Click the **OK** Button to cancel write prohibition.

8.11.2 Setting Up Speed Ripple Compensation


4. Click the Edit Button.

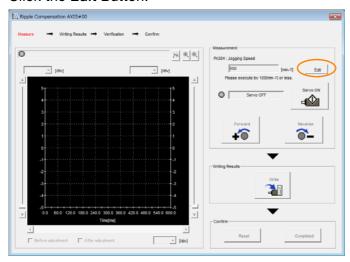

5. Enter the jogging speed in the Input Value Box and click the OK Button.

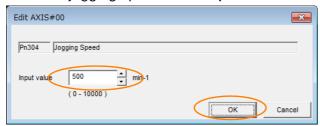

6. Click the Servo ON Button.

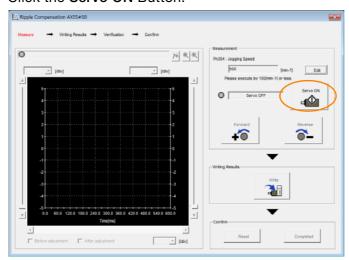



7. Click the Forward Button or the Reverse Button.

Measurement operation is started.

The Servomotor shaft will rotate at the preset jogging speed while you hold down the **Forward** or **Reverse** Button and the speed ripple will be measured.


The feedback speed and torque reference graph will be displayed in the Ripple Compensation Dialog Box during jogging.

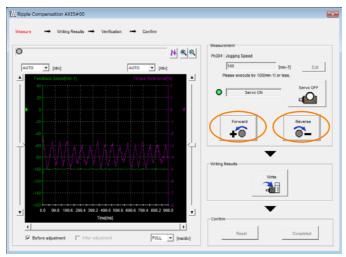

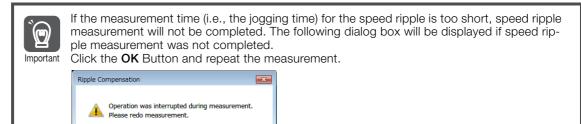



9. After writing has been completed, click the OK Button.

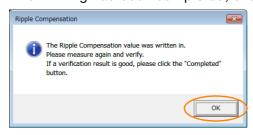


8.11.3 Setting Parameters

10. Click the Forward Button or the Reverse Button.

Verification operation is started.

The Servomotor shaft will rotate at the preset jogging speed while you hold down the **Forward** or **Reverse** Button.

The waveform with speed ripple compensation applied to it will be displayed.

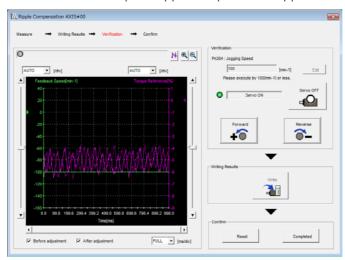

11. If the verification results are OK, click the **Completed** Button.

Information To discard the setup results, click the **Reset** Button.

This concludes the setup for speed ripple compensation.

8.11.3 Setting Parameters

The function is enabled when you perform the operating procedure on *Operating Procedure* on page 8-61. To cancel speed ripple compensation, use $Pn423 = n.\square\square\square\square$ (Disable speed ripple compensation) to disable it.

Parameter		Description		Classifi- cation
Pn423	n.□□□0 (default setting)	Disable speed ripple compensation.	Immedi- ately	Setup
	n.□□□1	Enable speed ripple compensation.	alely	

If you enable speed ripple compensation, a compensation reference will be applied to reduce ripple even when stopped at a 0 speed reference. In speed control mode, this may result in the Servomotor moving slightly. To prevent this, set $Pn423 = n.\Box X\Box\Box$ (Speed Ripple Compensation Enable Condition Selection) and Pn427 or Pn49F (Speed Ripple Compensation Enable Speed).


Parameter		Description	When Enabled	Classifi- cation
Pn423	n.□0□□ (default setting)	Speed reference	After restart	Setup
	n.🗆1 🗆 🗆	Motor Speed	restart	

• For Rotary Servomotors

	Speed Ripple Compensation Enable Speed		Speed Position	on Torque	
Pn427	Setting Range	Setting Unit	Default Setting	ting When Enabled Classif	
	0 to 10,000	1 min ⁻¹	0	Immediately	Tuning

• For Linear Servomotors

	Speed Ripple Comp	ensation Enable Spe	Speed Position	on Torque	
Pn49F	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	1 mm/s	0	Immediately	Tuning

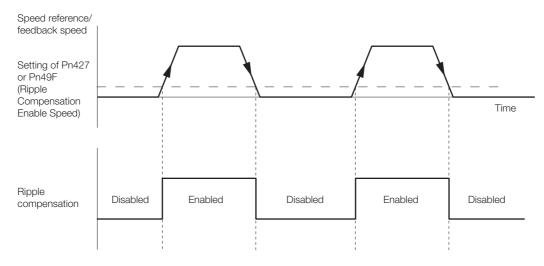

Speed Ripple Compensation Warnings

The speed ripple compensation value is specific to each Servomotor. If you replace the Servomotor while speed ripple compensation is enabled, an A.942 warning (Speed Ripple Compensation Information Disagreement) will occur to warn you.

You can use any of the following methods to clear A.942.

- Reset the speed ripple compensation value on the SigmaWin+.
- Disable speed ripple compensation (Pn423 = n.□□□0).
- Disable detection of A.942 (Pn423 = n.□□1□).

Parameter		Description	When Enabled	Classification
Pn423	n.□□0□ (default setting)	Detect A.942 alarms.	After restart	Setup
	n.□□1□	Do not detect A.942 alarms.		

8.12.1 Gain Switching

8.12

Additional Adjustment Functions

This section describes the functions that you can use to make adjustments after you perform autotuning without a host reference, autotuning with a host reference, and custom tuning.

Function	Applicable Control Methods	Reference
Gain Switching	Position control, speed control, or torque control*	page 8-66
Friction Compensation	Position control or speed control	page 8-70
Current Control Mode Selection	Position control, speed control, or torque control	page 8-73
Current Gain Level Setting	Position control or speed control	page 8-73
Speed Detection Method Selection	Position control, speed control, or torque control	page 8-74
Proportional Control	Position control or speed control	page 8-74

^{*} Automatic gain switching is enabled only for position control.

8.12.1 Gain Switching

Two gain switching functions are available, manual selection and automatic switching. The manual switching function uses an external input signal to select the gains, and the automatic switching function changes the gains automatically.

You can use gain switching to shorten the positioning time by increasing the gains during positioning and suppressing vibration by decreasing the gains while stopping.

Parameter		Function	When Enabled	Classification
Pn139	n.□□□0 (default setting)	Use manual gain switching.	Immediately	Tuning
	n.□□□2	Use automatic gain switching pattern 1.		

Note: $Pn139 = n.\square\square\square\square1$ is a reserved parameter. Do not change.

Refer to the following section for gain switching combinations.

Gain Switching Combinations on page 8-66

Refer to the following sections for information on manual and automatic gain switching.

Manual Gain Switching on page 8-67 and Automatic Gain Switching on page 8-67

Gain Switching Combinations

Selected Gains	Speed Loop Gain	Speed Loop Integral Time Constant	Position Loop Gain	Torque Reference Filter	Model Following Control Gain	Model Follow- ing Control Correction	Friction Compensa- tion Gain
Gain Set- tings 1	Speed Loop Gain (Pn100)	Speed Loop Integral Time Constant (Pn101)	Position Loop Gain (Pn102)	First Stage First Torque Reference Fil- ter Time Con- stant (Pn401)	Model Following Control Gain* (Pn141)	Model Follow- ing Control Correction* (Pn142)	Friction Compensa- tion Gain (Pn121)
Gain Set- tings 2	Second Speed Loop Gain (Pn104)	Second Speed Loop Integral Time Constant (Pn105)	Second Position Loop Gain (Pn106)	First Stage Second Torque Refer- ence Filter Time Con- stant (Pn412)	Second Model Fol- lowing Con- trol Gain* (Pn148)	Second Model Following Control Gain Correction* (Pn149)	Second Friction Compensa- tion Gain (Pn122)

^{*} Gain switching for the model following control gain and the model following control gain correction is applicable only to manual gain switching.

To enable gain switching with these parameters, a gain switching input signal must be used and the following conditions must be met. If the conditions are not met, these parameters will not be changed even if the other parameters in the above table are changed.

[•] There must be no reference.

The motor must be stopped.

Manual Gain Switching

With manual gain switching, you use the /G-SEL (Gain Selection) signal to change between gain settings 1 and gain settings 2.

Type	Signal	Connector Pin No.	Setting	Meaning
Input	Innut /C CEI	Must be allegated	OFF	Changes the gain settings to gain settings 1.
Input /G-SEL	Must be allocated.	ON	Changes the gain settings to gain settings 2.	

Automatic Gain Switching


Automatic gain switching is enabled only for position control. The switching conditions are specified by using the following settings.

Parameter		Switching Condition	Selected Gains	Switching Waiting Time	Switching Time
Pn139 n.□□□2	Condition A satisfied	Gain settings 1 to gain settings 2	Gain Switching Waiting Time 1 Pn135	Gain Switching Time 1 Pn131	
	n.□□□2	Condition A not satisfied	Gain settings 2 to gain settings 1	Gain Switching Waiting Time 2 Pn136	Gain Switching Time 2 Pn132

Select one of the following settings for switching condition A.

Parameter		Position Control Gain Switching Condition A	For Control Methods Other Than Position Control (No Switching)	When Enabled	Classification	
	n.□□0□ (default setting)	/COIN (Positioning Completion) signal ON	Gain settings 1 used.			
	n.0010	/COIN (Positioning Completion) signal OFF	Gain settings 2 used.			
	n.□□2□	/NEAR (Near) signal ON	Gain settings 1 used.			
Pn139	n.□□3□	/NEAR (Near) signal OFF	Gain settings 2 used.	Immediately	Tuning	
	n.□□4□	Position reference filter output is 0 and reference pulse input is OFF.	Gain settings 1 used.			
	n.□□5□	Position reference pulse input is ON.	Gain settings 2 used.			


Automatic Switching Pattern 1 (Pn139 = n.□□□2)

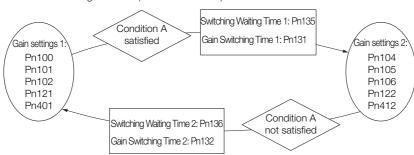

8.12.1 Gain Switching

◆ Relationship between the Waiting Times and Switching Times for Gain Switching

In this example, an ON /COIN (Positioning Completion) signal is set as condition A for automatic gain switching. The position loop gain is changed from the value in Pn102 (Position Loop Gain) to the value in Pn106 (Second Position Loop Gain). When the /COIN signal turns ON, the switching operation begins after the waiting time (Pn135). The switching operation changes the position loop gain linearly from the gain set in Pn102 to the gain set in Pn106 over the switching time (Pn131).

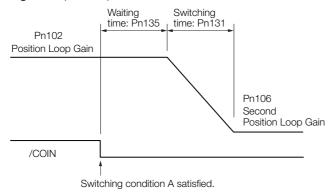

Information You can use gain switching for either PI control or I-P control (Pn10B = $n.\Box\Box\Box\Box$ or $\Box\Box\Box\Box$).

Related Parameters

	Speed Loop Gain			Speed Posit	ion	
Pn100	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 20,000	0.1 Hz	400	Immediately	Tuning	
	Speed Loop Integra	l Time Constant		Speed Posit	ion	
Pn101	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	15 to 51,200	0.01 ms	2,000	Immediately	Tuning	
	Position Loop Gain			Posit	ion	
Pn102	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 20,000	0.1/s	400	Immediately	Tuning	
	First Stage First Tor	que Reference Filter	Time Constant	Speed Posit	ion Torque	
Pn401	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 65,535	0.01 ms	100	Immediately	Tuning	
	Model Following Control Gain			Posit	ion	
Pn141	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 20,000	0.1/s	500	Immediately	Tuning	
	Model Following Control Gain Correction Position					
Pn142	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	500 to 2,000	0.1%	1,000	Immediately	Tuning	
	Friction Compensat	ion Gain		Speed Posit	ion	
Pn121	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 1,000	1%	100	Immediately	Tuning	
	Second Speed Loop	Gain		Speed Position		
Pn104	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 20,000	0.1 Hz	400	Immediately	Tuning	
	Second Speed Loop	Integral Time Cons	tant	Speed Posit	ion	
Pn105	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	15 to 51,200	0.01 ms	2,000	Immediately	Tuning	

Continued on next page.

Continued from previous page.

	Second Position Lo	op Gain		Posit	ion	
Pn106	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 20,000	0.1/s	400	Immediately	Tuning	
	First Stage Second	Torque Reference Fi	Iter Time Constant	Speed Posit	ion Torque	
Pn412	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 65,535	0.01 ms	100	Immediately	Tuning	
	Second Model Following Control Gain			Position		
Pn148	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 20,000	0.1/s	500	Immediately	Tuning	
	Second Model Follo	wing Control Gain C	orrection	Position		
Pn149	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	500 to 2,000	0.1%	1,000	Immediately	Tuning	
	Second Friction Co.	mpensation Gain		Speed Posit	ion	
Pn122	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 1,000	1%	100	Immediately	Tuning	

Parameters Related to Automatic Gain Switching

	Gain Switching Time	e 1	Position		
Pn131	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	1 ms	0	Immediately	Tuning
	Gain Switching Time	e 2		Posit	ion
Pn132	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	1 ms	0	Immediately	Tuning
	Gain Switching Wait	ting Time 1	Position		
Pn135	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	1 ms	0	Immediately	Tuning
	Gain Switching Wait	ting Time 2		Posit	ion
Pn136	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	1 ms	0	Immediately	Tuning

Related Monitoring

• SigmaWin+

You can monitor gain switching with the status monitor or with tracing.

Analog Monitors

Parameter	Analog Monitor	Monitor Name	Output Value	Description
Pn006	n.□□0B	Active Gain Monitor	1 V	Gain settings 1 are enabled.
Pn007	11.00	Active Gaill Mollitor	2 V	Gain settings 2 are enabled.

8.12.2 Friction Compensation

Friction compensation is used to compensate for viscous friction fluctuations and regular load fluctuations.

You can automatically adjust friction compensation with autotuning without a host reference, autotuning with a host reference, or custom tuning, or you can manually adjust it with the following procedure.

Required Parameter Settings

The following parameter settings are required to use friction compensation.

Parameter		Fund	tion	When Enabled	Classification	
Pn408	n.0□□□ (default setting)	Disable friction comper	nsation.	Immediately	Setup	
	n.1000	Enable friction compen	sation.			
	Friction Compens	sation Gain		Speed Posit	ion	
Pn121	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 1,000	1%	100	Immediately	Tuning	
	Second Friction (Compensation Gain		Speed Posit	Speed Position	
Pn122	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	10 to 1,000	1%	100	Immediately	Tuning	
	Friction Compens	sation Coefficient	Speed Posit	Speed Position		
Pn123	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 100	1%	0	Immediately	Tuning	
	Friction Compens	ation Frequency Correction		Speed Posit	ion	
Pn124	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	-10,000 to 10,00	0 0.1 Hz	0	Immediately	Tuning	
	Friction Compens	sation Gain Correction		Speed Posit	ion	
Pn125	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	1 to 1,000	1%	100	Immediately	Tuning	

Operating Procedure for Friction Compensation

Use the following procedure to perform friction compensation.

CAUTION


Before you execute friction compensation, set the moment of inertia ratio (Pn103) as accurately as possible. If the setting greatly differs from the actual moment of inertia, vibration may occur.

Step	Operation					
1	Set the following parameters related to friction compensation to their default settings. Friction compensation gain (Pn121): 100 Second friction compensation gain (Pn122): 100 Friction compensation coefficient (Pn123): 0 Friction compensation frequency correction (Pn124): 0 Friction compensation gain correction (Pn125): 100 Note: Always use the default settings for the friction compensation frequency correction (Pn124) and friction compensation gain correction (Pn125).					
2	Gradually increase the friction compensation coefficient (Pn123) to check the effect of friction compensation. Note: Usually, set the friction compensation coefficient (Pn123) to 95% or less. If the effect is insufficient, increase the friction compensation gain (Pn121) by 10% increments until vibration stops. Effect of Adjusted Parameters Pn121: Friction Compensation Gain and Pn122: Second Friction Compensation Gain These parameters set the response to external disturbances. The higher the setting is, the better the response will be. If the machine has a resonance frequency, however, vibration may occur if the setting is too high. Pn123: Friction Compensation Coefficient This parameter sets the effect of friction compensation. The higher the setting is, the more effective friction compensation will be. If the setting is too high, however, vibration will occur more easily. Usually, set the value to 95% or less.					
3	Effect of Adjustments The following graphs show the response with and without adjustment. Inconsistent response because of friction Low friction Position deviation High friction Position reference speed Before Friction Compensation After Friction Compensation					

8.12.3 Gravity Compensation

When the Servomotor is used with a vertical axis, gravity compensation prevents the moving part from falling due to the machine's own weight when the brake is released.


SERVOPACKs with software version 0023 or higher support gravity compensation.

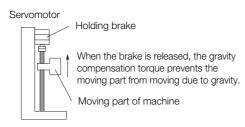

8.12.3 Gravity Compensation

A timing chart for when the moving part is raised then lowered is provided below. Refer to the following section for details on brake operation timing.

5.13.1 Brake Operating Sequence on page 5-36

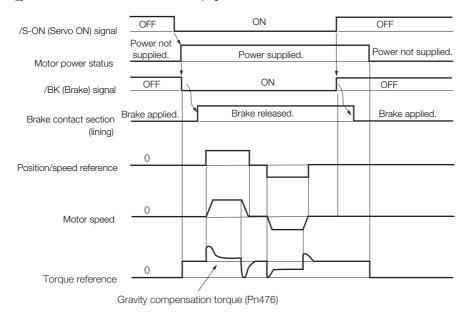

Required Parameter Settings

The following parameter settings are required to use gravity compensation.

Parameter		Description		When Enabled	Classification
Pn475	n.□□□0 (default setting)	Disable gravity compensation.		After restart	Setup
	n.□□□1	Enable gravity comper	nsation.		
Gravity Compensation Torque				Speed Posi	tion Torque
Pn476	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	-1,000 to 1,000	0.1%	0	Immediately	Tuning

Operating Procedure for Gravity Compensation

Use the following procedure to perform gravity compensation.

- 1. Set Pn475 to n.□□□1 (Enable gravity compensation).
- **2.** To enable changes to the settings, turn the power supply to the SERVOPACK OFF and ON again.
- 3. Use SigmaWin+ or an analog monitor to find the torque reference value when the motor is stopped with the servo ON.
- 4. Set the torque reference value found in step 3 in Pn476 (Gravity Compensation Torque).
- 5. Turn the servo ON and OFF a few times and fine-tune Pn476 so that the moving part of the machine does not fall.

8.12.4 Current Control Mode Selection

Current control mode selection reduces high-frequency noise while the Servomotor is being stopped.

The setting depends on the capacity of the SERVOPACK.

To use current control mode selection, use current control mode 2 (set Pn009 to $n.\Box\Box1\Box$ or $n.\Box\Box2\Box$).

• SERVOPACK Models SGD7S-R70A, -R90A, -1R6A, -2R8A, -3R8A, -5R5A, and -7R6A

Parameter		Meaning	When Enabled	Classification
	n. □□0□			
Pn009	n. 🗆 🗆 1 🗆	Use current control mode 1.	After restart	Tuning
	(default setting)			
	n. □□2□	Use current control mode 2 (low noise).		

SERVOPACK Models SGD7S-120A, -180A, -200A, -330A, -470A, -550A, -590A, and -780A

Parameter		Meaning	When Enabled	Classification
	n. □□0□	Use current control mode 1.		
Pn009	n. □□1□ (default setting) n. □□2□	Use current control mode 2 (low noise).	After restart	Tuning



If current control mode 2 is selected, the load ratio may increase while the Servomotor is being stopped.

8.12.5 Current Gain Level Setting

You can set the current gain level to reduce noise by adjusting the parameter for current control inside the SERVOPACK according to the speed loop gain (Pn100). The noise level can be reduced by decreasing the current gain level (Pn13D) from its default setting of 2,000% (disabled). However, if the setting is decreased, the level of noise will be lowered, but the response characteristic of the SERVOPACK will also be reduced. Adjust the current gain level within the range that maintains the SERVOPACK response characteristic. This function is always disabled during torque control (Pn000 = $n.\Box\Box2\Box$).

	Current Gain Level			Speed Posit	ion
Pn13D	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	100 to 2,000	1%	2,000	Immediately	Tuning



If the current gain level is changed, the response characteristic of the speed loop will also change. Servo tuning must therefore be performed again.

8.12.6 Speed Detection Method Selection

You can use the speed detection method selection to ensure smooth Servomotor speed changes during operation. To ensure smooth motor speed changes during operation, set Pn009 to $n.\Box 1\Box\Box$ (Use speed detection 2).

With a Linear Servomotor, you can reduce the noise level of the running motor when the linear encoder scale pitch is large.

Parameter		Meaning	When Enabled	Classification
Pn009	n. □0□□ (default setting)	Use speed detection 1.	After restart	Tuning
	n. 🗆 1 🗆 🗆	Use speed detection 2.		



If the speed detection method is changed, the response characteristic of the speed loop will also change. Servo tuning must therefore be performed again.

8.12.7 Speed Feedback Filter

You can set a first order lag filter for the speed feedback in the speed loop. This ensures smooth changes in the feedback speed to reduce vibration. If a large value is set, it will increase the delay and make response slower.

	Speed Feedback Filter	Time Constant	Speed Position		
Pn308	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535 (0.00 ms to 655.35 ms)	0.01 ms	0 (0.00 ms)	Immediately	Setup

8.12.8 Proportional Control (P Control)

You can input the /P-CON (Proportional Control) signal from the host controller to select P control.

The speed control section uses proportional-integral control (PI control) if the reference remains at zero during speed control. The integral effect may cause the Servomotor to move. To prevent that, you can change from PI control to P control.

P control is set using $Pn000 = n.\square\square X\square$ and the /P-CON signal.

However, if Pn000 is set to n. \(\sigma\) (Switching between speed control with analog references and speed control with zero clamping), a position loop will be formed. Therefore, there is no need to use this function. P control is used while the /P-CON signal is ON.

/P-CON (Proportional Control) Signal

The /P-CON signal is used to switch between P control and PI control.

Туре	Signal	Connector Pin No.	Setting	Meaning
Input /P-CON	/D CON	CN1-41	ON (closed)	Changes to P control
	/F-CON	(default setting)	OFF (open)	Changes to PI control

Example

When Using the Default Input Signal Allocations



Note: This example uses the default input signal allocations.

Control Methods and P Control Input Signals

Changing to P control is enabled when the control method is set to speed control or position control.

Parameter	Control Method Selection	Description	Changing to P Control	
	n.□□0□ Speed control with analog references Fig. 1 Speed control with analog references Fig. 2 Speed control with analog reference Fig. 2 Speed control with analog refere		You can change to P control with the default setting (CN1-41 = /P-CON).	
	n.□□1□	Position control with pulse train references	You can also allocate the /P-CON signal to another connector pin.	
	n.□□2□	Torque control with analog references	You cannot change to P control.	
	n.□□3□	Internal set speed control with contact commands		
Pn000	n.□□4□	Switching between internal set speed control with contact commands and speed control with analog references		
	n.□□5□	Switching between internal set speed control with contact commands and position control with pulse train references		
	n.□□6□	Switching between internal set speed control with contact commands and torque control with analog references		
	n.□□7□	Switching between position control with pulse train references and speed control with analog references	You must allocate the /P-CON signal to CN1-40 to CN1-46.	
	n.□□8□	Switching between position control with pulse train references and torque control with analog references		
	n.□□9□	Switching between torque control with analog references and speed control with analog references		
	п.ППАП	Switching between speed control with analog references and speed control with zero clamping		
	n.□□B□	Switching between position control with pulse train references and position control with reference pulse inhibition		

Note: Refer to the following section for information on changing the control method.

6.10 Selecting Combined Control Methods on page 6-59

8.13.1 Tuning the Servo Gains


8.13

Manual Tuning

This section describes manual tuning.

8.13.1 Tuning the Servo Gains

Servo Gains

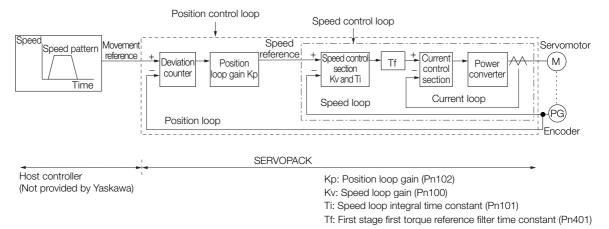

In order to manually tune the servo gains, you must understand the configuration and characteristic of the SERVOPACK and adjust the servo gains individually. In most cases, if you greatly change any one parameter, you must adjust the other parameters again. To check the response characteristic, you must prepare a measuring instrument to monitor the output waveforms from the analog monitor.

The SERVOPACK has three feedback systems (the position loop, speed loop, and current loop), and the response characteristic must be increased more with the inner loops. If this relationship is not maintained, the response characteristic will suffer and vibration will occur more easily.

A sufficient response characteristic is ensured for the current loop. There is never a need for it to be adjusted by the user.

Outline

You can use manual tuning to set the servo gains in the SERVOPACK to increase the response characteristic of the SERVOPACK. For example, you can reduce the positioning time for position control.

Use manual tuning in the following cases.

- When tuning with autotuning without a host reference or autotuning with a host reference does not achieve the desired results
- When you want to increase the servo gains higher than the gains that resulted from autotuning without a host reference or autotuning with a host reference
- When you want to determine the servo gains and moment of inertia ratio yourself

You start manual tuning either from the default parameter settings or from the gain settings that resulted from autotuning without a host reference or autotuning with a host reference.

Applicable Tools

You can monitor the servo gains with the SigmaWin+ or with the analog monitor.

Precautions

Vibration may occur while you are tuning the servo gains. We recommend that you enable vibration alarms (Pn310 = $n.\square\square\square$ 2) to detect vibration. Refer to the following section for information on vibration detection.

6.15 Initializing the Vibration Detection Level on page 6-99

Vibration alarms are not detected for all vibration. Also, an emergency stop method is necessary to stop the machine safely when an alarm occurs. You must provide an emergency stop device and activate it immediately whenever vibration occurs.

Tuning Procedure Example (for Position Control or Speed Control)

Step	Description
1	Adjust the first stage first torque reference filter time constant (Pn401) so that vibration does not occur.
2	Increase the Speed loop gain (Pn100) and reduce the speed loop integral time constant (Pn101) as far as possible within the range that does not cause machine vibration.
3	Repeat steps 1 and 2 and return the settings about 10% to 20% from the values that you set.
4	For position control, increase the position loop gain (Pn102) within the range that does not cause vibration.



If you greatly change any one servo gain parameter, you must adjust the other parameters again. Do not increase the setting of just one parameter. As a guideline, adjust the settings of the servo gains by approximately 5% each. As a rule, change the servo parameters in the following order.

- To Increase the Response Speed
- 1. Reduce the torque reference filter time constant.
- 2. Increase the speed loop gain.
- 3. Decrease the speed loop integral time constant.
- 4. Increase the position loop gain.
- To Reduce Response Speed and to Stop Vibration and Overshooting
- 1. Reduce the position loop gain.
- 2. Increase the speed loop integral time constant.
- 3. Decrease the speed loop gain.
- 4. Increase the torque filter time constant.

Adjusted Servo Gains

You can set the following gains to adjust the response characteristic of the SERVOPACK.

- Pn100: Speed Loop Gain
- Pn101: Speed Loop Integral Time Constant
- Pn102: Position Loop Gain
- Pn401: First Stage First Torque Reference Filter Time Constant

◆ Position Loop Gain

The position loop gain determines the response characteristic of the position loop in the SERVOPACK. If you can increase the setting of the position loop gain, the response characteristic will improve and the positioning time will be shortened. However, you normally cannot increase the position loop gain higher than the inherit vibration frequency of the machine system. Therefore, to increase the setting of the position loop gain, you must increase the rigidity of the machine to increase the inherit vibration frequency of the machine.

	Position Loop Gain			Position	
Pn102	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	10 to 20,000	0.1/s	400	Immediately	Tuning

8.13.1 Tuning the Servo Gains

Information

For machines for which a high position loop gain (Pn102) cannot be set, overflow alarms can occur during high-speed operation. If that is the case, you can increase the setting of the following parameter to increase the level for alarm detection. Use the following condition as a guideline for determining the setting.

$$Pn520 \geq \frac{Maximum feed speed [reference units/s]}{Pn102 \div 10 (1/s)} \times 2.0$$

If you use a position reference filter, transient deviation will increase due to the filter time constant. When you make the setting, consider deviation accumulation that may result from the filter.

Pn520	Position Deviation Overflow Alarm Level			Position	
	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	1 to 1,073,741,823	1 reference unit	5,242,880	Immediately	Setup

◆ Speed Loop Gain

This parameter determines the response characteristic of the speed loop. If the response characteristic of the speed loop is low, it becomes a delay factor for the position loop located outside of the speed loop. This will result in overshooting and vibration in the speed reference. Therefore, setting the speed loop gain as high as possible within the range that will not cause the machine system to vibrate will produce a stable servo system with a good response characteristic.

	Speed Loop Gain		Speed Positi	on Torque	
Pn100	Setting Range	Setting Unit	Default Setting	When Enabled	Classifica- tion
	10 to 20,000	0.1 Hz	400	Immediately	Tuning

Setting of Pn103 =
$$\frac{\text{Load moment of inertia at motor shaft } (J_L)}{\text{Servomotor moment of inertia } (L_M)} \times 100(\%)$$

The default setting of Pn103 (Moment of Inertia Ratio) is 100. Before you tune the servo, calculate the moment of inertia ratio with the above formula and set Pn103 to the calculation result.

	Moment of Inertia Ratio			Speed Positi	on Torque
Pn103	Setting Range	Setting Unit	Default Setting	When Enabled	Classifica- tion
	0 to 20,000	1%	100	Immediately	Tuning

◆ Speed Loop Integral Time Constant


To enable response to even small inputs, the speed loop has an integral element. The integral element becomes a delay factor in the servo system. If the time constant is set too high, overshooting will occur, positioning settling time will increase, and the response characteristic will suffer.

	Speed Loop Integral Time Constant			Speed Positi	on
Pn101	Setting Range	Setting Unit	Default Setting	When Enabled	Classifica- tion
	15 to 51,200	0.01 ms	2,000	Immediately	Tuning

◆ Torque Reference Filter

As shown in the following diagram, the torque reference filter contains a first order lag filter and notch filters arranged in series, and each filter operates independently.

The notch filters can be enabled and disabled with $Pn408 = n.\Box X\Box X$ and $Pn416 = n.\Box XXX$.

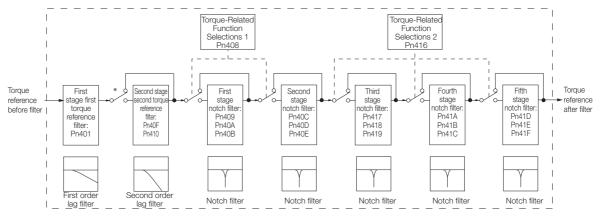

^{*} The second stage second torque reference filter is disabled when Pn40F is set to 5,000 (default setting) and it is enabled when Pn40F is set to a value lower than 5,000.

■ Torque Reference Filter

If you suspect that machine vibration is being caused by the Servo Drive, try adjusting the torque reference filter time constant. This may stop the vibration. The lower the value, the better the control response characteristic will be, but there may be a limit depending on the machine conditions.

	First Stage First Torque Reference Filter Time Constant			Speed Posit	ion Torque
Pn401	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	0.01 ms	100	Immediately	Tuning
Pn40F	Second Stage Second Torque Reference Filter Frequency		Speed Posit	ion Torque	
	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	100 to 5,000	1 Hz	5,000*	Immediately	Tuning
	Second Stage Second Torque Reference Filter Q Value			Speed Posit	ion Torque
Pn410	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	50 to 100	0.01	50	Immediately	Tuning

^{*} The filter is disabled if you set the parameter to 5,000.

Notch Filters

The notch filter can eliminate specific frequency elements generated by the vibration of sources such as resonance of the shaft of a ball screw.

The notch filter puts a notch in the gain curve at the specific vibration frequency (called the notch frequency). The frequency components near the notch frequency can be reduced or removed with a notch filter.


Notch filters are set with three parameters for the notch filter frequency, notch filter Q value, and notch filter depth. This section describes the notch filter Q value and notch filter depth.

8.13.1 Tuning the Servo Gains

· Notch filter Q Value

The setting of the notch filter Q value determines the width of the frequencies that are filtered for the notch filter frequency. The width of the notch changes with the notch filter Q value. The larger the notch filter Q value is, the steeper the notch is and the narrower the width of frequencies that are filtered is.

The notch filter frequency characteristics for different notch filter Q values are shown below.

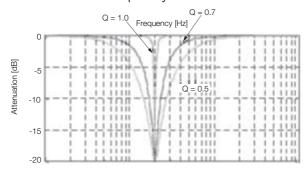


Note: The above notch filter frequency characteristics are based on calculated values and may be different from actual characteristics.

· Notch Filter Depth

The setting of the notch filter depth determines the depth of the frequencies that are filtered for the notch filter frequency. The depth of the notch changes with the notch filter depth. The smaller the notch filter depth is, the deeper the notch is, increasing the effect of vibration suppression. However, if the value is too small, vibration can actually increase.

The notch filter is disabled if the notch filter depth, d, is set to 1.0 (i.e., if Pn419 is set to 1,000). The notch filter frequency characteristics for different notch filter depths are shown below.

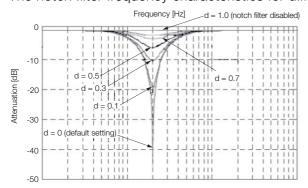

Note: The above notch filter frequency characteristics are based on calculated values and may be different from actual characteristics.

You can enable or disable the notch filter with Pn408 and Pn416.

Parameter		Meaning	When Enabled	Classification
Pn408	n.□□□0 (default setting)	Disable first stage notch filter.		
	n.□□□1	Enable first stage notch filter.		
	n.□0□□ (default setting)	Disable second stage notch filter.		
	n.🗆 1 🗆 🗆	Enable second stage notch filter.		Setup
	n.□□□0 (default setting)	Disable third stage notch filter.	Immediately	
	n.□□□1	Enable third stage notch filter.		
Pn416	n.□□0□ (default setting)	Disable fourth stage notch filter.		
	n.0010	Enable fourth stage notch filter.		
	n.□0□□ (default setting)	Disable fifth stage notch filter		
	n.□1□□	Enable fifth stage notch filter.		

	First Stage Notch Fi	Iter Frequency		Speed Posit	ion Torque
Pn409	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	50 to 5,000	1 Hz	5,000	Immediately	Tuning
	First Stage Notch Fi	Iter Q Value		Speed Posit	ion Torque
Pn40A	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	50 to 1,000	0.01	70	Immediately	Tuning
	First Stage Notch Fi	Iter Depth		Speed Posit	ion Torque
Pn40B	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 1,000	0.001	0	Immediately	Tuning
	Second Stage Notc	h Filter Frequency		Speed Posit	Torque
Pn40C	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	50 to 5,000	1 Hz	5,000	Immediately	Tuning
	Second Stage Notc	h Filter Q Value		Speed Posit	Torque
Pn40D	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	50 to 1,000	0.01	70	Immediately	Tuning
	Second Stage Notc	h Filter Depth		Speed Posit	ion Torque
Pn40E	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 1,000	0.001	0	Immediately	Tuning
	Third Stage Notch F	Filter Frequency		Speed Posit	ion Torque
Pn417	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	50 to 5,000	1 Hz	5,000	Immediately	Tuning
	Third Stage Notch F	ilter Q Value		Speed Posit	ion Torque
Pn418	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	50 to 1,000	0.01	70	Immediately	Tuning
	Third Stage Notch F	ilter Depth		Speed Posit	ion Torque
Pn419	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 1,000	0.001	0	Immediately	Tuning
	Fourth Stage Notch	Filter Frequency		Speed Posit	ion Torque
Pn41A	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	50 to 5,000	1 Hz	5,000	Immediately	Tuning
	Fourth Stage Notch	Filter Q Value		Speed Posit	ion Torque
Pn41B	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	50 to 1,000	0.01	70	Immediately	Tuning
	Fourth Stage Notch	Filter Depth		Speed Posit	ion Torque
Pn41C	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 1,000	0.001	0	Immediately	Tuning
	Fifth Stage Notch Fi	ilter Frequency		Speed Posit	ion Torque
Pn41D	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	50 to 5,000	1 Hz	5,000	Immediately	Tuning
	Fifth Stage Notch F	ilter Q Value		Speed Posit	ion Torque
Pn41E	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	50 to 1,000	0.01	70	Immediately	Tuning
	Fifth Stage Notch Fi	Iter Depth		Speed Posit	ion Torque
Pn41F	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 1,000	0.001	0	Immediately	Tuning



- Do not set notch filter frequencies (Pn409, Pn40C, Pn417, Pn41A, and Pn41D) that are close to the speed loop's response frequency. Set a frequency that is at least four times the speed loop gain (Pn100). (However, Pn103 (Moment of Inertia Ratio) must be set correctly. If the setting is not correct, vibration may occur and the machine may be damaged.
 Change the notch filter frequencies (Pn409, Pn40C, Pn417, Pn41A, and Pn41D) only while the
- Change the notch filter frequencies (Pn409, Pn40C, Pn417, Pn41A, and Pn41D) only while the Servomotor is stopped. Vibration may occur if a notch filter frequency is changed during operation.

8.13.1 Tuning the Servo Gains

Guidelines for Manually Tuning Servo Gains

When you manually adjust the parameters, make sure that you completely understand the information in the product manual and use the following conditional expressions as guidelines. The appropriate values of the parameter settings are influenced by the machine specifications, so they cannot be determined universally. When you adjust the parameters, actually operate the machine and use the SigmaWin+ or analog monitor to monitor operating conditions. Even if the status is stable while the Servomotor is stopped, an unstable condition may occur when an operation reference is input. Therefore, input operation references and adjust the servo gains as you operate the Servomotor.

Stable gain: Settings that provide a good balance between parameters.

However, if the load moment of inertia is large and the machine system contains elements prone to vibration, you must sometimes use a setting that is somewhat higher to prevent the machine from vibrating.

Critical gain: Settings for which the parameters affect each other

Depending on the machine conditions, overshooting and vibration may occur and operation may not be stable. If the critical gain condition expressions are not met, operation will become more unstable, and there is a risk of abnormal motor shaft vibration and round-trip operation with a large amplitude. Always stay within the critical gain conditions.

If you use the torque reference filter, second torque reference filter, and notch filters together, the interference between the filters and the speed loop gain will be superimposed. Allow leeway in the adjustments.



The following adjusted value guidelines require that the setting of Pn103 (Moment of Inertia Ratio) is correctly set for the actual machine.

♦ When Pn10B = n.□□0□ (PI Control)

Guidelines are given below for gain settings 1.

The same guidelines apply to gain settings 2 (Pn104, Pn105, Pn106, and Pn412).

- Speed Loop Gain (Pn100 [Hz]) and Position Loop Gain (Pn102 [/s]) Stable gain: Pn102 [/s] $\leq 2\pi \times$ Pn100/4 [Hz]
 - Stable gain: Pn102 [/s] $\leq 2\pi \times \text{Pn100/4}$ [Hz] Critical gain: Pn102 [/s] $< 2\pi \times \text{Pn100}$ [Hz]
- Speed Loop Gain (Pn100 [Hz]) and Speed Loop Integral Time Constant (Pn101 [ms])
 Stable gain: Pn101 [ms] ≥ 4,000/(2π × Pn100 [Hz])
 Critical gain: Pn101 [ms] > 1,000/(2π × Pn100 [Hz])
- Speed Loop Gain (Pn100 [Hz]) and First Stage First Torque Reference Filter Time Constant (Pn401 [ms])

```
Stable gain: Pn401 [ms] \leq 1,000/(2\pi × Pn100 [Hz] × 4) Critical gain: Pn401 [ms] < 1,000/(2\pi × Pn100 [Hz] × 1)
```

 Speed Loop Gain (Pn100 [Hz]) and Second Stage Second Torque Reference Filter Frequency (Pn40F [Hz])

Critical gain: Pn40F [Hz] > 4 × Pn100 [Hz]

Note: Set the Second Stage Second Torque Reference Filter Q Value (Pn410) to 0.70.

- Speed Loop Gain (Pn100 [Hz]) and First Stage Notch Filter Frequency (Pn409 [Hz]) (or Second Stage Notch Filter Frequency (Pn40C [Hz]))
 Critical gain: Pn409 [Hz] > 4 × Pn100 [Hz]
- Speed Loop Gain (Pn100 [Hz]) and Speed Feedback Filter Time Constant (Pn308 [ms]) Stable gain: Pn308 [ms] \leq 1,000/(2 π × Pn100 [Hz] × 4) Critical gain: Pn308 [ms] < 1,000/(2 π × Pn100 [Hz] × 1)

◆ When Pn10B = n.□□1□ (I-P Control)

Guidelines are given below for gain settings 1.

The same guidelines apply to gain settings 2 (Pn104, Pn105, Pn106, and Pn412).

For I-P control, the relationships between the speed loop integral time constant, speed loop gain, and position loop gain are different from the relationships for PI control. The relationship between other servo gains is the same as for PI control.

- Speed Loop Gain (Pn100 [Hz]) and Speed Loop Integral Time Constant (Pn101 [ms]) Stable gain: Pn100 [Hz] ≥ 320/Pn101 [ms]
- Position Loop Gain (Pn102 [/s]) and Speed Loop Integral Time Constant (Pn101 [ms]) Stable gain: Pn102 [/s] ≤ 320/Pn101 [ms]



Selecting the Speed Loop Control Method (PI Control or I-P Control)

Usually, I-P control is effective for high-speed positioning and high-speed, high-precision processing applications. With I-P control, you can use a lower position loop gain than for PI control to reduce the positioning time and reduce arc radius reduction. However, if you can use mode switching to change to proportional control to achieve the desired application, then using PI control would be the normal choice.

Decimal Points in Parameter Settings

For the SGD7S SERVOPACKs, decimal places are given for the settings of parameters on the Digital Operator, Panel Operator, and in the manual. For example with Pn100 (Speed Loop Gain), Pn100 = 40.0 is used to indicate a setting of 40.0 Hz. In the following adjusted value guidelines, the decimal places are also given.



• Speed Loop Gain (Pn100 [Hz]) and Speed Loop Integral Time Constant (Pn101 [ms]) Stable gain: Pn101 [ms] \geq 4,000/($2\pi \times$ Pn100 [Hz]), therefore If Pn100 = 40.0 [Hz], then Pn101 = 4,000/($2\pi \times$ 40.0) \approx 15.92 [ms].

Model Following Control


You can use model following control to improve response characteristic and shorten positioning time. You can use model following control only with position control.

Normally, the parameters that are used for model following control are automatically set along with the servo gains by executing autotuning or custom tuning. However, you must adjust them manually in the following cases.

- When the tuning results for autotuning or custom tuning are not acceptable
- When you want to increase the response characteristic higher than that achieved by the tuning results for autotuning or custom tuning
- · When you want to determine the servo gains and model following control parameters yourself

8.13.1 Tuning the Servo Gains

The block diagram for model following control is provided below.

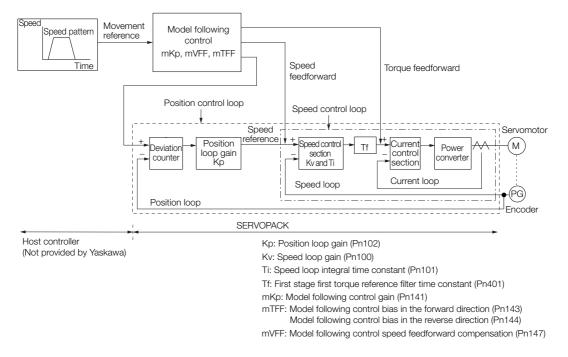

◆ Manual Tuning Procedure

Use the following tuning procedure for using model following control.

Step	Description
1	Friction compensation must also be used. Set the friction compensation parameters. Refer to the following section for the setting procedure. 8.12.2 Friction Compensation on page 8-70
	Adjust the servo gains. Refer to the following section for an example procedure. Tuning Procedure Example (for Position Control or Speed Control) on page 8-77
2	Note: 1. Set the moment of inertia ratio (Pn103) as accurately as possible. 2. Refer to the guidelines for manually tuning the servo gains and set a stable gain for the position loop gain (Pn102). Guidelines for Manually Tuning Servo Gains on page 8-82
3	Increase the model following control gain (Pn141) as much as possible within the range in which overshooting and vibration do not occur.
4	If overshooting occurs or if the response is different for forward and reverse operation, fine-tune model following control with the following settings: model following control bias in the forward direction (Pn143), model following control bias in the reverse direction (Pn144), and model following control speed feedforward compensation (Pn147).

◆ Related Parameters

Next we will describe the following parameters that are used for model following control.

- Pn140 (Model Following Control-Related Selections)
- Pn141 (Model Following Control Gain)
- Pn143 (Model Following Control Bias in the Forward Direction)
- Pn144 (Model Following Control Bias in the Reverse Direction)
- Pn147 (Model Following Control Speed Feedforward Compensation)

■ Model Following Control-Related Selections

Set $Pn140 = n.\square\square\square\square X$ to specify whether to use model following control.

If you use model following control with vibration suppression, set Pn140 to $n.\Box\Box1\Box$ or Pn140 = $n.\Box\Box2\Box$. When you also perform vibration suppression, adjust vibration suppression with custom tuning in advance.

Note: If you use vibration suppression (Pn140 = n. \$\square\$1\$ or Pn140 = n. \$\square\$2\$), always set Pn140 to n. \$\square\$1\$ (Use model following control).

F	Parameter	Function	When Enabled	Classification	
Pn140	n.□□□0 (default setting)	Do not use model following control.			
	n.□□□1	Use model following control.	Immediately	Tuning	
	n.□□0□ (default setting)	Do not perform vibration suppression.			
	n.□□1□	Perform vibration suppression for a specific frequency.			
	n.□□2□	Perform vibration suppression for two specific frequencies.			

■ Model Following Control Gain

The model following control gain determines the response characteristic of the servo system. If you increase the setting of the model following control gain, the response characteristic will improve and the positioning time will be shortened. The response characteristic of the servo system is determined by this parameter, and not by Pn102 (Position Loop Gain).

	Model Following Control Gain			Position	
Pn141	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	10 to 20,000	0.1/s	500	Immediately	Tuning

Information

For machines for which a high model following control gain cannot be set, the size of the position deviation in model following control will be determined by the setting of the model following control gain. For a machine with low rigidity, in which a high model following control gain cannot be set, position deviation overflow alarms may occur during high-speed operation. If that is the case, you can increase the setting of the following parameter to increase the level for alarm detection.

Use the following conditional expression for reference in determining the setting.

Pn 520
$$\geq \frac{\text{Maximum feed speed [reference units/s]}}{\text{Pn 141/10 [1/s]}} \times 2.0$$

	Position Deviation Overflow Alarm Level			Position	
Pn520	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
111020	1 to 1,073,741,823	1 reference unit	5,242,880	Immediately	Setup

8.13.1 Tuning the Servo Gains

■ Model Following Control Bias in the Forward Direction and Model Following Control Bias in the Reverse Direction

If the response is different for forward and reverse operation, use the following parameters for fine-tuning.

If you decrease the settings, the response characteristic will be lowered but overshooting will be less likely to occur.

	Model Following Control Bias in the Forward Direction			Position	
Pn143	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	0.1%	1,000	Immediately	Tuning
	Model Following Control Bias in the Reverse Direction			Position	
Pn144	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 10,000	0.1%	1,000	Immediately	Tuning

■ Model Following Control Speed Feedforward Compensation

If overshooting occurs even after you adjust the model following control gain, model following control bias in the forward direction, and model following control bias in the reverse direction, you may be able to improve performance by setting the following parameter.

If you decrease the settings, the response characteristic will be lowered but overshooting will be less likely to occur.

İ		Model Following Control Speed Feedforward Compensation			Position	
	Pn147	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
		0 to 10,000	0.1%	1,000	Immediately	Tuning

■ Model Following Control Type Selection

When you enable model following control, you can select the model following control type. Normally, set Pn14F to n. \$\square\$ (Use model following control type 2) (default setting). If compatibility with previous models is required, set Pn14F to n. \$\square\$ (Use model following control type 1).


Parameter		Meaning	When Enabled	Classification
	n.□□□0	Use model following control type 1.		Tuning
Pn14F	n.□□□1 (default setting)	Use model following control type 2.	After restart	

8.13.2 Compatible Adjustment Functions

The compatible adjustment functions are used together with manual tuning. You can use these functions to improve adjustment results. These functions allow you to use the same functions as for Σ -III-Series SERVOPACKs to adjust Σ -7-Series SERVOPACKs.

Feedforward

The feedforward function applies feedforward compensation to position control to shorten the positioning time.

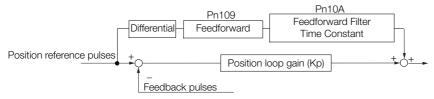

	Feedforward			Posit	ion	
Pn109	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 100	1%	0	Immediately	Tuning	
	Feedforward Filter Time Constant			Position		
Pn10A	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 6,400	0.01 ms	0	Immediately	Tuning	

Note: If you set the feedforward value too high, the machine may vibrate. As a guideline, use a setting of 80% or less.

Torque Feedforward and Speed Feedforward


You can use the torque feedforward and speed feedforward functions to help shorten the positioning time. The reference is created from the differential of the position reference at the host controller.

Torque feedforward: This is effective for speed control or position control. It is sent from the host controller along with the speed reference. Connect the speed reference from the host controller to the V-REF (CN1-5 and CN1-6) signal and the torque feedforward reference from the host controller to the T-REF (CN1- 9 and CN1-10) signal.

Speed feedforward: This is effective only for position control. It is sent to the SERVOPACK from the host controller along with the position reference. Connect the position reference from the host controller to the PULS and SIGN (CN1-7,CN1 -8, CN1-11, and CN1-12) signals and the speed feedforward reference from the host controller to the V-REF (CN1-5 and CN1-6) signal.

Examples of Connections to Host Controllers


■ When SERVOPACK Performs Speed Control

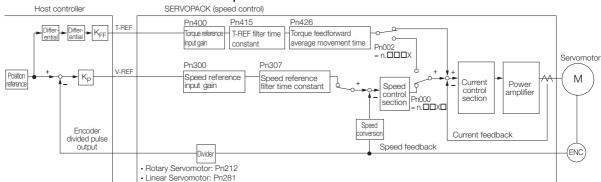

Kp: Position loop gain KFF: Feedforward gain

8.13.2 Compatible Adjustment Functions

■ When SERVOPACK Performs Position Control

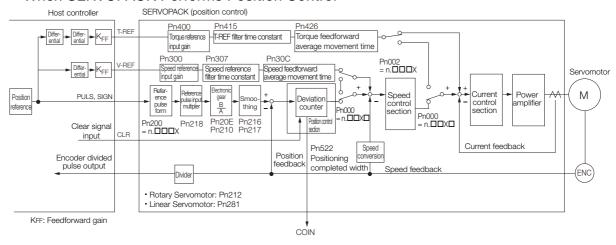

Related Parameters

■ Torque Feedforward

Torque feedforward is allocated to T-REF ($Pn002 = n.\Box\Box\Box X$) and it is set using the torque reference input gain (Pn400) and T-REF filter time constant (Pn415).

The default setting of Pn400 is 30. Therefore, if the torque feedforward value is ± 3 V, then the torque is limited to $\pm 100\%$ of the rated torque.

Parameter		Meaning		When Enabled	Classification	
n.□□□0 (default setting)		Do not use T-REF.				
Pn002	n.□□□1	Use T-REF as an external torque limit input.		After restart	Setup	
F11002	n.□□□2	Use T-REF as a torque feedback input.		7 III TOSIAIT		
	n.□□□3	Use T-REF as an external torque limit input when /P-CL or /N-CL is active.				
Torque Reference		e Input Gain		Speed Posit	ion Torque	
Pn400	Setting Range	Setting Unit	Default Setting	When Fnahled	Classification	

	Torque Reference Input Gain			Speed Position	on Torque
Pn400	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	10 to 100	0.1 V/rated torque	30	Immediately	Setup
	T-REF Filter Time Constant			Speed Position	on Torque
Pn415	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	0.01 ms	0	Immediately	Setup
	Torque feedforward average movement time			Speed Position	on
Pn426	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 5,100	0.1 ms	0	Immediately	Setup

Note: 1. Overshooting will occur if you set the torque feedforward too high. Set the optimum value while monitoring the response.

^{2.} You cannot use the torque feedforward function together with torque limiting with an analog voltage reference.

■ Speed Feedforward

You set the speed feedforward function with the position control option ($Pn207 = n.\Box\Box X\Box$) and the speed reference input gain (Pn300).

The default setting of Pn300 is 600. Therefore, if the speed feedforward value is ± 6 V, then it will indicate the rated speed.


F	Parameter	Mea	ning	When Enabled	Classification
Pn207	n.□□0□ (default setting)	Do not use V-REF.		After restart	Setup
	n.□□1□	Use V-REF as a speed	feedback input.		
	Speed Reference	Input Gain		Speed Positi	on Torque
Pn300	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
1 11300	150 to 3,000	0.01 V/Rated motor speed	600	Immediately	Setup
	Speed Reference	Filter Time Constant		Speed Position	
Pn307	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 65,535	0.01 ms	40	Immediately	Setup
Speed Feedforv		ard Average Movement Time		Positi	on
Pn30C	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 5,100	0.1 ms	0	Immediately	Setup

Note: Overshooting will occur if you set the feedforward too high. Set the optimum value while monitoring the response.

Mode Switching (Changing between Proportional and Pl Control)

You can use mode switching to automatically change between proportional control and PI control.

Overshooting caused by acceleration and deceleration can be suppressed and the settling time can be reduced by setting the switching condition and switching levels.

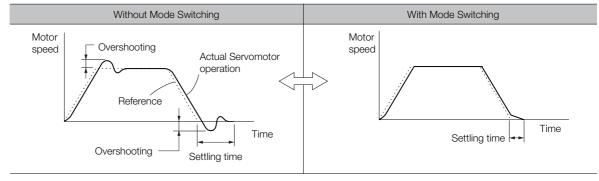

8.13.2 Compatible Adjustment Functions

◆ Related Parameters

Select the switching condition for mode switching with $Pn10B = n.\square\square\square\square X$.

Parameter		Mode Switching		Parameter That Sets the Level		Classification
•	-arameter	Selection	Rotary Servomotor	Linear Servomotor	Enabled	Ciassilication
	n.□□□0 (default setting)	Use the internal torque reference as the condition.	Pn ⁻	10C		
	n.□□□1	Use the speed reference as the condition.	Pn10D	Pn181		
Pn10B	n.□□□2	Use the acceleration reference as the condition.	Pn10E	Pn182	Immediately	Setup
	n.□□□3	Use the position deviation as the condition.	Pn10F			
	n.□□□4	Do not use mode switching.	-			

■ Parameters That Set the Switching Levels

Rotary Servomotors

	Mode Switching Level for Torque Reference			Speed	Speed Position	
Pn10C	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 800	1%	200	Immediately	Tuning	
	Mode Switching L	evel for Speed Ref	erence	Speed	Position	
Pn10D	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 10,000	1 min ⁻¹	0	Immediately	Tuning	
	Mode Switching Level for Acceleration			Speed Position		
Pn10E	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 30,000	1 min ⁻¹ /s	0	Immediately	Tuning	
	Mode Switching L	evel for Position De	eviation	Position		
Pn10F	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 10,000	1 reference unit	0	Immediately	Tuning	

Linear Servomotors


	Mode Switching L	evel for Force Refe	rence	Speed	Speed Position	
Pn10C	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 800	1%	200	Immediately	Tuning	
	Mode Switching L	evel for Speed Ref	erence	Speed	Position	
Pn181	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 10,000	1 mm/s	0	Immediately	Tuning	
	Mode Switching Level for Acceleration			Speed Position		
Pn182	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 30,000	1 mm/s ²	0	Immediately	Tuning	
Mode Switching Level for Position Dev			eviation	F	Position	
Pn10F	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 10,000	1 reference unit	0	Immediately	Tuning	

₽

■ Using the Internal Torque Reference as the Mode Switching Condition (Default Setting)

When the Internal torque reference equals or exceeds the torque set for the mode switching level for torque reference (Pn10C), the speed loop is changed to P control.


The default setting for the torque reference level is 200%.

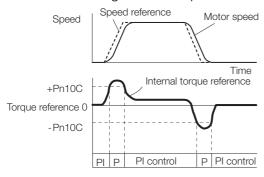

■ Using the Speed Reference as the Mode Switching Condition


Rotary Servomotors

When the speed reference equals or exceeds the speed set for the mode switching level for a speed reference (Pn10D), the speed loop is changed to P control.

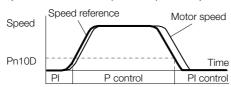

Linear Servomotors


When the speed reference equals or exceeds the speed set for the mode switching level for a speed reference (Pn181), the speed loop is changed to P control.

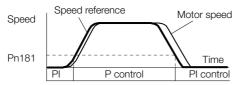

■ Using the Acceleration as the Mode Switching Condition

Rotary Servomotors


When the speed reference equals or exceeds the acceleration rate set for the mode switching level for acceleration (Pn10E), the speed loop is changed to P control.

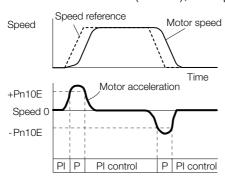

8.13.2 Compatible Adjustment Functions

· Linear Servomotors


When the speed reference equals or exceeds the acceleration rate set for the mode switching level for acceleration (Pn182), the speed loop is changed to P control.

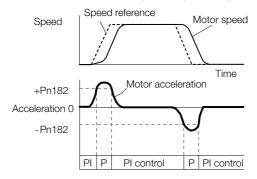

■ Using the Position Deviation as the Mode Switching Condition

When the position deviation equals or exceeds the value set for the mode switching level for position deviation (Pn10F), the speed loop is changed to P control.

This setting is enabled only for position control.

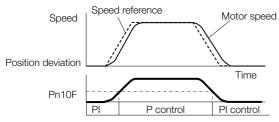

Position Integral

The position integral is the integral function of the position loop. It is used for the electronic cams and electronic shafts when using the SERVOPACK with a Yaskawa MP3000-Series Machine Controller.

	Position Integral Time Constant			Position		
Pn11F	Setting Range	Setting Unit	Default Setting	When Enabled	Classification	
	0 to 50,000	0.1 ms	0	Immediately	Tuning	


0

8.14 Diagnostic Tools

8.14.1 Mechanical Analysis

Overview

You can connect the SERVOPACK to a computer to measure the frequency characteristics of the machine. This allows you to measure the frequency characteristics of the machine without using a measuring instrument.

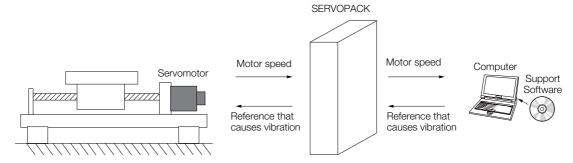

The Servomotor is used to cause machine vibration and then the speed frequency characteristics for the motor torque are measured. The measured frequency characteristics can be used to determine the machine resonance.

You determine the machine resonance for use in servo tuning and as reference for considering changes to the machine. The performance of the servo cannot be completely utilized depending on the rigidity of the machine. You may need to consider making changes to the machine. The information can also be used as reference for servo tuning to help you adjust parameters, such as the servo rigidity and torque filter time constant.

You can also use the information to set parameters, such as the notch filters.


WARNING

Mechanical analysis requires operating the Servomotor and therefore presents hazards.
 Before you execute mechanical analysis, check the information provided in the SigmaWin+ operating manual.

Frequency Characteristics

The Servomotor is used to cause the machine to vibrate and the frequency characteristics from the torque to the motor speed are measured to determine the machine characteristics. For a normal machine, the resonance frequencies are clear when the frequency characteristics are plotted on graphs with the gain and phase (Bode plots). The Bode plots show the size (gain) of the response of the machine to which the torque is applied, and the phase delay (phase) in the response for each frequency. Also, the machine resonance frequency can be determined from the maximum frequency of the valleys (anti-resonance) and peaks (resonance) of the gain and the phase delay.

For a Servomotor without a load or for a rigid mechanism, the gain and phase change gradually in the Bode plots.

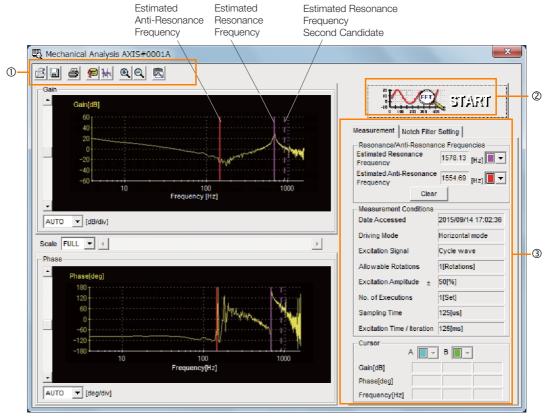

- ① Toolbar
- ② START Button

Click the START Button to start analysis.

③ Measurement and Notch Filter Setting Tab Pages
Measurement Tab Page: Displays detailed information on the results of analysis.
Notch Filter Setting Tab Page: Displays the notch filter frequencies. You can set these values in the parameters.

8.14.2 Easy FFT

The machine is made to vibrate and a resonance frequency is detected from the generated vibration to set notch filters according to the detected resonance frequencies. This is used to eliminate high-frequency vibration and noise.

During execution of Easy FFT, a frequency waveform reference is sent from the SERVOPACK to the Servomotor to automatically cause the shaft to rotate multiple times within 1/4th of a rotation, thus causing the machine to vibrate.


Execute Easy FFT after the servo is turned OFF if operation of the SERVOPACK results in high-frequency noise and vibration.

⚠ WARNING

 Never touch the Servomotor or machine during execution of Easy FFT. Doing so may result in injury.

⚠ CAUTION

Use Easy FFT when the servo gain is low, such as in the initial stage of servo tuning. If you
execute Easy FFT after you increase the gain, the machine may vibrate depending on the
machine characteristics or gain balance.

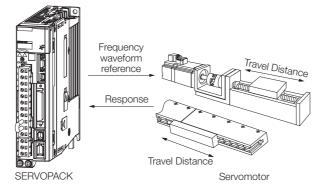

Easy FFT is built into the SERVOPACK for compatibility with previous products. Normally use autotuning without a host reference for tuning.

Preparations

Always check the following before you execute Easy FFT.

- The parameters must not be write prohibited.
- The main circuit power supply must be ON.
- The test without a motor function must be disabled ($Pn00C = n.\square\square\square\square$ 0).
- There must be no alarms.
- There must be no hard wire base block (HWBB).
- The servo must be OFF.
- There must be no overtravel.
- An external reference must not be input.

Applicable Tools

The following table lists the tools that you can use to perform EasyFFT.

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	Fn206	13.4.33 Easy FFT (Fn206) on page 13-32
Digital Operator	Fn206	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Diagnostic - Easy FFT	© Operating Procedure on page 8-96

Operating Procedure

Use the following procedure for Easy FFT.

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- 2. Select Easy FFT in the Menu Dialog Box.

The Easy FFT Dialog Box will be displayed.

Click the **Cancel** Button to cancel Easy FFT. You will return to the main window.

3. Click the OK Button.



4. Click the Servo ON Button.




5. Select the instruction (reference) amplitude and the rotation direction in the Measurement condition Area, and then click the Start Button.

The Servomotor shaft will rotate and measurements will start.




When measurements have been completed, the measurement results will be displayed.

6. Check the results in the **Measurement result** Area and then click the **Measurement complete** Button.

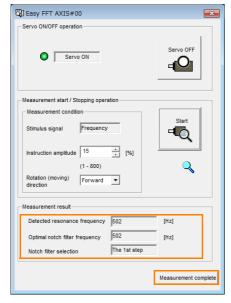

8.14.2 Easy FFT

7. Click the **Result Writing** Button if you want to set the measurement results in the parameters.

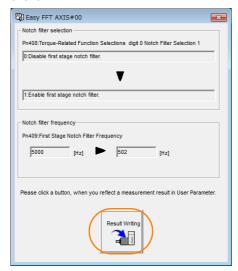

This concludes the procedure to set up Easy FFT.

Related Parameters

The following parameters are automatically adjusted or used as reference when you execute Easy FFT.

Do not change the settings of these parameters during execution of Easy FFT.

Parameter	Name	Automatic Changes
Pn408	Torque-Related Function Selections	Yes
Pn409	First Stage Notch Filter Frequency	Yes
Pn40A	First Stage Notch Filter Q Value	No
Pn40C	Second Stage Notch Filter Frequency	Yes
Pn40D	Second Stage Notch Filter Q Value	No
Pn456	Sweep Torque Reference Amplitude	No

Yes: The parameter is automatically set.

No: The parameter is not automatically set, but the setting is read during execution.

This chapter provides information on monitoring SERVO-PACK product information and SERVOPACK status.

9.1	Monit	oring Product Information9-2
	9.1.1 9.1.2	Items That You Can Monitor 9-2 Operating Procedures 9-3
9.2	Monit	oring SERVOPACK Status9-4
	9.2.1 9.2.2 9.2.3	Servo Drive Status
9.3	Monitori	ng Machine Operation Status and Signal Waveforms9-8
	9.3.1 9.3.2 9.3.3	Items That You Can Monitor9-8Using the SigmaWin+9-9Using the Analog Monitors9-10
9.4	Monit	oring Product Life9-15
	9.4.1 9.4.2 9.4.3	Items That You Can Monitor
9.5	Alarm	Tracing9-18
	9.5.1	Data for Which Alarm Tracing Is Performed 9-18

9.1.1 Items That You Can Monitor

9.1

Monitoring Product Information

9.1.1 Items That You Can Monitor

The items that you can monitor in the SigmaWin+ Product Information Window are listed below.

	Monitor Items
Information on SERVOPACKs	 Model/Type Serial Number Manufacturing Date Software version (SW Ver.) Remarks
Information on Servomotors	 Model/Type Serial Number Manufacturing Date Remarks
Information on Encoders	 Model/Type Serial Number Manufacturing Date Software version (SW Ver.) Remarks
Information on Option Modules	Model/Type Serial Number Manufacturing Date Software version (SW Ver.) Remarks

9.1.2 Operating Procedures

Use the following procedure to display the Servo Drive product information.

• Select *Read Product Information* in the Menu Dialog Box of the SigmaWin+. The Read Product Information Window will be displayed.



Information

- With the Panel Operator, you can use Fn011 and Fn012 to monitor this information. Refer to the following sections for the differences in the monitor items compared with the SigmaWin+.
 - 13.4.16 Display Servomotor Model (Fn011) on page 13-24
 - 13.4.17 Display Software Version (Fn012) on page 13-26
- With the Digital Operator, you can use Fn011, Fn012, and Fn01E to monitor this information.

Refer to the following manual for the differences in the monitor items compared with the SigmaWin+.

Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)

9.2.1 Servo Drive Status

9.2

Monitoring SERVOPACK Status

9.2.1 Servo Drive Status

Use the following procedure to display the Servo Drive status.

• Start the SigmaWin+. The Servo Drive status will be automatically displayed when you go online with a SERVOPACK.



The Servo Drive status is displayed.

The Servomotor type is displayed.

9.2.2 Monitoring Operation, Status, and I/O

Items That You Can Monitor

The items that you can monitor on the Operation Pane, Status Pane, and I/O Pane are listed below.

Operation Pane

Monitor Items

- · Motor Speed
- Speed Reference
- Internal Torque Reference
- Angle of Rotation 1
 - (Number of encoder pulses from origin within one encoder rotation)
- Angle of Rotation 2
 (angle from origin within)
- (angle from origin within one encoder rotation)
- Input Reference Pulse Speed
- Deviation Counter (Position Deviation)
- Cumulative Load
- Regenerative Load
- Power Consumption

- Consumed Power
- Cumulative Power Consumption
- DB Resistor Consumption Power
- Absolute Encoder Multiturn Data
- Absolute Encoder Position within One Rotation
- Absolute Encoder (Lower)
- Absolute Encoder (Upper)
- Input Reference Pulse Counter
- · Feedback Pulse Counter
- Fully Closed Feedback Pulse Counter
- Total Operating Time

Status Pane

Monitor Items

- Main Circuit
- Encoder (PGRDY)
- Motor Power (Request)
- Motor Power ON
- Dynamic Brake (DB)
- Rotation (Movement) Direction
- Mode Switch
- Speed Reference (V-Ref)
- Torque Reference (T-Ref)

- Position Reference (PULS)
- Position Reference Direction
- Clear Signal (CLR)
- Surge Current Limiting Resistor Short Relay
- Regenerative Transistor
- Regenerative Error Detection
- AC Power ON
- Overcurrent
- Origin Not Passed

Monitoring

I/O Pane

- /S-ON (Servo ON Input Signal)
- /P-CON (Proportional Control Input Signal)
- P-OT (Forward Drive Prohibit Input Signal)
- N-OT (Reverse Drive Prohibit Input Signal)
- /P-CL (Forward External Torque Limit Signal)
- /N-CL (Reverse External Torque Limit Signal)
- /ALM-RST (Alarm Reset Input Signal)
- SEN (Absolute Data Request Input Signal)
- /SPD-D (Motor Direction Signal)
- /SPD-A (Internal Set Speed Selection Input
- /SPD-B (Internal Set Speed Selection Input
- /C-SEL (Control Selection Input Signal)
- /ZCLAMP (Zero Clamping Input Signal)
- /INHIBIT (Reference Pulse Inhibit Input Signal)
- /G-SEL (Gain Selection Input Signal)
- /P-DET (Polarity Detection Input Signal)
- PULS (Pulse Reference Input Signal) • SIGN (Sign Reference Input Signal)
- CLR (Position Deviation Clear Input Signal)
- /PSEL (Reference Pulse Input Multiplication Input Signal)
- FSTP (Forced Stop Input Signal)

- ALM (Servo Alarm Output Signal)
 - /COIN (Positioning Completion Output Signal)
 - /V-CMP (Speed Coincidence Detection Output
 - /TGON (Rotation Detection Output Signal)
 - /S-RDY (Servo Ready Output Signal)
 - /CLT (Torque Limit Detection) Signal
 - VLT (Speed Limit Detection Output Signal)
 - /BK (Brake Output Signal)
 - /WARN (Warning Output Signal)
 - /NEAR (Near Output Signal)
 - ALO1 (Alarm Code Output Signal)
 - ALO2 (Alarm Code Output Signal)
 - ALO3 (Alarm Code Output Signal)
 - PAO (Encoder Divided Pulse Output Phase A Signal)
 - PBO (Encoder Divided Pulse Output Phase B Signal)
 - PCO (Encoder Divided Pulse Output Phase C Signal)
 - /PSELA (Reference Pulse Input Multiplication Switching Output Signal)
 - /PM (Preventative Maintenance Output Signal)

Operating Procedure


Use the following procedure to display the Operation Monitor, Status Monitor, and I/O Monitor for the SERVOPACK.

Monitor Items

Status

Signal

• Select Monitor in the SigmaWin+ Menu Dialog Box. The Operation Pane, Status Pane, and I/O Pane will be displayed in the Monitor Window.

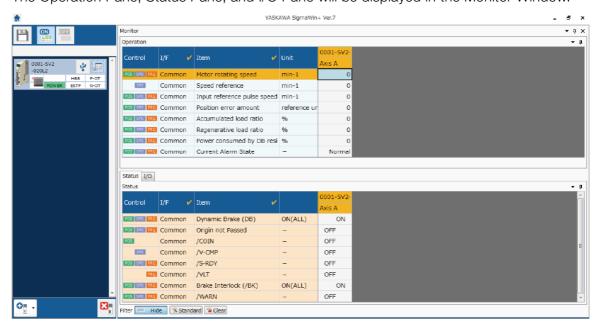

Information


You can flexibly change the contents that are displayed in the Monitor Window. Refer to the following manual for details.

Engineering Tool SigmaWin+ Operation Manual (Manual No.: SIET S800001 34)

9.2.3 I/O Signals Status Monitor


Use the following procedure to check the status of the I/O signals.

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select I/O Signal Allocation in the Menu Dialog Box. The I/O Signal Allocation Window will be displayed.
- 3. Click the Input Signal Tab.

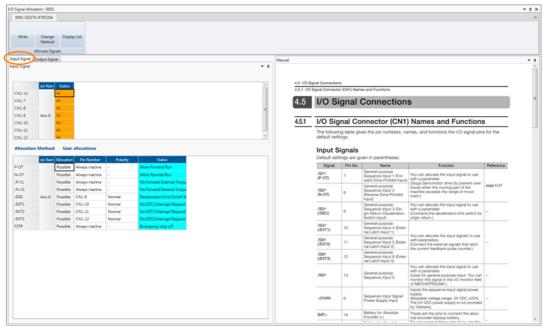

Check the status of the input signals.

4. Click the Output Signal Tab.

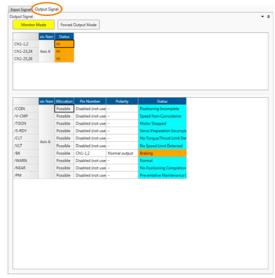

Check the status of the output signals.

Information

You can also use the above window to check wiring.

- Checking Input Signal Wiring
 Change the signal status at the host controller. If the input signal status on the window changes accordingly, then the wiring is correct.
 Checking Output Signal Wiring
- Checking Output Signal Wiring
 Click the **Force Output Mode** Button. This will force the output signal status to change. If
 the signal status at the host controller changes accordingly, then the wiring is correct.
 You cannot use the **Force Output Mode** Button while the servo is ON.

For details, refer to the following manual.

AC Servo Drive Engineering Tool SigmaWin+ Operation Manual (Manual No.: SIET S800001 34)

9.3.1 Items That You Can Monitor

9.3

Monitoring Machine Operation Status and Signal Waveforms

To monitor waveforms, use the SigmaWin+ trace function or a measuring instrument, such as a memory recorder.


9.3.1 Items That You Can Monitor

You can use the SigmaWin+ or a measuring instrument to monitor the shaded items in the following block diagram.

· Rotary Servomotors

SERVOPACK CN 1 Torque feedforward Speed feedforward T-REF Speed reference Position command speed V-REF Speed Position amplifier Active gain Torque reference conversion deviation Position loop **PULS** Reference SIGN Flectronic Deviation Current pulse input Κp Load gear counter loop multiplier × ı (U/V/W External encoder speed CN2 External External Motor speed Electronic encoder gear Speed (ENC conversion Deviation Speed Deviation Motor - load Position deviation Flectronic position deviation CN31 counter conversion Positioning completion gear Completion of position reference distribution Fully closed*

- * This speed is available when fully-closed loop control is being used.
- · Linear Servomotors

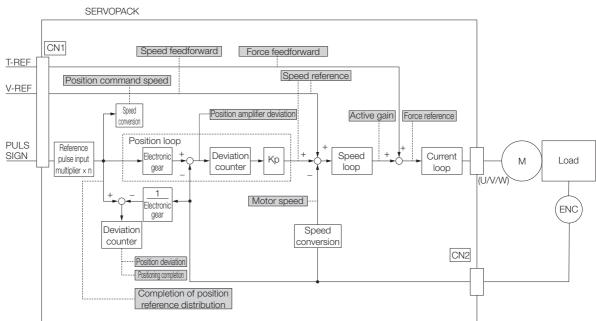

9.3.2 Using the SigmaWin+


This section describes how to trace data and I/O with the SigmaWin+.

Refer to the following manual for detailed operating procedures for the SigmaWin+.

Engineering Tool SigmaWin+ Operation Manual (Manual No.: SIET S800001 34)

Operating Procedure

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- Select Trace in the Menu Dialog Box. The Trace Dialog Box will be displayed.

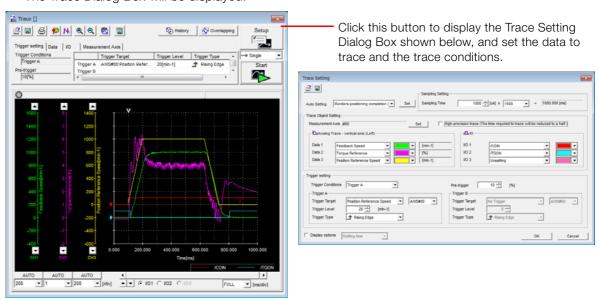

Trace Objects

You can trace the following items.

Data Tracing

Trace Objects Trace Objects Motor - Load Position Deviation Speed Feedforward Speed Feedforward Torque Feedforward Torque Feedforward Fosition Reference Speed Position Error (Deviation) Main Circuit DC Voltage External Encoder Speed

9.3.3 Using the Analog Monitors

I/O Tracing

	Trace Objects					
Input Signals	 /S-ON (Servo ON Input Signal) /P-CON (Proportional Control Input Signal) P-OT (Forward Drive Prohibit Input Signal) N-OT (Reverse Drive Prohibit Input Signal) /ALM-RST (Alarm Reset Input Signal) /P-CL (Forward External Torque/Force Limit Input Signal) /N-CL (Reverse External Torque/Force Limit Input Signal) /SPD-D (Internal Set Speed Selection Input Signal) /SPD-A (Internal Set Speed Selection Input Signal) /SPD-B (Internal Set Speed Selection Input Signal) /C-SEL (Control Selection Input Signal) /ZCLAMP (Zero Clamping Input Signal) /INHIBIT (Reference Pulse Inhibit Input Signal) /G-SEL (Gain Selection Input Signal) /P-DET (Polarity Detection Input Signal) FSTP (Forced Stop Input Signal) SEN (Absolute Data Request Input Signal) PULS (Pulse Reference Input Signal) SIGN (Sign Reference Input Signal) CLR (Position Deviation Clear Input Sig- 	Output Signals	 ALM (Servo Alarm Output Signal) /COIN (Positioning Completion Output Signal) /V-CMP (Speed Coincidence Detection Output Signal) /TGON (Rotation Detection Output Signal) /S-RDY (Servo Ready Output Signal) /CLT (Torque Limit Detection Output Signal) /VLT (Speed Limit Detection Output Signal) /WKT (Speed Limit Detection Output Signal) /BK (Brake Output Signal) /WARN (Warning Output Signal) ALO1 (Alarm Code Output Signal) ALO2 (Alarm Code Output Signal) ALO3 (Alarm Code Output Signal) PAO (Encoder Divided Pulse Output Phase A Signal) PBO (Encoder Divided Pulse Output Phase B Signal) PCO (Encoder Divided Pulse Output Phase C Signal) /PSELA (Reference Pulse Input Multiplication Switching Output Signal) 			
	nal) • /PSEL (Reference Pulse Input Multiplication Input Signal) • /HWBB1 (Hard Wire Base Block Input 1 Signal) • /HWBB2 (Hard Wire Base Block Input 2 Signal)	Internal Status	ACON (Main Circuit ON Signal) PDETCMP (Polarity Detection Completed Signal) DEN (Position Reference Distribution Completed Signal)			

9.3.3 Using the Analog Monitors

Connect a measuring instrument, such as a memory recorder, to the analog monitor connector (CN5) on the SERVOPACK to monitor analog signal waveforms. The measuring instrument is not provided by Yaskawa.

Refer to the following section for details on the connection.

4.7.3 Analog Monitor Connector (CN5) on page 4-52

Setting the Monitor Object

Use Pn006 = n.□□XX and Pn007 = n.□□XX (Analog Monitor 1 and 2 Signal Selections) to set the items to monitor.

Line Color	Signal	Parameter Setting	
White	Analog monitor 1	Pn006 = n.□□XX	
Red	Analog monitor 2	Pn007 = n.□□XX	
Black (2 lines)	GND	_	

Parameter		Description				
Par	ameter	Monitor Signal	Output Unit	Remarks		
	n.□□00 (default setting of Pn007)	Motor Speed	Rotary Servomotor: 1 V/1,000 min ⁻¹ Linear Servomotor: 1 V/1,000 mm/s	_		
	n.□□01	Speed Reference	 Rotary Servomotor:1 V/1,000 min⁻¹ Linear Servomotor:1 V/1,000 mm/s 	_		
	n.□□02 (default setting of Pn006)	Torque Reference	1 V/100% rated torque	_		
	n.□□03	Position Deviation	0.05 V/Reference unit	0 V for speed or torque control		
	n.□□04	Position Amplifier Deviation	0.05 V/encoder pulse unit	Position deviation after electronic gear conversion		
Pn006	n.□□05	Position Command Speed	Rotary Servomotor:1 V/1,000 min ⁻¹ Linear Servomotor:1 V/1,000 mm/s	The input reference pulses will be multiplied by n to output the position command speed.		
or Pn007	n.□□06	Reserved parameter (Do not change.)	-	_		
	n.□□07	Motor - Load Position Deviation	0.01 V/Reference unit	-		
	n.□□08	Positioning Completion	Positioning completed: 5 V Positioning not completed: 0 V	Completion is indicated by the output voltage.		
	n.□□09	Speed Feedforward	 Rotary Servomotor:1 V/1,000 min⁻¹ Linear Servomotor:1 V/1,000 mm/s 	_		
	n.□□0A	Torque Feedforward	1 V/100% rated torque	_		
	n.□□0B	Active Gain*	1st gain: 1 V 2nd gain: 2 V	The gain that is active is indicated by the output voltage.		
	n.□□0C	Completion of Position Reference Distribution	Distribution completed: 5 V Distribution not completed: 0 V	Completion is indicated by the output voltage.		
	n.□□0D	External Encoder Speed	1 V/1,000 min ⁻¹	Value calculated at the motor shaft		
	n.□□10	Main Circuit DC Voltage	1 V/100 V (main circuit DC voltage)	_		
* Refer to the following section for details.						

^{*} Refer to the following section for details.

**\mathbb{E} 8.12.1 \text{ Gain Switching on page 8-66}

9.3.3 Using the Analog Monitors

Changing the Monitor Factor and Offset

You can change the monitor factors and offsets for the output voltages for analog monitor 1 and analog monitor 2. The relationships to the output voltages are as follows:

Analog monitor 1 output voltage
$$= (-1) \times \left\{ \begin{array}{l} \text{Analog Monitor 1 Signal Nagnification (Pn552)}^+ & \text{Analog Monitor 1 Analog Monitor 1 Analog Monitor 1 Offset Voltage (Pn550)} \\ \text{Analog monitor 2 output voltage} = (-1) \times \left\{ \begin{array}{l} \text{Analog Monitor 2 Signal Nagnification (Pn552)}^+ & \text{Analog Monitor 2 Analog Monitor 2 Offset Voltage (Pn551)} \\ \text{Selection (Pn007 = n.} \square \square \square XX) \times \left\{ \begin{array}{l} \text{Analog Monitor 2 Analog Monitor 3 $

The following parameters are set.


	Analog Monitor 1 Offset Voltage			Speed Posi	tion Torque
Pn550	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	-10,000 to 10,000	0.1 V	0	Immediately	Setup
	Analog Monitor 2 Offset Voltage			Speed Posi:	Torque
Pn551	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	-10,000 to 10,000	0.1 V	0	Immediately	Setup
	Analog Monitor 1 M	agnification		Speed Posi:	Torque
Pn552	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	-10,000 to 10,000	×0.01	100	Immediately	Setup
	Analog Monitor 2 M	agnification		Speed Posi:	Torque
Pn553	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	-10,000 to 10,000	×0.01	100	Immediately	Setup




• Example for Setting the Item to Monitor to the Motor Speed (Pn006 = n.□□00)

When Pn552 = 100 (Setting Unit: ×0.01)

When Pn552 = 1,000 (Setting Unit: ×0.01)

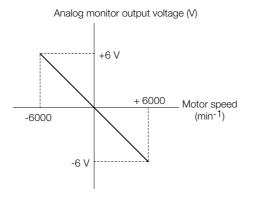

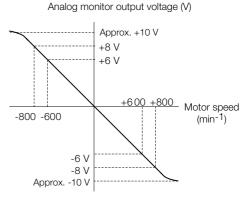

Note: The effective linearity range is ± 8 V. The resolution is 16 bits.

Adjusting the Analog Monitor Output

You can manually adjust the offset and gain for the analog monitor outputs for the torque reference monitor and motor speed monitor.


The offset is adjusted to compensate for offset in the zero point caused by output voltage drift or noise in the monitoring system.

The gain is adjusted to match the sensitivity of the measuring system.

The offset and gain are adjusted at the factory. You normally do not need to adjust them.

◆ Adjustment Example

An example of adjusting the output of the motor speed monitor is provided below.

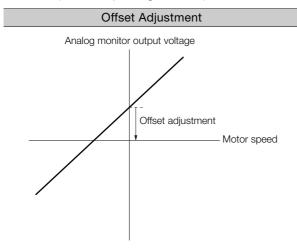

dain Adjustinent					
Analog monitor	Analog monitor output voltage				
1 [V]	Gain adjustment				
	1000 [min ⁻¹] Motor speed				

Gain Adjustment

Item	Specification
Offset Adjustment Range	-2.4 V to 2.4 V
Adjustment Unit	18.9 mV/LSB

Item	Specification
Gain Adjustment Range	100 ±50%
Adjustment Unit	0.4%/LSB

The gain adjustment range is made using a 100% output value (gain adjustment of 0) as the reference value with an adjustment range of 50% to 150%.

A setting example is given below.

- A setting example is given below.
- Setting the Adjustment Value to -125
 100 + (-125 × 0.4) = 50 [%]
 Therefore, the monitor output voltage goes to 50%
- of the original value.
 Setting the Adjustment Value to 125
 100 + (125 × 0.4) = 150 [%]
 Therefore, the monitor output voltage goes to 150%
 of the original value.

Information

- The adjustment values do not use parameters, so they will not change even if the parameter settings are initialized.
- Adjust the offset with the measuring instrument connected so that the analog monitor output value goes to zero. The following setting example achieves a zero output.
 - While power is not supplied to the Servomotor, set the monitor signal to the torque reference.
 - In speed control, set the monitor signal to the position deviation.

Preparations

Always check the following before you adjust the analog monitor output.

• The parameters must not be write prohibited.

◆ Applicable Tools

You can use the following tools to adjust analog monitor outputs.

· Offset Adjustment

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	Fn00C	3.4.11 Adjust Analog Monitor Output Offset (Fn00C) on page 13-20
Digital Operator	Fn00C	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Others - Adjust the Analog Monitor Output	

9.3.3 Using the Analog Monitors


· Gain Adjustment

Tool	Fn No./Function Name	Operating Procedure Reference
Panel Operator	Fn00D	13.4.12 Adjust Analog Monitor Output Gain (Fn00D) on page 13-20
Digital Operator	Fn00D	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Others - Adjust the Analog Monitor Output	


◆ Operating Procedure

Use the following procedure to adjust the analog monitor output.

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Adjust the Analog Monitor Output in the Menu Dialog Box. The Adjust the Analog Monitor Output Dialog Box will be displayed.
- 3. Click the Zero Adjustment or Gain Adjustment Tab.

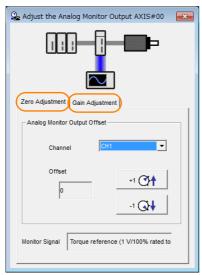

4. While watching the analog monitor, use the +1 and -1 Buttons to adjust the offset. There are two channels: CH1 and CH2. If necessary, click the down arrow on the **Channel** Box and select the channel.

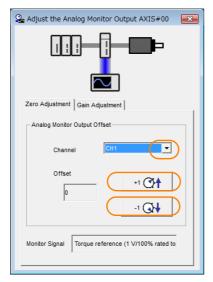

This concludes adjusting the analog monitor output.

9.4 Monitoring Product Life

9.4.1 Items That You Can Monitor


Monitor Item	Description
SERVOPACK Installation Environment	The operating status of the SERVOPACK in terms of the installation environment is displayed. Implement one or more of the following actions if the monitor value exceeds 100%. • Lower the surrounding temperature. • Decrease the load.
Servomotor Installation Environment	The operating status of the SERVOPACK in terms of the installation environment is displayed. Implement one or more of the following actions if the monitor value exceeds 100%. • Lower the surrounding temperature. • Decrease the load.
Built-in Fan Service Life Prediction	The unused status of the SERVOPACK is treated as the 100% value. The value decreases each time the main circuit power supply is turned ON and each time the servo is turned OFF. Use a monitor value of 0% as a guideline for the replacement period. Refer to the following section for part replacement guidelines. 12.1.2 Guidelines for Part Replacement on page 12-2
Capacitor Service Life Prediction	The unused status of the SERVOPACK is treated as the 100% value. The value decreases each time the main circuit power supply is turned ON and each time the servo is turned OFF. Use a monitor value of 0% as a guideline for the replacement period. Refer to the following section for part replacement guidelines. 12.1.2 Guidelines for Part Replacement on page 12-2
Surge Prevention Circuit Service Life Prediction	The unused status of the SERVOPACK is treated as the 100% value. The value decreases each time the main circuit power supply is turned ON and each time the servo is turned OFF. Use a monitor value of 0% as a guideline for the replacement period. Refer to the following section for part replacement guidelines. 12.1.2 Guidelines for Part Replacement on page 12-2
Dynamic Brake Circuit Service Life Prediction	The unused status of the SERVOPACK is treated as the 100% value. The value decreases each time the main circuit power supply is turned ON and each time the servo is turned OFF. Use a monitor value of 0% as a guideline for the replacement period. Refer to the following section for part replacement guidelines. 12.1.2 Guidelines for Part Replacement on page 12-2

9.4.2 Operating Procedure

Use the following procedure to display the installation environment and service life prediction monitor dialog boxes.

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Life Monitor in the Menu Dialog Box. The Life Monitor Dialog Box will be displayed.

Information With the Panel Operator or Digital Operator, you can use Un025 to Un02A to monitor this information.

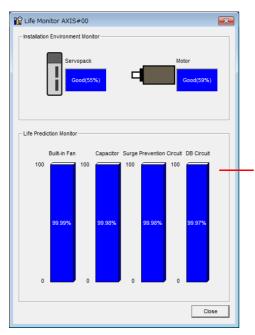

A value of 100% indicates that the SERVOPACK has not yet been used. The percentage decreases as the SERVOPACK is used and reaches 0% when it is time to replace the SERVOPACK.

9.4.3 Preventative Maintenance

You can use the following functions for preventative maintenance.

- Preventative maintenance warnings
- /PM (Preventative Maintenance Output) signal

The SERVOPACK can notify the host controller when it is time to replace any of the main parts.

Preventative Maintenance Warning

An A.9b0 warning (Preventative Maintenance Warning) is detected when any of the following service life prediction values drops to 10% or less: SERVOPACK built-in fan life, capacitor life, inrush current limiting circuit life, and dynamic brake circuit life. You can change the setting of $PnOOF = n.\Box\Box\Box\Box X$ to enable or disable these warnings.

Parameter		Description	When Enabled	Classifi- cation
Pn00F	n.□□□0 (default setting)	Do not detect preventative maintenance warnings.	After restart	Setup
	n.□□□1	Detect preventative maintenance warnings.	restart	

/PM (Preventative Maintenance Output) Signal

The /PM (Preventative Maintenance Output) signal is output when any of the following service life prediction values reaches 10% or less: SERVOPACK built-in fan life, capacitor life, inrush current limiting circuit life, and dynamic brake circuit life. The /PM (Preventative Maintenance Output) signal must be allocated.

Even if detection of preventive maintenance warnings is disabled ($Pn00F = n.\square\square\square\square0$), the /PM signal will still be output as long as it is allocated.

Classifi- cation	Signal	Connector Pin No.	Signal Status	Description
Output	/PM		ON (closed)	One of the following service life prediction values reached 10% or less: SERVOPACK built-in fan life, capacitor life, inrush current limiting circuit life, and dynamic brake circuit life.
	/PIVI	Must be allocated.	OFF (open)	All of the following service life prediction values are greater than 10%: SERVOPACK built-in fan life, capacitor life, inrush current limiting circuit life, and dynamic brake circuit life.

Note: You must allocate the /PM signal to use it. Use Pn514 = $n.\Box X\Box \Box$ (/PM (Preventative Maintenance Output) Signal Allocation) to allocate the signal to connector pins. Refer to the following section for details.

6.1.2 Output Signal Allocations on page 6-8

9.5.1 Data for Which Alarm Tracing Is Performed

Alarm Tracing

Alarm tracing records data in the SERVOPACK from before and after an alarm occurs. This data helps you to isolate the cause of the alarm.

You can display the data recorded in the SERVOPACK as a trace waveform on the SigmaWin+.

- Information
 Alarms that occur when the power supply is turned ON are not recorded.
 Alarms that occur during the recording of alarm trace data are not recorded.
 - Alarms that occur while utility functions are being executed are not recorded.
 - · Alarms that occur while the data tracing function of the SigmaWin+ is being executed are not recorded.

Data for Which Alarm Tracing Is Performed 9.5.1

Two types of data are recorded for alarm tracing: numeric data and I/O signal ON/OFF data.

Numeric Data					
Torque reference					
Feedback speed					
Reference speed					
Position reference speed					
Position deviation					
Motor-load position deviation					
Main circuit bus voltage					

ON/OFF Data						
ALM						
Servo ON command (/S-ON)						
Proportional control command (/P-CON)						
Forward torque command (/P-CL)						
Reverse torque command (/N-CL)						
G-SEL1 signal (/G-SEL1)						
ACON						

Applicable Tools 9.5.2

The following table lists the tools that you can use to perform alarm tracing.

Tool	Fn No./Function Name	Operating Procedure Reference			
Panel Operator	You cannot display alarm tracing data from the Panel Operator.				
Digital Operator	You cannot display alarm tracing data from the Digital Operator.				
SigmaWin+ Troubleshooting - Alarm Tracing		Engineering Tool SigmaWin+ Operation Manual (Manual No.: SIET S800001 34)			

Fully-Closed Loop Control

10

This chapter provides detailed information on performing fully-closed loop control with the SERVOPACK.

10.1	Fully-	Closed System10-2
10.2	SEDV.	OPACK Commissioning Procedure10-3
10.2	SERV	OFACK Commissioning Procedure 10-3
10.3	Parame	eter Settings for Fully-Closed Loop Control 10-5
	10.3.1	Control Block Diagram for Fully-Closed Loop Control
	10.3.2	Setting the Motor Direction and the Machine Movement Direction
	10.3.3	
	10.3.4	Setting the PAO, PBO, and PCO
	10.3.5	
	10.3.6	Sequence
	10.3.7	Alarm Detection Settings
	10.3.8	Analog Monitor Signal Settings 10-10
	10.3.9	Setting to Use an External Encoder
		for Speed Feedback

10.1


Fully-Closed System

With a fully-closed system, an externally installed encoder is used to detect the position of the controlled machine and the machine's position information is fed back to the SERVOPACK. High-precision positioning is possible because the actual machine position is fed back directly. With a fully-closed system, looseness or twisting of mechanical parts may cause vibration or oscillation, resulting in unstable positioning.

Refer to the following manual for details on Fully-closed Modules.

Σ-7-Series Peripheral Device Selection Manual (Manual No.: SIEP S800001 32)

The following figure shows an example of the system configuration.

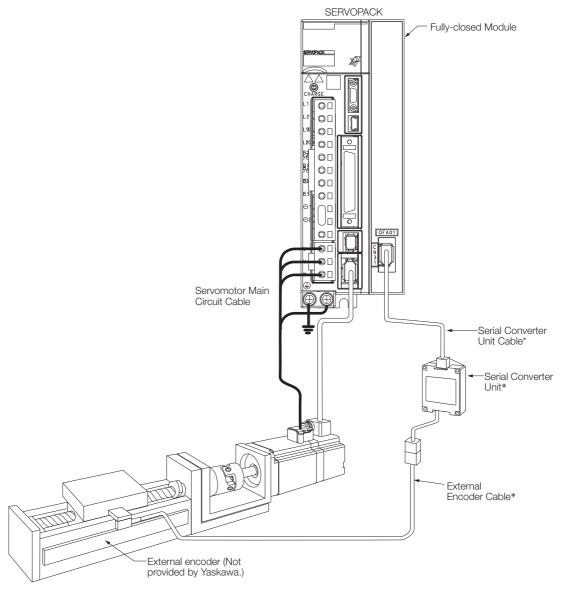

^{*} The connected devices and cables depend on the type of external linear encoder that is used.

Note: Refer to the following section for details on connections that are not shown above, such as connections to power supplies and peripheral devices.

2.4 Examples of Standard Connections between SERVOPACKs and Peripheral Devices on page 2-27

10.2 SERVOPACK Commissioning Procedure

First, confirm that the SERVOPACK operates correctly with semi-closed loop control, and then confirm that it operates correctly with fully-closed loop control.

The commissioning procedure for the SERVOPACK for fully-closed loop control is given below.

Step	Description	Operation	Required Parameter Settings	Con- trolling Device
1	Check operation of the entire sequence with semi-closed loop control and without a load. Items to Check • Power supply circuit wiring • Servomotor wiring • Wiring of I/O signal lines from the host controller • Servomotor rotation direction, motor speed, and multiturn data • Operation of safety mechanisms, such as the brakes and the overtravel mechanisms	Set the parameters so that the SERVOPACK operates correctly in semi-closed loop control without a load and check the following points. Set Pn002 to n.0□□□ to specify semi-closed loop control. • Are there any errors in the SERVOPACK? • Does jogging function correctly when you operate the SERVOPACK without a load? • Do the I/O signals turn ON and OFF correctly? • Is power supplied to the Servomotor when the /S-ON (Servo ON) signal is input? • Does the Servomotor operate correctly when a position reference is input by the host controller?	Pn000 (Basic Function Selections 0) Pn001 (Application Function Selections 1) Pn002 = n.X□□□ (External Encoder Usage) Pn20E (Electronic Gear Ratio (Numerator)) Pn210 (Electronic Gear Ratio (Denominator)) Pn50A, Pn50B, Pn511, Pn515, and Pn516 (Input Signal Selections) Pn50E, Pn50F, Pn510, Pn514, and Pn517 (Output Signal Selections)	SERVO- PACK or host con- troller
2	Check operation with the Servomotor connected to the machine with semi-closed loop control. Items to Check Initial response of the system connected to the machine Movement direction, travel distance, and movement speed as specified by the references from the host controller	Connect the Servomotor to the machine. Set the moment of inertia ratio in Pn103 using autotuning without a host reference. Check that the machine's movement direction, travel distance, and movement speed agree with the references from the host controller.	Pn103 (Moment of Inertia Ratio)	Host controller
3	Check the external encoder. Items to Check Is the signal from the external encoder received correctly?	Set the parameters related to fully-closed loop control and move the machine with your hand without turning ON the power supply to the Servomotor. Check the following status with the Panel Operator, Digital Operator, or SigmaWin+. • Does the fully-closed feedback pulse counter count up when the Servomotor moves in the forward direction? • Is the travel distance of the machine visually about the same as the amount counted by the fully-closed feedback pulse counter? Note: The unit for the fully-closed feedback pulse counter is pulses, which is equivalent to the external encoder sine wave pitch.	Pn002 = n.X□□□ (External Encoder Usage) Pn20A (Number of External Encoder Scale Pitches) Pn20E (Electronic Gear Ratio (Numerator)) Pn210 (Electronic Gear Ratio (Denominator)) Pn281 (Encoder Output Resolution) Pn51B (Motor-Load Position Deviation Overflow Detection Level) Pn522 (Positioning Completed Width) Pn52A (Multiplier per Fully-closed Rotation)	_

Continued on next page.

Continued from previous page.

Step	Description	Operation	Required Parameter Settings	Con- trolling Device
4	Perform a program jog- ging operation. Items to Check Does the fully-closed system operate correctly for the SERVOPACK without a load?	Perform a program jogging operation and confirm that the travel distance is the same as the reference value in Pn531. When you perform program jogging, start from a low speed and gradually increase the speed.	Pn530 to Pn536 (program jogging-related parameters)	SERVO- PACK
5	Operate the SERVO-PACK. Items to Check Does the fully-closed system operate correctly, including the host controller?	Input a position reference and confirm that the SERVOPACK operates correctly. Start from a low speed and gradually increase the speed.	_	Host controller


10.3 Parameter Settings for Fully-Closed Loop Control

This section describes the parameter settings that are related to fully-closed loop control.

Parameter to Set	Setting	Position Control	Speed Control	Torque Control	Reference
Pn000 = n.□□□X	Motor direction	√	√	√	2020 10 6
Pn002 = n.X□□□	External encoder usage method	√	√	√	page 10-6
Pn20A	Number of external encoder scale pitches	√	√	√	page 10-7
Pn281	Encoder divided pulse output signals (PAO, PBO, and PCO) from the SERVO-PACK	V	V	V	page 10-7
_	External absolute encoder data reception sequence	V	V	V	page 6-90
Pn20E and Pn210	Electronic gear ratio	√	_	_	page 5-46
Pn51B	Motor-load position deviation overflow detection level	V	_	_	page 10-8
Pn52A Multiplier per fully-closed rotation		√	_	_	
Pn006/Pn007	Analog monitor signal	√	√	√	page 10-10
Pn22A = n.X□□□	Speed feedback method during fully- closed loop control	V	_	_	page 10-10

10.3.1 Control Block Diagram for Fully-Closed Loop Control

The control block diagram for fully-closed loop control is provided below.

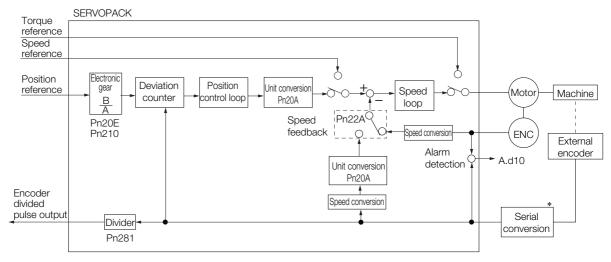

^{*} The connected device depends on the type of external encoder.

Note: You can use either an incremental or an absolute encoder. If you use an absolute encoder, set Pn002 to n.□1□□ (Use the absolute encoder as an incremental encoder).

10.3.2 Setting the Motor Direction and the Machine Movement Direction

10.3.2 Setting the Motor Direction and the Machine Movement Direction

You must set the motor direction and the machine movement direction. To perform fully-closed loop control, you must set the motor rotation direction with both $Pn000 = n.\square\square\squareX$ (Direction Selection) and $Pn002 = n.X\square\square\square$ (External Encoder Usage).

Parameter			Pn002 = n.X□□□ (External Encoder Usage)			
Faranieter		n.1□□□		n.3□□□		
Pn000 =n.□□□X (Direction Selection)		Reference direction	Forward reference	Reverse reference	Forward reference	Reverse reference
	n.□□□0	Motor direction	CCW	CW	CCW	CW
		External encoder	Forward movement	Reverse movement	Reverse movement	Forward movement
	n.□□□1	Reference direction	Forward reference	Reverse reference	Forward reference	Reverse reference
		Motor direction	CW	CCW	CW	CCW
		External encoder	Reverse movement	Forward movement	Forward movement	Reverse movement

- Phase B leads in the divided pulses for a forward reference regardless of the setting of Pn000
 = n.□□□□X.
- Forward direction: The direction in which the pulses are counted up.
- Reverse direction: The direction in which the pulses are counted down.

Related Parameters

◆ Pn000 = n.□□□X

Refer to the following section for details. 5.6 Motor Direction Setting on page 5-18

◆ Pn002 = n.X□□□

When you perform fully-closed loop control, set Pn002 to n.1 \(\sigma \sigma \) or n.3 \(\sigma \sigma \).

Parameter		Name	Meaning	When Enabled	Classification
Pn002	n.0□□□ (default setting)	External Encoder Usage	Do not use an external encoder.	After restart	Setup
	n.1□□□		External encoder moves in forward direction for CCW motor rotation.		
	n.2□□□		Reserved parameter (Do not change.)		
	n.3□□□		External encoder moves in reverse direction for CCW motor rotation.		
	n.4□□□		Reserved parameter (Do not change.)		

Information

Determine the setting of Pn002 = $n.X\square\square\square$ as described below.

- Set Pn000 to n.□□□0 (Use the direction in which the linear encoder counts up as the forward direction) and set Pn002 to n.1□□□ (The external encoder moves in the forward direction for CCW motor rotation).
- Manually rotate the motor shaft counterclockwise.
- If the fully-closed feedback pulse counter counts up, do not change the setting of Pn002 (Pn002 = n.1□□□).
- If the fully-closed feedback pulse counter counts down, set Pn002 to n.3 \(\sigma\).

10


Set the number of external encoder scale pitches per Servomotor rotation in Pn20A.

Setting Example

Specifications

External encoder scale pitch: 20 μm

Ball screw lead: 30 mm

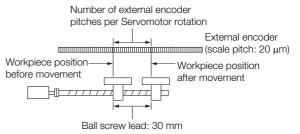

If the external encoder is connected directly to the Servomotor, the setting will be 1,500 (30 mm/0.02 mm = 1,500).

Note: 1. If there is a fraction, round off the digits below the decimal point.

2. If the number of external encoder scale pitches per Servomotor rotation is not an integer, there will be deviation in the position loop gain (Kp), feedforward, and position reference speed monitor. This is not relevant for the position loop and it therefore does not interfere with the position accuracy.

Related Parameters

	Number of Externa	l Encoder Scale Pito	Position		
Pn20A	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
1112071	4 to 1,048,576	1 scale pitch/revo- lution	32,768	After restart	Setup

10.3.4 Setting the PAO, PBO, and PCO (Encoder Divided Pulse Output) Signals

Set the position resolution in Pn281 (Encoder Output Resolution).

Enter the number of phase A and phase B edges for the setting.

Setting Example

Specifications


External encoder scale pitch: 20 µm

Ball screw lead: 30 mm Speed:1,600 mm/s

If a single pulse (multiplied by 4) is output for 1 μm, the setting would be 20.

If a single pulse (multiplied by 4) is output for 0.5 μ m, the setting would be 40.

The encoder divided pulse output would have the following waveform if the setting is 20.

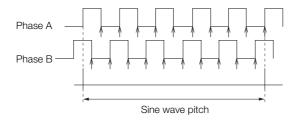

"1" indicates the edge positions. In this example, the set value is 20 and therefore the number of edges is 20.

Note: The upper limit of the encoder signal output frequency (multiplied by 4) is 6.4 Mpps. Do not set a value that would cause the output to exceed 6.4 Mpps.

If the output exceeds the upper limit, an A.511 alarm (Encoder Output Pulse Overspeed) will be output.

10.3.5 External Absolute Encoder Data Reception Sequence

Example

If the setting is 20 and the speed is 1,600 mm/s, the output frequency would be 1.6 Mpps $\frac{1600 \text{ mm/s}}{0.001 \text{ mm}} = 1,600,000 = 1.6 \text{ Mpps}$

Because 1.6 Mpps is less than 6.4 Mpps, this setting can be used.

Related Parameters

	Encoder Output Re	solution	Position		
Pn281	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	1 to 4,096	1 edge/pitch	20	After restart	Setup

Note: 1. The maximum setting for the encoder output resolution is 4,096.

If the resolution of the external encoder exceeds 4,096, pulse output will no longer be possible at the resolution given in ■ Feedback Resolution of Linear Encoder on page 5-49.

10.3.5 External Absolute Encoder Data Reception Sequence

Refer to the following section for details.

6.13.4 Reading the Position Data from the Absolute Linear Encoder on page 6-90

With fully-closed loop control, the same sequence as for a Linear Servomotor is used.

10.3.6 Electronic Gear Setting

Refer to the following section for details.

5.16 Electronic Gear Settings on page 5-46

With fully-closed loop control, the same setting as for a Linear Servomotor is used.

10.3.7 Alarm Detection Settings

This section describes the alarm detection settings (Pn51B and Pn52A).

Pn51B (Motor-Load Position Deviation Overflow Detection Level)

This setting is used to detect the difference between the feedback position of the Servomotor encoder and the feedback load position of the external encoder for fully-closed loop control. If the detected difference exceeds the setting, an A.d10 alarm (Motor-Load Position Deviation Overflow) will be output.

	Motor-Load Position	n Deviation Overflo	Position		
Pn51B	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 1,073,741,824	1 reference unit	1000	Immediately	Setup

Note: If you set this parameter to 0, A.d10 alarms will not be output and the machine may be damaged.

If the setting of Pn281 exceeds the resolution of the external encoder, the A.041 alarm (Encoder Output Pulse Setting Error) will be output.

Pn52A (Multiplier per Fully-closed Rotation)


Set the coefficient of the deviation between the Servomotor and the external encoder per Servomotor rotation. This setting can be used to prevent the Servomotor from running out of control due to damage to the external encoder or to detect belt slippage.

Setting Example

Increase the value if the belt slips or is twisted excessively.

If this parameter is set to 0, the external encoder value will be read as it is.

If you use the default setting of 20, the second rotation will start with the deviation for the first Servomotor rotation multiplied by 0.8.

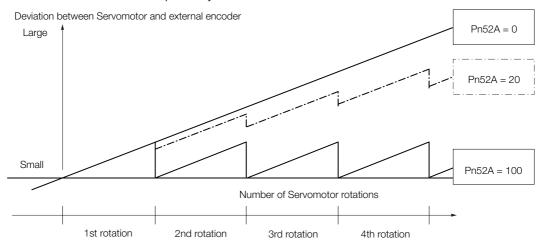

◆ Related Parameters

	Multiplier per Fully-closed Rotation			Position	
Pn52A	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0 to 100	1%	20	Immediately	Setup

10.3.8 Analog Monitor Signal Settings

10.3.8 Analog Monitor Signal Settings

You can monitor the position deviation between the Servomotor and load with an analog monitor.

F	Parameter Name		Meaning	When Enabled	Classification
Pn0	06 n.□□07	Analog Monitor 1 Signal Selection	Position deviation between motor and load (output unit: 0.01 V/reference unit).	Immedi-	Cotup
Pn0	07 n.□□07	Analog Monitor 2 Signal Selection	Position deviation between motor and load (output unit: 0.01 V/reference unit).	ately	Setup

10.3.9 Setting to Use an External Encoder for Speed Feedback

For fully-closed loop control, you normally set a parameter to specify using the motor encoder speed ($Pn22A = n.0 \square \square \square$).

If you will use a Direct Drive Servomotor and a high-resolution external encoder, set the parameter to specify using the speed of the external encoder ($Pn22A = n.1 \square \square \square$).

Parameter		Meaning	When Enabled	Classification
Pn22	n.0□□□ (default setting)	Use motor encoder speed.	After restart	Setup
	n.1□□□	Use external encoder speed.		

Note: This parameter cannot be used if Pn002 is set to n.0□□□ (Do not use external encoder).

Safety Functions

This chapter provides detailed information on the safety functions of the SERVOPACK.

11.1	Introd	uction to the Safety Functions11-3
	11.1.1 11.1.2	Safety Functions
11.2	Hard \	Wire Base Block (HWBB)11-4
		Risk Assessment
11.3	EDM1	(External Device Monitor)11-9
	11.3.1	EDM1 Output Signal Specifications 11-9
11.4	Applic	ations Examples for Safety Functions11-10
	11.4.1 11.4.2 11.4.3	Connection Example11-10Failure Detection Method11-10Procedure11-11
11.5	Valida	ting Safety Functions 11-12

11.6 Connecting a Safety Function Device ...11-13

Introduction to the Safety Functions

Safety Functions 11.1.1

Safety functions are built into the SERVOPACK to reduce the risks associated with using the machine by protecting workers from the hazards of moving machine parts and otherwise increasing the safety of machine operation.

Especially when working in hazardous areas inside guards, such as for machine maintenance, the safety function can be used to avoid hazardous moving machine parts.

Refer to the following section for information on the safety function and safety parameters. Compliance with UL Standards, EU Directives, UK Regulations, and Other Safety Standards on page xxvi



Products that display the TÜV mark on the nameplate have met the safety standards.

Precautions for Safety Functions 11.1.2

WARNING

- To confirm that the HWBB function satisfies the safety requirements of the system, you must conduct a risk assessment of the system.
 - Incorrect use of the safety function may cause injury.
- The Servomotor will move if there is an external force (e.g., gravity on a vertical axis) even when the HWBB function is operating. Use a separate means, such as a mechanical brake, that satisfies the safety requirements.
 - Incorrect use of the safety function may cause injury.
- While the HWBB function is operating, the Servomotor may move within an electric angle of 180° or less as a result of a SERVOPACK failure. Use the HWBB function for an application only after confirming that movement of the Servomotor will not result in a hazardous condi-
 - Incorrect use of the safety function may cause injury.
- The dynamic brake and the brake signal are not safety-related elements. You must design the system so that SERVOPACK failures will not cause a hazardous condition while the HWBB function is operating.
 - Incorrect use of the safety function may cause injury.
- Connect devices that satisfy the safety standards for the signals for safety functions. Incorrect use of the safety function may cause injury.
- The HWBB function does not shut OFF the power to the SERVOPACK or electrically isolate it. Implement measures to shut OFF the power supply to the SERVOPACK before you perform maintenance on it.
 - There is a risk of electric shock.

11.2.1 Risk Assessment

11.2

Hard Wire Base Block (HWBB)

A hard wire base block (abbreviated as HWBB) is a safety function that is designed to shut OFF the current to the Servomotor with a hardwired circuit.

The drive signals to the Power Module that controls the motor current are controlled by the circuits that are independently connected to the two input signal channels to turn OFF the Power Module and shut OFF the motor current.



For safety function signal connections, the input signal is the 0-V common and the output signal is a source output.


This is opposite to other signals described in this manual.

To avoid confusion, the ON and OFF status of signals for the safety function are defined as follows:

ON: The state in which the relay contacts are closed or the transistor is ON and current flows into the signal line.

OFF: The state in which the relay contacts are open or the transistor is OFF and no current flows into the signal line.

The input signal uses the 0-V common. The following figure shows a connection example.

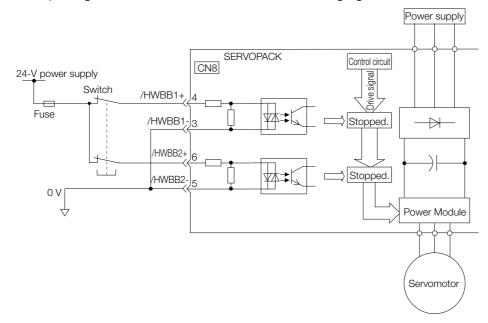

11.2.1 Risk Assessment

When using the HWBB, you must perform a risk assessment of the servo system in advance to confirm that the safety level of the standards is satisfied. Refer to the following section for details on the standards.

Compliance with UL Standards, EU Directives, UK Regulations, and Other Safety Standards on page xxvi

Note: To meet performance level e (PLe) in EN ISO 13849-1 and SIL3 in IEC 61508, the EDM1 signal must be monitored by the host controller. If the EDM1 signal is not monitored by the host controller, the level will be safety performance level c (PLc) and SIL1.


The following hazards exist even when the HWBB is operating. These hazards must be included in the risk assessment.

 The Servomotor will move if an external force is applied to it (for example, gravity on a vertical axis). Implement measures to hold the Servomotor, such as installing a separate mechanical brake.

- If a failure occurs such as a Power Module failure, the Servomotor may move within an electric angle of 180°. Ensure safety even if the Servomotor moves.
 - The rotational angle or travel distance depends on the type of Servomotor as follows:
 - Rotary Servomotor: 1/6 rotation max. (rotational angle calculated at the motor shaft)
 - Direct Drive Servomotor: 1/20 rotation max. (rotational angle calculated at the motor shaft)
 - · Linear Servomotor: 50 mm max.
- The HWBB does not shut OFF the power to the SERVOPACK or electrically isolate it. Implement measures to shut OFF the power supply to the SERVOPACK before you perform maintenance on it.


11.2.2 Hard Wire Base Block (HWBB) State

The SERVOPACK will be in the following state if the HWBB operates. If the /HWBB1 or /HWBB2 signal turns OFF, the HWBB will operate and the SERVOPACK will enter a HWBB state.

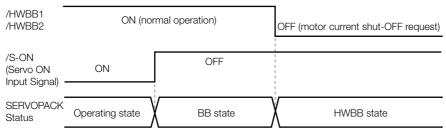


11.2.3 Resetting the HWBB State

Normally, after the /S-ON (Servo ON) signal is turned OFF and power is no longer supplied to the Servomotor, the /HWBB1 and /HWBB2 signals will turn OFF and the SERVOPACK will enter the HWBB state. If you turn ON the /HWBB1 and /HWBB2 signals in this state, the SERVOPACK will enter a base block (BB) state and will be ready to acknowledge the /S-ON signal.

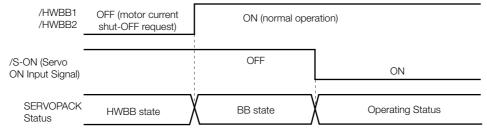

If the /HWBB1 and /HWBB2 signals are OFF and the /S-ON (Servo ON Input) signal is input, the HWBB state will be maintained even after the /HWBB1 and /HWBB2 signals are turned ON. Turn OFF the /S-ON signal to place the SERVOPACK in the BB state and then turn ON the /S-ON signal again.

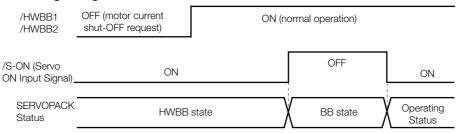

- Note: 1. If the SERVOPACK is placed in the BB state while the main circuit power supply is OFF, the HWBB state will be maintained until the /S-ON (Servo ON) signal is turned OFF.
 - 2. If the /S-ON (Servo ON) signal is set to be always active (Pn50A = n.□□7□), you cannot reset the HWBB state.

Do not set this value if you are using the HWBB.

11.2.4 Detecting Errors in HWBB Signal

11.2.4 Detecting Errors in HWBB Signal


If only the /HWBB1 or the /HWBB2 signal is input, an A.Eb1 alarm (Safety Function Signal Input Timing Error) will occur unless the other signal is input within 10 seconds. This makes it possible to detect failures, such as disconnection of an HWBB signal.

M CAUTION

The A.Eb1 alarm (Safety Function Signal Input Timing Error) is not a safety-related element.
 Keep this in mind when you design the system.

11.2.5 HWBB Input Signal Specifications

If an HWBB is requested by turning OFF the two HWBB input signal channels (/HWBB1 and / HWBB2), the power supply to the Servomotor will be turned OFF within 8 ms.

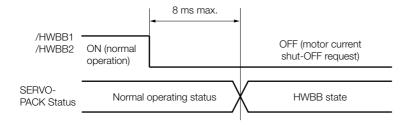


Note: 1. The OFF status is not recognized if the OFF interval of the /HWBB1 or /HWBB2 signal is 0.5 ms or shorter.

2. You can check the status of the input signals by using monitor displays.

11.2.6 Operation without a Host Controller

The HWBB will operate even for operation without a host controller.


However, if the HWBB operates during execution of the following functions, leave the execution mode for the function and then enter it again to restart operation. Operation will not be restarted simply by turning OFF the /HWBB1 and /HWBB2 signals.

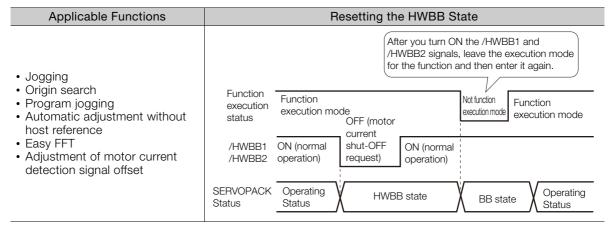

11.2.7 /S-RDY (Servo Ready Output) Signal

The /S-ON (Servo ON) signal will not be acknowledged in the HWBB state. Therefore, the Servo Ready Output Signal will turn OFF. The Servo Ready Output Signal will turn ON if both the /HWBB1 and /HWBB2 signals are ON and the /S-ON signal is turned OFF (BB state).

An example is provided below for when the main circuit power supply is ON and the SEN signal turns ON when there is no servo alarm. (An absolute encoder is used in this example.)

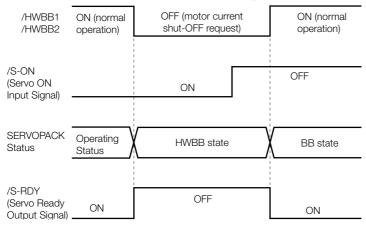

11.2.8 /BK (Brake Output) Signal

If the HWBB operates when the /HWBB1 or /HWBB2 signal is OFF, the /BK (Brake) signal will turn OFF. At that time, the setting in Pn506 (Brake Reference - Servo OFF Delay Time) will be disabled. Therefore, the Servomotor may be moved by external force until the actual brake becomes effective after the /BK signal turns OFF.

CAUTION

• The brake signal is not a safety-related element. You must design the system so that a hazardous condition does not occur even if the brake signal fails in the HWBB state. Also, if a Servomotor with a Brake is used, keep in mind that the brake in the Servomotor is used only to prevent the moving part from being moved by gravity or an external force and it cannot be used to stop the Servomotor.

11.2.9 Stopping Methods

If the /HWBB1 or /HWBB2 signal turns OFF and the HWBB operates, the Servomotor will stop according to the stop mode that is set for stopping the Servomotor when the servo turns OFF (Pn001 = $n.\Box\Box\Box\Box$ X). However, if the dynamic brake is enabled (Pn001 = $n.\Box\Box\Box\Box$ 0 or $n.\Box\Box\Box\Box$ 1), observe the following precautions.

⚠ CAUTION

- The dynamic brake is not a safety-related element. You must design the system so that a
 hazardous condition does not occur even if the Servomotor coasts to a stop in the HWBB
 state. Normally, we recommend that you use a sequence that returns to the HWBB state
 after stopping for a reference.
- If the application frequently uses the HWBB, stopping with the dynamic brake may result in the deterioration of elements in the SERVOPACK. To prevent internal elements from deteriorating, use a sequence in which the HWBB state is returned to after the Servomotor has come to a stop.

11.2.10 Settings to Clear the Position Deviation

11.2.10 Settings to Clear the Position Deviation

A position deviation in the HWBB state is cleared according to the setting of $Pn200 = n.\Box X\Box \Box$ (Clear Operation). If you specify not clearing the position deviation during position control ($Pn200 = n.\Box 1\Box \Box$), the position deviation will accumulate unless the position reference from the host controller is canceled in the HWBB state. The following conditions may result.

- An A.d00 alarm (Position Deviation Overflow) may occur.
- If you turn ON the servo after changing from HWBB state to BB state, the Servomotor may move for the accumulated position deviation.

Therefore, stop the position reference from the host controller while in the HWBB state. If you specify not clearing the position deviation during position control ($Pn200 = n.\Box 1\Box\Box$), input the CLR (Position Deviation Clear) signal during the HWBB or BB state to clear the position deviation.

11.2.11 ALM (Servo Alarm) Signal and ALO1, ALO2, and ALO3 (Alarm Code Output) Signals

The ALM (Servo Alarm) signal is not output in the HWBB state. The ALO1, ALO2, and ALO3 (Alarm Code Output) signals are not output in the HWBB state.

11.3 EDM1 (External Device Monitor)

The EDM1 (External Device Monitor) signal is used to monitor failures in the HWBB. Connect the monitor signal as a feedback signal, e.g., to the Safety Unit.

Note: To meet performance level e (PLe) in EN ISO 13849-1 and SIL3 in IEC 61508, the EDM1 signal must be monitored by the host controller. If the EDM1 signal is not monitored by the host controller, the level will be safety performance level c (PLc) and SIL1.

Failure Detection Signal for EDM1 Signal

The relationship between the EDM1, /HWBB1, and /HWBB2 signals is shown below.

Detection of failures in the EDM1 signal circuit can be achieved by using the status of the /HWBB1, /HWBB2, and EDM1 signals in the following table. A failure can be detected by checking the failure status, e.g., when the power supply is turned ON.


Signal	Logic			
/HWBB1	ON	ON	OFF	OFF
/HWBB2	ON	OFF	ON	OFF
EDM1	OFF	OFF	OFF	ON

MARNING

• The EDM1 signal is not a safety output. Use it only for monitoring for failures.

11.3.1 EDM1 Output Signal Specifications

If an HWBB is requested by turning OFF the two HWBB input signal channels (/HWBB1 and /HWBB2) when the safety function is operating normally, the EDM1 output signal will be turned ON within 8 ms.

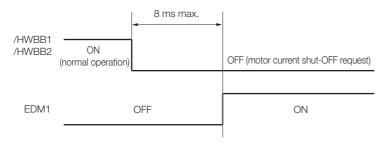

11.4.1 Connection Example


11.4

Applications Examples for Safety Functions

This section provides examples of using the safety functions.

11.4.1 Connection Example

In the following example, a Safety Unit is used and the HWBB operates when the guard is opened.

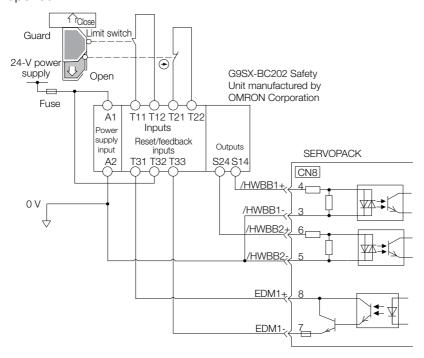


When the guard is opened, both the /HWBB1 and the /HWBB2 signals turn OFF, and the EDM1 signal turns ON. Because the feedback circuit is ON while the guard is closed, the Safety Unit is reset, the /HWBB1 and the / HWBB2 signals turn ON, and the operation is enabled.

Note: The EDM1 signal is used as a source output. Connect the EDM1 so that the current flows from EMD1+ to EMD1-.

11.4.2 Failure Detection Method

If a failure occurs (e.g., the /HWBB1 or the /HWBB2 signal remains ON), the Safety Unit is not reset when the guard is closed because the EDM1 signal remains OFF. Therefore starting is not possible and a failure is detected.

In this case the following must be considered: an error in the external device, disconnection of the external wiring, short-circuiting in the external wiring, or a failure in the SERVOPACK. Find the cause and correct the problem.

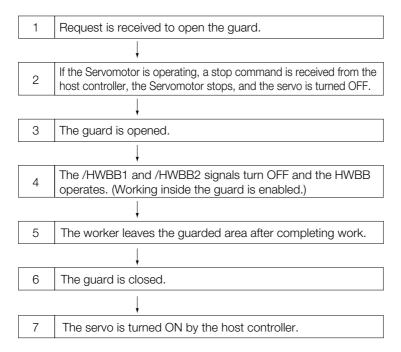

11.5 Validating Safety Functions

When you commission the system or perform maintenance or SERVOPACK replacement, you must always perform the following validation test on the HWBB function after completing the wiring. (It is recommended that you keep the confirmation results as a record.)

- When the /HWBB1 and /HWBB2 signals turn OFF, confirm that the Panel Operator or Digital Operator displays **Hbb** and that the Servomotor does not operate.
- Monitor the ON/OFF status of the /HWBB1 and /HWBB2 signals.
 If the ON/OFF status of the signals do not coincide with the display, the following must be considered: an error in the external device, disconnection of the external wiring, short-circuiting in the external wiring, or a failure in the SERVOPACK. Find the cause and correct the problem.


Refer to the following sections for details on the monitor.

- 13.3.4 Safety Input Signal Monitor (Un015) on page 13-10
- Confirm that the EDM1 signal is OFF while in normal operation by using the feedback circuit input display of the connected device.

11.6 Connecting a Safety Function Device

Use the following procedure to connect a safety function device.

1. Remove the Safety Jumper Connector from the connector for the safety function device (CN8).

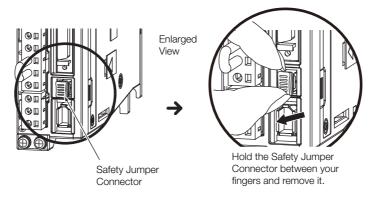

2. Connect the safety function device to the connector for the safety function device (CN8).

Note: If you do not connect a safety function device, leave the Safety Jumper Connector connected to the connector for the safety function device (CN8). If the SERVOPACK is used without the Safety Jumper Connector connected to CN8, no current will be supplied to the Servomotor and no motor torque will be output. In this case, **Hbb** will be displayed on the Digital Operator.

Maintenance

This chapter provides information on the meaning of, causes of, and corrections for alarms and warnings.

12.1	Inspe	ctions and Part Replacement 12-2
	12.1.1 12.1.2 12.1.3	Inspections
12.2	Alarm	Displays12-5
	12.2.1 12.2.2 12.2.3 12.2.4 12.2.5 12.2.6	List of Alarms
12.3	Warni	ng Displays 12-48
	12.3.1 12.3.2	List of Warnings
12.4	Troublesho	poting Based on the Operation and Conditions of the Servomotor 12-56

12.1.1 Inspections

12.1

Inspections and Part Replacement

This section describes inspections and part replacement for SERVOPACKs.

12.1.1 Inspections

Perform the inspections given in the following table at least once every year for the SERVO-PACK. Daily inspections are not required.

Item	Frequency	Inspection	Correction
Exterior	At least once a	Check for dust, dirt, and oil on the surfaces.	Clean with compressed air or a cloth.
Loose Screws	At least once a year	Check for loose terminal block and connector screws and for other loose parts.	Tighten any loose screws or other loose parts.

12.1.2 Guidelines for Part Replacement

The following electric or electronic parts are subject to mechanical wear or deterioration over time. Use one of the following methods to check the standard replacement period.

- Use the service life prediction function of the SERVOPACK.
 Refer to the following section for information on service life predictions.
 9.4 Monitoring Product Life on page 9-15
- Use the following table.

Part	Standard Replacement Period	Remarks
Cooling Fan	4 years to 5 years	The standard replacement periods given on the left are for
Electrolytic Capacitor	10 years	 the following operating conditions. Surrounding air temperature: Annual average of 30°C Load factor: 80% max. Operation rate: 20 hours/day max.
Relays	100,000 power ON operations	Power ON frequency: Once an hour
Battery	3 years without power supplied	Surrounding temperature without power supplied: 20°C

When any standard replacement period is close to expiring, contact your Yaskawa representative. After an examination of the part in question, we will determine whether the part should be replaced.



The parameters of any SERVOPACKs that are sent to Yaskawa for part replacement are reset to the factory settings before they are returned to you. Always keep a record of the parameter settings. And, always confirm that the parameters are properly set before starting operation.

12.1.3 Replacing the Battery

If the battery voltage drops to approximately 2.7 V or less, an A.830 alarm (Encoder Battery Alarm) or an A.930 warning (Absolute Encoder Battery Error) will be displayed.

If this alarm or warning is displayed, the battery must be replaced.

Refer to the following section for the battery replacement procedure.

Battery Replacement Procedure on page 12-3

Battery Alarm/Warning Selection

Whether to display an alarm or a warning is determined by the setting of $Pn008 = n.\Box\Box\Box X$ (Low Battery Voltage Alarm/Warning Selection).


Parameter		Meaning	When Enabled	Classification
Pn008	n.□□□0 (default setting)	Output alarm (A.830) for low battery voltage.	After restart	Setup
	n.□□□1	Output warning (A.930) for low battery voltage.		

• $Pn008 = n.\Box\Box\Box0$

The ALM (Servo Alarm) signal is output for up to five seconds when the control power supply is turned ON, and then the battery voltage is monitored for four seconds. No alarm will be displayed even if the battery voltage drops below the specified value after

these four seconds. • $Pn008 = n.\square\square\square\square$ 1

The ALM (Servo Alarm) signal is output for up to five seconds when the control power supply is turned ON, and then the battery voltage is monitored continuously.

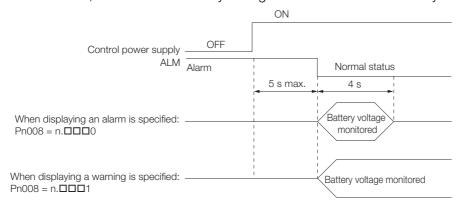

Battery Replacement Procedure

- When Installing a Battery on the Host Controller
- 1. Turn ON only the control power supply to the SERVOPACK.
- 2. Remove the old battery and mount a new battery.
- **3.** Turn OFF the control power supply to the SERVOPACK to clear the A.830 alarm (Encoder Battery Alarm).
- 4. Turn ON the control power supply to the SERVOPACK again.
- 5. Make sure that the alarm has been cleared and that the SERVOPACK operates normally.

12.1.3 Replacing the Battery


◆ When Using an Encoder Cable with a Battery Case

1. Turn ON only the control power supply to the SERVOPACK.




If you remove the Battery or disconnect the Encoder Cable while the control power supply to the SERVOPACK is OFF, the absolute encoder data will be lost.


2. Open the cover of the Battery Case.

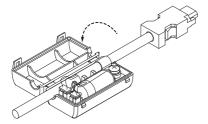

3. Remove the old Battery and mount a new Battery.

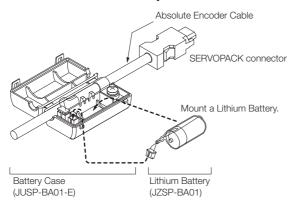

4. Close the cover of the Battery Case.

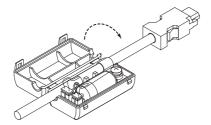

- 5. Turn OFF the power supply to the SERVOPACK to clear the A.830 alarm (Encoder Battery Alarm).
- 6. Turn ON the power supply to the SERVOPACK.
- 7. Make sure that the alarm has been cleared and that the SERVOPACK operates normally.

Maintenanc

12.2 A

Alarm Displays

If an error occurs in the SERVOPACK, an alarm number will be displayed on the panel display. However, if only "-" appears on the panel display, this indicates a SERVOPACK system error. Replace the SERVOPACK.



This section provides a list of the alarms that may occur and the causes of and corrections for those alarms.

12.2.1 List of Alarms

The list of alarms gives the alarm name, alarm meaning, alarm stopping method, alarm reset possibility, and alarm code output in order of the alarm numbers.

Servomotor Stopping Method for Alarms

Refer to the following section for information on the stopping method for alarms.

5.14.2 Servomotor Stopping Method for Alarms on page 5-42

Alarm Reset Possibility

Yes: You can use an alarm reset to clear the alarm. However, this assumes that the cause of the alarm has been removed.

No: You cannot clear the alarm.

List of Alarms

Alarm			Servo- motor	Alarm Reset	ו ו	rm Co Output	t .
Number	Alarm Name	Alarm Meaning	Stop- ping Method	Possi- ble?	ALO1	ALO2	ALO3
A.020	Parameter Checksum Error	There is an error in the parameter data in the SERVOPACK.	Gr.1	No	Н	Н	Н
A.021	Parameter Format Error	There is an error in the parameter data format in the SERVOPACK.	Gr.1	No	Н	Н	Н
A.022	System Checksum Error	There is an error in the parameter data in the SERVOPACK.	Gr.1	No	Н	Н	Н
A.024	System Alarm	An internal program error occurred in the SERVO-PACK.	Gr.1	No	Н	Н	Н
A.025	System Alarm	An internal program error occurred in the SERVO-PACK.	Gr.1	No	Н	Н	Н
A.030	Main Circuit Detector Error	There is an error in the detection data for the main circuit.	Gr.1	Yes	Н	Н	Н
A.040	Parameter Setting Error	A parameter setting is outside of the setting range.	Gr.1	No	Н	Н	Н

12.2.1 List of Alarms

Continued from previous page.

			Servo-	ntinued from Alarm	Ala	ırm Co	ode
Alarm Number	Alarm Name	Alarm Meaning	motor Stop- ping Method	Reset Possi- ble?		Outpu ⁻ ALO2	ALO3
A.041	Encoder Output Pulse Setting Error	The setting of Pn212 (Number of Encoder Output Pulses) or Pn281 (Encoder Output Resolution) is outside of the setting range or does not satisfy the setting conditions.	Gr.1	No	Н	Н	Н
A.042	Parameter Combination Error	The combination of some parameters exceeds the setting range.	Gr.1	No	Н	Н	Н
A.044	Semi-Closed/Fully-Closed Loop Control Parameter Setting Error	The settings of the Option Module and Pn002 = n.X□□□ (External Encoder Usage) do not match.	Gr.1	No	Н	Н	Н
A.050	Combination Error	The capacities of the SERVOPACK and Servomotor do not match.	Gr.1	Yes	Н	Н	Н
A.051	Unsupported Device Alarm	An unsupported device was connected.	Gr.1	No	Н	Н	Н
A.070	Motor Type Change Detected	The connected motor is a different type of motor from the previously connected motor.	Gr.1	No	Н	Н	Н
A.080	Linear Encoder Pitch Setting Error	The setting of Pn282 (Linear Encoder Scale Pitch) has not been changed from the default setting.	Gr.1	No	Н	Н	Н
A.0b0	Invalid Servo ON Command Alarm	The /S-ON (Servo ON) signal was input from the host controller after a utility function that turns ON the Servomotor was executed.	Gr.1	Yes	Н	Н	Н
A.100	Overcurrent Detected	An overcurrent flowed through the power transistor or the heat sink overheated.	Gr.1	No	L	Н	Н
A.101	Motor Overcurrent Detected	The current to the motor exceeded the allowable current.	Gr.1	No	L	Н	Н
A.300	Regeneration Error	There is an error related to regeneration.	Gr.1	Yes	L	L	Н
A.320	Regenerative Overload	A regenerative overload occurred.	Gr.2	Yes	L	L	Н
A.330	Main Circuit Power Supply Wiring Error	The AC power supply input setting or DC power supply input setting is not correct. The power supply wiring is not correct.	Gr.1	Yes	L	L	Н
A.400	Overvoltage	The main circuit DC voltage is too high.	Gr.1	Yes	Н	Н	L
A.410	Undervoltage	The main circuit DC voltage is too low.	Gr.2	Yes	Н	Н	L
A.510	Overspeed	The motor exceeded the maximum speed.	Gr.1	Yes	L	Н	L

Continued from previous page.

Alarm			Servo- motor	Alarm Reset	Alarm Code Output		
Number	Alarm Name	Alarm Meaning	Stop- ping Method	Possi- ble?	ALO1	ALO2	ALO3
A.511	Encoder Output Pulse Overspeed	Rotary Servomotor: The pulse output speed for the setting of Pn212 (Number of Encoder Output Pulses) was exceeded. Linear Servomotor: The motor speed upper limit for the setting of Pn281 (Encoder Output Resolution) was exceeded.	Gr.1	Yes	L	Н	L
A.520	Vibration Alarm	Abnormal oscillation was detected in the motor speed.	Gr.1	Yes	L	Н	L
A.521	Autotuning Alarm	Vibration was detected during autotuning for the tuning-less function.	Gr.1	Yes	L	Н	L
A.550	Maximum Speed Setting Error	The setting of Pn385 (Maximum Motor Speed) is greater than the maximum motor speed.	Gr.1	Yes	L	Н	L
A.710	Instantaneous Overload	The Servomotor was operating for several seconds to several tens of seconds under a torque that largely exceeded the rating.	Gr.2	Yes	L	L	L
A.720	Continuous Overload	The Servomotor was operating continuously under a torque that exceeded the rating.	Gr.1	Yes	L	L	L
A.730 A.731	-Dynamic Brake Overload	When the dynamic brake was applied, the rotational or linear kinetic energy exceeded the capacity of the dynamic brake resistor.	Gr.1	Yes	L	L	L
A.740	Inrush Current Limiting Resistor Overload	The main circuit power supply was frequently turned ON and OFF.	Gr.1	Yes	L	L	L
A.7A1	Internal Temperature Error 1 (Control Board Temperature Error)	The surrounding temperature of the control PCB is abnormal.	Gr.2	Yes	L	L	L
A.7A2	Internal Temperature Error 2 (Power Board Temperature Error)	The surrounding temperature of the power PCB is abnormal.	Gr.2	Yes	L	L	L
A.7A3	Internal Temperature Sensor Error	An error occurred in the temperature sensor circuit.	Gr.2	No	L	L	L
A.7Ab	SERVOPACK Built-in Fan Stopped	The fan inside the SERVO-PACK stopped.	Gr.1	Yes	L	L	L
A.810	Encoder Backup Alarm	The power supplies to the encoder all failed and the position data was lost.	Gr.1	No	Н	Н	Н
A.820	Encoder Checksum Alarm	There is an error in the checksum results for encoder memory.	Gr.1	No	Н	Н	Н
A.830	Encoder Battery Alarm	The battery voltage was lower than the specified level after the control power supply was turned ON.	Gr.1	Yes	Н	Н	Н

12.2.1 List of Alarms

Continued from previous page.

Alarm Name Alarm Meaning Alarm Mea				Servo-	ntinued fr		evious arm Co	
A.840 Encoder Data Alarm There is an internal data error in the encoder. Gr.1 No H H H A.850 Encoder Overspeed The encoder was operating at high speed when the power was turned ON. Gr.1 No H H H A.860 Encoder Overheated The internal temperature of the rotary encoder or linear encoder is too high. A.861 Motor Overheated The internal temperature of motor is too high. Gr.1 No H H H A.861 Motor Overheated The internal temperature of motor is too high. The internal temperature of motor is too high. Gr.1 No H H H A.862 Overheat Alarm The internal temperature of motor is too high. Gr.1 No H H H A.863 Encoder Scale Error A failure occurred in the linear encoder. Gr.1 No H H H A.864 External Encoder Error A failure occurred in the linear encoder. Gr.1 No H H H A.865 External Encoder Error A failure occurred in the linear encoder. Gr.1 No H H H A.866 External Encoder Error A failure occurred in the linear encoder. Gr.1 Yes H H A.867 External Encoder Module Error A failure occurred in the linear encoder. Gr.1 Yes H H A.868 External Encoder Module Error A failure occurred in the linear encoder. Gr.1 Yes H H A.869 External Encoder Module Error A failure occurred in the external incremental A failure occurred in the set Gr.1 Yes H H A.860 External Encoder Module Error A failure occurred in the external incoder. Gr.1 Yes H H A.861 External Encoder Module Error A failure occurred in the external encoder. Gr.1 Yes H H A.862 External Encoder An error occurred in the external encoder. An error occurred in the A/D con	Alarm	Aleman Nama	Alouse Many in a		Alarm Reset			
A 850 Encoder Data Alarm In the encoder. The encoder was operating at high speed when the power was turned ON. A 860 Encoder Overspeed A 860 Encoder Overheated The internal temperature of the rotary encoder or linear encoder is too high. A 861 Motor Overheated The internal temperature of motor is too high. A 862 Overheat Alarm The internal temperature of motor is too high. A 862 Overheat Alarm The internal temperature of motor is too high. A 863 Encoder Scale Error A 864 A 865 External Encoder Error A 866 External Encoder Error A 867 External Encoder Module Error encoder. A 868 External Encoder Module Error A 869 External Encoder Module Error A 860 External Encoder Module Error A 861 External Encoder Module Error external encoder. A 862 External Encoder Module Error external encoder. A 863 External Encoder Module Error external encoder. A 864 External Encoder Module Error external encoder. A 865 External Encoder Module Error external encoder. A 866 External Encoder Module Error external encoder. A 867 External Encoder Module external encoder. A 868 External Encoder Sensor Error external encoder. A 869 External Encoder Sensor Error external encoder. A 860 External Encoder Overspeed in the external encoder. A 861 External Encoder Overspeed A 862 External Encoder Overspeed A 863 External Encoder Overspeed A 864 External Encoder Overspeed A 865 External Encoder Overspeed A 866 External Encoder Overspeed A 867 External Encoder Overspeed A 868 External Encoder Overspeed A 868 External Encoder Overspeed A 869 External Encoder Overspeed A 860 External Encoder	Number	Alarm Name	Alarm Meaning	ping		ALO1	ALO2	ALO3
A.860 Encoder Overspeed power was turned ON. A.861 Motor Overheated The internal temperature of the rotary encoder or linear encoder is too high. A.862 Overheat Alarm The internal temperature of the rotary encoder or linear encoder. A.862 Overheat Alarm The internal temperature of the rotary encoder or linear encoder. A.863 Overheat Alarm The internal temperature of motor is too high. A.864 Overheat Alarm The internal temperature of motor is too high. A.865 Overheat Alarm The internal temperature of motor is too high. A.866 Overheat Alarm The internal temperature of motor is too high. A.867 Encoder Scale Error Alarm The input (7H1) signal exceeded the setting of Pn61B (Overheat Alarm Level). A.868 Encoder Module Error An error occurred in the linear encoder. A.869 External Encoder Error An error occurred in the Error External Encoder Module Error External Incremental Encoder Module Error External Incremental Encoder Sensor Error External encoder. A.860 External Absolute Encoder Position Error External encoder. A.861 External Absolute Encoder Position Error External encoder. A.862 External Encoder Overspeed in the external encoder. A.863 External Encoder Overspeed in the external encoder. A.864 External Encoder Overspeed in the external encoder. A.865 External Encoder Overspeed in the external encoder. A.866 External Encoder Overspeed in the external encoder. A.867 External Encoder Overspeed in the external encoder. A.868 External Encoder Overspeed From the external encoder. A.869 External Encoder Overspeed From the external encoder. A.870 External Encoder Overspeed From the external encoder. A.871 Yes H H H H H H H H H H H H H H H H H H H	A.840	Encoder Data Alarm		Gr.1	No	Н	Н	Н
A.861 Motor Overheated the rotary encoder or linear encoder is too high. A.861 Motor Overheated The internal temperature of motor is too high. A.862 Overheat Alarm External Encoder Scale Error A failure occurred in the linear encoder. An error occurred in the linear encoder. An error occurred in the linear encoder. An error occurred in the linear encoder. A.864 External Encoder Error A.865 External Encoder Module Error external encoder. A.866 External Incremental Encoder Encoder External Encoder Encoder external encoder. A.865 External Absolute Encoder Position Error A.866 External Encoder Overspeed A.866 External Encoder Overspeed A.866 External Encoder Overspeed A.867 External Encoder Overspeed A.868 External Encoder Overspeed A.869 External Encoder Overspeed A.860 External Encoder Overspeed A.860 External Encoder Overspeed A.860 External Encoder Overspeed A.860 External Encoder Overspeed An overspeed error occurred in the position data of the external encoder. A.860 External Encoder Overspeed in the external encoder. A.861 External Encoder Overspeed error occurred in the external encoder. A.862 External Encoder Overspeed in the external encoder. A.863 External Encoder Overspeed error occurred in the external encoder. A.864 External Encoder Overspeed error occurred in the external encoder. A.865 External Encoder Overspeed An overheating error occurred in the A/D conversion data for the speed reference input. A.866 External Encoder Overspeed error occurred in the External encoder. A.867 External Encoder Overspeed error occurred in the External encoder. A.868 External Encoder Overspeed error occurred in the External encoder. A.869 External Encoder Overspeed error occurred in the External encoder.	A.850	Encoder Overspeed	at high speed when the	Gr.1	No	Н	Н	Н
A.862 Overheat Alarm The input voltage (temperature) for the overheat protection input (TIH) signal exceeded the setting of Pn61B (Overheat Alarm Leve)). A.890 Encoder Scale Error A failure occurred in the linear encoder. A.891 Encoder Module Error A failure occurred in the linear encoder. A.802 External Encoder Error An error occurred in the server of the Error An error occurred in the server of the Error A.804 External Encoder Module Error An error occurred in the server of the Error A.805 External Incremental Encoder Module Error A.806 External Incremental Encoder Overheated External Absolute Encoder An error occurred in the external encoder. An external Encoder Overspeed in the external encoder. An overspeed error occurred in the AID converter for the speed reference input. A.806 External Encoder Overheated An overheating error occurred in the AID converter for the speed reference input. A.807 Speed Reference AID Error An error occurred in the AID converter for the speed reference input. A.808 Torque Reference AID Error An error occurred in the AID converter for the torque reference input. A.809 Torque Reference AID Error An error occurred in the Current in the AID converter for the torque reference input. A.809 Torque Reference AID Error An error occurred in the AID converter for the torque reference input. A.809 Torque Reference AID Error An error occurred in the Current in the Error An error occurred in the Error An error occurred in the Error An error occurred in the SERVO- PACK. Internal program error 1 occurred in the SERVO- PACK. Internal program error 1 occurred	A.860	Encoder Overheated	the rotary encoder or linear	Gr.1	No	Н	Н	Н
A.862 Overheat Alarm turel for the overheat protection input (TIP) signal exceeded the setting of Pn61B (Overheat Alarm Lovel). A.890 Encoder Scale Error A failure occurred in the linear encoder. A.891 Encoder Module Error An error occurred in the linear encoder. A.892 External Encoder Error An error occurred in the external encoder. A.893 External Encoder Module Error An error occurred in the External Encoder Error An error occurred in the position data of the external encoder. An error occurred in the position data of the external encoder. An overspeed error occurred in the External Encoder Overspeed An overspeed error occurred in the External Encoder Overspeed An overspeed error occurred in the External Encoder Overspeed An overspeed error occurred in the External Encoder Overspeed An overspeed error occurred in the A/D Converted to the External Encoder. An error occurred in the A/D Converted to the External Encoder. An error occurred in the A/D Converted to the External Encoder. An error occurred in the A/D Converted to the External Encoder. An error occurred in the A/D Converted to the External Encoder. An error occurred in the External Encoder Error E	A.861	Motor Overheated		Gr.1	No	Н	Н	Н
A.890 Encoder Scale Error ear encoder. A.891 Encoder Module Error A.892 Encoder Module Error A.893 External Encoder Error An error occurred in the linear encoder. An error occurred in the external encoder. An error occurred in the external encoder. A.841 External Encoder Module Error A.842 External Incremental Encoder Sensor Error A.843 External Incremental Encoder Position Error A.844 External Absolute Encoder Position Error A.845 External Absolute Encoder Position Error A.846 External Encoder Overspeed An external encoder. A.846 External Encoder Overspeed An overspeed error occurred in the external encoder. A.846 External Encoder Overspeed An overspeed error occurred in the external encoder. An overspeed error occurred in the external encoder. An overspeed error occurred in the external encoder. An error occurred in the A/D converter for the speed reference input. A.847 External Encoder Overspeed error occurred in the external encoder. An error occurred in the A/D converter for the speed reference input. An error occurred in the A/D converter for the speed reference input. A.858 External Encoder Overheated An error occurred in the A/D converter for the speed reference input. An error occurred in the A/D converter for the speed reference. An error occurred in the A/D converter for the torque reference input. A.869 External Encoder Overheated An error occurred in the A/D converter for the torque reference input. A.870 External Encoder Overheated An error occurred in the A/D converter for the torque reference input. A.871 External Encoder Overheated An error occurred in the A/D converter for the torque reference input. A.883 External Encoder Overheated An error occurred in the External encoder. An error occurred in th	A.862	Overheat Alarm	ture) for the overheat protection input (TH) signal exceeded the setting of Pn61B (Overheat Alarm	Gr.1	Yes	Н	Н	Н
A.891 Encoder Module Error ear encoder. Gr.1 No H H H H A.8A0 External Encoder Error An error occurred in the external encoder. Gr.1 Yes H H H A.8A1 External Encoder Module Error Serial Converter Unit. Gr.1 Yes H H H A.8A2 External Incremental Encoder Sensor Error external encoder. A.8A3 External Absolute Encoder Position Error occurred in the external encoder. A.8A4 External Encoder Position Error external encoder. A.8A5 External Encoder Overspeed in the external encoder. A.8A6 External Encoder Overspeed in the external encoder. A.8A7 External Encoder Overspeed in the external encoder. A.8A8 External Encoder Overspeed in the external encoder. A.8A9 External Encoder Over	A.890	Encoder Scale Error		Gr.1	No	Н	Н	Н
A.8A1 External Encoder Error A.8A2 External Incremental Encoder Sensor Error A.8A3 External Absolute Encoder Position Error A.8A4 External Encoder Module Encoder Sensor Error A.8A5 External Incremental Encoder Sensor Error A.8A6 External Absolute Encoder Position Error A.8A6 External Encoder Overspeed rror occurred in the external encoder. A.8A6 External Encoder Overspeed error occurred in the external encoder. A.8A6 External Encoder Overspeed error occurred in the external encoder. A.8A6 External Encoder Overspeed error occurred in the external encoder. A.8A7 Overspeed error occurred in the External Encoder Overspeed error occurred in the external encoder. A.8A8 External Encoder Overspeed error occurred in the External Encoder Overspeed error Overspeed error Overspeed error External Encoder Overspeed error Overspeed error External Encoder Overspeed error Overspeed error External Encoder Overspeed error External Enc	A.891	Encoder Module Error		Gr.1	No	Н	Н	Н
A.8A1 Error Serial Converter Unit. Gr.1 Yes H H H H A.8A2 External Incremental Encoder Sensor Error external encoder. A.8A3 External Absolute Encoder Position Error Position Error External Encoder Overspeed in the external encoder. A.8A5 External Encoder Overspeed in the external encoder. A.8A6 External Encoder Overheated Poverheated Po	A.8A0	External Encoder Error		Gr.1	Yes	Н	Н	Н
A.8A2 Encoder Sensor Error external encoder. A.8A3 External Absolute Encoder Position Error encoder. A.8A5 External Encoder Overspeed in the external encoder. A.8A6 External Encoder Overheated An overheating error occurred in the external encoder. A.8A6 External Encoder Overheated An overheating error occurred in the external encoder. An overheating error occurred in the A/D converter for the speed reference input. A.B10 Speed Reference A/D Error An error occurred in the A/D converter for the speed reference input. A.B11 Speed Reference A/D Data Error An error occurred in the A/D converter for the speed reference. An error occurred in the A/D converter for the speed reference. An error occurred in the A/D converter for the torque reference input. A.B20 Torque Reference A/D Error An error occurred in the A/D converter for the torque reference input. A.B33 Current Detection Error 3 An error occurred in the current detection circuit. Internal program error 10 occurred in the SERVO-PACK. A.B66 System Alarm 0 A.B67 System Alarm 1 Internal program error 1 occurred in the SERVO-PACK. Internal program error 1 occurred in the SERVO-GR.1 No H H H H	A.8A1			Gr.1	Yes	Н	Н	Н
A.8A3 Position Error tion data of the external encoder. Gr.1 Yes H H H A.8A5 External Encoder Overspeed An overspeed error occurred in the external encoder. Gr.1 Yes H H H A.8A6 External Encoder Overheated An overheating error occurred in the external encoder. Gr.1 Yes H H H A.BA6 External Encoder Overheated An overheating error occurred in the external encoder. Gr.1 Yes H H H A.BA6 External Encoder Overheated An overheating error occurred in the external encoder. Gr.1 Yes H H H A.BA6 External Encoder Overheated Gr.1 Yes H H H A.BA6 External Encoder Overheated Gr.1 Yes H H H A.BA6 External Encoder Overheated Gr.1 Yes H H H A.BA6 External Encoder Overheated Gr.1 Yes H H H A.BA6 External Encoder Overheated Gr.1 Yes H H H A.BA6 External Encoder Overheated Gr.2 Yes H H H A.BA6 External Encoder Overheated Gr.2 Yes H H H A.BA6 External Encoder Overheated Gr.2 Yes H H H A.BA6 External Encoder Overheated Gr.2 Yes H H H A.BA6 External Encoder Overheated Gr.2 Yes H H H A.BA6 External Encoder Overheated Gr.2 Yes H H H A.BA6 External Encoder overheated Gr.2 Yes H H H A.BA6 External Encoder overheated Gr.2 Yes H H H A.BA6 External Encoder overheated Gr.2 Yes H H A.BA6 External Encoder Gr.2 Yes H H A.BA6 H H H A.BA6 External Encoder Gr.2 Yes H H A.BA6 H H H A.BA6 External Encoder Gr.2 Yes H H A.BA6 External Encoder Gr.2 Yes H H A.BA6 H H H A.BA6 External Encoder Gr.2 Yes H H A.BA6 H	A.8A2			Gr.1	Yes	Н	Н	Н
A.8A6	A.8A3		tion data of the external	Gr.1	Yes	Н	Н	Н
A.8A6 Overheated Overh	A.8A5		•	Gr.1	Yes	Н	Н	Н
A.b10 Speed Reference A/D	A.8A6		occurred in the external	Gr.1	Yes	Н	Н	Н
A.b11 Speed Reference A/D ata Error speed reference. A.b20 Torque Reference A/D Error Speed reference. A.b33 Current Detection Error 3 An error occurred in the Current detection circuit. A.bC0 System Alarm 10 System Alarm 0 System Alarm 1 Servo- Gr.1 No H H H H H H H H H H H H H H H H H H	A.b10		converter for the speed refer-	Gr.2	Yes	Н	Н	Н
A.b20 Converter for the torque reference input. Converter for the torque reference input. Current Detection Error 3 An error occurred in the current detection circuit. Gr.1 No H H H H A.b33 Current Detection Error 3 An error occurred in the current detection circuit. Gr.1 No H H H A.bC0 System Alarm 10 Internal program error 10 occurred in the SERVO-PACK. Internal program error 0 occurred in the SERVO-PACK. Gr.1 No H H H A.bF1 System Alarm 1 Internal program error 1 occurred in the SERVO-FACK. Gr.1 No H H H H H H H H H	A.b11		conversion data for the	Gr.2	Yes	Н	Н	Н
A.bC0 System Alarm 10 Internal program error 10 occurred in the SERVO-PACK. A.bF0 System Alarm 0 Internal program error 0 occurred in the SERVO-PACK. Internal program error 0 occurred in the SERVO-PACK. Internal program error 0 occurred in the SERVO-PACK. Internal program error 1 occurred in the SERVO-PACK. Internal program error 1 occurred in the SERVO-PACK. Internal program error 1 occurred in the SERVO-PACK.	A.b20	I	converter for the torque ref-	Gr.2	Yes	Н	Н	Н
A.bC0 System Alarm 10 occurred in the SERVO-PACK. Internal program error 0 occurred in the SERVO-PACK. System Alarm 0 occurred in the SERVO-PACK. Internal program error 1 occurred in the SERVO-Gr.1 No H H H H Occurred in the SERVO-FACK.	A.b33	Current Detection Error 3		Gr.1	No	Н	Н	Н
A.bF0 System Alarm 0 occurred in the SERVO-PACK. Gr.1 No H H H H A.bF1 System Alarm 1 occurred in the SERVO-Gr.1 No H H H H	A.bC0	System Alarm 10	occurred in the SERVO-	Gr.1	No	Н	Н	Н
A.bF1 System Alarm 1 occurred in the SERVO- Gr.1 No H H H	A.bF0	System Alarm 0	occurred in the SERVO-	Gr.1	No	Н	Н	Н
	A.bF1	System Alarm 1	occurred in the SERVO-	Gr.1	No	Н	Н	Н

Continued from previous page.

			Servo- motor	Alarm	Alarm Cod Output		
Alarm Number	Alarm Name	Alarm Meaning	Stop- ping Method	Reset Possi- ble?	ALO1		
A.bF2	System Alarm 2	Internal program error 2 occurred in the SERVO-PACK.	Gr.1	No	Н	Н	Н
A.bF3	System Alarm 3	Internal program error 3 occurred in the SERVO-PACK.	Gr.1	No	Н	Н	Н
A.bF4	System Alarm 4	Internal program error 4 occurred in the SERVO-PACK.	Gr.1	No	Н	Н	Н
A.bF5	System Alarm 5	Internal program error 5 occurred in the SERVO-PACK.	Gr.1	No	Н	Н	Н
A.bF6	System Alarm 6	Internal program error 6 occurred in the SERVO-PACK.	Gr.1	No	Н	Н	Н
A.bF7	System Alarm 7	Internal program error 7 occurred in the SERVO-PACK.	Gr.1	No	Н	Н	Н
A.bF8	System Alarm 8	Internal program error 8 occurred in the SERVO-PACK.	Gr.1	No	Н	Н	Н
A.C10	Servomotor Out of Control	The Servomotor ran out of control.	Gr.1	Yes	L	Н	L
A.C20	Phase Detection Error	The detection of the phase is not correct.	Gr.1	No	L	Н	L
A.C21	Polarity Sensor Error	An error occurred in the polarity sensor.	Gr.1	No	L	Н	L
A.C22	Phase Information Disagreement	The phase information does not match.	Gr.1	No	L	Н	L
A.C50	Polarity Detection Failure	The polarity detection failed.	Gr.1	No	L	Н	L
A.C51	Overtravel Detected during Polarity Detection	The overtravel signal was detected during polarity detection.	Gr.1	Yes	L	Н	L
A.C52	Polarity Detection Not Completed	The servo was turned ON before the polarity was detected.	Gr.1	Yes	L	Н	L
A.C53	Out of Range of Motion for Polarity Detection	The travel distance exceeded the setting of Pn48E (Polarity Detection Range).	Gr.1	No	L	Н	L
A.C54	Polarity Detection Failure 2	The polarity detection failed.	Gr.1	No	L	Н	L
A.C80	Encoder Clear Error or Multiturn Limit Setting Error	The multiturn data for the absolute encoder was not correctly cleared or set.	Gr.1	No	L	Н	L
A.C90	Encoder Communications Error	Communications between the encoder and SERVO-PACK is not possible.	Gr.1	No	L	Н	L
A.C91	Encoder Communications Position Data Acceleration Rate Error	An error occurred in calculating the position data of the encoder.	Gr.1	No	L	Н	L
A.C92	Encoder Communications Timer Error	An error occurred in the communications timer between the encoder and SERVO-PACK.	Gr.1	No	L	Н	L

12.2.1 List of Alarms

Continued from previous page.

	Continued from previous page.						
Alarm	Alama Nara	Alayna Maranina	Servo- motor	Alarm Reset		arm Co Outpu	
Number	Alarm Name	Alarm Meaning	Stop- ping Method	Possi- ble?	ALO1	ALO2	ALO3
A.CA0	Encoder Parameter Error	The parameters in the encoder are corrupted.	Gr.1	No	L	Н	L
A.Cb0	Encoder Echoback Error	The contents of communications with the encoder are incorrect.	Gr.1	No	L	Н	L
A.CC0	Multiturn Limit Disagreement	Different multiturn limits have been set in the encoder and the SERVOPACK.	Gr.1	No	L	Н	L
A.CF1	Reception Failed Error in Feedback Option Module Communications	Receiving data from the Feedback Option Module failed.	Gr.1	No	L	Н	L
A.CF2	Timer Stopped Error in Feedback Option Module Communications	An error occurred in the timer for communications with the Feedback Option Module.	Gr.1	No	L	Н	L
A.d00	Position Deviation Overflow	The setting of Pn520 (Position Deviation Overflow Alarm Level) was exceeded by the position deviation.	Gr.1	Yes	L	L	Н
A.d01	Position Deviation Overflow Alarm at Servo ON	The servo was turned ON after the position deviation exceeded the setting of Pn526 (Position Deviation Overflow Alarm Level at Servo ON) while the servo was OFF.	Gr.1	Yes	L	L	Н
A.d02	Position Deviation Overflow Alarm for Speed Limit at Servo ON	If position deviation remains in the deviation counter, the setting of Pn529 or Pn584 (Speed Limit Level at Servo ON) limits the speed when the servo is turned ON. This alarm occurs if reference pulses are input and the setting of Pn520 (Position Deviation Overflow Alarm Level) is exceeded before the limit is cleared.	Gr.2	Yes	L	L	Н
A.d10	Motor-Load Position Deviation Overflow	There was too much position deviation between the motor and load during fully-closed loop control.	Gr.2	Yes	L	L	Н
A.d30	Position Data Overflow	The position feedback data exceeded ±1,879,048,192.	Gr.1	No	L	L	Н
A.E71	Safety Option Module Detection Failure	Detection of the Safety Option Module failed.	Gr.1	No	Н	L	L
A.E72	Feedback Option Module Detection Failure	Detection of the Feedback Option Module failed.	Gr.1	No	Н	L	L
A.E74	Unsupported Safety Option Module	An unsupported Safety Option Module was con- nected.	Gr.1	No	Н	L	L
A.Eb1	Safety Function Signal Input Timing Error	An error occurred in the input timing of the safety function signal.	Gr.1	No	Н	L	L
A.EC8	Gate Drive Error 1	An error occurred in the gate drive circuit.	Gr.1	No	Н	L	L
A.EC9	Gate Drive Error 2	An error occurred in the gate drive circuit.	Gr.1	No	Н	L	L

Continued from previous page.

Alarm Number			Servo- motor Alarm Output				
	Alarm Name	Alarm Meaning	Stop- ping Method	Possi- ble?	ALO1	ALO2	ALO3
A.F10	Power Supply Line Open Phase	The voltage was low for more than one second for phase R, S, or T when the main power supply was ON.	Gr.2	Yes	Н	L	Н
FL-1*							
FL-2*			- No				
FL-3*		An internal program error					
FL-4*	System Alarm	occurred in the SERVO-		Undefined.			
FL-5*		PACK.					
FL-6*							
FL-7*							
CPF00	Digital Operator Communications Error 1	Communications were not possible between the Digital			No Undefined.		
CPF01	Digital Operator Communications Error 2	Operator (model: JUSP- OP05A-1-E) and the SERVO- PACK (e.g., a CPU error occurred).	_	No			ed.

^{*} These alarms are not stored in the alarm history. They are only displayed on the panel display.

Note: The A.Eb0, A.Eb2 to A.Eb9, and A.EC0 to A.EC2 alarms can occur when a Safety Module is connected. Refer to the following manual for details.

Σ-V-Series/Σ-V-Series for Large-Capacity Models/Σ-7-Series User's Manual Safety Module (Manual No.: SIEP C720829 06)

12.2.2 Troubleshooting Alarms

The causes of and corrections for the alarms are given in the following table. Contact your Yaskawa representative if you cannot solve a problem with the correction given in the table.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
	The power supply voltage suddenly dropped.	Measure the power supply voltage.	Set the power supply voltage within the specified range, and initialize the parameter settings.	page 5-11
	The power supply was shut OFF while writing parameter settings.	Check the timing of shutting OFF the power supply.	Initialize the parameter settings and then set the parameters again.	page 5 11
A.020: Parameter	The number of times that parameters were written exceeded the limit.	Check to see if the parameters were frequently changed from the host controller.	The SERVOPACK may be faulty. Replace the SERVOPACK. Reconsider the method for writing the parameters.	-
Checksum Error (There is an error in the parameter data in the SERVOPACK.)	A malfunction was caused by noise from the AC power supply, ground, static electricity, or other source.	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, noise may be the cause.	Implement countermeasures against noise.	page 4-5
	Gas, water drops, or cutting oil entered the SERVOPACK and caused failure of the internal components.	Check the installation conditions.	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
	A failure occurred in the SERVOPACK.	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may have failed.	The SERVOPACK may be faulty. Replace the SERVOPACK.	_
A.021: Parameter Format Error (There is an error in the parameter data format in the	The software version of the SERVOPACK that caused the alarm is older than the software version of the parameters specified to write.	Read the product information to see if the software versions are the same. If they are different, it could be the cause of the alarm.	Write the parameters from another SERVOPACK with the same model and the same software version, and then turn the power OFF and ON again.	page 9-2
SERVOPACK.)	A failure occurred in the SERVOPACK.	-	The SERVOPACK may be faulty. Replace the SERVOPACK.	_
	The power supply voltage suddenly dropped.	Measure the power supply voltage.	The SERVOPACK may be faulty. Replace the SERVOPACK.	_
A.022: System Check- sum Error (There is an error	The power supply was shut OFF while setting a utility function.	Check the timing of shutting OFF the power supply.	The SERVOPACK may be faulty. Replace the SERVOPACK.	_
in the parameter data in the SERVOPACK.)	A failure occurred in the SERVOPACK.	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may have failed.	The SERVOPACK may be faulty. Replace the SERVOPACK.	_

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
A.024: System Alarm (An internal pro- gram error occurred in the SERVOPACK.)	A failure occurred in the SERVOPACK.	-	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.025: System Alarm (An internal pro- gram error occurred in the SERVOPACK.)	A failure occurred in the SERVOPACK.	-	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
	A failure occurred in the SERVOPACK.	_	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.030: Main Circuit Detector Error	The jumper between the DC Reactor terminals (⊝1 and ⊝2) was removed or there is faulty contact. The cable between	_	Correct the wiring between the DC Reactor	_
	the DC Reactor and SERVOPACK is not wired correctly or there is a faulty con- tact.		terminals.	
	The SERVOPACK and Servomotor capacities do not match each other.	Check the combination of the SERVOPACK and Servomotor capacities.	Select a proper combination of SERVOPACK and Servomotor capacities.	page 1-9
A.040: Parameter Set-	The motor parameter file was not written to the linear encoder. (This applies only when not using a Serial Converter Unit.)	Check to see if the motor parameter file was written to the linear encoder.	Write the motor parameter file to the linear encoder.	page 5-20
ting Error (A parameter set- ting is outside of	A failure occurred in the SERVOPACK.	_	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
the setting range.)	A parameter setting is outside of the setting range.	Check the setting ranges of the parameters that have been changed.	Set the parameters to values within the setting ranges.	-
	The electronic gear ratio is outside of the setting range.	Check the electronic gear ratio. The ratio must be within the following range: 0.001 < (Pn20E/Pn210) < 64,000.	Set the electronic gear ratio in the following range: 0.001 < (Pn20E/Pn210) < 64,000.	page 5-47
A.041: Encoder Output Pulse Setting Error	The setting of Pn212 (Number of Encoder Output Pulses) or Pn281 (Encoder Output Resolution) is outside of the setting range or does not satisfy the setting conditions.	Check the setting of Pn212 or Pn281.	Set Pn212 or Pn281 to an appropriate value.	page 6-48

12.2.2 Troubleshooting Alarms

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
	The speed of program jogging went below the setting range when the electronic gear ratio (Pn20E/Pn210) or the Servomotor was changed.	Check to see if the detection conditions*1 are satisfied.	Decrease the setting of the electronic gear ratio (Pn20E/Pn210).	page 5-47
A.042: Parameter Combination Error	The speed of program jogging went below the setting range when Pn533 or Pn585 (Program Jogging Movement Speed) was changed.	Check to see if the detection conditions*1 are satisfied.	Increase the setting of Pn533 or Pn585.	page 7-20
	The movement speed of advanced autotuning went below the setting range when the electronic gear ratio (Pn20E/ Pn210) or the Servomotor was changed.	Check to see if the detection conditions*2 are satisfied.	Decrease the setting of the electronic gear ratio (Pn20E/Pn210).	page 5-47
A.044: Semi-Closed/ Fully-Closed Loop Control Parameter Setting Error	The setting of the Fully-closed Module does not match the setting of Pn002 = n.XDDD (External Encoder Usage).	Check the setting of Pn002 = n.X□□□.	Make sure that the setting of the Fully-closed Module agrees with the setting of Pn002 = n.X□□□.	page 10-6
A.050: Combination Error	The SERVOPACK and Servomotor capacities do not match each other.	Confirm that the following condition is met: 1/4 ≤ (Servomotor capacity/SERVOPACK capacity) ≤ 4	Select a proper combination of the SERVOPACK and Servomotor capacities.	page 1-9
(The capacities of the SERVOPACK and Servomotor	A failure occurred in the encoder.	Replace the encoder and check to see if the alarm still occurs.	Replace the Servomotor or encoder.	-
do not match.)	A failure occurred in the SERVOPACK.	_	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.051:	The motor parameter file was not written to the linear encoder. (This applies only when not using a Serial Converter Unit.)	Check to see if the motor parameter file was written to the linear encoder.	Write the motor parameter file to the linear encoder.	page 5-20
Unsupported Device Alarm	An unsupported Serial Converter Unit or encoder (e.g., an external encoder) is connected to the SERVOPACK.	Check the product combination specifications.	Change to a correct combination of models.	-

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
A.070: Motor Type Change Detected (The connected	A Rotary Servomotor was removed and a Linear Servomotor was connected.	-	Set the parameters for a Linear Servomotor and reset the motor type alarm. Then, turn the power supply to the SERVOPACK OFF and ON again.	page 12-46
motor is a differ- ent type of motor from the previ- ously connected motor.)	A Linear Servomotor was removed and a Rotary Servomotor was connected.	_	Set the parameters for a Rotary Servomotor and reset the motor type alarm. Then, turn the power supply to the SERVOPACK OFF and ON again.	page 12-46
A.080: Linear Encoder Pitch Setting Error	The setting of Pn282 (Linear Encoder Scale Pitch) has not been changed from the default setting.	Check the setting of Pn282.	Correct the setting of Pn282.	page 5-19
A.0b0: Invalid Servo ON Command Alarm	The /S-ON (Servo ON) signal was input from the host controller after a utility function that turns ON the Servomotor was executed.	_	Turn the power supply to the SERVOPACK OFF and ON again. Or, execute a software reset.	page 6-97
	The Main Circuit Cable is not wired correctly or there is faulty contact.	Check the wiring.	Correct the wiring.	
	There is a short-circuit or ground fault in a Main Circuit Cable.	Check for short-circuits across Servomotor phases U, V, and W, or between the ground and Servomotor phases U, V, and W.	The cable may be short-circuited. Replace the cable.	
A.100: Overcurrent Detected (An overcurrent flowed through the power tran-	There is a short-circuit or ground fault inside the Servomotor.	Check for short-circuits across Servomotor phases U, V, and W, or between the ground and Servomotor phases U, V, or W.	The Servomotor may be faulty. Replace the Servomotor.	page 4-25
sistor or the heat sink overheated.)	There is a short-circuit or ground fault inside the SERVOPACK.	Check for short-circuits across the Servomotor connection terminals U, V, and W on the SERVOPACK, or between the ground and terminals U, V, or W.	The SERVOPACK may be faulty. Replace the SERVOPACK.	
	The regenerative resistor is not wired correctly or there is faulty contact.	Check the wiring.	Correct the wiring.	page 4-22

12.2.2 Troubleshooting Alarms

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference	
	The dynamic brake (DB, emergency stop executed from the SERVOPACK) was frequently activated, or a DB overload alarm occurred.	Check the power consumed by the DB resistor to see how frequently the DB is being used. Or, check the alarm display to see if a DB overload alarm (A.730 or A.731) has occurred.	Change the SERVOPACK model, operating methods, or the mechanisms so that the dynamic brake does not need to be used so frequently.	-	
	The regenerative processing capacity was exceeded.	Check the regenerative load ratio in the SigmaWin+ Motion Monitor Tab Page to see how frequently the regenerative resistor is being used.	Recheck the operating conditions and load.	*3	
A.100: Overcurrent Detected (An overcurrent flowed through the power transistor or the heat	The SERVOPACK regenerative resistance is too small.	Check the regenerative load ratio in the SigmaWin+ Motion Monitor Tab Page to see how frequently the regenerative resistor is being used.	Change the regenerative resistance to a value larger than the SERVO-PACK minimum allowable resistance.	3	
sink overheated.)	A heavy load was applied while the Servomotor was stopped or running at a low speed.	Check to see if the operating conditions exceed Servo Drive specifications.	Reduce the load applied to the Servomotor. Or, increase the operating speed.	-	
	A malfunction was caused by noise.	Improve the noise envi- ronment, e.g. by improving the wiring or installation conditions, and check to see if the alarm still occurs.	Implement countermeasures against noise, such as correct wiring of the FG. Use an FG wire size equivalent to the SERVO-PACK's main circuit wire size.	_	
	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-	

Continued from previous page.		
Correction	Reference	

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
A.101: Motor Overcurrent Detected (The current to the motor exceeded the allowable current.)	The Main Circuit Cable is not wired correctly or there is faulty contact.	Check the wiring.	Correct the wiring.	page 4-25
	There is a short-circuit or ground fault in a Main Circuit Cable.	Check for short-circuits across cable phases U, V, and W, or between the ground and cable phases U, V, and W.	The cable may be short-circuited. Replace the cable.	
	There is a short-circuit or ground fault inside the Servomotor.	Check for short-circuits across Servomotor phases U, V, and W, or between the ground and Servomotor phases U, V, or W.	The Servomotor may be faulty. Replace the Servomotor.	
	There is a short-circuit or ground fault inside the SERVOPACK.	Check for short-circuits across the Servomotor connection terminals U, V, and W on the SERVOPACK, or between the ground and terminals U, V, or W.	The SERVOPACK may be faulty. Replace the SERVOPACK.	
	A heavy load was applied while the Servomotor was stopped or running at a low speed.	Check to see if the operating conditions exceed Servo Drive specifications.	Reduce the load applied to the Servomotor. Or, increase the operating speed.	-
	A malfunction was caused by noise.	Improve the noise envi- ronment, e.g. by improving the wiring or installation conditions, and check to see if the alarm still occurs.	Implement countermeasures against noise, such as correct wiring of the FG. Use an FG wire size equivalent to the SERVO-PACK's main circuit wire size.	-
	A failure occurred in the SERVOPACK.	-	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-

12.2.2 Troubleshooting Alarms

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
A.300: Regeneration Error	When using the built-in regenerative resistor, the jumper between the regenerative resistor terminals (B2 and B3) was removed from one of the following SERVO-PACKs: SGD7S-3R8A, -5R5A, -7R6A, -120A, -180A, -200A, or -330A.	Check to see if the jumper is connected between power supply terminals B2 and B3.*4	Correctly connect a jumper.	page 4-22
	The External Regenerative Resistor or Regenerative Resistor Unit is not wired correctly, or was removed or disconnected.	Check the wiring of the External Regenerative Resistor or Regenerative Resistor Unit.*4	Correct the wiring of the External Regenerative Resistor or Regenerative Resistor Unit.	
	Pn600 (Regenerative Resistor Capacity) is not set to 0 and an External Regenerative Resistor is not con- nected to one of the following SERVO- PACKs: SGD7S- R70A, -R90A,-1R6A, -2R8A, -R70F, -R90F, -2R1F, or -2R8F.	Check to see if an External Regenerative Resistor is connected and check the setting of Pn600.	Connect an External Regenerative Resistor, or set Pn600 (Regenerative Resistor Capacity) to 0 (setting unit: ×10 W) if no Regenerative Resistor is required.	page 5-58
	An External Regenerative Resistor is not connected to one of the following SERVO-PACKs: SGD7S-470A, -550A, -590A, or -780A.	Check to see if an External Regenerative Resistor or a Regenerative Resistor Unit is connected and check the setting of Pn600.	Connect an External Regenerative Resistor and set Pn600 to an appropri- ate value, or connect a Regenerative Resistor Unit and set Pn600 to 0.	
	A failure occurred in the SERVOPACK.	_	While the main circuit power supply is OFF, turn the control power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	_

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
A.320: Regenerative Overload	The power supply voltage exceeded the specified range.	Measure the power supply voltage.	Set the power supply voltage within the specified range.	-
	The external regenerative resistance value or regenerative resistor capacity is too small, or there has been a continuous regeneration state.	Check the operating conditions or the capacity using the SigmaJunmaSize+ Capacity Selection Software or other means.	Change the regenerative resistance value or capacity. Reconsider the operating conditions using the SigmaJunmaSize+ Capacity Selection Software or other means.	*3
	There was a continuous regeneration state because a negative load was continuously applied.	Check the load applied to the Servomotor during operation.	Reconsider the system including the servo, machine, and operating conditions.	-
	The setting of Pn600 (Regenerative Resistor Capacity) is smaller than the capacity of the External Regenerative Resistor.	Check to see if a Regenerative Resistor is connected and check the setting of Pn600.	Correct the setting of Pn600.	page 5-58
	The setting of Pn603 (Regenerative Resistance) is smaller than the capacity of the External Regenerative Resistor.	Check to see if a Regenerative Resistor is connected and check the setting of Pn603.	Correct the setting of Pn603.	page 5-58
	The external regenerative resistance is too high.	Check the regenerative resistance.	Change the regenerative resistance to a correct value or use an External Regenerative Resistor of an appropriate capacity.	*3
	A failure occurred in the SERVOPACK.	_	The SERVOPACK may be faulty. Replace the SERVOPACK.	_

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
	The regenerative resistor was disconnected when the SERVOPACK power supply voltage was high.	Measure the resistance of the regenerative resistor using a measuring instrument.	If you are using the regenerative resistor built into the SERVOPACK, replace the SERVOPACK. If you are using an External Regenerative Resistor, replace the External Regenerative Resistor.	-
A 000-	DC power was supplied when an AC power supply input was specified in the settings.	Check the power supply to see if it is a DC power supply.	Correct the power supply setting to match the actual power supply.	page 5 14
A.330: Main Circuit Power Supply Wiring Error (Detected when the main circuit power supply is turned ON.)	AC power was supplied when a DC power supply input was specified in the settings.	Check the power supply to see if it is an AC power supply.	Correct the power supply setting to match the actual power supply.	page 5-14
	Pn600 (Regenerative Resistor Capacity) is not set to 0 and an External Regenerative Resistor is not con- nected to one of the following SERVOPACKs: SGD7S-R70A, -R90A, -1R6A, -2R8A, -R70F, -R90F, -2R1F, or -2R8F.	Check to see if an External Regenerative Resistor is connected and check the setting of Pn600.	Connect an External Regenerative Resistor, or if an External Regenera- tive Resistor is not required, set Pn600 to 0.	page 4-22, page 5-58
	A failure occurred in the SERVOPACK.	_	The SERVOPACK may be faulty. Replace the SERVOPACK.	_

Continued from previous pa				
	Confirmation	Correction	Reference	
	Measure the power supply voltage.	Set the AC/DC power supply voltage within the specified range.	-	
		Improve the power supply conditions, install a		

A.400: Overvoltage (Detected in the main circuit power supply section of the SERVOPACK.)

Alarm Number:

Alarm Name

Possible Cause

The power supply voltage exceeded the specified range.	Measure the power supply voltage.	Set the AC/DC power supply voltage within the specified range.	-
The power supply is not stable or was influenced by a lightning surge.	Measure the power supply voltage.	Improve the power supply conditions, install a surge absorber, and then turn the power supply OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
The voltage for AC power supply was too high during acceleration or deceleration.	Check the power supply voltage and the speed and torque during operation.	Set the AC power supply voltage within the specified range.	_
The external regenerative resistance is too high for the operating conditions.	Check the operating conditions and the regenerative resistance.	Select a regenerative resistance value that is appropriate for the operating conditions and load.	*3
The moment of inertia ratio or mass ratio exceeded the allowable value.	Check to see if the moment of inertia ratio or mass ratio is within the allowable range.	Increase the deceleration time, or reduce the load.	-
A failure occurred in the SERVOPACK.	_	While the main circuit power supply is OFF, turn the control power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	_
		Continued o	n next page.

Continued from previous page.

Alama Nivershair			Continued from pre	evious page.
Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
	The power supply voltage went below the specified range.	Measure the power supply voltage.	Set the power supply voltage within the specified range.	_
	The power supply voltage dropped during operation.	Measure the power supply voltage.	Increase the power supply capacity.	_
	A momentary power interruption occurred.	Measure the power supply voltage.	If you have changed the setting of Pn509 (Momentary Power Interruption Hold Time), decrease the setting.	page 6-13
A.410: Undervoltage (Detected in the main circuit power supply	The SERVOPACK fuse is blown out.	-	Replace the SERVO-PACK and connect a reactor to the DC reactor terminals (⊝1 and ⊝2) on the SERVOPACK.	-
section of the SERVOPACK.)	A failure occurred in the SERVOPACK.	-	The SERVOPACK may be faulty. Replace the SERVOPACK.	_
	The jumper between the DC Reactor terminals (⊝1 and ⊝2) was removed or there is faulty contact.		Correct the wiring between the DC Reactor	
	The cable between the DC Reactor and SERVOPACK is not wired correctly or there is a faulty contact.	_	terminals.	
	The order of phases U, V, and W in the motor wiring is not correct.	Check the wiring of the Servomotor.	Make sure that the Servo- motor is correctly wired.	_
A.510: Overspeed (The motor	A reference value that exceeded the overspeed detection level was input.	Check the input reference.	Reduce the reference value. Or, adjust the gain.	nogo 6 17
exceeded the maximum speed.)	The motor exceeded the maximum speed.	Check the waveform of the motor speed.	Reduce the speed reference input gain and adjust the servo gain. Or, reconsider the operating conditions.	page 6-17
	A failure occurred in the SERVOPACK.	-	The SERVOPACK may be faulty. Replace the SERVOPACK.	_
A.511: Encoder Output	The encoder output pulse frequency exceeded the limit.	Check the encoder output pulse setting.	Decrease the setting of Pn212 (Number of Encoder Output Pulses) or Pn281 (Encoder Out- put Resolution).	page 6-53
Pulse Overspeed	The encoder output pulse frequency exceeded the limit because the motor speed was too high.	Check the encoder output pulse setting and the motor speed.	Reduce the motor speed.	-

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
	Abnormal oscillation was detected in the motor speed.	Check for abnormal motor noise, and check the speed and torque waveforms during operation.	Reduce the motor speed. Or, reduce the setting of Pn100 (Speed Loop Gain).	page 8-76
A.520: Vibration Alarm	The setting of Pn103 (Moment of Inertia Ratio) is greater than the actual moment of inertia or was greatly changed.	Check the moment of inertia ratio or mass ratio.	Set Pn103 (Moment of Inertia Ratio) to an appropriate value.	page 8-16
	The vibration detection level (Pn312 or Pn384) is not suitable.	Check that the vibration detection level (Pn312 or Pn384) is suitable.	Set a suitable vibration detection level (Pn312 or Pn384).	page 6-99
A.521: Autotuning Alarm (Vibration was detected while executing the	The Servomotor vibrated considerably while performing the tuning-less function.	Check the waveform of the motor speed.	Reduce the load so that the moment of inertia ratio is within the allowable value. Or increase the load level or reduce the rigidity level in the tuning- less level settings.	page 8-13
custom tuning, Easy FFT, or the tuning-less func- tion.)	The Servomotor vibrated considerably while performing custom tuning or Easy FFT.	Check the waveform of the motor speed.	Check the operating procedure of corresponding function and implement corrections.	page 8-42, page 8-95
A.550: Maximum Speed Setting Error	The setting of Pn385 (Maximum Motor Speed) is greater than the maximum speed.	Check the setting of Pn385, and the upper limits of the maximum motor speed setting and the encoder output resolution setting.	Set Pn385 to a value that does not exceed the maximum motor speed.	page 6-16
	The wiring is not cor- rect or there is a faulty connection in the motor or encoder wir- ing.	Check the wiring.	Make sure that the Servo- motor and encoder are correctly wired.	page 4-25
	Operation was per- formed that exceeded the overload protec- tion characteristics.	Check the motor over- load characteristics and Run command.	Reconsider the load and operating conditions. Or, increase the motor capacity.	-
A.710: Instantaneous Overload A.720: Continuous Overload	An excessive load was applied during operation because the Servomotor was not driven due to mechanical problems.	Check the operation reference and motor speed.	Correct the mechanical problem.	-
	There is an error in the setting of Pn282 (Linear Encoder Scale Pitch).	Check the setting of Pn282.	Correct the setting of Pn282.	page 5-19
	There is an error in the setting of Pn080 = n.□□X□ (Motor Phase Sequence Selection).	Check the setting of Pn080 = n.□□X□.	Set Pn080 = n.□□X□ to an appropriate value.	page 5-24
	A failure occurred in the SERVOPACK.	_	The SERVOPACK may be faulty. Replace the SERVOPACK.	_

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction Correction	Reference
A.730 and	The Servomotor was rotated by an external force.	Check the operation status.	Implement measures to ensure that the motor will not be rotated by an external force.	-
A.731: Dynamic Brake Overload (An excessive power consumption by the dynamic brake was detected.)	When the Servomotor was stopped with the dynamic brake, the rotational or linear kinetic energy exceeded the capacity of the dynamic brake resistor.	Check the power consumed by the DB resistor to see how frequently the DB is being used.	Reconsider the following: Reduce the Servomotor command speed. Decrease the moment of inertia ratio or mass ratio. Reduce the frequency of stopping with the dynamic brake.	-
	A failure occurred in the SERVOPACK.	_	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.740: Inrush Current Limiting Resistor Overload (The main circuit power supply	The allowable frequency of the inrush current limiting resistor was exceeded when the main circuit power supply was turned ON and OFF.	_	Reduce the frequency of turning the main circuit power supply ON and OFF.	-
was frequently turned ON and OFF.)	A failure occurred in the SERVOPACK.	_	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
	The surrounding air temperature is too high.	Check the surrounding air temperature using a thermometer. Or, check the operating status with the SERVOPACK installation environment monitor.	Decrease the surrounding temperature by improving the SERVO-PACK installation conditions.	page 3-7
0.704.	An overload alarm was reset by turning OFF the power supply too many times.	Check the alarm display to see if there is an overload alarm.	Change the method for resetting the alarm.	-
A.7A1: Internal Temperature Error 1 (Control Board Temperature Error)	There was an excessive load or operation was performed that exceeded the regenerative processing capacity.	Use the accumulated load ratio to check the load during operation, and use the regenerative load ratio to check the regenerative processing capacity.	Reconsider the load and operating conditions.	-
	The SERVOPACK installation orientation is not correct or there is insufficient space around the SERVOPACK.	Check the SERVOPACK installation conditions.	Install the SERVOPACK according to specifications.	page 3-3, page 3-6
	A failure occurred in the SERVOPACK.	-	The SERVOPACK may be faulty. Replace the SERVOPACK.	_

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
	The surrounding air temperature is too high.	Check the surrounding air temperature using a thermometer. Or, check the operating status with the SERVOPACK installation environment monitor.	Decrease the surrounding temperature by improving the SERVO-PACK installation conditions.	page 3-7
	An overload alarm was reset by turning OFF the power supply too many times.	Check the alarm display to see if there is an overload alarm.	Change the method for resetting the alarm.	-
A.7A2: Internal Tempera- ture Error 2 (Power Board Temperature Error)	There was an excessive load or operation was performed that exceeded the regenerative processing capacity.	Use the accumulated load ratio to check the load during operation, and use the regenerative load ratio to check the regenerative processing capacity.	Reconsider the load and operating conditions.	-
	The SERVOPACK installation orientation is not correct or there is insufficient space around the SERVOPACK.	Check the SERVOPACK installation conditions.	Install the SERVOPACK according to specifications.	page 3-3, page 3-6
	A failure occurred in the SERVOPACK.	-	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.7A3: Internal Temperature Sensor Error (An error occurred in the temperature sensor circuit.)	A failure occurred in the SERVOPACK.	-	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.7Ab: SERVOPACK Built-in Fan Stopped	The fan inside the SERVOPACK stopped.	Check for foreign matter inside the SERVOPACK.	Remove foreign matter from the SERVOPACK. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
	The power to the absolute encoder was turned ON for the first time.	Check to see if the power supply was turned ON for the first time.	Set up the encoder.	
A.810:	The Encoder Cable was disconnected and then connected again.	Check to see if the power supply was turned ON for the first time.	Check the encoder connection and set up the encoder.	page 5-52
Encoder Backup Alarm (Detected at the encoder, but only when an abso- lute encoder is used.)	Power is not being supplied both from the control power supply (+5 V) from the SERVOPACK and from the battery power supply.	Check the encoder connector battery and the connector status.	Replace the battery or implement similar measures to supply power to the encoder, and set up the encoder.	
	A failure occurred in the absolute encoder.	-	If the alarm still occurs after setting up the encoder again, replace the Servomotor.	-
	A failure occurred in the SERVOPACK.	_	The SERVOPACK may be faulty. Replace the SERVOPACK.	- n next page.

Continued from previous page.

Alarm Number:	Described O	0 1'	Continued from pre	1 0
Alarm Name	Possible Cause	Confirmation	Correction	Reference
A.820: Encoder Check- sum Alarm (Detected at the encoder.)	A failure occurred in the encoder.	_	■ When Using an Absolute Encoder Set up the encoder again. If the alarm still occurs, the Servomotor may be faulty. Replace the Servomotor. ■ When Using a Singleturn Absolute Encoder or Incremental Encoder or Incremental Encoder alulty. Replace the Servomotor. • The linear encoder may be faulty. Replace the linear encoder.	page 5-52
	A failure occurred in the SERVOPACK.	_	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.830: Encoder Battery	The battery connection is faulty or a battery is not connected.	Check the battery connection.	Correct the battery connection.	page 4-26
Alarm (The absolute encoder battery voltage was lower	The battery voltage is lower than the specified value (2.7 V).	Measure the battery voltage.	Replace the battery.	page 12-3
than the speci- fied level.)	A failure occurred in the SERVOPACK.	_	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
	The encoder malfunctioned.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the Servomotor or linear encoder may be faulty. Replace the Servo- motor or linear encoder.	-
	An error occurred in reading data from the linear encoder.	_	The linear encoder is not mounted within an appropriate tolerance. Correct the mounting of the linear encoder.	-
A.840: Encoder Data Alarm (Detected at the encoder.)	Excessive speed occurred in the linear encoder.	_	Control the motor speed within the range specified by the linear encoder manufacturer and then turn ON the control power supply.	-
	The encoder malfunctioned due to noise.	_	Correct the wiring around the encoder by separating the Encoder Cable from the Servomotor Main Circuit Cable or by grounding the encoder.	-
	The polarity sensor is not wired correctly.	Check the wiring of the polarity sensor.	Correct the wiring of the polarity sensor.	_
	The polarity sensor failed.	_	Replace the polarity sensor.	-

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
A.850: Encoder Over- speed (Detected at the	Rotary Servomotor: The Servomotor speed was 200 min ⁻¹ or higher when the control power supply was turned ON.	Check the motor speed when the power supply is turned ON.	Reduce the Servomotor speed to a value less than 200 min ⁻¹ , and turn ON the control power supply.	-
	Linear Servomotor: The Servomotor exceeded the specified speed when the control power supply was turned ON.	Check the motor speed when the power supply is turned ON.	Control the motor speed within the range specified by the linear encoder manufacturer and then turn ON the control power supply.	-
encoder when the control power supply is turned ON.)	A failure occurred in the encoder.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the Servomotor or linear encoder may be faulty. Replace the Servo- motor or linear encoder.	-
	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.860:	The surrounding air temperature around the Servomotor is too high.	Measure the surrounding air temperature around the Servomotor.	Reduce the surrounding air temperature of the Servomotor to 40°C or less.	-
Encoder Over- heated (Detected when a Rotary Servomo-	The Servomotor load is greater than the rated load.	Use the accumulated load ratio to check the load.	Operate the Servo Drive so that the motor load remains within the specified range.	page 9-4
tor, Absolute Linear Encoder, or Direct Drive Servomotor is connected. However, this alarm is not detected for SGMCS Servomotors.) (Detected at the encoder.)	A failure occurred in the encoder.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the Servomotor or absolute linear encoder may be faulty. Replace the Servomotor or absolute linear encoder.	-
	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-

Continued from previous page.

	Continued from previous pag			
Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
	The surrounding temperature around the Servomotor is too high.	Measure the surrounding temperature around the Servomotor.	Reduce the surrounding air temperature of the Servomotor to 40°C or less.	-
	The motor load is greater than the rated load.	Check the load with the accumulated load ratio on the Motion Monitor Tab Page on the SigmaWin+.	Operate the Servo Drive so that the motor load remains within the specified range.	page 9-4
A.861: Motor Over- heated	A failure occurred in the Serial Converter Unit.	-	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the Serial Con- verter Unit may be faulty. Replace the Serial Con- verter Unit.	-
	A failure occurred in the SERVOPACK.	-	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
	The surrounding temperature is too high.	Check the surrounding temperature using a thermometer.	Lower the surrounding temperature by improving the installation conditions of the Linear Servomotor or the machine.	-
	The overheat protection input signal line is disconnected or short-circuited.	Check the input voltage with the overheat protection input information on the Motion Monitor Tab Page on the SigmaWin+.	Repair the line for the overheat protection input signal.	-
A.862:	An overload alarm was reset by turning OFF the power supply too many times.	Check the alarm display to see if there is an overload alarm.	Change the method for resetting the alarm.	-
Overheat Alarm	Operation was performed under an excessive load.	Use the accumulated load ratio to check the load during operation.	Reconsider the load and operating conditions.	_
	A failure occurred in the SERVOPACK.	_	The SERVOPACK may be faulty. Replace the SERVOPACK.	-
	The temperature detection circuit in the Linear Servomotor is faulty or the sensor attached to the machine is faulty.		The temperature detection circuit in the Linear Servomotor may be faulty or the sensor attached to the machine may be faulty. Replace the Linear Servomotor or repair the sensor attached to the machine.	-
A.890: Encoder Scale Error	A failure occurred in the linear encoder.	_	The linear encoder may be faulty. Replace the linear encoder.	-
A.891: Encoder Module Error	A failure occurred in the linear encoder.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the linear encoder may be faulty. Replace the linear encoder.	-

Continued from previous page.

	Continued from previous page.			
Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
A.8A0: External Encoder Error	Setting the origin of the absolute linear encoder failed because the motor moved.	Before you set the origin, use the fully-closed feedback pulse counter to confirm that the motor is not moving.	The motor must be stopped while setting the origin position.	page 5-55
	A failure occurred in the external encoder.	_	Replace the external encoder.	-
A.8A1:	A failure occurred in the external encoder.	_	Replace the external encoder.	-
External Encoder Module Error	A failure occurred in the Serial Converter Unit.	_	Replace the Serial Converter Unit.	-
A.8A2: External Incremental Encoder Sensor Error	A failure occurred in the external encoder.	_	Replace the external encoder.	-
A.8A3: External Absolute Encoder Position Error	A failure occurred in the external absolute encoder.	-	The external absolute encoder may be faulty. Refer to the encoder manufacturer's instruction manual for corrections.	-
A.8A5: External Encoder Overspeed	An overspeed error was detected in the external encoder.	Check the maximum speed of the external encoder.	Keep the external encoder below its maximum speed.	-
A.8A6: External Encoder Overheated	An overheating error was detected in the external encoder.	-	Replace the external encoder.	-
A.b10: Speed Reference	A malfunction occurred in the speed reference input section.	_	Reset the alarm and restart operation.	page 12-41
A'D Error (Detected when the servo is turned ON.)	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.b11:	A malfunction occurred in the speed reference input section.	_	Reset the alarm and restart operation.	page 12-41
A.b11: Speed Reference A/D Data Error	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.b20: Torque Refer-	A malfunction occurred in the reading section for the torque reference input.	_	Reset the alarm and restart operation.	page 12-41
ence A/D Error (Detected when the servo is turned ON.)	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-

Continued from previous page.

Alarm Number: Continued from previous				
Alarm Name	Possible Cause	Confirmation	Correction	Reference
A.b33: Current Detection Error 3	A failure occurred in the current detection circuit.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.bC0: System Alarm 10	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.bF0: System Alarm 0	A failure occurred in the SERVOPACK.	-	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.bF1: System Alarm 1	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.bF2: System Alarm 2	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.bF3: System Alarm 3	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.bF4: System Alarm 4	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.bF5: System Alarm 5	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.bF6: System Alarm 6	A failure occurred in the SERVOPACK.	-	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.bF7: System Alarm 7	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-

Continued from previous page.

Alarm Number:	Possible Cause	Confirmation	Correction	Reference
A.bF8: System Alarm 8	A failure occurred in the SERVOPACK.	-	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
	The order of phases U, V, and W in the motor wiring is not correct.	Check the Servomotor wiring.	Make sure that the Servo- motor is correctly wired.	-
A C10:	There is an error in the setting of Pn080 = n.□□X□ (Motor Phase Sequence Selection).	Check the setting of Pn080 = n.□□X□.	Set Pn080 = n.□□X□ to an appropriate value.	page 5-24
A.C10: Servomotor Out of Control (Detected when the servo is turned ON.)	A failure occurred in the encoder.	_	If the motor wiring is correct and the alarm still occurs after turning the power supply OFF and ON again, the Servomotor or linear encoder may be faulty. Replace the Servomotor or linear encoder.	-
	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
	The linear encoder signal level is too low.	Check the voltage of the linear encoder signal.	Fine-tune the mounting of the scale head. Or, replace the linear encoder.	_
A.C20: Phase Detection Error	The count-up direction of the linear encoder does not match the forward direction of the Moving Coil in the motor.	Check the setting of Pn080 = n.□□X□ (Motor Phase Sequence Selection). Check the installation orientation for the linear encoder and Moving Coil.	Change the setting of Pn080 = n.□□X□. Correctly reinstall the linear encoder or Moving Coil.	page 5-24
	The polarity sensor signal is being affected by noise.	_	Correct the FG wiring. Implement countermea- sures against noise for the polarity sensor wiring.	-
	The setting of Pn282 (Linear Encoder Scale Pitch) is not correct.	Check the setting of Pn282 (Linear Encoder Scale Pitch).	Check the specifications of the linear encoder and set a correct value.	page 5-19
A.C21: Polarity Sensor Error	The polarity sensor is protruding from the Magnetic Way of the motor.	Check the polarity sensor.	Correctly reinstall the Moving Coil or Magnetic Way of the motor.	_
	The polarity sensor is not wired correctly. The polarity sensor failed.	Check the wiring of the polarity sensor.	Correct the wiring of the polarity sensor. Replace the polarity sensor.	-
A.C22: Phase Information Disagreement	The SERVOPACK phase information is different from the linear encoder phase information.	_	Perform polarity detection.	page 5-30

Continued from previous page.

Alarm Number:			Continued from pr	
Alarm Name	Possible Cause	Confirmation	Correction	Reference
	The parameter settings are not correct.	Check the linear encoder specifications and feedback signal status.	The settings of Pn282 (Linear Encoder Scale Pitch) and Pn080 = n.□□X□ (Motor Phase Sequence Selection) may not match the installation. Set the parameters to correct values.	page 5-19, page 5-24
	There is noise on the scale signal.	Check to make sure that the frame grounds of the Serial Converter Unit and Servomotor are connected to the FG terminal on the SER-VOPACK and that the FG terminal on the SER-VOPACK is connected to the frame ground on the power supply. And, confirm that the shield is properly processed on the Linear Encoder Cable. Check to see if the detection reference is repeatedly output in one direction.	Implement appropriate countermeasures against noise for the Linear Encoder Cable.	_
A.C50: Polarity Detection Failure	An external force was applied to the Moving Coil of the motor.	_	The polarity cannot be properly detected if the detection reference is 0 and the speed feedback is not 0 because of an external force, such as cable tension, applied to the Moving Coil. Implement measures to reduce the external force so that the speed feedback goes to 0. If the external force cannot be reduced, increase the setting of Pn481 (Polarity Detection Speed Loop Gain).	-
	The linear encoder resolution is too low.	Check the linear encoder scale pitch to see if it is within 100 µm.	If the linear encoder scale pitch is $100~\mu m$ or higher, the SERVOPACK cannot detect the correct speed feedback. Use a linear encoder scale pitch with higher resolution. (We recommend a pitch of $40~\mu m$ or less.) Or, increase the setting of Pn485 (Polarity Detection Reference Speed). However, increasing the setting of Pn485 will increase the Servomotor movement range that is required for polarity detection.	-

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
A.C51: Overtravel Detected during Polarity Detection	The overtravel signal was detected during polarity detection.	Check the overtravel position.	Wire the overtravel signals. Execute polarity detection at a position where an overtravel signal would not be detected.	page 4-39
A.C52: Polarity Detection Not Completed	The servo was turned ON under the following circumstances. • Before polarity detection was completed • Before /P-DET was input	_	Input the /P-DET signal.	page 5-29
A.C53: Out of Range of Motion for Polar- ity Detection	The travel distance exceeded the setting of Pn48E (Polarity Detection Range) in the middle of detection.	_	Increase the setting of Pn48E (Polarity Detection Range). Or, increase the setting of Pn481 (Polarity Detection Speed Loop Gain).	-
A.C54: Polarity Detection Failure 2	An external force was applied to the Servomotor.	_	Increase the setting of Pn495 (Polarity Detection Confirmation Force Reference). Increase the setting of Pn498 (Polarity Detection Allowable Error Range). Increasing the allowable error will also increase the motor temperature.	_
A.C80: Encoder Clear Error or Multiturn	A failure occurred in the encoder.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the Servomotor or linear encoder may be faulty. Replace the Servomotor or linear encoder.	_
Limit Setting Error	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	_

Continued from previous page.

Alarm Number:	Possible Course	Confirmation	Correction	1 0
Alarm Name	Possible Cause	Confirmation	Correction	Reference
	There is a faulty contact in the connector or the connector is not wired correctly for the encoder.	Check the condition of the encoder connector.	Reconnect the encoder connector and check the encoder wiring.	page 4-25
	There is a cable disconnection or short-circuit in the encoder. Or, the cable impedance is outside the specified values.	Check the condition of the Encoder Cable.	Use the Encoder Cable within the specifications.	-
A.C90: Encoder Commu-	One of the following has occurred: corrosion caused by improper temperature, humidity, or gas, a short-circuit caused by entry of water drops or cutting oil, or faulty contact in connector caused by vibration.	Check the operating environment.	Improve the operating environment, and replace the cable. If the alarm still occurs, replace the SER-VOPACK.	page 3-2
nications Error	A malfunction was caused by noise.	_	Correct the wiring around the encoder by separating the Encoder Cable from the Servomotor Main Circuit Cable or by grounding the encoder.	page 4-5
	A failure occurred in the SERVOPACK.	_	Connect the Servomotor to another SERVOPACK, and turn ON the control power supply. If no alarm occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
	A failure occurred in the encoder.	_	Connect the Servomotor to another SERVOPACK, and turn ON the control power supply. If the alarm occurs, the Servomotor may be faulty. Replace the Servomotor.	-
	Noise entered on the signal lines because the Encoder Cable is bent or the sheath is damaged.	Check the condition of the Encoder Cable and connectors.	Check the Encoder Cable to see if it is installed correctly.	page 4-8
A.C91: Encoder Communications Position Data Acceleration Rate Error	The Encoder Cable is bundled with a high- current line or installed near a high- current line.	Check the installation condition of the Encoder Cable.	Confirm that there is no surge voltage on the Encoder Cable.	-
	There is variation in the FG potential because of the influ- ence of machines on the Servomotor side, such as a welder.	Check the installation condition of the Encoder Cable.	Properly ground the machine to separate it from the FG of the encoder.	-

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
	Noise entered on the signal line from the encoder.	_	Implement countermeasures against noise for the encoder wiring.	page 4-5
	Excessive vibration or shock was applied to the encoder.	Check the operating conditions.	Reduce machine vibration. Correctly install the Servomotor or linear encoder.	-
A.C92: Encoder Communications Timer Error	A failure occurred in the encoder.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the Servomotor or linear encoder may be faulty. Replace the Servo- motor or linear encoder.	-
	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.CA0: Encoder Parame-	A failure occurred in the encoder.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the Servomotor or linear encoder may be faulty. Replace the Servo- motor or linear encoder.	-
ter Error	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-

Continued from previous page.

Continued from previous page.				
Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
	The encoder is wired incorrectly or there is faulty contact.	Check the wiring of the encoder.	Make sure that the encoder is correctly wired.	page 4-25
	The specifications of the Encoder Cable are not correct and noise entered on it.	_	Use a shielded twisted- pair wire cable or a screened twisted-pair cable with conductors of at least 0.12 mm ² .	-
	The Encoder Cable is too long and noise entered on it.	_	Rotary Servomotors: The Encoder Cable wiring distance must be 50 m max. Linear Servomotors: The Encoder Cable wiring distance must be 20 m max.	-
A.Cb0: Encoder Echo- back Error	There is variation in the FG potential because of the influ- ence of machines on the Servomotor side, such as a welder.	Check the condition of the Encoder Cable and connectors.	Properly ground the machine to separate it from the FG of the encoder.	-
	Excessive vibration or shock was applied to the encoder.	Check the operating conditions.	Reduce machine vibration. Correctly install the Servomotor or linear encoder.	-
	A failure occurred in the encoder.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the Servomotor or linear encoder may be faulty. Replace the Servo- motor or linear encoder.	-
	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
	When using a Direct Drive Servomotor, the setting of Pn205 (Mul- titurn Limit) does not agree with the encoder.	Check the setting of Pn205.	Correct the setting of Pn205 (0 to 65,535).	page 6-85
A.CC0: Multiturn Limit Disagreement	The multiturn limit of the encoder is different from that of the SERVOPACK. Or, the multiturn limit of the SERVOPACK has been changed.	Check the setting of Pn205 in the SERVO-PACK.	Change the setting if the alarm occurs.	page 6-85
	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-

Continued from previous page.

Alarm Number:	Continued from previous page.			
Alarm Name	Possible Cause	Confirmation	Correction	Reference
	The cable between the Serial Converter Unit and SERVOPACK is not wired correctly or there is a faulty contact.	Check the wiring of the external encoder.	Correctly wire the cable between the Serial Converter Unit and SERVO-PACK.	page 4-27
A.CF1: Reception Failed Error in Feed-	A specified cable is not being used between Serial Con- verter Unit and SER- VOPACK.	Check the wiring specifications of the external encoder.	Use a specified cable.	-
back Option Module Commu- nications	The cable between the Serial Converter Unit and SERVOPACK is too long.	Measure the length of the cable that connects the Serial Converter Unit.	The length of the cable between the Serial Converter Unit and SERVO-PACK must be 20 m or less.	-
	The sheath on cable between the Serial Converter Unit and SERVOPACK is broken.	Check the cable that connects the Serial Converter Unit.	Replace the cable between the Serial Converter Unit and SERVO-PACK.	-
A.CF2: Timer Stopped Error in Feed-	Noise entered the cable between the Serial Converter Unit and SERVOPACK.	_	Correct the wiring around the Serial Converter Unit, e.g., separate I/O signal lines from the Main Circuit Cables or ground.	-
back Option Module Communications	A failure occurred in the Serial Converter Unit.	_	Replace the Serial Converter Unit.	-
	A failure occurred in the SERVOPACK.	_	Replace the SERVO- PACK.	
	The Servomotor U, V, and W wiring is not correct.	Check the wiring of the Servomotor's Main Circuit Cables.	Make sure that there are no faulty contacts in the wiring for the Servomotor and encoder.	-
A.d00:	The frequency of the position reference pulse is too high.	Reduce the reference pulse frequency and try operating the SERVO- PACK.	Reduce the position reference pulse frequency or the reference acceleration rate, or reconsider the electronic gear ratio.	page 5-47
Position Deviation Overflow (The setting of Pn520 (Position Deviation Over- flow Alarm Level)	The acceleration of the position reference is too high.	Reduce the reference acceleration and try operating the SERVO- PACK.	Apply smoothing, i.e., by using Pn216 (Position Reference Acceleration/ Deceleration Time Constant).	page 6-35
was exceeded by the position devi- ation.)	The setting of Pn520 (Position Deviation Overflow Alarm Level) is too low for the operating conditions.	Check Pn520 (Position Deviation Overflow Alarm Level) to see if it is set to an appropriate value.	Optimize the setting of Pn520.	page 8-8
	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-

Continued from previous page.

Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
A.d01: Position Deviation Overflow Alarm at Servo ON	The servo was turned ON after the position deviation exceeded the setting of Pn526 (Position Deviation Overflow Alarm Level at Servo ON) while the servo was OFF.	Check the position deviation while the servo is OFF.	Set the position deviation to be cleared while the servo is OFF. Optimize the setting of Pn526 (Position Deviation Overflow Alarm Level at Servo ON).	
A.d02: Position Deviation Overflow Alarm for Speed Limit at Servo ON	If position deviation remains in the deviation counter, the setting of Pn529 or Pn584 (Speed Limit Level at Servo ON) limits the speed when the servo is turned ON. This alarm occurs if reference pulses are input and the setting of Pn520 (Position Deviation Overflow Alarm Level) is exceeded.	_	Set the position deviation to be cleared while the servo is OFF. Optimize the setting of Pn520 (Position Deviation Overflow Alarm Level). Or, adjust the setting of Pn529 or Pn584 (Speed Limit Level at Servo ON).	page 8-8
A.d10: Motor-Load Position Deviation	The motor direction and external encoder installation orientation are backward.	Check the motor direction and the external encoder installation orientation.	Install the external encoder in the opposite direction, or change the setting of Pn002 = n.X□□□ (External Encoder Usage) to reverse the direction.	page 10-6
Overflow	There is an error in the connection between the load (e.g., stage) and external encoder coupling.	Check the coupling of the external encoder.	Check the mechanical coupling.	-
A.d30: Position Data Overflow	The position data exceeded ±1,879,048,192.	Check the input reference pulse counter.	Reconsider the operating specifications.	-
	There is a faulty connection between the SERVOPACK and the Safety Option Module.	Check the connection between the SERVO- PACK and the Safety Option Module.	Correctly connect the Safety Option Module.	-
A.E71: Safety Option Module Detec- tion Failure	The Safety Option Module was discon- nected.	_	Execute Fn014 (Reset Option Module Configuration Error) from the Digital Operator or SigmaWin+ and then turn the power supply to the SERVO-PACK OFF and ON again.	page 12-44
	A failure occurred in the Safety Option Module.	_	Replace the Safety Option Module.	-
	A failure occurred in the SERVOPACK.	-	Replace the SERVO- PACK.	_

Continued from previous page.

Alarm Number:	Possible Cause	Confirmation	Correction	Reference
Alarm Name	There is a faulty con- nection between the SERVOPACK and the Feedback Option Module.	Check the connection between the SERVO- PACK and the Feed- back Option Module.	Correctly connect the Feedback Option Module.	-
A.E72: Feedback Option Module Detec- tion Failure	The Feedback Option Module was discon- nected.	_	Reset the Option Module configuration error and turn the power supply to the SERVOPACK OFF and ON again.	page 12-44
	A failure occurred in the Feedback Option Module.	-	Replace the Feedback Option Module.	-
	A failure occurred in the SERVOPACK.	-	Replace the SERVO-PACK.	-
A.E74: Unsupported	A failure occurred in the Safety Option Module.	-	Replace the Safety Option Module.	-
Safety Option Module	An unsupported Safety Option Module was connected.	Refer to the catalog of the connected Safety Option Module.	Connect a compatible Safety Option Module.	-
A.Eb1: Safety Function Signal Input Tim- ing Error	The delay between activation of the /HWBB1 and /HWBB2 input signals for the HWBB was ten second or longer.	Measure the time delay between the /HWBB1 and /HWBB2 signals.	The output signal circuits or devices for /HWBB1 and /HWBB2 or the SER-VOPACK input signal circuits may be faulty. Alternatively, the input signal cables may be disconnected. Check to see if any of these items are faulty or have been disconnected.	-
	A failure occurred in the SERVOPACK.	-	Replace the SERVO- PACK.	-
A.EC8: Gate Drive Error 1 (An error occurred in the gate drive circuit.) A.EC9: Gate Drive Error 2 (An error occurred in the gate drive circuit.)	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	_

Continued from previous page.

A1 N1 1			Continued from pro	evious page.
Alarm Number: Alarm Name	Possible Cause	Confirmation	Correction	Reference
	The three-phase power supply wiring is not correct.	Check the power supply wiring.	Make sure that the power supply is correctly wired.	page 4-11
A.F10: Power Supply Line Open Phase	The three-phase power supply is unbalanced.	Measure the voltage for each phase of the three-phase power supply.	Balance the power supply by changing phases.	-
(The voltage was low for more than one second for phase R, S, or T when the main power supply	A single-phase power supply was input without specifying a single-phase AC power supply input (Pn00B = n.□1□□).	Check the power supply and the parameter setting.	Match the parameter setting to the power supply.	page 4-11
was ON.)	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
FL-1*5: System Alarm FL-2*5: System Alarm FL-3*5: System Alarm FL-4*5: System Alarm FL-5*5: System Alarm FL-6*5: System Alarm FL-6*5: System Alarm FL-7*5: System Alarm	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	_
CPF00: Digital Operator Communications	There is a faulty connection between the Digital Operator and the SERVOPACK.	Check the connector contact.	Disconnect the connector and insert it again. Or, replace the cable.	-
Error 1	A malfunction was caused by noise.	_	Keep the Digital Operator or the cable away from sources of noise.	-
CPF01: Digital Operator	A failure occurred in the Digital Operator.	_	Disconnect the Digital Operator and then con- nect it again. If the alarm still occurs, the Digital Operator may be faulty. Replace the Digital Oper- ator.	-
Communications Error 2	A failure occurred in the SERVOPACK.	_	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-

^{*1.} Detection Conditions
• Rotary Servomotor

If either of the following conditions is detected, an alarm will occur.

• Pn533 [min⁻¹]
$$\times$$
 Encoder resolution 6×10^5 \leq Pn210

• Maximum motor speed
$$[min^{-1}] \times \frac{Encoder resolution}{Approx. 3.66 \times 10^{12}} \ge \frac{Pn20E}{Pn210}$$

Rotary Servomotor
 If either of the following conditions is detected.

• Linear Servomotor
If either of the following conditions is detected, an alarm will occur.

- *2. Detection Conditions
 - · Rotary Servomotor

If either of the following conditions is detected, an alarm will occur.

• Rated motor speed [min⁻¹]
$$\times$$
 1/3 \times $\frac{\text{Encoder resolution}}{6 \times 10^5} \le \frac{\text{Pn20E}}{\text{Pn210}}$

• Maximum motor speed [min⁻¹]
$$\times \frac{\text{Encoder resolution}}{\text{Approx. } 3.66 \times 10^{12}} \ge \frac{\text{Pn20E}}{\text{Pn210}}$$

Linear Servomotor

If either of the following conditions is detected, an alarm will occur.

- *3. Refer to the following manual for details.
 - Σ-7-Series Peripheral Device Selection Manual (Manual No.: SIEP S800001 32)
- *4. The SERVOPACK will fail if the External Regenerative Resistor or Regenerative Resistor Unit is connected while the jumper is connected between the B2 and B3 terminals.
- *5. These alarms are not stored in the alarm history. They are only displayed on the panel display.

12.2.3 Resetting Alarms

If there is an ALM (Servo Alarm) signal, use one of the following methods to reset the alarm after eliminating the cause of the alarm.

The /ALM-RST (Alarm Reset) signal will not always reset encoder-related alarms. If you cannot reset an alarm with the /ALM-RST signal, turn OFF the control power supply to reset it.



Be sure to eliminate the cause of an alarm before you reset the alarm.

If you reset the alarm and continue operation without eliminating the cause of the alarm, it may result in damage to the equipment or fire.

Resetting Alarms with the /ALM-RST (Alarm Reset Input) Signal

Type	Signal	Connector Pin No.	Name
Input	/ALM-RST	CN1-44	Alarm Reset

Note: Use Pn50B = n. \$\sigma X \sigma \text{(/ALM-RST (Alarm Reset) Signal Allocation)}\$ to allocate the /ALM-RST signal to other connector pins. Refer to the following section for details.

6.1.1 Input Signal Allocations on page 6-5


Resetting Alarms with the SigmaWin+

Use the following procedure to reset alarms with the SigmaWin+.

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- 2. Select Display Alarm in the Menu Dialog Box. The Alarm Display Dialog Box will be displayed.

12.2.4 Displaying the Alarm History

3. Click the Reset axes Button.

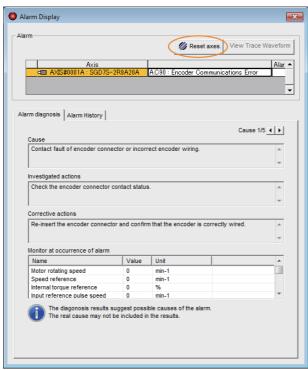

The alarm will be reset, and the alarm display will be cleared.

This concludes the procedure to reset alarms.

Resetting Alarms Using the Panel Operator

Simultaneously press the **UP** and the **DOWN** Keys on the Panel Operator.

Resetting Alarms Using the Digital Operator

Press the **ALARM RESET** Key on the Digital Operator. Refer to the following manual for details on resetting alarms.

 \square Σ -7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)

12.2.4 Displaying the Alarm History

The alarm history displays up to the last ten alarms that have occurred in the SERVOPACK.

Preparations

No preparations are required.

Applicable Tools

The following table lists the tools that you can use to display the alarm history.


Tool	Fn No./Function Name	Reference
Panel Operator	Fn000	13.4.1 Display Alarm History (Fn000) on page 13-12
Digital Operator	Fn000	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Troubleshooting - Display Alarm	Operating Procedure on page 12-43

Operating Procedure

Use the following procedure to display the alarm history.

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Display Alarm in the Menu Dialog Box. The Alarm Display Dialog Box will be displayed.
- 3. Click the Alarm History Tab.

The following display will appear and you can check the alarms that occurred in the past.

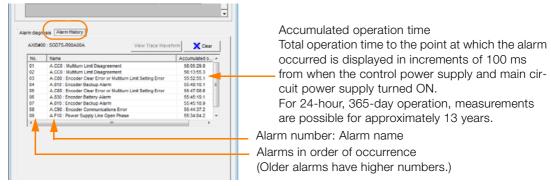

Information

- 1. If the same alarm occurs consecutively within one hour, it is not saved in the alarm history. If it occurs after an hour or more, it is saved.
- 2. You can clear the alarm history by clicking the **Clear** Button. The alarm history is not cleared when alarms are reset or when the SERVOPACK main circuit power is turned OFF.

This concludes the procedure to display the alarm history.

12.2.5 Clearing the Alarm History

You can clear the alarm history that is recorded in the SERVOPACK.

The alarm history is not cleared when alarms are reset or when the SERVOPACK main circuit power is turned OFF. You must perform the following procedure.

Preparations

Always check the following before you clear the alarm history.

• The parameters must not be write prohibited.

Applicable Tools

The following table lists the tools that you can use to clear the alarm history.

Tool	Fn No./Function Name	Reference
Panel Operator	Fn006	13.4.6 Clear Alarm History (Fn006) on page 13-16
Digital Operator	Fn006	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Troubleshooting - Display Alarm	Operating Procedure on page 12-44

12.2.6 Resetting Alarms Detected in Option Modules

Operating Procedure

Use the following procedure to reset the alarm history.

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Display Alarm in the Menu Dialog Box. The Alarm Display Dialog Box will be displayed.
- 3. Click the Alarm History Tab.
- **4.** Click the Clear Button. The alarm history will be cleared.

This concludes the procedure to reset the alarm history.

12.2.6 Resetting Alarms Detected in Option Modules

If any Option Modules are attached to the SERVOPACK, the SERVOPACK detects the presence and models of the connected Option Modules. If it finds any errors, it outputs alarms. You can delete those alarms with this operation.



- This operation is the only way to reset alarms for Option Modules. The alarms are not reset when you reset other alarms or when you turn OFF the power supply to the SERVOPACK.
- Always remove the cause of an alarm before you reset the alarm.

Preparations

Always check the following before you clear an alarm detected in an Option Module.

• The parameters must not be write prohibited.


Applicable Tools

The following table lists the tools that you can use to reset Option Module configuration errors.

Tool	Fn No./Function Name	Reference
Panel Operator	Fn014	13.4.19 Reset Option Module Configuration Error (Fn014) on page 13-27
Digital Operator	Fn014	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Troubleshooting - Display Alarm	© Operating Procedure on page 12-45


Use the following procedure to reset alarms detected in Option Modules.

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Display Alarm in the Menu Dialog Box. The Display Alarm Dialog Box will be displayed.
- 3. Click the Reset axes Button.

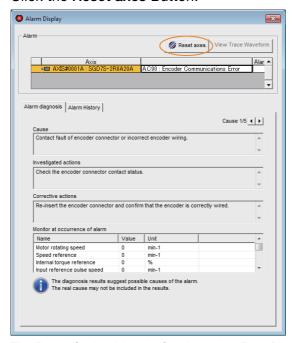

The Reset Option Module Configuration Error Dialog Box will be displayed.

4. Select the Clear Check Box for the Option Module for which to reset the alarm and then click the Execute Button.

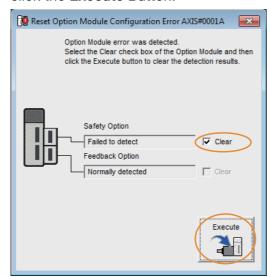

12-45

12.2.7 Resetting Motor Type Alarms

5. Read the precaution and then click the **OK** Button.



6. Read the precaution and then click the OK Button.



7. Turn the power supply to the SERVOPACK OFF and ON again.

This concludes the procedure to reset alarms detected in Option Modules.

12.2.7 Resetting Motor Type Alarms

The SERVOPACK automatically determines the type of Servomotor that is connected to it. If the type of Servomotor that is connected is changed, an A.070 alarm (Motor Type Change Detected) will occur the next time the SERVOPACK is started. If an A.070 alarm occurs, you must set the parameters to match the new type of Servomotor.

An A.070 alarm is reset by executing the Reset Motor Type Alarm utility function.



- This utility function is the only way to reset an A.070 alarm (Motor Type Change Detected).
 The errors are not reset when you reset alarms or turn OFF the power supply to the
 SERVOPACK.
- 2. If an A.070 alarm occurs, first set the parameters according to the newly connected Servomotor type and then execute the Reset Motor Type Alarm utility function.

Preparations

Always check the following before you reset a motor type alarm.

The parameters must not be write prohibited.

Applicable Tools


The following table lists the tools that you can use to clear the motor type alarm.

Tool	Fn No./Function Name	Reference
Panel Operator	Fn021	13.4.24 Resetting Motor Type Alarms (Fn021) on page 13-29
Digital Operator	Fn021	Σ-7-Series Digital Operator Operating Manual (Manual No.: SIEP S800001 33)
SigmaWin+	Troubleshooting - Reset Motor Type Alarm	© Operating Procedure on page 12-47


Operating Procedure

Use the following procedure to reset Motor Type alarm.

- 1. Click the Servo Drive Button in the workspace of the Main Window of the SigmaWin+.
- **2.** Select Reset Motor Type Alarm in the Menu Dialog Box. The Reset Motor Type Alarm Dialog Box will be displayed.
- 3. Click the Reset Button.

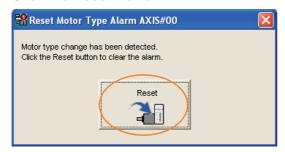

4. Read the precaution and then click the OK Button.

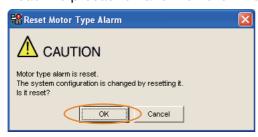

5. Read the precaution and then click the OK Button.



6. Turn the power supply to the SERVOPACK OFF and ON again.

This concludes the procedure to reset Motor Type alarms.

12.3

Warning Displays

If a warning occurs in the SERVOPACK, a warning number will be displayed on the panel display. Warnings are displayed to warn you before an alarm occurs.

This section provides a list of warnings and the causes of and corrections for warnings.

12.3.1 List of Warnings

The list of warnings gives the warning name, warning meaning, and warning code output in order of the warning numbers.

Warning	Warning Name	Meaning		Warning Co Output	
Number		Ğ	ALO1	ALO2	ALO3
A.900	Position Deviation Overflow	The position deviation exceeded the percentage set with the following formula: (Pn520 × Pn51E/100)	Н	Н	Н
A.901	Position Deviation Overflow Alarm at Servo ON	The position deviation when the servo was turned ON exceeded the percentage set with the following formula: (Pn526 × Pn528/100)	Н	Н	Н
A.910	Overload	This warning occurs before an overload alarm (A.710 or A.720) occurs. If the warning is ignored and operation is continued, an alarm may occur.	L	Н	Н
A.911	Vibration	Abnormal vibration was detected during motor operation. The detection level is the same as A.520. Set whether to output an alarm or a warning by setting Pn310 (Vibration Detection Selection).	L	Н	Н
A.912	Internal Temperature Warning 1 (Control Board Temperature Error)	The surrounding air temperature of the control PCB is abnormal.	Н	L	Н
A.913	Internal Temperature Warning 2 (Power Board Temperature Error)	The surrounding air temperature of the power PCB is abnormal.	Н	L	Н
A.920	Regenerative Overload	This warning occurs before an A.320 alarm (Regenerative Overload) occurs. If the warning is ignored and operation is continued, an alarm may occur.	Н	L	Н
A.921	Dynamic Brake Over- load	This warning occurs before an A.731 alarm (Dynamic Brake Overload) occurs. If the warning is ignored and operation is continued, an alarm may occur.	Н	L	Н
A.923	SERVOPACK Built-in Fan Stopped	The fan inside the SERVOPACK stopped.	Н	L	Н
A.930	Absolute Encoder Battery Error	This warning occurs when the voltage of absolute encoder's battery is low.	L	L	Н
A.93B	Overheat Warning	The input voltage (temperature) for the overheat protection input (TH) signal exceeded the setting of Pn61C (Overheat Warning Level).	L	L	Н
A.941	Change of Parameters Requires Restart	Parameters have been changed that require the power supply to be turned OFF and ON again.	Н	Н	L
A.942	Speed Ripple Compensation Information Disagreement	The speed ripple compensation information stored in the encoder does not agree with the speed ripple compensation information stored in the SER-VOPACK.	H	Н	L

Continued from previous page.

Warning Number	Warning Name	Meaning		Warning Code aning Output	
Number				ALO2	ALO3
A.971	Undervoltage	This warning occurs before an A.410 alarm (Undervoltage) occurs. If the warning is ignored and operation is continued, an alarm may occur.	L	L	L
A.9A0	Overtravel	Overtravel was detected while the servo was ON.	Η	L	L
A.9b0	Preventative Mainte- nance Warning	One of the consumable parts has reached the end of its service life.	Н	L	Н

- Note: 1. A warning code is not output unless you set Pn001 to n.1 \(\sigma\) (Output both alarm codes and warning codes).
 - Use Pn008 = n.□X□□ (Warning Detection Selection) to control warning detection.
 However, the following warnings are not affected by the setting of Pn008 = n.□X□□ and other parameter settings are required in addition to Pn008 = n.□X□□.

Warning	Parameters That Must Be Set to Select Warning Detection	Reference
A.911	Pn310 = n.□□□X (Vibration Detection Selection)	page 6-99
A.923	_ (Not affected by the setting of Pn008 = n.□X□□.)	_
A.930	Pn008 = n.□□□X (Low Battery Voltage Alarm/Warning Selection)	page 12-3
A.942	Pn423 = n.□□X□ (Speed Ripple Compensation Information Disagreement Warning Detection Selection)	page 8-60
A.971	Pn008 = n.□□X□ (Function Selection for Undervoltage) (Not affected by the setting of Pn008 = n.□X□□.)	page 6-14
A.9A0	Pn00D = n.X□□□ (Overtravel Warning Detection Selection) (Not affected by the setting of Pn008 = n.□X□□.)	page 5-34
A.9b0	Pn00F = n.□□□X (Preventative Maintenance Warning Selection)	page 9-17

12.3.2 Troubleshooting Warnings

The causes of and corrections for the warnings are given in the following table. Contact your Yaskawa representative if you cannot solve a problem with the correction given in the table.

Warning Number: Warning Name	Possible Cause	Confirmation	Correction	Reference
	The Servomotor U, V, and W wiring is not correct.	Check the wiring of the Servomotor's Main Circuit Cables.	Make sure that there are no faulty connections in the wiring for the Servomotor and encoder.	-
	A SERVOPACK gain is too low.	Check the SERVO- PACK gains.	Increase the servo gain, e.g., by using autotuning without a host reference.	page 8-24
	The frequency of the position reference pulse is too high.	Reduce the reference pulse frequency and try operating the SERVO- PACK.	Reduce the position reference pulse frequency or the reference acceleration rate, or reconsider the electronic gear ratio.	page 5-47
A.900: Position Deviation Overflow	The acceleration of the position reference is too high.	Reduce the reference acceleration and try operating the SERVO-PACK.	Apply smoothing, i.e., by using Pn216 (Position Reference Acceleration/ Deceleration Time Constant).	page 6-30
	The excessive position deviation alarm level (Pn520 × Pn51E/100) is too low for the operating conditions.	Check excessive position deviation alarm level (Pn520 × Pn51E/100) to see if it is set to an appropriate value.	Optimize the settings of Pn520 and Pn51E.	page 8-8
	A failure occurred in the SERVO-PACK.	-	Turn the power supply to the SERVOPACK OFF and ON again. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.901: Position Deviation Overflow Alarm at Servo ON	The position deviation when the servo was turned ON exceeded the percentage set with the following formula: (Pn526 × Pn528/100)	_	Set the position deviation to be cleared while the servo is OFF. Optimize the setting of Pn528 (Position Deviation Overflow Warning Level at Servo ON).	page 8-10

10

			Continued from pre	vious page.
Warning Number: Warning Name	Possible Cause	Confirmation	Correction	Reference
	The wiring is not correct or there is a faulty connection in the motor or encoder wiring.	Check the wiring.	Make sure that the Servo- motor and encoder are cor- rectly wired.	-
	Operation was performed that exceeded the overload protection characteristics.	Check the motor over- load characteristics and Run command.	Reconsider the load and operating conditions. Or, increase the motor capacity.	-
A.910: Overload (warning before an A.710 or A.720 alarm occurs)	An excessive load was applied during operation because the Servomotor was not driven because of mechanical problems.	Check the operation reference and motor speed.	Remove the mechanical problem.	-
	The overload warning level (Pn52B) is not suitable.	Check that the overload warning level (Pn52B) is suitable.	Set a suitable overload warning level (Pn52B).	page 5-44
	A failure occurred in the SERVO-PACK.	_	The SERVOPACK may be faulty. Replace the SERVO-PACK.	-
	Abnormal vibration was detected during motor operation.	Check for abnormal motor noise, and check the speed and torque waveforms during operation.	Reduce the motor speed. Or, reduce the servo gain with custom tuning.	page 8-42
A.911: Vibration	The setting of Pn103 (Moment of Inertia Ratio) is greater than the actual moment of inertia or was greatly changed.	Check the moment of inertia ratio or mass ratio.	Set Pn103 (Moment of Inertia Ratio) to an appropriate value.	page 8-16
	The vibration detection level (Pn312 or Pn384) is not suitable.	Check that the vibration detection level (Pn312 or Pn384) is suitable.	Set a suitable vibration detection level (Pn312 or Pn384).	page 6-99

12.3.2 Troubleshooting Warnings

Continued from previous page.

Warning Number: Warning Name	Possible Cause	Confirmation	Correction Correction	Reference
	The surrounding temperature is too high.	Check the surrounding temperature using a thermometer. Or, check the operating status with the SERVOPACK installation environment monitor.	Decrease the surrounding temperature by improving the SERVOPACK installation conditions.	page 3-7
	An overload alarm was reset by turning OFF the power supply too many times.	Check the alarm display to see if there is an overload alarm.	Change the method for resetting the alarm.	-
A.912: Internal Tempera- ture Warning 1 (Control Board Tem- perature Error)	There was an excessive load or operation was performed that exceeded the regenerative processing capacity.	Use the accumulated load ratio to check the load during operation, and use the regenerative load ratio to check the regenerative processing capacity.	Reconsider the load and operating conditions.	-
	The SERVOPACK installation orientation is not correct or there is insufficient space around the SERVOPACK.	Check the SERVO- PACK installation con- ditions.	Install the SERVOPACK according to specifications.	page 3-3, page 3-6
	A failure occurred in the SERVO-PACK.	_	The SERVOPACK may be faulty. Replace the SERVO-PACK.	_
	The surrounding temperature is too high.	Check the surrounding temperature using a thermometer. Or, check the operating status with the SERVOPACK installation environment monitor.	Decrease the surrounding temperature by improving the SERVOPACK installation conditions.	page 3-7
	An overload alarm was reset by turning OFF the power supply too many times.	Check the alarm display to see if there is an overload alarm.	Change the method for resetting the alarm.	-
A.913: Internal Tempera- ture Warning 2 (Power Board Tem- perature Error)	There was an excessive load or operation was performed that exceeded the regenerative processing capacity.	Use the accumulated load ratio to check the load during operation, and use the regenerative load ratio to check the regenerative processing capacity.	Reconsider the load and operating conditions.	-
	The SERVOPACK installation orientation is not correct or there is insufficient space around the SERVOPACK.	Check the SERVO- PACK installation con- ditions.	Install the SERVOPACK according to specifications.	page 3-3, page 3-6
	A failure occurred in the SERVO-PACK.	_	The SERVOPACK may be faulty. Replace the SERVO-PACK.	_

Continued from previous page.

Warning Number: Warning Name	Possible Cause	Confirmation	Correction	Reference
	The power supply voltage exceeded the specified range.	Measure the power supply voltage.	Set the power supply voltage within the specified range.	-
A.920: Regenerative Overload (warning before an A.320 alarm occurs)	There is insufficient external regenerative resistance, regenerative resistor capacity, or SERVOPACK capacity, or there has been a continuous regeneration state.	Check the operating conditions or the capacity using the SigmaJunmaSize+ Capacity Selection Software or another means.	Change the regenerative resistance value, regenerative resistance capacity, or SERVOPACK capacity. Reconsider the operating conditions using the Sigma-JunmaSize+ Capacity Selection Software or other means.	-
	There was a continuous regeneration state because a negative load was continuously applied.	Check the load applied to the Servomotor during operation.	Reconsider the system including the servo, machine, and operating conditions.	-
	The Servomotor was rotated by an external force.	Check the operation status.	Implement measures to ensure that the motor will not be rotated by an external force.	-
A.921: Dynamic Brake Overload (warning before an A.731 alarm occurs)	When the Servo- motor was stopped with the dynamic brake, the rotational or linear kinetic energy exceeded the capacity of the dynamic brake resistor.	Check the power consumed by the DB resistor to see how frequently the DB is being used.	Reconsider the following: Reduce the Servomotor command speed. Decrease the moment of inertia or mass. Reduce the frequency of stopping with the dynamic brake.	-
	A failure occurred in the SERVO-PACK.	_	The SERVOPACK may be faulty. Replace the SERVO-PACK.	_
A.923: SERVOPACK Built- in Fan Stopped	The fan inside the SERVOPACK stopped.	Check for foreign matter inside the SERVO-PACK.	Remove foreign matter from the SERVOPACK. If the alarm still occurs, the SERVOPACK may be faulty. Replace the SERVOPACK.	-
A.930: Absolute Encoder Battery Error (The absolute encoder battery voltage was lower than the spec- ified level.) (Detected only when an abso-	The battery connection is faulty or a battery is not connected.	Check the battery connection.	Correct the battery connection.	page 4-26
	The battery voltage is lower than the specified value (2.7 V).	Measure the battery voltage.	Replace the battery.	page 12-3
lute encoder is connected.)	A failure occurred in the SERVO-PACK.	_	The SERVOPACK may be faulty. Replace the SERVO-PACK.	-

12.3.2 Troubleshooting Warnings

Continued from previous page.

Marning Nivesham			Continued from pre	vious page.
Warning Number: Warning Name	Possible Cause	Confirmation	Correction	Reference
	The surrounding temperature is too high.	Check the surrounding temperature using a thermometer.	Lower the surrounding temperature by improving the installation conditions of the Linear Servomotor or the machine.	-
	Operation was performed under an excessive load.	Use the accumulated load ratio to check the load during operation.	Reconsider the load and operating conditions.	-
A.93B: Overheat Warning	A failure occurred in the SERVO-PACK.	_	The SERVOPACK may be faulty. Replace the SERVO-PACK.	_
	The temperature detection circuit in the Linear Servomotor is faulty or the sensor attached to the machine is faulty.	_	The temperature detection circuit in the Linear Servomotor may be faulty or the sensor attached to the machine may be faulty. Replace the Linear Servomotor or repair the sensor attached to the machine.	-
A.941: Change of Parameters Requires Restart	Parameters have been changed that require the power supply to be turned OFF and ON again.	_	Turn the power supply to the SERVOPACK OFF and ON again.	-
	The speed ripple	_	Reset the speed ripple compensation value on the SigmaWin+.	page 8-60
A.942: Speed Ripple Compensation Information Disagreement	compensation information stored in the encoder does not agree with the speed ripple compensa-	_	Set Pn423 to n. □□1□ (Do not detect A.942 alarms). However, changing the setting may increase the speed ripple.	page 8-60
tion Disagreement	tion information stored in the SERVOPACK.	_	Set Pn423 to n. \(\sum \sup 0\) (Disable speed ripple compensation). However, changing the setting may increase the speed ripple.	page 8-60
	For a 200-V SERVOPACK, the AC power supply voltage dropped below 140 V.	Measure the power supply voltage.	Set the power supply voltage within the specified range.	-
	For a 100-V SERVOPACK, the AC power supply voltage dropped below 60 V.	Measure the power supply voltage.	Set the power supply voltage within the specified range.	-
A.971: Undervoltage	The power supply voltage dropped during operation.	Measure the power supply voltage.	Increase the power supply capacity.	-
	A momentary power interruption occurred.	Measure the power supply voltage.	If you have changed the setting of Pn509 (Momentary Power Interruption Hold Time), decrease the setting.	page 6-13
	The SERVOPACK fuse is blown out.	_	Replace the SERVOPACK and connect a reactor.	page 4-24
	A failure occurred in the SERVO-PACK.	-	The SERVOPACK may be faulty. Replace the SERVO-PACK.	-

Continued from previous page.

Warning Number: Warning Name	Possible Cause	Confirmation	Correction	Reference
A.9A0: Overtravel (Overtravel status was detected.)	Overtravel was detected while the servo was ON.	Check the status of the overtravel signals on the input signal monitor.	Even if an overtravel signal is not shown by the input signal monitor, momentary overtravel may have been detected. Take the following precautions. • Do not specify movements that would cause overtravel from the host controller. • Check the wiring of the overtravel signals. • Implement countermeasures against noise.	page 5-34
A.9b0: Preventative Mainte- nance Warning	One of the consumable parts has reached the end of its service life.	_	Replace the part. Contact your Yaskawa representative for replacement.	page 9-17

12.4

Troubleshooting Based on the Operation and Conditions of the Servomotor

This section provides troubleshooting based on the operation and conditions of the Servomotor, including causes and corrections.

Problem	Possible Cause	Confirmation	Correction	Reference
	The control power supply is not turned ON.	Measure the voltage between control power supply terminals.	Turn OFF the power supply to the servo system. Correct the wiring so that the control power supply is turned ON.	-
	The main circuit power supply is not turned ON.	Measure the voltage between the main circuit power input terminals.	Turn OFF the power supply to the servo system. Correct the wiring so that the main circuit power supply is turned ON.	-
	The I/O signal connector (CN1) pins are not wired correctly or are disconnected.	Turn OFF the power supply to the servo system. Check the wiring condition of the I/O signal connector (CN1) pins.	Correct the wiring of the I/O signal connector (CN1) pins.	page 4-35, page 9-6
	The wiring for the Servomotor Main Circuit Cables or Encoder Cable is disconnected.	Check the wiring conditions.	Turn OFF the power supply to the servo system. Wire the cable correctly.	-
Servomotor Does Not	There is an overload on the Servomotor.	Operate the Servomotor with no load and check the load status.	Turn OFF the power supply to the servo system. Reduce the load or replace the Servomotor with a Servomotor with a larger capacity.	-
Start	The type of encoder that is being used does not agree with the setting of Pn002 = n.\(\sigma \times \sigma	Check the type of the encoder that is being used and the setting of $Pn002 = n.\square X \square \square$.	Set Pn002 = n. \(\Pi\)X\(\Pi\) according to the type of the encoder that is being used.	page 6-74
	No speed or position reference is input.	Turn OFF the power supply to the servo system. Check the allocation status of the input signals.	Allocate an input signal so that the speed and position references are input correctly.	page 4-35, page 9-6
	There is a mistake in the input signal allocations (Pn50A to Pn50D, Pn515, and Pn516).	Check the input signal allocations (Pn50A to Pn50D, Pn515, and Pn516).	Correctly allocate the input signals (Pn50A to Pn50D, Pn515, and Pn516).	page 6-5, page 9-6
	The /S-ON (Servo ON) signal is OFF.	Check the settings of Pn50A = n. \(\sigma\) \(\sigma\) X (Input Signal Allocation Mode) and Pn50A = n. \(\sigma\) \(\sigma\) (/S-ON (Servo ON) Signal Allocation).	Set Pn50A = n.□□XX correctly and turn ON the /S-ON signal.	page 5-17, page 9-6
	The function setting of the / P-CON (Proportional Control) signal is not correct.	Check the setting of Pn000 = n.□□X□ (Control Method Selection).	Set the parameter to match the application.	page 5-13
	The SEN input is OFF.	Check the ON/OFF status of the SEN input.	If you are using an absolute encoder, turn ON the SEN signal.	page 6-74, page 9-6
	The reference pulse mode selection is not correct.	Check the setting of Pn200 =n.□□□X (Reference Pulse Form) and the reference pulse form.	Set Pn200 =n. \(\begin{align*} \pi \pi \) so that is agrees with the reference pulse form. Continued or	page 6-31

Continued from previous page.

Problem	Possible Cause	Confirmation	Continued from pre	Reference
	Speed control: The speed reference input is not appropriate.	Check between the speed reference input (V-REF) and signal ground (SG) to see if the control method and the input agree.	Correctly set the control method and input method.	page 9-6
	Torque control: The torque reference input is not appropriate.	Check between the torque reference input (T-REF) and signal ground (SG) to see if the control method and the input agree.	Correctly set the control method and input method.	page 9-6
	Position control: The reference pulse input is not appropriate.	Check the setting of Pn200 =n.□□□X (Reference Pulse Form) and the sign and pulse signals.	Correctly set the control method and input method.	page 6-31
	The /CLR (Position Deviation Clear) input signal has not been turned OFF.	Check the /CLR signal (CN1-14 and CN1-15).	Turn OFF the /CLR signal.	page 9-6
	The P-OT (Forward Drive Prohibit) or N-OT (Reverse Drive Prohibit) signal is still OFF.	Check the P-OT and N-OT signals.	Turn ON the P-OT and N-OT signals.	page 9-6
Servomotor Does Not Start	The safety input signals (/HWBB1 or /HWBB2) were not turned ON.	Check the /HWBB1 and /HWBB2 input signals.	Turn ON the /HWBB1 and /HWBB2 input signals. If you are not using the safety function, connect the Safety Jumper Connector (provided as an accessory) to CN8.	page 9-6
	The FSTP (Forced Stop Input) signal is still OFF.	Check the FSTP signal.	Turn ON the FSTP signal. If you will not use the function to force the motor to stop, set Pn516 = n.□□□X (FSTP (Forced Stop Input) Signal Allocation) to disable the signal.	page 9-6
	A failure occurred in the SERVOPACK.	-	Turn OFF the power supply to the servo system. Replace the SERVO-PACK.	-
		Check the setting of Pn080 =n.□□□X (Polarity Sensor Selection).	Correct the parameter setting.	page 5-26
	The polarity detection was not executed.	Check the /S-ON (Servo ON) or /P-DET (Polarity Detection) input signal.	If you are using an incremental linear encoder, turn ON the /S-ON or /P-DET signal. If you are using an absolute linear encoder, turn OFF the external /S-ON signal and execute polarity detection.	page 5-27

Problem	Possible Cause	Confirmation	Continued from pre	Reference
	There is a mistake in the Servomotor wiring.	Turn OFF the power supply to the servo system. Check the wiring.	Wire the Servomotor correctly.	-
	There is a mistake in the wiring of the encoder or Serial Converter Unit.	Turn OFF the power supply to the servo system. Check the wiring.	Wire the Serial Converter Unit correctly.	-
Servomotor	There is a mistake in the linear encoder wiring.	Turn OFF the power supply to the servo system. Check the wiring.	Wire the cable correctly.	-
Moves Instanta- neously,	The setting of Pn282 (Linear Encoder Scale Pitch) is not correct.	Check the setting of Pn282.	Correct the setting of Pn282.	page 5-19
and Then Stops	The count-up direction of the linear encoder does not match the forward direction of the Moving Coil in the motor.	Check the directions.	Change the setting of Pn080 = n.□□X□ (Motor Phase Sequence Selection). Place the linear encoder and motor in the same direction.	page 5-24
	Polarity detection was not performed correctly.	Check to see if electrical angle 2 (electrical angle from polarity origin) at any position is between ±10°.	Correct the settings for the polarity detection-related parameters.	-
Servomotor Speed Is Unstable	There is a faulty connection in the Servomotor wiring.	The connector connections for the power line (U, V, and W phases) and the encoder or Serial Converter Unit may be unstable. Turn OFF the power supply to the servo system. Check the wiring.	Tighten any loose terminals or connectors and correct the wiring.	-
	Speed control: The speed reference input is not appropriate.	Check between the speed reference input (V-REF) and signal ground (SG) to see if the control method and the input agree.	Correctly set the control method and input method.	page 9-6
	Torque control: The torque reference input is not appropriate.	Check between the torque reference input (T-REF) and signal ground (SG) to see if the control method and the input agree.	Correctly set the control method and input method.	page 9-6
Servomotor	The speed reference offset is not correct.	The SERVOPACK offset is adjusted incorrectly.	Adjust the SERVO-PACK offset.	page 6-19
Moves with- out a Refer- ence Input	Position control: The reference pulse input is not appropriate.	Check the setting of Pn200 =n.□□□X (Reference Pulse Form) and the sign and pulse signals.	Correctly set the control method and input method.	-
	A failure occurred in the SERVOPACK.	_	Turn OFF the power supply to the servo system. Replace the SERVO-PACK.	-
	The count-up direction of the linear encoder does not match the forward direction of the Moving Coil in the motor.	Check the directions.	Change the setting of Pn080 = n.□□X□ (Motor Phase Sequence Selection). Match the linear encoder direction and Servomotor direction.	page 5-24

Continued from previous page.

Duchler	Descible Orma	Confirmation	Continued from pre	
Problem	Possible Cause	Confirmation	Correction	Reference
Servomotor Moves with- out a Refer- ence Input	Polarity detection was not performed correctly.	Check to see if electrical angle 2 (electrical angle from polarity origin) at any position is between ±10°.	Correct the settings for the polarity detection-related parameters.	_
	The setting of Pn001 = n.□□□X (Motor Stopping Method for Servo OFF and Group 1 Alarms) is not suitable.	Check the setting of Pn001 = n.□□□X.	Set Pn001 = n.□□□X correctly.	-
Dynamic Brake Does Not Operate	The dynamic brake resistor is disconnected.	Check the moment of inertia, motor speed, and dynamic brake frequency of use. If the moment of inertia, motor speed, or dynamic brake frequency of use is excessive, the dynamic brake resistance may be disconnected.	Turn OFF the power supply to the servo system. Replace the SERVO-PACK. To prevent disconnection, reduce the load.	-
	There was a failure in the dynamic brake drive circuit.	_	There is a defective component in the dynamic brake circuit. Turn OFF the power supply to the servo system. Replace the SERVO-PACK.	-
Abnormal Noise from Servomotor	The Servomotor vibrated considerably while performing the tuning-less function with the default settings.	Check the waveform of the motor speed.	Reduce the load so that the moment of inertia ratio or mass ratio is within the allowable value, or increase the load level or reduce the rigidity level in the tuning-less level settings. If the situation is not improved, disable the tuning-less function (i.e., set Pn170 to n.□□□0) and execute autotuning either with or without a host reference.	page 8-12
		Turn OFF the power supply to the servo system. Check to see if there are any loose mounting screws.	Tighten the mounting screws.	-
	The machine mounting is not secure.	Turn OFF the power supply to the servo system. Check to see if there is misalignment in the coupling.	Align the coupling.	-
		Turn OFF the power supply to the servo system. Check to see if the coupling is balanced.	Balance the coupling.	-
	The bearings are defective.	Turn OFF the power supply to the servo system. Check for noise and vibration around the bearings.	Replace the Servomotor.	_

Problem	Possible Cause	Confirmation	Continued from pre	Reference
1 TODICITI	1 Ossible Gause	Turn OFF the power sup-	Correction	Helefelle
	There is a vibration source at the driven machine.	ply to the servo system. Check for any foreign matter, damage, or defor- mation in the machine's moving parts.	Consult with the machine manufacturer.	-
	Noise interference occurred because of incorrect I/O signal cable specifications.	Turn OFF the power supply to the servo system. Check the I/O signal cables to see if they satisfy specifications. Use shielded twisted-pair cables or screened twisted-pair cables with conductors of at least 0.12 mm ² (stranded wire).	Use cables that satisfy the specifications.	_
	Noise interference occurred because an I/O signal cable is too long.	Turn OFF the power supply to the servo system. Check the lengths of the I/O signal cables.	The I/O signal cables must be no longer than 3 m.	-
Abnormal Noise from	Noise interference occurred because of incorrect Encoder Cable specifications.	Turn OFF the power supply to the servo system. Check the Encoder Cable to see if it satisfies specifications. Use shielded twisted-pair cables or screened twisted-pair cables with conductors of at least 0.12 mm ² (stranded wire).	Use cables that satisfy the specifications.	_
Servomotor	Noise interference occurred because the Encoder Cable is too long.	Turn OFF the power supply to the servo system. Check the length of the Encoder Cable.	Rotary Servomotors: The Encoder Cable length must be 50 m max. Linear Servomotors: Make sure that the Serial Converter Unit cable is no longer than 20 m and that the Linear Encoder Cable and the Sensor Cable are no longer than 15 m each.	_
	Noise interference occurred because the Encoder Cable is damaged.	Turn OFF the power supply to the servo system. Check the Encoder Cable to see if it is pinched or the sheath is damaged.	Replace the Encoder Cable and correct the cable installation envi- ronment.	-
	The Encoder Cable was subjected to excessive noise interference.	Turn OFF the power supply to the servo system. Check to see if the Encoder Cable is bundled with a high-current line or installed near a high-current line.	Correct the cable lay- out so that no surge is applied by high-current lines.	-
	There is variation in the FG potential because of the influence of machines on the Servomotor side, such as a welder.	Turn OFF the power supply to the servo system. Check to see if the machines are correctly grounded.	Properly ground the machines to separate them from the FG of the encoder.	-

Problem	Possible Cause	Confirmation	Continued from pre	Reference
	There is a SERVOPACK pulse counting error due to noise.	Check to see if there is noise interference on the signal line from the encoder.	Turn OFF the power supply to the servo system. Implement countermeasures against noise for the encoder wiring.	-
Abnormal Noise from Servomotor	The encoder was subjected to excessive vibration or shock.	Turn OFF the power supply to the servo system. Check to see if vibration from the machine occurred. Check the Servomotor installation (mounting surface precision, securing state, and alignment). Check the linear encoder installation (mounting surface precision and securing method).	Reduce machine vibration. Improve the mounting state of the Servomotor or linear encoder.	-
	A failure occurred in the encoder.	_	Turn OFF the power supply to the servo system. Replace the Servomotor.	-
	A failure occurred in the Serial Converter Unit.	_	Turn OFF the power supply to the servo system. Replace the Serial Converter Unit.	_
	A failure occurred in the linear encoder.	_	Turn OFF the power supply to the servo system. Replace the linear encoder.	-
	The servo gains are not balanced.	Check to see if the servo gains have been correctly tuned.	Perform autotuning without a host reference.	page 8-24
Servomotor Vibrates at Frequency of Approx. 200 to 400 Hz.	The setting of Pn100 (Speed Loop Gain) is too high.	Check the setting of Pn100. The default setting is Kv = 40.0 Hz.	Set Pn100 to an appropriate value.	_
	The setting of Pn102 (Position Loop Gain) is too high.	Check the setting of Pn102. The default setting is Kp = 40.0/s.	Set Pn102 to an appropriate value.	-
	The setting of Pn101 (Speed Loop Integral Time Constant) is not appropriate.	Check the setting of Pn101. The default setting is Ti = 20.0 ms.	Set Pn101 to an appropriate value.	-
	The setting of Pn103 (Moment of Inertia Ratio or Mass Ratio) is not appropri- ate.	Check the setting of Pn103.	Set Pn103 to an appropriate value.	-

Problem	Possible Cause	Confirmation	Continued from pre	Reference
1 TOSIGITI	The servo gains are not balanced.	Check to see if the servo gains have been correctly tuned.	Perform autotuning without a host reference.	page 8-24
	The setting of Pn100 (Speed Loop Gain) is too high.	Check the setting of Pn100. The default setting is Kv = 40.0 Hz.	Set Pn100 to an appropriate value.	-
Large Motor Speed	The setting of Pn102 (Position Loop Gain) is too high.	Check the setting of Pn102. The default setting is Kp = 40.0/s.	Set Pn102 to an appropriate value.	-
Overshoot on Starting and Stop- ping	The setting of Pn101 (Speed Loop Integral Time Constant) is not appropriate.	Check the setting of Pn101. The default setting is Ti = 20.0 ms.	Set Pn101 to an appropriate value.	-
	The setting of Pn103 (Moment of Inertia Ratio or Mass Ratio) is not appropri- ate.	Check the setting of Pn103.	Set Pn103 to an appropriate value.	-
	The torque reference is saturated.	Check the waveform of the torque reference.	Use the mode switch.	-
	The force limits (Pn483 and Pn484) are set to the default values.	The default values of the force limits are Pn483 = 30% and Pn484 = 30%.	Set Pn483 and Pn484 to appropriate values.	page 6-64
Absolute Encoder Position Deviation Error (The position that was saved in the host con- troller when the power was turned OFF is dif- ferent from the posi- tion when the power was next turned ON.)	Noise interference occurred because of incorrect Encoder Cable specifications.	Turn OFF the power supply to the servo system. Check the Encoder Cable to see if it satisfies specifications. Use shielded twisted-pair cables or screened twisted-pair cables with conductors of at least 0.12 mm ² (stranded wire).	Use cables that satisfy the specifications.	-
	Noise interference occurred because the Encoder Cable is too long.	Turn OFF the power supply to the servo system. Check the length of the Encoder Cable.	Rotary Servomotors: The Encoder Cable length must be 50 m max. Linear Servomotors: Make sure that the Serial Converter Unit cable is no longer than 20 m and that the Linear Encoder Cable and the Sensor Cable are no longer than 15 m each.	-
	Noise interference occurred because the Encoder Cable is damaged.	Turn OFF the power supply to the servo system. Check the Encoder Cable to see if it is pinched or the sheath is damaged.	Replace the Encoder Cable and correct the cable installation envi- ronment.	-
	The Encoder Cable was subject to excessive noise interference.	Turn OFF the power supply to the servo system. Check to see if the Encoder Cable is bundled with a high-current line or installed near a high-current line.	Correct the cable lay- out so that no surge is applied by high-current lines.	-

Problem	Possible Cause	Confirmation	Correction	Reference
	There is variation in the FG potential because of the influence of machines on the Servomotor side, such as a welder.	Turn OFF the power supply to the servo system. Check to see if the machines are correctly grounded.	Properly ground the machines to separate them from the FG of the encoder.	-
	There is a SERVOPACK pulse counting error due to noise.	Turn OFF the power supply to the servo system. Check to see if there is noise interference on the I/O signal line from the encoder or Serial Converter Unit.	Implement counter- measures against noise for the encoder or Serial Converter Unit wiring.	-
Absolute Encoder Position Deviation Error (The position that was saved in the host con- troller when	The encoder was subjected to excessive vibration or shock.	Turn OFF the power supply to the servo system. Check to see if vibration from the machine occurred. Check the Servomotor installation (mounting surface precision, securing state, and alignment). Check the linear encoder installation (mounting surface precision and securing method).	Reduce machine vibration. Improve the mounting state of the Servomotor or linear encoder.	_
the power was turned OFF is different from the position when the power was next turned ON.)	A failure occurred in the encoder.	_	Turn OFF the power supply to the servo system. Replace the Servomotor or linear encoder.	-
	A failure occurred in the SERVOPACK.	_	Turn OFF the power supply to the servo system. Replace the SERVO-PACK.	-
		Check the error detection section of the host controller.	Correct the error detection section of the host controller.	_
	Host Controller Multiturn Data or Absolute Encoder	Check to see if the host controller is executing data parity checks.	Perform parity checks for the multiturn data or absolute encoder posi- tion data.	-
	Position Data Reading Error	Check for noise interference in the cable between the SERVO-PACK and the host controller.	Implement counter- measures against noise and then perform parity checks again for the multiturn data or abso- lute encoder position data.	_

Problem	Possible Cause	Confirmation	Continued from pre	Reference
		Check the external power supply (+24 V) voltage for the input signals.	Correct the external power supply (+24 V) voltage for the input signals.	-
	The P-OT/N-OT (Forward Drive Prohibit or Reverse	Check the operating condition of the overtravel limit switches.	Make sure that the overtravel limit switches operate correctly.	-
	Drive Prohibit) signal was input.	Check the wiring of the overtravel limit switches.	Correct the wiring of the overtravel limit switches.	page 5-31
		Check the settings of the overtravel input signal allocations (Pn50A/Pn50B).	Set the parameters to correct values.	page 5-31
		Check for fluctuation in the external power supply (+24 V) voltage for the input signals.	Eliminate fluctuation from the external power supply (+24 V) voltage for the input signals.	-
Overtravel	The P-OT/N-OT (Forward Drive Prohibit or Reverse Drive Prohibit) signal malfunctioned.	Check to see if the operation of the overtravel limit switches is unstable.	Stabilize the operating condition of the over-travel limit switches.	-
Occurred		Check the wiring of the overtravel limit switches (e.g., check for cable damage and loose screws).	Correct the wiring of the overtravel limit switches.	-
	There is a mistake in the allocation of the P-OT or N-OT (Forward Drive Prohibit or Reverse Drive Prohibit) signal in Pn50A = n.X□□□ or Pn50B = n.□□□X.	Check to see if the P-OT signal is allocated in Pn50A = n.X□□□.	If another signal is allocated in Pn50A =n.X□□□, allocate the P-OT signal instead.	- page 5-31
		Check to see if the N-OT signal is allocated in Pn50B = n.□□□X.	If another signal is allocated in Pn50B =n.□□□X, allocate the N-OT signal instead.	page 3-31
	The selection of the Servo- motor stopping method is not correct.	Check the servo OFF stopping method set in Pn001 = n.□□□X or Pn001 = n.□□X□.	Select a Servomotor stopping method other than coasting to a stop.	- page 5-33
		Check the torque control stopping method set in $Pn001 = n.\square\square\square X$ or $Pn001 = n.\square\square X\square$.	Select a Servomotor stopping method other than coasting to a stop.	page 5 55
Improper Stop Posi-	The limit switch position and dog length are not appropriate.	_	Install the limit switch at the appropriate position.	_
tion for Overtravel (OT) Signal	The overtravel limit switch position is too close for the coasting distance.	_	Install the overtravel limit switch at the appropriate position.	_

Problem	Possible Cause	Confirmation	Continued from pre	Reference
	Noise interference occurred because of incorrect Encoder Cable specifications.	Check the Encoder Cable to see if it satisfies specifications. Use shielded twisted-pair cables or screened twisted-pair cables with conductors of at least 0.12 mm ² (stranded wire).	Use cables that satisfy the specifications.	-
	Noise interference occurred because the Encoder Cable is too long.	Turn OFF the power supply to the servo system. Check the length of the Encoder Cable.	Rotary Servomotors: The Encoder Cable length must be 50 m max. Linear Servomotors: Make sure that the Serial Converter Unit cable is no longer than 20 m and that the Linear Encoder Cable and the Sensor Cable are no longer than 15 m each.	-
	Noise interference occurred because the Encoder Cable is damaged.	Turn OFF the power supply to the servo system. Check the Encoder Cable to see if it is pinched or the sheath is damaged.	Replace the Encoder Cable and correct the cable installation envi- ronment.	-
Position Deviation (without Alarm)	The Encoder Cable was subjected to excessive noise interference.	Turn OFF the power supply to the servo system. Check to see if the Encoder Cable is bundled with a high-current line or installed near a high-current line.	Correct the cable lay- out so that no surge is applied by high-current lines.	-
	There is variation in the FG potential because of the influence of machines on the Servomotor side, such as a welder.	Turn OFF the power supply to the servo system. Check to see if the machines are correctly grounded.	Properly ground the machines to separate them from the FG of the encoder.	-
	There is a SERVOPACK pulse counting error due to noise.	Turn OFF the power supply to the servo system. Check to see if there is noise interference on the I/O signal line from the encoder or Serial Converter Unit.	Implement counter- measures against noise for the encoder wiring or Serial Converter Unit wiring.	-
	The encoder was subjected to excessive vibration or shock.	Turn OFF the power supply to the servo system. Check to see if vibration from the machine occurred. Check the Servomotor installation (mounting surface precision, securing state, and alignment). Check the linear encoder installation (mounting surface precision and securing method).	Reduce machine vibration. Improve the mounting state of the Servomotor or linear encoder.	-
	The coupling between the machine and Servomotor is not suitable.	Turn OFF the power supply to the servo system. Check to see if position offset occurs at the coupling between machine and Servomotor.	Correctly secure the coupling between the machine and Servomotor.	-

Problem	Possible Cause	Confirmation	Correction	Reference
	Noise interference occurred because of incorrect I/O signal cable specifications.	Turn OFF the power supply to the servo system. Check the I/O signal cables to see if they satisfy specifications. Use shielded twisted-pair cables or screened twisted-pair cables with conductors of at least 0.12 mm ² (stranded wire).	Use cables that satisfy the specifications.	-
Position Deviation (without	If reference pulse input multiplication switching is being used, noise may be causing the I/O signals used for this function (/PSEL and /PSELA) to be falsely detected.	Turn OFF the power supply to the servo system. Check the I/O signal cables to see if they satisfy specifications. Use shielded twisted-pair cables or screened twisted-pair cables with conductors of at least 0.12 mm² (stranded wire).	Use cables that satisfy the specifications.	-
Alarm)	Pulses are being lost because the filter for the reference pulse input is not appropriate.	Check the setting of Pn200=n.X□□□(Filter Selection).	Set the parameters to correct values.	page 6-31
	Noise interference occurred because an I/O signal cable is too long.	Turn OFF the power supply to the servo system. Check the lengths of the I/O signal cables.	The I/O signal cables must be no longer than 3 m.	-
	An encoder fault occurred. (The pulse count does not change.)	_	Turn OFF the power supply to the servo system. Replace the Servomotor or linear encoder.	-
	A failure occurred in the SERVOPACK.	_	Turn OFF the power supply to the servo system. Replace the SERVO-PACK.	-
	The surrounding air temperature is too high.	Measure the surrounding air temperature around the Servomotor.	Reduce the surrounding air temperature to 40°C or less.	_
	The surface of the Servomotor is dirty.	Turn OFF the power supply to the servo system. Visually check the surface for dirt.	Clean dirt, dust, and oil from the surface.	-
Servomotor Overheated	There is an overload on the Servomotor.	Check the load status with a monitor.	If the Servomotor is overloaded, reduce the load or replace the Servo Drive with a SERVOPACK and Ser- vomotor with larger capacities.	-
	Polarity detection was not performed correctly.	Check to see if electrical angle 2 (electrical angle from polarity origin) at any position is between ±10°.	Correct the settings for the polarity detection-related parameters.	_

Panel Displays and Panel Operator Procedures

This chapter describes how to interpret panel displays and the operation of the Panel Operator.

13.1	Panel	Operator13-3
	13.1.1 13.1.2 13.1.3	Panel Operator Key Names and Functions 13-3 Changing Modes
13.2	Parame	ter (Pn□□□) Operations on the Panel Operator 13-6
	13.2.1 13.2.2	Setting Parameters That Require Numeric Settings
		of Functions
13.3	Monitor	Display (Un□□□) Operations on the Panel Operator13-8
	13.3.1 13.3.2 13.3.3 13.3.4 13.3.5	Basic Monitor Display Operations
	13.3.6	Polarity Sensor Signal Monitor (Un011) 13-11

13.4	Utility Fu	nction (Fn \square \square) Operations on the Panel Operator13-12
	13.4.1	Display Alarm History (Fn000)13-12
	13.4.2	Jog (Fn002)
	13.4.3	Origin Search (Fn003)13-14
	13.4.4	Jog Program (Fn004)
	13.4.5	Initialize Parameters (Fn005)13-16
	13.4.6	Clear Alarm History (Fn006)13-16
	13.4.7	Reset Absolute Encoder (Fn008)13-17
	13.4.8	Autotune Analog (Speed/Torque) Reference
		Offset (Fn009)
	13.4.9	Manually Adjust Speed Reference Offset
	10 1 10	(Fn00A)
	13.4.10	Manually Adjust Torque Reference Offset
	10 / 11	(Fn00B)
	13.4.11	Adjust Analog Monitor Output Offset (Fn00C)
	12 / 12	Adjust Analog Monitor Output Gain (Fn00D)13-20
		Autotune Motor Current Detection Signal Offset
	10.4.10	(Fn00E)13-21
	13 4 14	Manually Adjust Motor Current Detection Signal
	10.4.14	Offset (Fn00F)
	13.4.15	Write Prohibition Setting (Fn010)
		Display Servomotor Model (Fn011)13-24
		Display Software Version (Fn012)
		Multiturn Limit Setting after Multiturn Limit
		Disagreement Alarm (Fn013)13-26
	13.4.19	Reset Option Module Configuration Error
		(Fn014)
		Initialize Vibration Detection Level (Fn01B)13-27
	13.4.21	Display SERVOPACK and Servomotor IDs
		(Fn01E)13-28
	13.4.22	Display Servomotor ID from Feedback Option
		Module (Fn01F)
		Set Absolute Linear Encoder Origin (Fn020)13-28
		Resetting Motor Type Alarms (Fn021)13-29
		Software Reset (Fn030)
		Polarity Detection (Fn080)
		Tuning-less Level Setting (Fn200)13-30
	13.4.28	Advanced Autotuning without Reference
	12 / 20	(Fn201)
	13.4.29	Advanced Autotuning with Reference
	13 / 30	(Fn202)
		Adjust Anti-resonance Control (Fn204)
		Vibration Suppression (Fn205)
		Easy FFT (Fn206)


13.1 Panel Operator

13.1.1 Panel Operator Key Names and Functions

The Panel Operator consists of a panel display and Panel Operator keys.

You can use the Panel Operator to set parameters, display status, execute utility functions, and monitor SERVOPACK operation.

The Panel Operator key names and functions are given below.

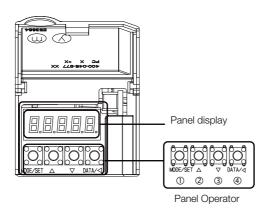


	Key No.	Key Name	Function		
	①	MODE/SET Key	Changes the display.Confirms settings.		
	2	UP Key	Increases the setting.		
	3	DOWN Key	Decreases the setting.		
_	4	DATA/SHIFT Key	 Displays the setting. To display the setting, press the DATA/SHIFT Key for approximately one second. Moves to the next digit on the left when a digit is flashing. 		

13.1.2 Changing Modes

Press the MODE/SET Key to change between the modes as shown below.

Refer to the reference pages for the operating procedures in each function mode.

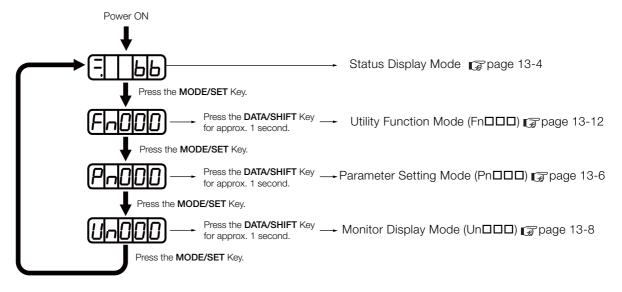

13.1.3 Status Displays

Information

You can change the setting of Pn52F (Monitor Display at Startup) to display the Monitor Display Mode instead of the Status Display Mode after the power supply is turned ON. Set Pn52F to the Un number of the monitor display to display after the power supply is turned ON.

	Monitor Display at Startup			Speed	Position Torque
Pn52F	Setting Range	Setting Unit	Default Setting	When Enabled	Classification
	0000 to 0FFF	ı	OFFF	Immediately	Setup

If OFFF is set (default setting), the SERVOPACK will enter the Status Display Mode after the power supply is turned ON.

13.1.3 Status Displays

The status is displayed as described below.



Interpreting Bit Data

Display	Meaning
8.8	Control Power ON Display Lit while the SERVOPACK control power is ON. Not lit if the SERVOPACK control power is OFF.
8.8	Base Block Display Lit if the servo is OFF. Not lit while the servo is ON.
8.8	During Speed Control: /V-CMP (Speed Coincidence Detection) Signal Display Lit if the difference between the Servomotor speed and the reference speed is the same as or less than the setting of Pn503 or Pn582. (The default setting is 10 min ⁻¹ or 10 mm/s.) Always lit during torque control. Additional Information If there is noise in the reference voltage during speed control, the horizontal segment (-) on the top of the leftmost digit on the Panel Operator display may flash. Refer to the following section and implement countermeasures against noise. **A.1.2 Countermeasures against Noise on page 4-5 During Position Control: /COIN (Positioning Completion) Signal Display Lit if the deviation between the position reference and actual motor position is equal to or less than the setting of Pn522. (The default setting is 7 reference units.) Not lit it the devia- tion exceeds the setting.
88	/TGON (Rotation Detection) Signal Display Lit if the Servomotor speed is higher than the setting of Pn502 or Pn581 and not lit if the speed is lower than the setting. (The default setting is 20 min ⁻¹ or 20 mm/s.)
88	During Speed Control: Speed Reference Input Display Lit if the current input reference is larger than the setting of Pn502 or Pn581 and not lit if the reference is smaller than the setting. (The default setting is 20 min ⁻¹ or 20 mm/s.) During Position Control: Reference Pulse Input Display Lit while reference pulses are being input. Not lit if reference pulses are not being input.
88	During Torque Control: Torque Reference Input Display Lit if the current input torque reference is larger than the specified value (10% of the rated torque) and not lit if the reference is smaller than the specified value. During Position Control: Clear Signal Input Display Lit while the clear signal is being input. Not lit if the clear signal is not being input.
88.	Power Ready Display Lit while the main circuit power supply is ON. Not lit if the main circuit power supply is OFF.

• Interpreting Codes

Display	Meaning	Display	Meaning
	Base Block Active Indicates that the servo is OFF.	חורור	Safety Function Indicates that the SERVOPACK is in
run	Operation in Progress Indicates that the servo is ON.	<u>ויוטוט)</u>	the hard wire base block state due to a safety function.
Pob	Forward Drive Prohibited Indicates that the P-OT (Forward Drive Prohibit) signal is open.	(Example: Operation in Progress Status)	Test without Motor in Progress Indicates that the test without a motor is in progress. The status display changes according
not	Reverse Drive Prohibited Indicates that the N-OT (Reverse Drive Prohibit) signal is open.	(Displayed alternately.)	to the status of Servomotor and SERVOPACK. However, tSt will not be displayed during a test without a motor even if an alarm occurs.
FSE	Forced Stop Status Indicates that the FSTP (Force Stop Input) signal forced the Servomotor to	020	Alarm Status Flashes the alarm number.

13.2.1 Setting Parameters That Require Numeric Settings

13.2

Parameter (Pn□□□) Operations on the Panel Operator

This section describes the procedures for setting the parameters that are used in this manual.

Refer to the following sections for details on parameter classifications and notation.

5.1.1 Parameter Classification on page 5-4

5.1.2 Notation for Parameters on page 5-5

13.2.1 Setting Parameters That Require Numeric Settings

The following procedure shows how to change the setting of Pn100 (Speed Loop Gain) from 40.0 to 100.0 as an example of a parameter that requires a numeric setting.

Step	Panel Display after Operation	Keys	Operation
1	Pn 100	MODE/SET ▲ DATA/◀	Press the MODE/SET Key to enter Parameter Setting Mode. If Pn100 is not displayed, press the UP Key or DOWN Key to display Pn100.
2	00400	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The current setting of Pn100 will be displayed.
3	0040,0	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key to move the digit that is flashing to "4". (You can change the value of the digit that is flashing.)
4	0 100.0	MODE/SET A DATA/	Press the UP Key six times to change the setting to 100.0. Refer to the following section for the operating procedure for settings with more than five digits. **Parameters with Settings of More Than Five Digits on page 13-7
5	(Flashing)	MODE/SET ▲ DATA/◀	Press the MODE/SET Key. The display will flash. The setting has now been changed from 40.0 to 100.0.
6	P- 100	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Pn100 .


Information

Setting Negative Numbers

- For parameters that accept a negative setting, display 00000 and then press the DOWN Key to set a negative number.
- For a negative number, the value increases when the DOWN Key is pressed and decreases when the UP Key is pressed.

Parameters with Settings of More Than Five Digits

The Panel Operator displays five digits. Settings of more than five digits are displayed as shown in the following figure.

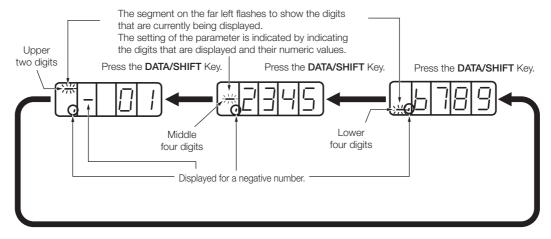

13.2.2 Setting Parameters That Require Selection of Functions

For parameters that require selection of functions, you can select the individual digits of the numbers displayed on the Panel Operator to set the functions assigned to them.

The following example shows how to change the setting of $Pn000 = n.\square\squareX\square$ (Control Method Selection) in Pn000 (Basic Function Selections 0) from speed control to position control.

Step	Panel Display after Operation	Keys	Operation	
1	P-000	MODE/SET ▲ DATA/◀	Press the MODE/SET Key to enter Parameter Setting Mode. If Pn000 is not displayed, press the UP Key or DOWN Key to display Pn000.	
2	<u>0000</u>	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The current setting of Pn000 will be displayed.	
3	-0000	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key to move the digit that is flashing. (You can change the value of the digit that is flashing.)	
4	-00 10	MODE/SET ▲ DATA/◀	Press the UP Key once to change the display to n.0010 . (This changes the control method from speed control to position control.)	
5	(Flashing)	MODE/SET ▲ DATA/◀	Press the MODE/SET Key. The display will flash. The control method has now been changed from speed control to position control.	
6	P-000	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. Pn000 is displayed again.	
7	To enable the change to the setting, turn the power supply to the SERVOPACK OFF and ON again.			

13

13.3.1 Basic Monitor Display Operations

13.3 Monitor Display (Un□□□) Operations on the Panel Operator

You can monitor the status of the reference values and I/O signals that are set in the SERVO-PACK and the internal status of the SERVOPACK with monitor displays.

The Panel Operator displays numbers beginning with "Un."

Display Example for Motor Speed



This section describes the basic operations for monitor displays and how to interpret some special monitor displays.

Refer to the following section for details on the contents of the monitor display.

**Index: 15.2.2 Corresponding SERVOPACK Monitor Display Function Names on page 15-9

13.3.1 Basic Monitor Display Operations

The procedure for Un000 (Motor Speed) is described here as an example.

Step	Panel Display after Operation	Keys	Operation
1	U-000	MODE/SET A DATA/	Press the MODE/SET Key to enter Monitor Display Mode.
2		MODE/SET ▲ V DATA/◀	Press the UP Key or DOWN Key to select the Un number of the item that you want to monitor.
3		MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The contents of the monitor display for the specified Un number will appear. Refer to the following section for the operating procedure for displays with more than five digits. **Parameters with Settings of More Than Five Digits on page 13-7
4		MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The display shown for step 1 will appear again.

13.3.2 Input Signal Monitor (Un005)

You can use Un005 to display the status of allocated signals on the LED segments of the Panel Operator.

Interpreting the Display

LED Segments



- If the input signal that corresponds to the LED number is OFF, the top LED segment will be lit.
- If the input signal that corresponds to the LED number is ON, the bottom LED segment will be lit.

13


The allocations are given in the following table.

LED number Input Pin Number		Signal Name (Default Setting)	
1	CN1-40	/SI0 (/S-ON)	
2	CN1-41	/SI3 (/P-CON)	
3	CN1-42	/SI1 (P-OT)	
4 CN1-43		/SI2 (N-OT)	
5	CN1-44	/SI4 (/ALM-RST)	
6	CN1-45	/SI5 (/P-CL)	
7	CN1-46	/SI6 (/N-CL)	
8	CN1-4	SEN	

Information

The configuration of the input circuits is shown below.

OFF: Open ON: Closed Example:

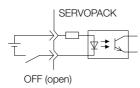

Display Examples

Display examples for input signals are shown below.

• When the /S-ON (Servo ON) Signal Is ON



When the /S-ON (Servo ON) Signal Is OFF



• When the P-OT (Forward Drive Prohibit) Signal Is Active



13.3.3 Output Signal Monitor (Un006)

You can use Un006 to display the status of allocated signals on the LED segments of the Panel Operator.

◆ Interpreting the Display

LED Segments



• If the output signal that corresponds to the LED number is OFF, the top LED segment will be lit.

13.3.4 Safety Input Signal Monitor (Un015)

• If the output signal that corresponds to the LED number is ON, the bottom LED segment will be lit.

The allocations are given in the following table.

LED number	Output Pin Numbers	Signal Name (Default Setting)		
1	CN1-31and CN1-32	ALM+, CALM-		
2	CN1-25 and CN1-26	/SO1+ (/COIN+ or /V-CMP+) and /SO1- (/COIN- or /V-CMP-)		
3	CN1-27 and CN1-28	/SO2+ (/TGON+) /SO2- (/TGON-)		
4	CN1-29 and CN1-30	/SO3+ (/S-RDY+) /SO3- (/S-RDY-)		
5	CN1-37	ALO1		
6	CN1-38	ALO2		
7	CN1-39	ALO3		
8	_	Reserved.		

Information

The configuration of the output circuits is shown below.

OFF: Transistor OFF ON: Transistor ON Example:

SERVOPACK

ON (transistor ON)

◆ Display Examples

A display example for output signals is shown below.

• When the ALM (Servo Alarm) Signal Is OFF



13.3.4 Safety Input Signal Monitor (Un015)

◆ Interpreting the Display

You can display the status of allocated signals on the LED segments of the Panel Operator.

LED Segments



- If the signal that corresponds to the LED number is ON, the top LED segment will be lit.
- If the signal that corresponds to the LED number is OFF, the bottom LED segment will be lit. The allocations are given in the following table.

LED number	Input Pin Numbers	Signal
1	CN8-3 and CN8-4	/HWBB1
2	CN8-5 and CN8-6	/HWBB2
3	_	Reserved.
4	_	Reserved.
5	_	Reserved.
6	_	Reserved.
7	_	Reserved.
8	_	Reserved.

13.3.5 Upper Limit Setting Monitor for Maximum Motor Speed/Upper Limit Setting for Encoder Output Resolution (Un010)

Information


The configuration of the input circuits is shown below.

OFF: Open
ON: Closed
Example:

Display Example

A display example for safety input signals is shown below.

When the /HWBB1 Signal Turns OFF to Activate a HWBB

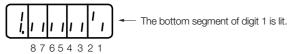

13.3.5 Upper Limit Setting Monitor for Maximum Motor Speed/Upper Limit Setting for Encoder Output Resolution (Un010)

You can use Un010 to monitor the upper limit setting for the maximum motor speed or the upper limit setting for the encoder output resolution.

You can monitor the upper limit of the encoder output resolution setting (Pn281) for the current maximum motor speed setting (Pn385), or you can monitor the upper limit of the maximum motor speed setting for the current encoder output resolution setting.


Select which signal to monitor with $Pn080 = n.X\square\square\square$ (Calculation Method for Maximum Speed or Encoder Output Pulses).

- If $Pn080 = n.0 \square \square \square$, the encoder output resolution (Pn281) that can be set is displayed.
- If Pn080 = n.1□□□, the maximum motor speed (Pn385) that can be set is displayed in mm/s.

13.3.6 Polarity Sensor Signal Monitor (Un011)

You can use Un011 to monitor the signal pattern of the polarity sensor.

Press the **DATA/SHIFT** Key for approximately one second to display the polarity sensor signal pattern.

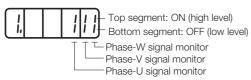

Polarity Sensor	Signal Monitor		
Signal Pattern	Phase U	Phase V	Phase W
0	L	L	L
1	L	L	Н
2	L	Н	L
3	L	Н	Н
4	Н	L	L
5	Н	L	Н
6	Н	Н	L
7	Н	Н	Н

13.4.1 Display Alarm History (Fn000)

13.4

Utility Function (Fn□□□) Operations on the Panel Operator

Utility functions are used to set up and tune the SERVOPACK.

The Panel Operator displays numbers beginning with "Fn."

Display Example: Origin Search



The operating procedures from the Panel Operator are described here. Refer to the descriptions of individual utility functions for preparations and related parameters.

Refer to the following section for details on utility functions.

15.2.1 Corresponding SERVOPACK Utility Function Names on page 15-7

13.4.1 Display Alarm History (Fn000)

Refer to the following section for information on this utility function other than the procedure.

12.2.4 Displaying the Alarm History on page 12-42

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET A V DATA/	Press the MODE/SET Key to enter Utility Function Mode. If Fn000 is not displayed, press the UP Key or DOWN Key to display Fn000.
2	0.810	MODE/SET ▲ ▼ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The most recent alarm will be displayed.
3	Alarm number	MODE/SET ▲ DATA/■	Press the DOWN Key to display the next older alarm. Press the UP Key to display the next newer alarm. The higher the far-left segment is, the older the alarm is. Refer to the following section for information on alarms. 12.2.1 List of Alarms on page 12-5
4	_3456	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key. The lower four digits of the time stamp will be displayed.
5	-7890	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key. The middle four digits of the time stamp will be displayed.
6		MODE/SET ▲ ▼ DATA/◀	Press the DATA/SHIFT Key. The upper two digits of the time stamp will be displayed.
7		MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key. The alarm number will flash on the display.
8	Fn000	MODE/SET A DATA/	Press the DATA/SHIFT Key again for approximately one second to return the display to Fn000 .



Time Stamp

A time stamp gives the total operation time to the point at which the alarm occurred in increments of 100 ms from when the control power supply and main circuit power supply were turned ON. For 24-hour, 365-day operation, measurements are possible for approximately 13 years.



Time Stamp Display Example

If 36000 is displayed, 3,600,000 ms = 3,600 s = 60 min = 1 h Therefore, the total operation time in hours is 1 hour.

13.4.2 Jog (Fn002)

Refer to the following section for information on this utility function other than the procedure.
7.3 Trial Operation for the Servomotor without a Load on page 7-7

Step	Panel Display after Operation	Keys	Operation
1	Fn000	MODE/SET ▲ ▼ DATA/◀	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn002	MODE/SET A DATA/	Press the UP Key or DOWN Key to display Fn002 .
3		MODE/SET A DATA/	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4		MODE/SET ▲ ▼ DATA/◀	Press the MODE/SET Key to turn ON the servo.
5		MODE/SET A DATA/	The Servomotor will operate at the speed set in Pn304 or Pn383 while the UP Key (for forward operation) or DOWN Key (for reverse operation) is pressed.
6		MODE/SET ▲ DATA/◀	Press the MODE/SET Key to turn OFF the servo. Additional Information You can turn OFF the servo by pressing the DATA/ SHIFT Key for approximately one second.
7	Fn002	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn002 .
8	Turn the power supply	to the SERVOPACK O	FF and ON again after you finish jogging.

13.4.3 Origin Search (Fn003)

Refer to the following section for information on this utility function other than the procedure. \bigcirc 7.6.2 Origin Search on page 7-25

Step	Panel Display after Operation	Keys			Operation	
1	F-000	MODE/SET ▲ ▼ DATA/◀	Press the Mode.	MODE/SE	T Key to enter l	Jtility Function
2	F-1003	MODE/SET A DATA/	Press the	UP Key or	DOWN Key to	display Fn003 .
3		MODE/SET DATA/			T Key for apprown on the left w	oximately one sec- vill appear.
4		MODE/SET ▲ ▼ DATA/▼			T Key to turn O left will appear	N the servo. The
	5 NODE/SET A DATA/		ward direct Press the reverse dienthe rotation according shown in the Rotary S	ction. DOWN Key rection. on direction to the settithe followin Servomotors	to operate the of the Servoming of Pn000 = g table.	n.□□□X as
			Ра	rameter n.□□□0	UP Key CCW	CW CW
			Pn000	n. 🗆 🗆 🗆 1	CW	CCW
5		Note: This is the direction when viewed from the load side of the Servomotor. • Linear Servomotors				
			Para	ameter	UP Key	DOWN Key
			Pn000 -	n.□□□0	Linear encoder counts up.	Linear encoder counts down.
				n.□□□1	Linear encoder counts down.	Linear encoder counts up.
			the for	forward dire details.		encoder counts up is e following section y on page 5-18
6	(Flashing)	_	pleted, the	e display wi o-locked at		has been com- ime, the Servomo- n one rotation of
7	F-003	MODE/SET ▲ ▼ DATA/◀			T Key for approplay to Fn003.	oximately one sec-
8	Turn the power supply to the SERVOPACK OFF and ON again after you finish the origin search.					

13.4.4 Jog Program (Fn004)

Refer to the following section for information on this utility function other than the procedure. \bigcirc 7.6.1 Program Jogging on page 7-20

Step	Panel Display after Operation	Keys	Operation		
1	F-000	MODE/SET A DATA/	Press the MODE/SET Key to enter Utility Function Mode.		
2	F-004	MODE/SET A DATA/	Press the UP Key or DOWN Key to display Fn004 .		
3	F.P.JOG	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The display shown on the left will appear.		
4		MODE/SET ▲ ▼ DATA/◀	Press the MODE/SET Key to turn ON the servo. The display shown on the left will appear.		
5	.P.J05	MODE/SET ▲ DATA/◀	Press the UP Key or DOWN Key according to the initial movement direction of the operation pattern. The operation will start after the preset waiting time. Additional Information • Press the MODE/SET Key during operation. The servo will turn OFF and the Servomotor will stop. • Press the DATA/SHIFT Key for approximately one second during operation. The display shown for step 2 will appear again.		
6		-	When program jogging has been completed, End will flash on the display, and then the display shown on the left will appear again. Additional Information • Press the MODE/SET Key during operation to turn OFF the servo and return to the display shown for step 3. • Press the DATA/SHIFT Key for approximately one second during operation to return to the display shown for step 2.		
7	Turn the power supply to the SERVOPACK OFF and ON again after you finish program jogging.				

13.4.5 Initialize Parameters (Fn005)

13.4.5 Initialize Parameters (Fn005)

Refer to the following section for information on this utility function other than the procedure. *5.1.5 Initializing Parameter Settings* on page 5-11

Step	Panel Display after Operation	Keys	Operation	
1	F-000	MODE/SET A DATA/	Press the MODE/SET Key to enter Utility Function Mode.	
2	F-005	MODE/SET A DATA/	Press the UP Key or DOWN Key to display Fn005 .	
3	P. 1-1-1-	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.	
4	P. In IL	MODE/SET ▲ ▼ DATA/◀	Press the MODE/SET Key to initialize the parameters. When the initialization has been completed, donE will flash on the display, and then the display shown on the left will appear again.	
5	To enable the change to the setting, turn the power supply to the SERVOPACK OFF and ON again after the initialization of the parameter settings has been completed.			

13.4.6 Clear Alarm History (Fn006)

Refer to the following section for information on this utility function other than the procedure.

12.2.5 Clearing the Alarm History on page 12-43

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET DATA/	Press the MODE/SET Key to enter Utility Function Mode.
2	F-005	MODE/SET A DATA/	Press the UP Key or DOWN Key to display Fn006 .
3		MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4	ELCL	MODE/SET A DATA/	Press the MODE/SET Key to clear the alarm history. When deleting the alarms has been completed, donE will flash on the display, and then the display shown on the left will appear again.
5	Fn005	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn006 .

13.4.7 Reset Absolute Encoder (Fn008)

Refer to the following section for information on this utility function other than the procedure. 5.17 Resetting the Absolute Encoder on page 5-52

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET A DATA/	Press the MODE/SET Key to enter Utility Function Mode.
2	F-008	MODE/SET ▲ ▼ DATA/◀	Press the UP Key or DOWN Key to display Fn008 .
3	PGELI	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. PGCL1 will be displayed.
4	PDELS	MODE / SET ▲ DATA / ■	Continue pressing the UP Key until PGCL5 is displayed. Note: If you press the wrong key, no-oP will flash on the display for approximately one second and the display will return to the original Utility Function Mode display. Repeat the operation from the beginning.
5	donE	MODE/SET DATA	Press the MODE/SET Key. The absolute encoder will be initialized. When initialization has been completed, donE will flash on the display for approximately one second.
6	PSCLS	_	After displaying donE, the display will return to the PGCL5 display.
7	F-008	MODE/SET ▲ ▼ DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn008 .
8	To enable the change t	o the settings, turn the	power supply to the SERVOPACK OFF and ON again.

13.4.8 Autotune Analog (Speed/Torque) Reference Offset (Fn009)

Refer to the following section for information on this utility function other than the procedure.

- ♠ Automatically Adjusting the Speed Reference Offset on page 6-20
- Automatically Adjusting the Torque Reference Offset on page 6-41

Step	Panel Display after Operation	Keys	Operation
1	-	-	Turn OFF the servo, and input a 0-V reference voltage from the host controller or an external circuit.
2	F-000	MODE/SET A DATA	Press the MODE/SET Key to enter Utility Function Mode.
3	F-009	MODE/SET ▲ ▼ DATA/◀	Press the UP Key or DOWN Key to display Fn009 .
4	-EF_o	MODE/SET ▲ ▼ DATA/◀	Press the DATA/SHIFT Key for approximately one second. rEF_o will be displayed.
5	FEF_O	MODE/SET A DATA/	Press the MODE/SET Key. donE will flash on the display for approximately one second, and then the display shown on the left will appear.
6	F-009	MODE/SET ▲ ▼ DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn009 .

13.4.9 Manually Adjust Speed Reference Offset (Fn00A)

Refer to the following section for information on this utility function other than the procedure.

**Manually Adjusting the Speed Reference Offset on page 6-22*

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET DATA/	Press the MODE/SET Key to enter Utility Function Mode.
2	FNOOR	MODE/SET ▲ ▼ DATA/◀	Press the UP Key or DOWN Key to display Fn00A .
		A A A A A A A A	Press the DATA/SHIFT Key for approximately one second. The display shown on the left will appear.
3	[=] .[5]2[3]	MODE/SET ▲ ▼ DATA/▼	Note: If write protection is set, no_oP will flash on the display for approximately one second. Change the setting of Fn010 to enable writing.
4	TSPa	_	Turn ON the servo from an external device. The display shown on the left will appear.
5	00000	MODE/SET ▲ ▼ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The current amount of offset will be displayed.
6	Example:	MODE/SET ▲ V DATA/◀	Press the UP Key or DOWN Key to adjust the offset until the Servomotor stops. The displayed value is the amount of the offset.
7	<u> </u>	MODE/SET A DATA/	Press the MODE/SET Key. donE will flash on the display, and then the display shown on the left will appear.

13.4.10 Manually Adjust Torque Reference Offset (Fn00B)

Step	Panel Display after Operation	Keys	Operation
8	FADDA		Press the DATA/SHIFT Key for approximately one second to return the display to Fn00A .

Continued from previous page.

13.4.10 Manually Adjust Torque Reference Offset (Fn00B)

Refer to the following section for information on this utility function other than the procedure. Manually Adjusting the Torque Reference Offset on page 6-43

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET A DATA/	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn00b	MODE/SET A ▼ DATA/◀	Press the UP Key or DOWN Key to display Fn00b .
3		MODE/SET ▲ DATA/	Press the DATA/SHIFT Key for approximately one second. The display shown on the left will appear. Note: If write protection is set, no_oP will flash on the display for approximately one second. Change the setting of Fn010 to enable writing.
4		_	Turn ON the servo. The display shown on the left will appear.
5	00000	MODE/SET ▲ ▼ DĂTA/◀	Press the DATA/SHIFT Key for approximately one second. The current amount of offset will be displayed.
6	Example:	MODE/SET ▲ V DATA/◀	Press the UP Key or DOWN Key to adjust the amount of offset.
7		MODE/SET A DATA/	Press the MODE/SET Key. donE will flash on the display, and then the display shown on the left will appear.
8	F-00b	MODE/SET ■ DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn00b .

13.4.11 Adjust Analog Monitor Output Offset (Fn00C)

Refer to the following section for information on this utility function other than the procedure. \bigcirc Adjusting the Analog Monitor Output on page 9-12

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET A DATA/	Press the MODE/SET Key to enter Utility Function Mode.
2	FACCE	MODE/SET A DATA/	Press the UP Key or DOWN Key to display Fn00C .
3		MODE/SET A DATA/	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4		MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key. The offset will be displayed as shown on the left.
5	-0001	MODE/SET A DATA/	Press the UP Key or DOWN Key to adjust the offset.
6		MODE/SET A DATA/	Press the DATA/SHIFT Key. The display shown on the left will appear again.
7		MODE/SET A DATA/	Press the MODE/SET Key. The display will change to the monitor output for channel 2 (analog monitor 2 output).
8		MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key. The offset will be displayed as shown on the left.
9	<u>-000 i</u>	MODE/SET A DATA/	Press the UP Key or DOWN Key to adjust the offset.
10	FADDE	MODE/SET A DATA	Press the DATA/SHIFT Key for approximately one second. Ch2-o will be displayed, and then Fn00C will be displayed again.

13.4.12 Adjust Analog Monitor Output Gain (Fn00D)

Refer to the following section for information on this utility function other than the procedure. \bigcirc Adjusting the Analog Monitor Output on page 9-12

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET A DATA/	Press the MODE/SET Key to enter Utility Function Mode.
2	FNDOd	MODE/SET ▲ V DATA/◀	Press the UP Key or DOWN Key to display Fn00D .
3		MODE/SET ▲ V DATA/◀	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4		MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key. The gain adjustment will be displayed as shown on the left.

Step	Panel Display after Operation	Keys	Operation
5	-0001	MODE/SET A DATA/	Press the UP Key or DOWN Key to adjust the gain.
6		MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key. The display shown on the left will appear again.
7	CH2_6	MODE/SET ▲ ▼ DATA/◀	Press the MODE/SET Key. The display will change from the monitor output for channel 1 to the monitor output for channel 2.
8		MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key. The gain adjustment will be displayed as shown on the left.
9	-0001	MODE/SET A DATA/	Press the UP Key or DOWN Key to adjust the gain.
10	FNOOd	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. Ch2-G will be displayed, and then Fn00D will be displayed again.

13.4.13 Autotune Motor Current Detection Signal Offset (Fn00E)

Refer to the following section for information on this utility function other than the procedure. 6.16.1 Automatic Adjustment on page 6-103

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET A DATA/	Press the MODE/SET Key to enter Utility Function Mode.
2	FADDE	MODE/SET ▲ V DATA/◀	Press the UP Key or DOWN Key to display Fn00E .
3		MODE/SET ▲ V DATA/◀	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4		MODE/SET ▲ ▼ DATA/◀	Press the MODE/SET Key to perform automatic off- set-signal adjustment. When the adjustment has been completed, donE will flash on the display, and then the display shown on the left will appear again.
5	FADDE	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn00E .

13.4.14 Manually Adjust Motor Current Detection Signal Offset (Fn00F)

13.4.14 Manually Adjust Motor Current Detection Signal Offset (Fn00F)

Refer to the following section for information on this utility function other than the procedure. 6.16.2 Manual Adjustment on page 6-105

Step	Panel Display after Operation	Keys	Operation	
1	F-000	MODE/SET A DATA/	Press the MODE/SET Key to enter Utility Function Mode.	
2	FADDE	MODE/SET ▲ DATA/◀	Press the UP Key or DOWN Key to display Fn00F .	
3		MODE/SET A DATA/	First you adjust the offset for phase U (Cu1-o). Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.	
4		MODE/SET A DATA/	Press the DATA/SHIFT Key. The amount of offset for phase U will be displayed.	
5	-0010	MODE/SET ▲ V DATA/◀	Press the UP Key or DOWN Key to change the amount of offset. Change the setting by approximately 10 units at a time in the direction that reduces the torque ripple to find the value that minimizes the torque ripple, and set that value. Adjustment range: -512 to +511	
6		MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key. The display shown on the left will appear again.	
7		MODE/SET ▲ ▼ DATA/◀	Next you adjust the offset for phase V (Cu2-o). Press the MODE/SET Key for approximately one second. The display shown at the left will appear.	
8		MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key. The amount of offset for phase V will be displayed.	
9	-0010	MODE/SET ▲ V DATA/◀	Press the UP Key or DOWN Key to change the amount of offset. In the same way as for the phase-U adjustment, change the setting by approximately 10 units at a time in the direction that reduces the torque ripple to find the value that minimizes the torque ripple, and set that value. Adjustment range: -512 to +511	
10	FNOOF	MODE/SET A DATA/	Press the DATA/SHIFT Key for approximately one second. Cu2-o will be displayed, and then Fn00F will be displayed again.	
11	Reduce the amount by which you change the offsets each time and repeat steps 3 to 10* to fine-tune the amounts of offset.			

^{*} Examples of the Amount of Change to Adjust Offsets

The above values are guidelines. Vary the amount of change and the number of repetitions according to your system.

[•] First time: 10 units at a time

[•] Second time: 5 units at a time

[•] Third time: 1 unit at a time

13.4.15 Write Prohibition Setting (Fn010)

Refer to the following section for information on this utility function other than the procedure. *5.1.4 Write Prohibition Setting for Parameters* on page 5-8

Step	Panel Display after Operation	Keys	Operation
1	Fn000	MODE/SET ▲ ▼ DATA/◀	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn0 10	MODE/SET A DATA/	Press the UP Key or DOWN Key to display Fn010 .
3	P.0000	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4	P.000 I	MODE/SET A DATA/	Press the UP Key or DOWN Key and set one of the following. P.0000: Write permitted (default setting) P.0001: Write prohibited
5	P.000 i	MODE/SET A DATA/	Press the MODE/SET Key to enter the value. When the setting has been completed, donE will flash on the display, and then the display shown on the left will appear again. Note: If you set any value other than P.0000 or P.0001, Error will be displayed.
6	To enable the change to the setting, turn the power supply to the SERVOPACK OFF and ON again after write protection has been set or cleared.		

13.4.16 Display Servomotor Model (Fn011)

Refer to the following section for information on this utility function other than the procedure.

3.1 Monitoring Product Information on page 9-2

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET ▲ DATA/◀	Press the MODE/SET Key to enter Utility Function Mode.
2	FnD I I	MODE/SET A DATA/	Press the UP Key or DOWN Key to display Fn011 .
3	Example [F.[] []	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second to display the Servomotor voltage and model codes. Servomotor Voltage No. Type
4	Example	MODE/SET A DATA/	Press the MODE/SET Key. The Servomotor capacity will be displayed. Servomotor capacity (× 10 W) The above example indicates 100 W.

13.4.16 Display Servomotor Model (Fn011)

Step	Panel Display after Operation	Keys	Operation
5	Example E.OOZO	MODE/SET ▲ DATA/	Rotary Servomotors Press the MODE/SET Key. The encoder type and resolution codes will be displayed. Encoder Type No.
6	(5,0000)	MODE/SET ▲ ▼ DATA/▼	Press the MODE/SET Key. The FT specifications code for the SERVOPACK will be displayed. s.0000 indicates a standard model. If a specification code other than s.0000 is displayed, a SERVOPACK with FT specifications is being used. FT specifications code
7	<u> </u>	MODE/SET ▲ DATA/◀	Press the MODE/SET Key. The code for custom SERVOPACK specifications will be displayed. y.0000 indicates a standard model. If anything other than y.0000 is displayed, a customized SERVOPACK is being used. Specifications code
8	Fn0 I I	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn011 .

13.4.17 Display Software Version (Fn012)

Refer to the following section for information on this utility function other than the procedure.

9.1 Monitoring Product Information on page 9-2

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET ▲ ▼ DATA/◀	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn0 12	MODE/SET ▲ V DATA/◀	Press the UP Key or DOWN Key to display Fn012 .
3	000 I	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The software version of the SERVOPACK will be displayed.
4	E.0001	MODE/SET ▲ ▼ DATA/▼	Press the MODE/SET Key. The software version of the encoder will be displayed. Additional Information If you press the MODE/SET Key again, a pre-programmed display will appear. The display will change as follows: 0.0000 → S.FFFF → F.FFFF .
5	F-012	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn012 .

13.4.18 Multiturn Limit Setting after Multiturn Limit Disagreement Alarm (Fn013)

Refer to the following section for information on this utility function other than the procedure. 6.12.9 Multiturn Limit Disagreement Alarm (A.CCO) on page 6-85

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET A DATA/	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn0 13	MODE/SET ▲ DATA/◀	Press the UP Key or DOWN Key to display Fn013 .
3	PSSEL	MODE/SET ▼ DATA/◀	Press the DATA/SHIFT Key for approximately one second. PGSEt will be displayed.
4	(donE)	MODE/SET A DATA/	Press the MODE/SET Key. The value of the multiturn limit setting in the absolute encoder will be made the same as the setting of Pn205. When unifying the values has been completed, donE will flash on the display for approximately one second.
5	PSSEL	_	After displaying donE , the display will return to the PGSEt display.
6	Fn0 13	MODE/SET ▲ ▼ DĀTA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn013 .
7	To enable the change to the settings, turn the power supply to the SERVOPACK OFF and ON again.		

Refer to the following section for information on this utility function other than the procedure.

12.2.6 Resetting Alarms Detected in Option Modules on page 12-44

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET ▲ V DATA/◀	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn0 14	MODE/SET A DATA/	Press the UP Key or DOWN Key to display Fn014 .
3	o,SAFE	MODE/SET DATA/	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4	O.FEEd	MODE/SET A DATA/	Press the UP Key or DOWN Key to select the Option Module to be cleared.
5	0.	MODE/SET A DATA/	Press the MODE/SET Key for approximately one second. The display shown at the left will appear.
6	o,FEEd	MODE/SET ▲ ▼ DATA/◀	Press the MODE/SET Key again. The alarms in the Option Module will be cleared. donE will flash on the display and the display shown on the left will appear again.
7	Fn0 14	MODE/SET ▲ V DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn014 .
8	To enable the change to the setting, turn the power supply to the SERVOPACK OFF and ON again after clearing detected Option Module alarms has been completed.		

13.4.20 Initialize Vibration Detection Level (Fn01B)

Refer to the following section for information on this utility function other than the procedure. \bigcirc 6.15 Initializing the Vibration Detection Level on page 6-99

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET ▲ ▼ DATA/◀	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn0 16	MODE/SET ▲ V DATA/◀	Press the UP Key or DOWN Key to display Fn01b .
3	d n E	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4	(Flashing)	MODE/SET ▲ ▼ DATA/▼	Press the MODE/SET Key for approximately one second. The display shown on the left will flash and the vibration level will be detected and updated. Note: 1. Operate the SERVOPACK with the references that will be used for actual operation. 2. If the Servomotor operates at 10% or less of the maximum speed, Error will be displayed.

13.4.21 Display SERVOPACK and Servomotor IDs (Fn01E)

Continued from previous page.

Step	Panel Display after Operation	Keys	Operation
5	donE	MODE/SET A DATA/	Wait for a period of time and then press the MODE/ SET Key again to complete vibration detection and updating the setting. This will enable the setting. If the setting is completed normally, donE will be displayed. If there was an error in making the setting, Error will be displayed.
6	F-016	MODE/SET ▲ ▼ DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn01b .

13.4.21 Display SERVOPACK and Servomotor IDs (Fn01E)

This function cannot be executed from the Panel Operator on the SERVOPACK.

13.4.22 Display Servomotor ID from Feedback Option Module (Fn01F)

This function cannot be executed from the Panel Operator on the SERVOPACK.

13.4.23 Set Absolute Linear Encoder Origin (Fn020)

Refer to the following section for information on this utility function other than the procedure. *5.18.1 Setting the Origin of the Absolute Linear Encoder* on page 5-55

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET A DATA/	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn020	MODE/SET A V DATA/	Press the UP Key or DOWN Key to display Fn020 .
3	OSELI	MODE/SET A DATA/	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4	05885	MODE/SET A DATA/	Continue pressing the UP Key until 0SET5 is displayed. Note: If you make a mistake during key operations, no_oP will flash on the display for approximately one second and then Fn000 will be displayed again.
5		MODE/SET A DATA/	Press the MODE/SET Key to set the origin of the absolute linear encoder. When the setting has been completed, donE will flash on the display, and then the display shown on the left will appear again.
6	Fn020	MODE/SET DATA/	Press the DATA/SHIFT Key for approximately one second to return the display to Fn020 .
7	To enable the change to the settings, turn the power supply to the SERVOPACK OFF and ON again.		

13.4.24 Resetting Motor Type Alarms (Fn021)

Refer to the following section for information on this utility function other than the procedure.
12.2.7 Resetting Motor Type Alarms on page 12-46

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET A DATA/-	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn021	MODE/SET A DATA -	Press the UP Key or DOWN Key to display Fn021 .
3		MODE SET A DATA	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4		MODE/SET A DATA -	Press the MODE/SET Key to reset the motor type alarm. donE will flash on the display and the display shown on the left will appear again.
5	Fn021)	MODE/SET ▲ DATA/▼	Press the DATA/SHIFT Key for approximately one second to return the display to Fn021 .
6	To enable the change to the settings, turn the power supply to the SERVOPACK OFF and ON again		

13.4.25 Software Reset (Fn030)

Refer to the following section for information on this utility function other than the procedure. 6.14 Software Reset on page 6-97

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET ▲ ▼ DATA/▼	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn030	MODE/SET ▲ V DATA/◀	Press the UP Key or DOWN Key to display Fn030 .
3	S-5E !	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4	5-5-5	MODE/SET A DATA/	Continue pressing the UP Key until the display shown on the left appears. Note: If you make a mistake during key operations, no_oP will flash on the display for approximately one second.
5		MODE/SET ▲ V DATA/◀	Press the MODE/SET Key. The panel display will go blank and then will change to the same initial status display as when the power supply is turned ON.

13.4.26 Polarity Detection (Fn080)

Refer to the following section for information on this utility function other than the procedure. *5.11 Polarity Detection* on page 5-27

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET DATA	Press the MODE/SET Key to enter Utility Function Mode.

13.4.27 Tuning-less Level Setting (Fn200)

Continued from previous page.

Step	Panel Display after Operation	Keys	Operation
2	F-080	MODE/SET ▲ DATA/◀	Press the UP Key or DOWN Key to display Fn080 .
3	<u> </u>	MODE/SET A DATA/	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4	P-dE	MODE/SET DATA	Press the MODE/SET Key to start polarity detection.
5	<u> </u>	_	After polarity detection has been completed, the display shown on the left will appear. The Servomotor will enter the servo OFF state.
6	F-080	MODE/SET ▲ V DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn080.

13.4.27 Tuning-less Level Setting (Fn200)

Refer to the following section for information on this utility function other than the procedure. 8.4 Tuning-less Function on page 8-12

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET A DATA/	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn200	MODE/SET A ▼ DATA/◀	Press the UP Key or DOWN Key to display Fn200 .
3	Load level	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The load level setting display for the tuning-less levels will appear. Note: If the response waveform shows overshooting, if the load moment of inertia exceeds the allowable level (i.e., outside the scope of product warranty), or if the mass ratio is 30 or higher (i.e., outside the scope of product warranty), press the UP Key and change the load level to 2.
4		MODE/SET ▲ DATA/◀	Press the MODE/SET Key to display. The rigidity level setting display for the tuning-less levels will appear.
5	Rigidity level	MODE/SET ▲ DATA/◀	Press the UP Key or DOWN Key to set the rigidity level. Set the rigidity level to between 0 and 7. The larger the value is, the higher the gain is and the better response performance will be. (The default setting is 4.) Note: Vibration may occur if the rigidity level is too high. Lower the rigidity level if vibration occurs. If high-frequency noise is generated, press the DATA/SHIFT Key to automatically set a notch filter for the vibration frequency.
6		MODE/SET ▲ ▼ DATA/◀	Press the MODE/SET Key. "donE" will flash for approximately one second and then L0004 will be displayed. The settings will be saved in the SERVOPACK.
7	Fn200	MODE/SET ▲ ▼ DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn200 .

13.4.28 Advanced Autotuning without Reference (Fn201)

This function cannot be executed from the Panel Operator on the SERVOPACK.

13.4.29 Advanced Autotuning with Reference (Fn202)

This function cannot be executed from the Panel Operator on the SERVOPACK.

13.4.30 One-Parameter Tuning (Fn203)

Refer to the following section for information on this utility function other than the procedure. $8.8 \, \text{Custom Tuning}$ on page 8-42

Step	Panel Display after Operation	Keys	Operation
1	Fn000	MODE/SET DATA	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn203	MODE/SET ▲ V DATA/◀	Press the UP Key or DOWN Key to display Fn203 .
3	d 0	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second. The display shown at the left will appear.
4		MODE/SET A DATA/	Press the UP Key or DOWN Key to enter Tuning Mode. Tuning Mode (Strength of Tuning Setting) 0: Performs tuning giving priority to stability. 1: Performs tuning giving priority to response. Note: The rigidity type is always 2.
5		-	If the servo is OFF (i.e., if power is not supplied to the Servomotor), input the /S-ON (Servo ON) from the host controller. If the servo is ON, go to step 6.
6	L0040	MODE/SET ▲ V DATA/◀	Press the DATA/SHIFT Key for less than one second. The one-parameter gain will be displayed as shown on the left.
7		MODE/SET ▲ DATA/◀	Press the UP Key or DOWN Key to change the one- parameter gain value and change the actual servo gains (Pn100, Pn101, Pn102, and Pn401) at the same time. You end this tuning function when you decide that the response is satisfactory.
8	L0055	MODE/SET A DATA/	Press the MODE/SET Key to save the four calculated gains to the parameters. When tuning has been completed, donE will flash on the display, and then the display shown on the left will appear again. Note: To end operation without saving the calculated gains, go to step 9.
9	Fn203	MODE/SET ▲ DATA/	Press the DATA/SHIF T Key for approximately one second to return the display to Fn203 .

13.4.31 Adjust Anti-resonance Control (Fn204)

13.4.31 Adjust Anti-resonance Control (Fn204)

This function cannot be executed from the Panel Operator on the SERVOPACK.

13.4.32 Vibration Suppression (Fn205)

This function cannot be executed from the Panel Operator on the SERVOPACK.

13.4.33 Easy FFT (Fn206)

Refer to the following section for information on this utility function other than the procedure. 8.14.2 Easy FFT on page 8-95

Step	Panel Display after Operation	Keys	Operation
1	F-000	MODE/SET ▲ ▼ DATA/▼	Press the MODE/SET Key to enter Utility Function Mode.
2	Fn205	MODE/SET A DATA/	Press the UP Key or DOWN Key to display Fn206 .
3	(Reference amplitude setting)	MODE/SET A DATA/	Press the DATA/SHIFT Key for approximately one second. The display shown on the left will appear and the Panel Operator will enter Reference Amplitude Setting Mode.
4	[] [] [] []	MODE/SET ▲ DATA/■	Press the UP Key or DOWN Key to set the reference amplitude. Reference amplitude setting range: 1 to 800 Note: 1. If you are setting Easy FFT for the first time, do not change the reference amplitude setting, but rather start from the default value of 15. Although increasing the reference amplitude will increase the detection accuracy, the vibration and noise in the machine will increase momentarily. Increase the reference amplitude a little at a time and observe the results. 2. The set reference amplitude will be stored in Pn456.
5	(Ready to operate status)	MODE/SET A DATA/	Press the DATA/SHIFT Key for approximately one second. The ready to operate status will be entered.
6		MODE/SET A DATA/	Press the MODE/SET Key to turn ON the servo. Additional Information Press the MODE/SET Key again to turn OFF the servo. Return to step 5.
7	(Flashing) (Flashing) Slight movement in Servomotor	MODE/SET ▲ DATA/◀	While the servo is ON, press the UP Key (forward) or the DOWN Key (reverse). The Servomotor will automatically perform round-trip operation, moving in forward and reverse several times for 1/4th of a rotation for a Rotary Servomotor and 10 mm or less for a Linear Servomotor. The Servomotor performs this operation for approximately 2 seconds. During this operation, the display shown on the left will flash. Note: 1. Press the MODE/SET Key to cancel the operation. Return to step 5. 2. The Servomotor will move slightly. Also at the same time, the Servomotor will emit noise. To ensure safety, do not approach or enter the range of machine motion.

Continued from previous page.

Step	Panel Display after Operation	Keys	Operation					
8	(Detection result display example)	_	If detection is completed normally, E_FFt will stop flashing and the detected resonance frequency will be displayed. If detection fails, F will be displayed. To check the results, go to step 9. To monitor the resonance frequency without setting the detection result, press the DATA/SHIFT Key for approximately one second and return to step 2. ■ IMPORTANT If the operation ended normally but it took two seconds or longer, the detection accuracy may not be sufficient. Increase the reference amplitude to a value higher than 15 to increase the detection accuracy. Although increasing the reference amplitude will increase the detection accuracy, the vibration and noise in the machine will increase momentarily. Increase the reference amplitude a little at a time and observe the results.					
9		MODE/SET ▲ DATA/	Press the MODE/SET Key. The optimum notch filter for the detected resonance frequency will automatically be set. If the notch filter is set correctly, donE will flash on the display, and then the display shown on the left will appear. If the 1st notch filter frequency is already set (Pn408 = n.□□□1), the 2nd notch filter frequency will be automatically set (Pn40C). Press the MODE/SET Key to return to step 5. Note: 1. If both the 1st and 2nd notch filter frequencies are already set (Pn408 = n.□1□1), no more notch filter frequencies can be set. 2. If the frequency detected by this function is not to be used, set Pn408 to n.□□□0 (Disable notch filter).					
10	Fn206	MODE/SET ▲ DATA/◀	Press the DATA/SHIFT Key for approximately one second to return the display to Fn206 .					
11	Turn the power supply to the SERVOPACK OFF and ON again after you finish executing Easy FFT.							

Parameter Lists

(14)

This chapter provides information on the parameters.

14.1	List o	f Parameters
		Interpreting the Parameter Lists
14.2	Paran	neter Recording Table 14-34

14.1.1 Interpreting the Parameter Lists

The types of Servomotors to which the parameter applies.

- All: The parameter is used for both Rotary Servomotors and Linear Servomotors.
- Rotary: The parameter is used for only Rotary Servomotors.
- · Linear: The parameter is used for only Linear Servomotors.

Rotary Servomotor terms are used for parameters that are applicable to all Servomotors. If you are using a Linear Servomotor, you need to interpret the terms accordingly. Refer to the following section for details.

THE SE

◆ Differences in Terms for Rotary Servomotors and Linear Servomotors on page xi

Indicates when a change to the parameter will be effective.

Parameter No.	Size	Name	Setting Range	Setting Unit	Default Setting	Applica- ble Motors	When Enabled	Classi- fication	Refer- ence
	2	Basic Function Selections 0	0000h to 10B1h	-	0000h	All	After restart	Setup	_

If there are differences in the parameters for Rotary Servomotor and Linear Servomotor, information is provided for both.

- Top row: For Rotary Servomotors
- Bottom row: For Linear Servomotors

There are the following two classifications.

- Setup
- Tuning

Refer to the following section for details.

5.1.1 Parameter Classification on page 5-4

	Rotation	Direction Sel ction	Reference				
	Movement Direction Selection						
	0	Use CCW as the forward direction.					
n.□□□X		Use the direction in which the linear encoder counts up as the forward direction.	page 5-18				
		Use CW as the forward direction. (Reverse Rotation Mode)	page 5-16				
	1	Use the direction in which the linear encoder counts down as the forward direction. (Reverse Movement Mode)					

	Control I	Method Selection	Reference			
	0	Speed control with analog references				
n.00X0	1	Position control with pulse train references				
	2	Torque control with analog references				
	3	Internal set speed control with contact commands				
	4	Switching between internal set speed control with contact references and speed control with analog references				
	5	Switching between internal set speed control with contact references and position control with pulse train references				
	6	Switching between internal set speed control with contact references and torque control with analog references	page 5-13			
	7	Switching between position control with pulse train references and speed control with analog references				
	8	Switching between position control with pulse train references and torque control with analog references				
	9	Switching between torque control with analog references and speed control with analog references				
	А	Switching between speed control with analog references and speed control with zero clamping				
	В	Switching between position control with pulse train references and position control with reference pulse inhibition				

n.□X□□	Reserve	d parameter (Do not change.)			
n.X□□□	Rotary/Li	near Servomotor Startup Selection When Encoder Is Not Connected	Reference		
	When an encoder is not connected, start as SERVOPACK for Rotary Servomotor.				
	1	When an encoder is not connected, start as SERVOPACK for Linear Servomotor.	page 5-16		

Pn000

Parameter Lists

14.1.2 List of Parameters

The following table lists the parameters.

- Note: Do not change the following parameters from their default settings.

 Reserved parameters

 Parameters not given in this manual

 Parameters that are not valid for the Servomotor that you are using, as given in the parameter table

Parameter No.	Size	N	ame	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence	
	2	Basic Fund tions 0	ction Selec-	0000h to 10B1h	-	0000h	All	After restart	Setup	-	
						•					
				ation Direction Selection						ence	
				nt Direction Selection							
		n.□□□X		Use CCW as the forward direction.							
			Wa	Use the direction in which the linear encoder counts up as the forward direction.						page 5-18	
			–	se CW as the for		•		· · · · · · · · · · · · · · · · · · ·			
			00	se the direction ward direction.				down as the	9		
			Control Met	hod Selection					Refere	ence	
			0 Sp	eed control wit	n analog re	eferences					
				sition control w			nces				
				rque control wit							
				ernal set speed							
			4 er	vitching betwee ces and speed	control wit	th analog r	eferences				
Pn000		n.□□X□		vitching betwee ces and positio							
				vitching betwee ces and torque				ontact refer-	page (5-13	
				Switching between position control with pulse train references and speed control with analog references							
				vitching betwee rque control wit			h pulse train r	eferences an	d		
				vitching betwee eed control with			analog refere	ences and			
				Switching between speed control with analog references and speed control with zero clamping							
				vitching betwee esition control w				eferences an	b		
		n.□X□□	Reserved pa	arameter (Do no	ot change.	.)					
			Rotary/Line nected	ar Servomotor S	Startup Se	election W	hen Encoder	Is Not Con-	Refere	ence	
		n.X□□□		hen an encoder stary Servomoto		nected, st	art as SERVC	PACK for	page	 5 ₋ 16	
				hen an encoder r Servomotor.	is not cor	nected, st	art as SERVC	PACK for Lir	1- page :	5-16	

Continued from previous page.

Parameter No.	Size	N	Name		Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence		
	2	Application Selections		0000h to 1142h	_	0000h	All	After restart	Setup	-		
			I						Refere			
		n.□□□X										
				 Stop the motor by applying the dynamic brake. Stop the motor by the applying dynamic brake and then release the dynamic brake. 								
										5-41		
			2 Co	ast the motor t	o a stop w	ithout the	dynamic brak	ie.				
			Overtravel S	topping Metho	d				Refere	ence		
		n.□□X□		ply the dynamic pping method				op (use the				
				celerate the mo maximum tord								
				celerate the mo maximum tord				in Pn406 as	page 5	page 5-33		
Pn001				celerate the mo 30A and then s				on time set in				
				celerate the mo 30A and then le			he deceleration	on time set in				
			Main Circuit Power Supply AC/DC Input Selection						Refere	ence		
				out AC power as d L3 terminals (ng the L1, L2	,			
		n.□X□□	1 and	out DC power a d ⊝ 2 terminal nverter or the s	s or the B	1 and ⊖ 2		•		5-14		
			Warning Cod	de Output Sele	ction				Refere	ence		
			0 Ou	tput only alarm s.	codes on	the ALO1	, ALO2, and A	LO3 termi-				
		n.X□□□	1 and our	tput both warn d ALO3 termina tput, the ALM (ll state).	als. Howev	er, while a	n warning cod	de is being	pago	3-10		
			·									

Continued from previous page.

Parameter No.	Size	N	ame	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence	
	2	Application Selections	Function 2	0000h to 4213h	_	0000h	-	After restart	Setup	_	
			Speed/Po	location)	Applicable Reference		ance				
				· ·		Motors	Tielele	neierence			
				Do not use T-REF.					_		
		n.□□□X		Jse T-REF as an e		· ·	'	All	page (
				Jse T-REF as a to				All	page 8	3-87	
				Use T-REF as an e /P-CL or /N-CL is		rque limit i	nput when		page 6	6-71	
			Torque Control Option (V-REF Input Allocation)					Applicable Motors	Refere	Reference	
		n.□□X□	0	Do not use V-REF	•			All	3-46		
			1	Jse V-REF as an	external sp	peed limit i	nput.	All	page (J-40 	
Pn002		n.0X00	Encoder Usage					Applicable Motors	Refere	ence	
				Use the encoder according to encoder specifications.				All			
			1	Use the encoder as an incremental encoder.					page 6	5-74	
				2 Use the encoder as a single-turn absolute encoder.							
			External E	incoder Usage				Applicable Motors	Refere	ence	
			0	Do not use an ext	ernal encc	der.					
		n.X□□□		The external encoder moves in the forward direction for CCW motor rotation.							
			2	Reserved parame	ter (Do no	change.)		Rotary page 10-6			
				The external enco			erse direc-				
					ter (Do no				1		

Parameter _N

Continued from previous page.

Classi- Refer-

Setting Default Applicable When

No.	Siz	N	ame	Range Unit Setting Motors Enabled fication end							
	2	Application Selections		0000h to 105Fh	_	0002h	All	Immedi- ately	Setup	page 9-10	
			Analog Monitor 1 Signal Selection								
			00	Motor speed (1 V/1,000 min ⁻¹) Motor speed (1 V/1,000 mm/s)							
			01	Speed reference (1 V/1,000 min ⁻¹) Speed reference (1 V/1,000 mm/s)							
				Torque reference (1 V/100% rated torque)							
			02	Force reference	•		· '				
			03	Position deviation							
				Position amplifie	r deviatio	n (after elec	ctronic gear) (0.05 V/encc	der pulse	unit)	
			04	0.05 V/linea	r encoder						
			05	Position reference speed (1 V/1,000 min ⁻¹)							
				Position reference	ce speed	(1 V/1,000	mm/s)				
			06	Reserved parameter (Do not change.)							
Pn006		n.□□XX	07	Load-motor pos	sition devia	ation (0.01	V/reference u	ınit)			
			08	Positioning completion (positioning completed: 5 V, positioning not completed: 0 V)						-	
			09	Speed feedforward (1 V/1,000 min ⁻¹)							
				Speed feedforward (1 V/1,000 mm/s)							
			OA	Torque feedforward (1 V/100% rated torque)							
				Force feedforward (1 V/100% rated force)							
			0B	Active gain (1st							
			0C	Completion of p pleted: 0 V)	osition ref	erence dis	tribution (com	pleted: 5 V,	not com-		
			0D	External encode	er speed (*	l V/1,000 r	min ⁻¹ : value at	the motor s	shaft)		
			0E	Reserved param	neter (Do r	not change	.)				
			0F	Reserved param	neter (Do r	not change	.)				
			10	Main circuit DC	voltage						
			11 to 5F	Reserved param	neters (Do	not chang	e.)				
		n.□X□□	Reserved	parameter (Do no	ot change	.)					
		n.X000	Reserved	oarameter (Do no	ot change	.)					
	3-7										

Setting

Continued	from	provious	n
Continued	HOH	DIEVIOUS	Daue

Parameter No.	Size	N	ame	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence	
	2	Application Selections		0000h to 105Fh	-	0000h	All	Immedi- ately	Setup	page 9-10	
			Analog Mor	nitor 2 Signal Se	election						
			00	Motor speed (1							
				Motor speed (1							
			01 ⊨	Speed reference Speed reference	,						
			-	Torque reference			raue)				
			l ∩2 ⊢	Force reference	•		. ,				
				Position deviation							
			l 04 -	Position amplifie		•				unit)	
				Position amplifie pulse unit)	er deviation	n (aπer elec	ctronic gear) (0.05 V/IIneai	rencoder		
			05	Position reference	ce speed (1 V/1,000	min ⁻¹)				
				Position reference							
		n.□□XX	-	Reserved param	•			nit)			
Pn007				Load-motor pos		•			a not com		
				pleted: 0 V)	(I			,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,			
			09 -	Speed feedforw	•						
			-	Speed feedforw Torque feedforw	•		,				
			1 0A -	Force feedforwa	•						
				Active gain (1st gain: 1 V, 2nd gain: 2 V)							
				Completion of p pleted: 0 V)	osition ref	erence dis	tribution (com	pleted: 5 V,	not com-		
			0D	External encode	r speed (1	V/1,000 r	min ⁻¹ : value at	the motor s	haft)		
			-	Reserved param	•						
				Reserved param	•	ot change	.)				
				Main circuit DC Reserved param		not chang	e)				
			1	·	,		o.,				
		n.□X□□	Reserved p	arameter (Do no	ot change.	.)					
		n.X□□□	Reserved p	arameter (Do no	ot change.	.)					
		Application	- Function	0000b to	I			A ft o r			
	2	Application Selections	8	0000h to 7121h	-	0000h	Rotary	After restart	Setup	_	
				Voltage Alarm					Refere	ence	
		n.□□□X		utput alarm (A.8					page -	12-2	
			1 0	utput warning (A	1.930) for i	ow battery	voitage.				
				election for Und					Refere	ence	
Pn008		n.□□X□		o not detect und etect undervolta			torque at hos	t controller			
			D		<u> </u>		· ·		page 6	6-14	
			Detect undervoltage warning and limit torque with Pn424 and Pn425 (i.e., only in SERVOPACK).								
			Warning De	tection Selectio	n				Refere	ence	
		n.□X□□		etect warnings.					page		
			1 D	o not detect war	nings exc	ept for A.9	71.		48		
		n.XDDD	Reserved p	arameter (Do no	ot change	.)					

Continued from previous page.

	Continued from prev									o page.			
Parameter No.	Size	N	lame	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence			
	2	Application Selections		0000h to 0121h	-	0010h	All	After restart	Tuning	-			
		n.□□□X	Reserved	parameter (Do no	ot change.	.)							
				ontrol Mode Sele					Refere	ence			
				Jse current contro			D004 4D0		_				
Pn009		n.□□X□	1	SERVOPACK Mo 3R8A, -5R5A, ar SERVOPACK Mo 470A, -550A, -5	nd -7R6A: odels SGD	Use currei 7S-120A,	nt control mod -180A, -200A	de 1. A, -330A, -	page 8	3-73			
			2 (Jse current contro	ol mode 2.								
			Speed Det	ection Method S	election				Refere	ence			
		n.□X□□	0 (
			1 L	Jse speed detect	ion 2.				page 8				
		n.X□□□	Reserved	parameter (Do no	ot change.	.)							
						,							
	2	Application Selections	n Function A	0000h to 1044h	-	0001h	All	After restart	Setup	-			
			Motor Sto	Motor Stopping Method for Group 2 Alarms									
		n.□□□X	0	Apply the dynami	the dynamic brake or coast the motor to a stop (use the ng method set in Pn001 = n. \(\pi\)\(\pi\)\(\pi\)\(\text{X}\). The erate the motor to a stop using the torque set in Pn406 as a aximum torque. Use the setting of Pn001 = n. \(\pi\)\(\pi\)\(\pi\)\(\pi\)\(\text{tor the after stopping.}								
			1	Decelerate the m									
			2 .	Decelerate the m	page	5-42							
			3	Decelerate the m Pn30A. Use the s stopping.									
				Decelerate the m Pn30A and then			the decelerati	on time set ir	1				
Pn00A			Stopping	Method for Force	ed Stops				Refer	ence			
				Apply the dynamistopping method				op (use the					
				1	Decelerate the m the maximum tor status after stopp	que. Use t							
		n.□□X□	2 .	Decelerate the m	otor to a s que and th	top using nen let the	the torque set motor coast.	t in Pn406 as	page 6	6-107			
			3	Decelerate the m Pn30A. Use the s stopping.	otor to a s setting of F	stop using Pn001 = n.	the decelerati □□□X for th	on time set ir e status after	e set in s after				
			Decelerate the motor to a stop using the deceleration time set in Pn30A and then let the motor coast.										
		n.□X□□	Reserved parameter (Do not change.)										
		n.X□□□	Reserved	parameter (Do n	ot change	e.)							
				, (= 5		,							

Continued	from	provious	n
Continued	HOH	DIEVIOUS	Daue.

Parameter No.	Size	N	lame	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence	
	2	Application Selections	n Function B	0000h to 1121h	-	0000h	All	After restart	Setup	-	
Pn00B		n.000X	0 Disp 1 Disp Motor Stoppi 0 Sto	ameter Display olay only setup olay all parame ng Method for the motor by oly the dynamic pping method:	paramete ters. Group 2 / setting the brake or	Alarms e speed recoast the	motor to a sto	pp (use the	Refere page 5	5-4	
		n.0X00	2 Set Power Input 9 0 Use 1 Use	sthe stopping r Selection for T a three-phase a three-phase	nethod with hree-phase power su	th Pn00A = se SERVOI pply input.	PACK	nase power	Refere page 5		
		n.X000	sup	ply input. rameter (Do no	t change.))					
	2	Application Selections	n Function s C	0000h to 0131h	_	0000h	-	After restart	Setup	page 7-27	
		n.□□□X	0 Dis	Function Selection for Test without a Motor O Disable tests without a motor. 1 Enable tests without a motor.							
			Encoder Res	solution for Tes					Applica Motor		
Pn00C		n.□□X□	1 Use 2 Use	1 Use 20 bits. 2 Use 22 bits.						у	
		n.□X□□	0 Use	e Selection for e an increment e an absolute e	al encoder		tor		Applica Motor		
		n.X□□□	Reserved pa	rameter (Do no	ot change.	.)					
	2	Application Selections	n Function s D	0000h to 2001h	_	0000h	All	Immedi- ately	Setup	page 5-34	
		n.□□□X	Reserved pa	rameter (Do no	ot change.	.)					
		n.□□X□	Reserved pa	rameter (Do no	ot change.	.)					
Pn00D		n.□X□□	Reserved pa	rameter (Do no	ot change.	.)					
		n.XППП	0 Do 1 De	larning Detection not detect overtravel served parame	ertravel wa warnings.	rnings.					

Continued from previous page.

_					0.111				1		
Parameter No.	Size		Name		Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence
	2	Application Selection	on Functior is F	1	0000h to 2011h	_	0000h	All	After restart	Setup	-
	i		Prevent	ative	Maintenance \	Narning S	Selection			Reference	20
		n.□□□X	0		ot detect preve			warnings		TIOTOTOTIC	,,,
			1		ct preventative					page 9-	17
Pn00F					· · · · · · · · · · · · · · · · · · ·			.90.			
		n. 🗆 🗆 🗆			rameter (Do no		,				
		n.□X□□	Reserve	ea par	ameter (Do no	ot change	.)				
		n.X□□□	Reserve	ed par	ameter (Do no	ot change	.)				
								1			
Pn010	2		ress Select /USB Com		0000h to 007Fh	_	0001h	All	After restart	Setup	_
Pn021	2	Reserved not chan	l parametei ge.)	r (Do	_	-	0000h	All	-	_	-
Pn022	2	not chan		•	-	-	0000h	All	-	-	_
	2	Σ-V Com tion Swite	patible Fur ch	IC-	0000h to 2111h	_	0000h	_	After restart	Setup	_
Pn040	₁ Use a				`	Applica Motor Rotar	rs				
	n	.0X00	Reserved	parai	meter (Do not						
	n	.X000	Reserved	paraı	meter (Do not	change.)					
	2	Application Selection	on Function is 80	1	0000h to 1111h	-	0000h	Linear	After restart	Setup	-
	_										
			Polarity	Senso	or Selection					Refere	nce
		n.□□□X	0		polarity senso					page 5	5-26
			1	Do r	not use polarity	sensor.				1- 290 0	
			Motor Pl	hase :	Sequence Sele	ection				Refere	nce
		n.□□X□	0		a phase-A lead		se sequen	ce of U, V, an	d W.		
Pn080			1	Set	a phase-B lead	d as a pha	se sequen	ce of U, V, ar	nd W.	page 5	-24
		n.□X□□	Reserve	d para	ameter (Do no	t change.					
			Calculat	ion M	ethod for Max	imum Spe	eed or End	oder Output	Pulses	Refere	ence
	1	n.X000	0		ulate the enco			•		2000	15.0
			1	Calculate the maximum speed for a fixed encoder output pulse setting.						10-9	
		- Collection of the Collection									

Continued	from	previous	nage
Continued	110111	previous	page.

Parameter No.	Size	N	ame	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence
	2	Application Selections		0000h to 1111h	_	0000h	All	After restart	Setup	page 6-50
Pn100 Pn101 Pn102 Pn103		n.□□X□ n.□X□□ n.X□□□ Speed Loc Time Cons Position Lo	Reserved p Reserved p Reserved p Reserved p Reserved p	ulse Output Selectory of the Dutput phase-C proparameter (Do not parameter (Do not p	oulses only oulses in boot change. ot change.	oth the for)		Immediately Immediately Immediately Immediately Immediately Immediately	Tuning Tuning Tuning Tuning Tuning	page 8-76 page 8-76 page 8-76 page 8-76
Pn104	2	Second Sp		10 to 20,000	0.1 Hz	400	All	ately Immedi-	Tuning	page
Pn105	2	Gain Second Sp Integral Tir	peed Loop ne Constant	15 to 51,200	0.01 ms	2000	All	ately Immedi- ately	Tuning	8-66 page 8-66
Pn106	2		sition Loop	10 to 20,000	0.1/s	400	All	Immedi- ately	Tuning	page 8-66
Pn109	2	Feedforwa	rd	0 to 100	1%	0	All	Immedi- ately	Tuning	page 8-87
Pn10A	2	Feedforwa Constant	rd Filter Time	0 to 6,400	0.01 ms	0	All	Immedi- ately	Tuning	page 8-87
	2	Gain Applications	cation Selec	- 0000h to 5334h	_	0000h	All		Setup	_
			Mode Swit	itching Selection					Refere	ence
			0 (1	Jse the internal to evel setting: Pn1	0Ċ).					
			1 ti	Ise the speed refing: Pn10D). Ise the speed refing: Pn181).			,			
		n.□□□X	2 L	Use the accelerating: Pn10E). Use the accelerating the acceleration is accelerated in				atery	page 8	3-90
Pn10B			3 L	etting: Pn182). Jse the position on the position of the posit			lition (level set-			
				o not use mode				When		
		n.□□X□		PI control Metho	od			Enabled	Refere	ence
		п. ББА	1 I-	P control Reserved parame	ters (Do no	ot change.)	After restart	page 8	3-82
		n.□X□□	Reserved p	parameter (Do no	ot change.	.)				
		n.X□□□	Reserved p	parameter (Do no	ot change.	.)				
Pn10C	2	Mode Swit for Torque	ching Level Reference	0 to 800	1%	200	All	Immedi- ately	Tuning	page 8-90

	Continued from previous page.										
Parameter No.	Size	N	ame		Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence
Pn10D	2	Mode Swite for Speed I			0 to 10,000	1 min ⁻¹	0	Rotary	Immedi- ately	Tuning	page 8-90
Pn10E	2	Mode Swite for Acceler		el	0 to 30,000	1 min ⁻¹ /s	0	Rotary	Immedi- ately	Tuning	page 8-90
Pn10F	2	Mode Switt for Position	ching Leven Deviation	el 1	0 to 10,000	1 refer- ence unit	0	All	Immedi- ately	Tuning	page 8-90
Pn11F	2	Position Int Constant	tegral Time	Э	0 to 50,000	0.1 ms	0	All	Immedi- ately	Tuning	page 8-92
Pn121	2	Friction Co Gain	mpensatio	n	10 to 1,000	1%	100	All	Immedi- ately	Tuning	page 8-66, page 8-70
Pn122	2	Second Fri pensation (1-	10 to 1,000	1%	100	All	Immedi- ately	Tuning	page 8-66, page 8-70
Pn123	2	Friction Co Coefficient		n	0 to 100	1%	0	All	Immedi- ately	Tuning	page 8-70
Pn124	2	Friction Co Frequency			-10,000 to 10,000	0.1 Hz	0	All	Immedi- ately	Tuning	page 8-70
Pn125	2	Friction Co Gain Corre	mpensatio ction	n	1 to 1,000	1%	100	All	Immedi- ately	Tuning	page 8-70
Pn131	2	Gain Switc	hing Time	1	0 to 65,535	1 ms	0	All	Immedi- ately	Tuning	page 8-66
Pn132	2	Gain Switc	hing Time	2	0 to 65,535	1 ms	0	All	Immedi- ately	Tuning	page 8-66
Pn135	2	Gain Switc Time 1	hing Waiti	ng	0 to 65,535	1 ms	0	All	Immedi- ately	Tuning	page 8-66
Pn136	2	Gain Switc Time 2	hing Waiti	ng	0 to 65,535	1 ms	0	All	Immedi- ately	Tuning	page 8-66
	2	Automatic ing Selection		ch-	0000h to 0052h	_	0000h	All	Immedi- ately	Tuning	page 8-66
			Gain Swi	tchi	ng Selection						
			0		e manual gain s e gain is switch		lly with the	/C	Colootion)	oianal	
			1		served paramet		,	: /G-SEL (Gail	1 Selection)	signal.	
		n.□□□X	,		e automatic gai	•	- ,	1			
			2	The sat	e gain settings isfied. The gain n A is not satisf	1 switch a settings 2	utomatical	ly to 2 when s	switching co o 1 when swi	ndition A i itching cor	s ndi-
Pn139	l		Gain Swi	tchi	ng Condition A	1					
			0		OIN (Positioning		ion Output) signal turns	ON.		
			1		OIN (Positioning		<u> </u>	,			
		n.□□X□	2		EAR (Near Outp	<u> </u>		, 5 : : : : : : : : : : : : : : : : : :			
			3		EAR (Near Outp						
			4		sition reference				lse input is (OFF.	
			5		sition reference						
		n.□X□□	Reserved	d pa	rameter (Do no	ot change.	.)				
		n.X000	Reserved	d pa	rameter (Do no	ot change.	.)				
Pn13D	2	Current Ga	in Level		100 to 2,000	1%	2000	All	Immedi- ately	Tuning	page 8-73
									Continue		.4

Continued from previous page.

Parameter No.	Size	N	lame		Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence	
	2	Model Foll trol-Relate	owing Co d Selection	n- ons	0000h to 1121h	-	0100h	All	Immedi- ately	Tuning	-	
	-	n.□□□X	0	Do n	ving Control Se	ollowing c	ontrol.			Referer		
			1		model following	,						
			Vibratio	•	opression Sele ot perform vibr		oression			Referer	ice	
		n.□□X□	1		orm vibration su			cific frequency	/.	page 8-83		
			2	Perfo	orm vibration su	uppression	for two sp	pecific frequer	ncies.			
Pn140			Vibratio	n Sup	pression Adju	stment Se	election			Reference		
		n.ロXロロ	0	tion	not adjust vibra of autotuning st reference, an		page 8-	33				
			1	aut	ust vibration suotuning withounce, and custo	t a host re		pago o				
	Ī	Speed Feedforward (VFF)/Torque Feedforward (TFF) Selection							on	Referer	ice	
		n.X□□□	0		not use model d together.	ue feedfor-	page 8-33,					
			1	Use	e model following ether.	orward	page 8-					
Pn141	2	Model Foll trol Gain	owing Co	n-	10 to 20,000	0.1/s	500	All	Immedi- ately	Tuning	page 8-83	
Pn142	2	Model Foll trol Gain C			500 to 2,000	0.1%	1000	All	Immedi- ately	Tuning	page 8-66	
Pn143	2	Model Foll trol Bias in Direction			0 to 10,000	0.1%	1000	All	Immedi- ately	Tuning	page 8-83	
Pn144	2	Model Foll trol Bias in Direction			0 to 10,000	0.1%	1000	All	Immedi- ately	Tuning	page 8-83	
Pn145	2	Vibration S Frequency		on 1	10 to 2,500	0.1 Hz	500	All	Immedi- ately	Tuning	page 8-59	
Pn146	2	Vibration S Frequency		on 1	10 to 2,500	0.1 Hz	700	All	Immedi- ately	Tuning	page 8-59	
Pn147	2	Model Foll trol Speed Compensa	Feedforv	n- vard	0 to 10,000	0.1%	1000	All	Immedi- ately	Tuning	page 8-83	
Pn148	2	Second M ing Contro		W-	10 to 20,000	0.1/s	500	All	Immedi- ately	Tuning	page 8-66	
Pn149	2		and Model Follow- Control Gain Correc-		500 to 2,000	0.1%	1000	All	Immedi- ately	Tuning	page 8-66	
Pn14A	2	Vibration S Frequency		on 2	10 to 2,000	0.1 Hz	800	All	Immedi- ately	Tuning	page 8-59	
Pn14B	2	Vibration S Correction	ation Suppression 2		10 to 1,000	1%	100	All	Immedi- ately	Tuning	page 8-59	

Continued from previous page.

				_	_			itinuea iron	· .	
Parameter No.	Size	Na	ıme	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence
	2	Control-Relations	ated Selec-	0000h to 0021h	-	0021h	All	After restart	Tuning	-
								1		
	Ī		Model Follov	ving Control Ty	pe Select	ion			Refere	ence
		n.□□□X		e model following					page 8	3-86
			1 Use	e model followi	ng control	type 2.				
Pn14F				Type Selection					Refere	ence
		n.□□X□ -		e tuning-less ty e tuning-less ty	•				page 8	2_12
				e tuning-less ty	•				page	J-10
		n.□X□□	Reserved pa	rameter (Do no	ot change.)				
		n.X000	Reserved pa	rameter (Do no	ot change.)				
	-				<u> </u>	,				
	2	Anti-Resona trol-Related		0000h to 0011h	-	0010h	All	Immedi- ately	Tuning	-
				nce Control Se	election				Refere	ence
		n.□□□X		not use anti-re		control.			page 8	3-51
				e anti-resonanc						
			Anti-Resonal	Refere	ence					
Pn160		n.□□X□	0 tion	Do not adjust anti-resonance control automatically during execution of autotuning without a host reference, autotuning with a host reference, and custom tuning.						
			1 aut	Adjust anti-resonance control automatically during execution of						
		n. 🗆 X 🗆 🗆	Reserved pa	rameter (Do no	ot change.)			1	
	-		•	•		,				
		n.X□□□	neserveu pa	rameter (Do no	n change.	1				
Pn161	2	Anti-Resona	ance Fre-	10 to 20,000	0.1 Hz	1000	All	Immedi- ately	Tuning	page 8-51
Pn162	2	Anti-Resona Correction	ance Gain	1 to 1,000	1%	100	All	Immedi- ately	Tuning	page 8-51
Pn163	2	Anti-Resona ing Gain	ance Damp-	0 to 300	1%	0	All	Immedi- ately	Tuning	page 8-51
Pn164	2	Anti-Resona Time Consta rection		-1,000 to 1,000	0.01 ms	0	All	Immedi- ately	Tuning	page 8-51
Pn165	2	Anti-Resona Time Consta rection		-1,000 to 1,000	0.01 ms	0	All	Immedi- ately	Tuning	page 8-51
Pn166	2	Anti-Resona	ance Damp-	0 to 1,000	1%	0	All	Immedi- ately	Tuning	page 8-54

Parameter	Size	N	ame	Setting	Setting	Default	Applicable	ntinued from	Classi-	s page			
No.		Tuning-less	s Function-	Range 0000h to	Unit	Setting	Motors	Enabled	fication	page			
	2	Related Se	elections	2711h	_	1401h	All	_	Setup	8-12			
			Tuning-less	Selection					Whe Enab				
		n.□□□X		isable tuning-les					Afte				
			1 E	nable tuning-less	s function.				resta	art			
			Speed Con	trol Method					When Enabled				
Pn170		n.□□X□	0 U	se for speed cor	ntrol.				After				
			1 U	se for speed cor	ntrol and u	ise host co	ntroller for po	sition control					
			Rigidity Lev	/el					Whe Enab	-			
		n.□X□□	0 to 7 S	et the rigidity lev	el.				Imme				
			Tuning-less	Whe									
		n.X□□□	0 to 2 S	et the load level	for the tur	ning-less fu	ınction.		Immedi- ately				
Pn181	2	Mode Swit for Speed	ching Level Reference										
Pn182	2	Mode Swit	ching Level										
	2		ontrol Refer- Selections	0000h to 2236h	_	0000h	All	After restart	Setup	-			
				eference Pulse Form									
		n.□□□X		Sign and pulse train, positive logic.									
			2 1	CW and CCW pulse trains, positive logic Two-phase pulse trains with 90° phase differential (phase A and									
			Т	phase B) x1, positive logic Two-phase pulse trains with 90° phase differential (phase A and									
			3 р	hase B) ×2, posi	tive logic				page (5-31			
				wo-phase pulse hase B) ×4, posi		90° phase	e differential (p	ohase A and					
			5 S	ign and pulse tra	ain, negativ	ve logic.							
			6 C	W and CCW pul	se trains,	negative Ic	gic						
			Clear Signa						Refere	ence			
Pn200		- DDVD		lear position dev									
		n.□□X□		lear position dev					page (5-33			
				lear position dev									
				·	nation on t	ine railing e	sage of the sig	griai.	D (
			Clear Oper	lear position dev	viation at a	base bloc	k (at servo Ol	F or when	Refere	ence			
		n.□X□□	0 a	arm occurs).						2.00			
			' D	o not clear posit eviation) signal).				Jear Position	page (0-33			
			2 C										
			Filter Selec						Refere	ence			
		- VDDD		1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1									
		n.X□□□		se the reference ops max.)	ınput filte	r for an op	en-collector s	ıgnal. (200	page 6-31				
			2 U	se reference inp	ut filter 2 f	or a line-dı	river signal. (1	to 4 Mpps)					

Continued from previous page.

Parameter No.	Size	N	Name		Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence
Pn205	2	Multiturn L	imit	0 to 65,535	1 rev	65535	Rotary	After restart	Setup	page 6-83
	2	Position Co	ontrol Func-	0000h to 2210h	_	0000h	All	After restart	Setup	_
		n.□□□X	Reserved p	arameter (Do no	ot change.	.)				
				ontrol Option					Refere	ence
		n.□□X□		o not use V-REF se V-REF as a sp		back input			page 8	3-89
		n.□X□□	Reserved p	arameter (Do no	ot change	.)				
Pn207			/COIN (Pos	itioning Comple	tion Outp	ut) Signal	Output Timin	g	Refe	
			0 s	output when the a ame or less than /idth).						
		n.X□□□	1 o	rutput when the a r less than the se nd the reference	etting of Pi	n522 (Posi	tioning Comp	leted Width)		6-37
			2 o	r lėss than the se	out when the absolute value of the position error is the same ss than the setting of Pn522 (Positioning Completed Width) the reference input is 0.					
						T	T	I	I	
Pn20A	4	Number of Encoder So	External cale Pitches	4 to 1,048,576	1 scale pitch/ revolu- tion	32768	Rotary	After restart	Setup	page 10-7
Pn20E	4	Electronic (Numerator		1 to 1,073,741,824	1	64	All	After restart	Setup	page 5-47
Pn210	4	Electronic (Denomina		1 to 1,073,741,824	1	1	All	After restart	Setup	page 5-47
Pn212	4	Number of Output Pul		16 to 1,073,741,824	1 P/Rev	2048	Rotary	After restart	Setup	page 6-53
Pn216	2	Position Re Acceleration tion Time C	n/Decelera-	0 to 65,535	0.1 ms	0	All	Immedi- ately after the motor stops	Setup	page 6-35
Pn217	2	Average Po	osition Referement Time	0 to 10,000	0.1 ms	0	All	Immedi- ately after the motor stops	Setup	page 6-35
Pn218	2	Reference Multiplier	Pulse Input	1 to 100	× 1	1	All	Immedi- ately	Setup	page 6-34
	2	Fully-close Selections	d Control	0000h to 1003h	-	0000h	Rotary	After restart	Setup	page 10-10
			ь .	. (0		`				
		n.□□□X		parameter (Do no		,				
Pn22A		n.□□X□		parameter (Do no		,				
		n.□X□□		arameter (Do no						
		n.X□□□		d Control Speed		k Selectio	n			
				se external enco		l.				
		Engaria: 0	Face de O to 1 Board		1 000-1			Λ f+ a :-		nace
Pn281	2	tion	utput Resolu	1 10 4,096	1 edge/ pitch	20	All	After restart	Setup	6-54
Pn282	4	Linear Enc	oder Scale	0 to 6,553,600	0.01 μm	0	Linear	After restart	Setup	5-19

Continued from previous page.

Parameter No.	Size	Name	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence
Pn300	2	Speed Reference Input Gain	150 to 3,000	0.01 V/ Rated motor speed	600	All	Immedi- ately	Setup	page 6-19, page 6-47, page 8-89
Pn301	2	Internal Set Speed 1	0 to 10,000	Rotary: 1 min ⁻¹ Direct Drive: 0.1 min ⁻¹	100	Rotary	Immedi- ately	Setup	page 6-55
Pn302	2	Internal Set Speed 2	0 to 10,000	Rotary: 1 min ⁻¹ Direct Drive: 0.1 min ⁻¹	200	Rotary	Immedi- ately	Setup	page 6-55
Pn303	2	Internal Set Speed 3	0 to 10,000	Rotary: 1 min ⁻¹ Direct Drive: 0.1 min ⁻¹	300	Rotary	Immedi- ately	Setup	page 6-55
Pn304	2	Jogging Speed	0 to 10,000	Rotary: 1 min ⁻¹ Direct Drive: 0.1 min ⁻¹	500	Rotary	Immedi- ately	Setup	page 7-7
Pn305	2	Soft Start Acceleration Time	0 to 10,000	1 ms	0	All	Immedi- ately	Setup	page 6-24
Pn306	2	Soft Start Deceleration Time	0 to 10,000	1 ms	0	All	Immedi- ately	Setup	page 6-24
Pn307	2	Speed Reference Filter Time Constant	0 to 65,535	0.01 ms	40	All	Immedi- ately	Setup	page 6-24
Pn308	2	Speed Feedback Filter Time Constant	0 to 65,535	0.01 ms	0	All	Immedi- ately	Setup	page 8-82
Pn30A	2	Deceleration Time for Servo OFF and Forced Stops	0 to 10,000	1 ms	0	All	Immedi- ately	Setup	page 5-34
Pn30C	2	Speed Feedforward Average Movement Time	0 to 5,100	0.1 ms	0	All	Immedi- ately	Setup	page 8-89
	2	Vibration Detection Selections	0000h to 0002h	-	0000h	All	Immedi- ately	Setup	page 6-99

	Vibration	Detection Selection
n.□□□X	0	Do not detect vibration.
11.000	1	Output a warning (A.911) if vibration is detected.
	2	Output an alarm (A.520) if vibration is detected.

$n.\Box X\Box\Box$	Reserved p	aramatar (D	not	change \
	neserved k	Jaiailletei (D	O HOL	Change.

n.X□□□ Reserved parameter (Do not change.)

Pn311	2	Vibration Detection Sensitivity	50 to 500	1%	100	All	Immedi- ately	Tuning	page 6-99
Pn312	2	Vibration Detection Level	0 to 5,000	1 min ⁻¹	50	Rotary	Immedi- ately	Tuning	page 6-99
Pn316	2	Maximum Motor Speed	0 to 65,535	1 min ⁻¹	10000	Rotary	After restart	Setup	page 6-16
Pn324	2	Moment of Inertia Cal- culation Starting Level	0 to 20,000	1%	300	All	Immedi- ately	Setup	page 8-31
Pn380	2	Internal Set Speed 1	0 to 10,000	1 mm/s	10	Linear	Immedi- ately	Setup	page 6-55

Continued from previous page.

Parameter No.	Size	N	ame		Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence	
Pn381	2	Internal Se	t Speed 2		0 to 10,000	1 mm/s	20	Linear	Immedi- ately	Setup	page 6-55	
Pn382	2	Internal Se	t Speed 3		0 to 10,000	1 mm/s	30	Linear	Immedi- ately	Setup	page 6-55	
Pn383	2	Jogging Sp	peed		0 to 10,000	1 mm/s	50	Linear	Immedi- ately	Setup	page 7-7	
Pn384	2	Vibration D Level	dibration Detection evel		0 to 5,000	1 mm/s	10	Linear	Immedi- ately	Tuning	page 6-99	
Pn385	2	Maximum I	Maximum Motor Speed		1 to 100	100 mm/s	50	Linear	After restart	Setup	page 6-16	
Pn400	2	Torque Ref Gain	Torque Reference Input Gain		10 to 100	0.1 V/ rated torque	30	All	Immedi- ately	Setup	page 6-41, page 8-88	
Pn401	2	First Stage Reference Constant	First Torqu Filter Time	ie	0 to 65,535	0.01 ms	100	All	Immedi- ately	Tuning	page 8-79	
Pn402	2	Forward To	orque Limit		0 to 800	1%*1	800	Rotary	Immedi- ately	Setup	page 6-64	
Pn403	2	Reverse To	orque Limit		0 to 800	1%* ¹	800	Rotary	Immedi- ately	Setup	page 6-64	
Pn404	2	Forward Ex Limit	kternal Torq	ue	0 to 800	1%*1	100	All	Immedi- ately	Setup	page 6-65, page 6-70	
Pn405	2	Reverse Ex Limit	Reverse External Torque Limit		0 to 800	1%*1	100	All	Immedi- ately	Setup	page 6-65, page 6-70	
Pn406	2	Emergency	Emergency Stop Torque		0 to 800	1%*1	800	All	Immedi- ately	Setup	page 5-33	
Pn407	2		Speed Limit during orque Control		0 to 10,000	1 min ⁻¹	10000	Rotary	Immedi- ately	Setup	page 6-46	
	2	Torque-Rel	ated Func- ions		0000h to 1111h	-	0000h	All	-	Setup	-	
	n.□□□X		0	Disa	Selection 1 able first stage				When Enabled Immediately			
			Speed Lin	Limit Selection					When Enabled	Refere	Reference	
				Use	e the smaller of ting of Pn407 a			speed and th		<u> </u>		
		n.□□X□		Use the smaller of the maximum motor speed and the setting of Pn480 as the speed limit.					e After restart	page 6	S-46	
Pn408			1	spe	Use the smaller of the overspeed alarm detection speed and the setting of Pn407 as the speed limit.					pago		
					e the smaller of eed and the set							
			Notch Filt	er S	Selection 2				When Enabled	Refere	ence	
		n.□X□□			able second st				Immedi ately	page 8	3-79	
				1 Enable second stage notch filter.				When				
		n.X□□□		Friction Compensation Function Selection				Enabled				
				Disable friction compensation. Enable friction compensation.				Immedi ately	page 8	3-70		
		Firet Stage	Notch Filte	ar.					Immedi-		nage	
Pn409	2	Frequency		/1	50 to 5,000	1 Hz	5000	All	ately	Tuning	page 8-79	

Tuning 8-79

Continued on next page.

Continued from previous page.

Parameter No.	Size	Name	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence
Pn40A	2	First Stage Notch Filter Q Value	50 to 1,000	0.01	70	All	Immedi- ately	Tuning	page 8-79
Pn40B	2	First Stage Notch Filter Depth	0 to 1,000	0.001	0	All	Immedi- ately	Tuning	page 8-79
Pn40C	2	Second Stage Notch Filter Frequency	50 to 5,000	1 Hz	5000	All	Immedi- ately	Tuning	page 8-79
Pn40D	2	Second Stage Notch Filter Q Value	50 to 1,000	0.01	70	All	Immedi- ately	Tuning	page 8-79
Pn40E	2	Second Stage Notch Filter Depth	0 to 1,000	0.001	0	All	Immedi- ately	Tuning	page 8-79
Pn40F	2	Second Stage Second Torque Reference Filter Frequency	100 to 5,000	1 Hz	5000	All	Immedi- ately	Tuning	page 8-79
Pn410	2	Second Stage Second Torque Reference Filter Q Value	50 to 100	0.01	50	All	Immedi- ately	Tuning	page 8-79
Pn412	2	First Stage Second Torque Reference Filter Time Constant	0 to 65,535	0.01 ms	100	All	Immedi- ately	Tuning	page 8-66
Pn415	2 T-REF Filter Time Constant		0 to 65,535	0.01 ms	0	All	Immedi- ately	Setup	page 6-45
	2 Torque-Related Function Selections 2		0000h to 1111h	-	0000h	All	Immedi- ately	Setup	page 8-81

	Notch F	ilter Selection 3		
n.□□□X	0	Disable third stage notch filter.		
	1	Enable third stage notch filter.		
	Notab E	ilter Selection 4		
	NOICH	inter Selection 4		
n.□□X□	0	Disable fourth stage notch filter.		
	1	Enable fourth stage notch filter.		
	Notch E	ilter Selection 5		
	NOICHT	iller Selection 5		
n.□X□□	0	Disable fifth stage notch filter.		
	1	Enable fifth stage notch filter.		
$n.X\square\square\square$	Reserve	d parameter (Do not change.)		

Pn416

Pn417	2	Third Stage Notch Filter Frequency	50 to 5,000	1 Hz	5000	All	Immedi- ately	Tuning	page 8-81
Pn418	2	Third Stage Notch Filter Q Value	50 to 1,000	0.01	70	All	Immedi- ately	Tuning	page 8-81
Pn419	2	Third Stage Notch Filter Depth	0 to 1,000	0.001	0	All	Immedi- ately	Tuning	page 8-81
Pn41A	2	Fourth Stage Notch Filter Frequency	50 to 5,000	1 Hz	5000	All	Immedi- ately	Tuning	page 8-81
Pn41B	2	Fourth Stage Notch Filter Q Value	50 to 1,000	0.01	70	All	Immedi- ately	Tuning	page 8-81
Pn41C	2	Fourth Stage Notch Filter Depth	0 to 1,000	0.001	0	All	Immedi- ately	Tuning	page 8-81
Pn41D	2	Fifth Stage Notch Filter Frequency	50 to 5,000	1 Hz	5000	All	Immedi- ately	Tuning	page 8-81
Pn41E	2	Fifth Stage Notch Filter Q Value	50 to 1,000	0.01	70	All	Immedi- ately	Tuning	page 8-81
Pn41F	2	Fifth Stage Notch Filter Depth	0 to 1,000	0.001	0	All	Immedi- ately	Tuning	page 8-80

Continued from previous page.

Parameter No.	Size	N	ame	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence	
	2	Speed Ripp sation Sele	ple Compen- ections	0000h to 1111h	_	0000h	Rotary	_	Setup	page 8-64	
		n.□□□X	0 Dis	and the second s							
Pn423		n.□□X□	tion Selection O Def	e Compensation tect A.942 alarmot detect A.9	ms.		greement War	rning Detec-	Enab Afte	When Enabled After restart	
		n.□X□□	0 Spe	e Compensation eed reference tor speed	on Enable	Condition	Selection		Enab Afte	When Enabled After restart	
		п.ХППП	Reserved pa	rameter (Do no	ot change.	.)					
Pn424	2	Torque Lim	nit at Main Cir- e Drop	0 to 100	1%*1	50	All	Immedi- ately	Setup	page 6-15	
Pn425	2	Limit at Ma	Release Time for Torque Limit at Main Circuit Voltage Drop		1 ms	100	All	Immedi- ately	Setup	page 6-15	
Pn426	2	Torque Fee Average M Time		0 to 5,100	0.1 ms	0	All	Immedi- ately	Setup	page 8-88	
Pn427	2	Speed Ripp sation Ena	ple Compen- ble Speed	0 to 10,000	1 min ⁻¹	0	Rotary	Immedi- ately	Tuning	page 8-64	
Pn456	2	Sweep Tor- ence Ampl		1 to 800	1%	15	All	Immedi- ately	Tuning	page 8-98	
	2	Notch Filte Selections	r Adjustment 1	0000h to 0101h	_	0101h	All	Immedi- ately	Tuning	page 8-15, page 8-32	
		n.□□□X	Notch Filter Adjustment Selection 1 Do not adjust the first stage notch filter automatically during execution of autotuning without a host reference, autotuning with a host reference, and custom								
			1 Adj	ing. ust the first sta hout a host refe							
Pn460		$n.\Box\Box X\Box$	Reserved pa	rameter (Do no	ot change	.)					
		n.ロXロロ	0 fun aut Adj	autotuning with a host reference, and custom tuning. Adjust the second stage notch filter automatically when the tun					ost referer	nce, 	
		n.X□□□	Reserved pa	rameter (Do no	ot change.	.)					

Continued	from	provious	naga
	11()111	THE AICHS	Daue.

					T			Cor	tinued fron	previou	s page.
Parameter No.	Size	N	ame		Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence
	2	Gravity Co Related Se		n-	0000h to 0001h	-	0000h	All	After restart	Setup	page 8-71
	١,	n.□□□X	Gravity C	omn	ensation Selec	tion					
			0	•	able gravity co		n				
			1		able gravity con						
Pn475	_		ı		ible gravity cor	препѕаног	1.				
		n.□□X□	Reserved	para	ameter (Do not	change.)					
		n.□X□□	Reserved	para	ameter (Do not	change.)					
		n.X000	Reserved	para	ameter (Do not	change.)					
Pn476	2	Gravity Co Torque	mpensatio	n	-1,000 to 1,000	0.1%	0	All	Immedi- ately	Tuning	page 8-71
Pn480	2	Speed Lim Force Con			0 to 10,000	1 mm/s	10000	Linear	Immedi- ately	Setup	page 6-46
Pn481	2	Polarity De Speed Loc	etection op Gain		10 to 20,000	0.1 Hz	400	Linear	Immedi- ately	Tuning	-
Pn482	2	Polarity De Speed Loc Time Cons	p Integral		15 to 51,200	0.01 ms	3000	Linear	Immedi- ately	Tuning	-
Pn483	2	Forward Fo	orce Limit		0 to 800	1%*1	30	Linear	Immedi- ately	Setup	page 6-64
Pn484	2	Reverse Fo	orce Limit		0 to 800	1%*1	30	Linear	Immedi- ately	Setup	page 6-64
Pn485	2	Polarity Detection Reference Speed		0 to 100	1 mm/s	20	Linear	Immedi- ately	Tuning	_	
Pn486	2	Polarity Detection Reference Acceleration/ Deceleration Time		0 to 100	1 ms	25	Linear	Immedi- ately	Tuning	-	
Pn487	2	Polarity De stant Spee		n-	0 to 300	1 ms	0	Linear	Immedi- ately	Tuning	_
Pn488	2	Polarity De ence Waiti	ng Time	fer-	50 to 500	1 ms	100	Linear	Immedi- ately	Tuning	-
Pn48E	2	Polarity De Range			1 to 65,535	1 mm	10	Linear	Immedi- ately	Tuning	-
Pn490	2	Polarity De Level			0 to 20,000	1%	100	Linear	Immedi- ately	Tuning	_
Pn495	2	Polarity De firmation F ence			0 to 200	1%	100	Linear	Immedi- ately	Tuning	-
Pn498	2	Polarity De able Error	Range		0 to 30	1 deg	10	Linear	Immedi- ately	Tuning	-
Pn49F	2	Speed Rip sation Ena	ple Compe ble Speed	en-	0 to 10,000	1 mm/s	0	Linear	Immedi- ately	Tuning	page 8-64
Pn501	2	Zero Clam	ping Level		0 to 10,000	1 min ⁻¹	10	Rotary	Immedi- ately	Setup	page 6-25
Pn502	2	Rotation D		evel	1 to 10,000	1 min ⁻¹	20	Rotary	Immedi- ately	Setup	page 6-11
Pn503	2	Speed Coi Detection 9 Width		put	0 to 100	1 min ⁻¹	10	Rotary	Immedi- ately	Setup	page 6-27
Pn506	2	Brake Refe OFF Delay	Time		0 to 50	10 ms	0	All	Immedi- ately	Setup	page 5-36
Pn507	2	Brake Refe put Speed	Level		0 to 10,000	1 min ⁻¹	100	Rotary	Immedi- ately	Setup	page 5-36
Pn508	2	Servo OFF mand Wait	ing Time		10 to 100	10 ms	50	All	Immedi- ately	Setup	page 5-36
Pn509	2	Momentary ruption Ho	y Power In Id Time	ter-	20 to 50,000	1 ms	20	All	Immedi- ately	Setup	page 6-13

Continued from previous page.

Parameter No.	Size	N	ame	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence	
	2	Input Signa	al Selection	s 0000h to FFF2h	-	2100h	All	After restart	Setup	_	
			Input Sigi	nal Allocation Mod	de				Refere	ence	
		n.□□□X	0	Use the sequence tions.	e input sigr	nal termina	ls with the de	fault alloca-		0.5	
			2	Change the seque Reserved parame	•		cations.		page	6-5	
			/S-ON (S	ervo ON) Signal A	llocation				Refere	ence	
			0	Active when CN1		ignal is Of	V (closed).		Tiolore		
			1	Active when CN1							
			2	Active when CN1							
			3	Active when CN1							
			4	Active when CN1	-44 input s	ignal is Of	V (closed).				
			5	Active when CN1-	-45 input s	ignal is Of	V (closed).				
			6	Active when CN1-	-46 input s	ignal is Of	V (closed).				
		n.□□X□	7	The signal is alwa	ys active.				page (5-17	
			8	The signal is alwa	ys inactive				pago	5 17	
			9	Active when CN1	•		· · · ·				
				A Active when CN1-41 input signal is OFF (open). B Active when CN1-42 input signal is OFF (open).							
			В	B Active when CN1-42 input signal is OFF (open). C Active when CN1-43 input signal is OFF (open).							
							,				
Pn50A			D E	Active when CN1-		_					
FIISOA			F	Active when CN1	•		,				
			/P-CON (/P-CON (Proportional Control) Signal Allocation Onto F The allocations are the same as the /S-ON (Servo ON) signal allo-							
		n.□X□□	0 to F	The allocations ar cations.	e the same	e as the /S	-ON (Servo C	N) signal allo	page 8	8-74	
			P-OT (For	ward Drive Prohil	bit) Signal	Allocation)		Refere	ence	
			0	Enable forward dr	rive when (CN1-40 inp	out signal is C	N (closed).			
			1	Enable forward dr	ive when (CN1-41 inp	out signal is C	N (closed).			
			2	Enable forward dr	rive when (CN1-42 inp	out signal is C	N (closed).			
			3	Enable forward dr				, ,			
			4	Enable forward dr				, ,			
			5	Enable forward dr							
		V	6	Enable forward dr		•		N (closed).			
		n.X□□□	7	Set the signal to a					page (5-32	
			8	Set the signal to a Enable forward dr				NEE (opon)			
			A	Enable forward dr		<u> </u>					
			В	Enable forward dr		•					
			C	Enable forward dr		•					
			D	Enable forward dr		·		(1 /			
			E	Enable forward dr		•					
			F	Enable forward dr		•					
	I										

Continued from	previous	page.

Param No	 Size	Name	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence	
	2	Input Signal Selections 2	0000h to FFFFh	_	6543h	All	After restart	Setup	_	_

	N OT /D	Division Division Division Allocation	Deference
		everse Drive Prohibit) Signal Allocation	Reference
	0	Enable reverse drive when CN1-40 input signal is ON (closed).	
	1	Enable reverse drive when CN1-41 input signal is ON (closed).	
	2	Enable reverse drive when CN1-42 input signal is ON (closed).	
	3	Enable reverse drive when CN1-43 input signal is ON (closed).	_
	4	Enable reverse drive when CN1-44 input signal is ON (closed).	
	5	Enable reverse drive when CN1-45 input signal is ON (closed).	
	6	Enable reverse drive when CN1-46 input signal is ON (closed).	
n.□□□X	7	Set the signal to always prohibit reverse drive.	page 5-32
	8	Set the signal to always enable reverse drive.	
	9	Enable reverse drive when CN1-40 input signal is OFF (open).	
	A	Enable reverse drive when CN1-41 input signal is OFF (open).	
	В	Enable reverse drive when CN1-42 input signal is OFF (open).	
	С	Enable reverse drive when CN1-43 input signal is OFF (open).	
	D	Enable reverse drive when CN1-44 input signal is OFF (open).	
	Е	Enable reverse drive when CN1-45 input signal is OFF (open).	
	F	Enable reverse drive when CN1-46 input signal is OFF (open).	
	/ALM-RS	ST (Alarm Reset) Signal Allocation	Reference
	0	Active on signal edge when CN1-40 input signal changes from OFF (open) to ON (closed).	
	1	Active on signal edge when CN1-41 input signal changes from OFF (open) to ON (closed).	
	2	Active on signal edge when CN1-42 input signal changes from OFF (open) to ON (closed).	
	3	Active on signal edge when CN1-43 input signal changes from OFF (open) to ON (closed).	
	4	Active on signal edge when CN1-44 input signal changes from OFF (open) to ON (closed).	
	5	Active on signal edge when CN1-45 input signal changes from OFF (open) to ON (closed).	
	6	Active on signal edge when CN1-46 input signal changes from OFF (open) to ON (closed).	
n.□□X□	7	Reserved parameter (Do not change.)	page 12-
	8	The signal is always inactive.	41
	9	Active on signal edge when CN1-40 input signal changes from ON (closed) to OFF (open).	
	А	Active on signal edge when CN1-41 input signal changes from ON (closed) to OFF (open).	
	В	Active on signal edge when CN1-42 input signal changes from ON (closed) to OFF (open).	
	С	Active on signal edge when CN1-43 input signal changes from ON (closed) to OFF (open).	
	D	Active on signal edge when CN1-44 input signal changes from ON (closed) to OFF (open).	
	Е	Active on signal edge when CN1-45 input signal changes from ON (closed) to OFF (open).	
	F	Active on signal edge when CN1-46 input signal changes from ON (closed) to OFF (open).	
	/P-CL (Fo	orward External Torque Limit Input) Signal Allocation	Reference
n.□X□□	0 to F	The allocations are the same as the /S-ON (Servo ON) signal allocations.	page 6-6
n.X□□□	/N-CL (R	leverse External Torque Limit Input) Signal Allocation	Reference

Continued from previous page.

Parameter No.	Size	N	ame		Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence				
	2	Input Signa 3	al Selectio	ns	0000h to FFFFh	_	8888h	All	After restart	Setup	-				
			/SPD-D	/SPD-D (Motor Direction) Signal Allocation 0 Active when CN1-40 input signal is ON (closed).											
			1		ive when CN1-			-							
			2		ive when CN1-		·	, ,		_					
			3		ive when CN1-		0	,							
			4		ive when CN1-		0	,							
			5		ive when CN1-					_					
			6					-							
		n.□□□X	7			when CN1-46 input signal is ON (closed). gnal is always active.									
			8		signal is alwa	page 6	3-55								
			9			when CN1-40 input signal is OFF (open).									
			A		ive when CN1-										
Pn50C			В		ive when CN1-		-								
			C		ive when CN1-										
			D	Act	ive when CN1-	-44 input s	signal is OF	F (open).							
			E	Act	ive when CN1-	-45 input s	signal is OF	F (open).							
			F		ive when CN1-		-								
			/SPD-A	(Inter	nal Set Speed	d Selection	n Input) Si	gnal Allocatio	n	Refere	ence				
		n.□□X□	0 to F		allocations are allocations.	e the same	e as the /S	PD-D (Motor	Direction) sig	page 6	6-55				
			/SPD-B	(Inter	nal Set Speed	d Selection	n Input) Si	gnal Allocatio	on	Refere	ence				
		n.□X□□	0 to F	The nal	allocations are	e the same	e as the /S	PD-D (Motor	Direction) sig	page 6	6-55				
			/C-SEL (Cont	rol Selection I	nput) Sigr	nal Allocat	on		Refere	ence				
		n.X□□□	0 to F		allocations ar	e the same	e as the /S	PD-D (Motor	Direction) sig	page 6	6-61				

Continued from previous page.

Parameter	(D)				Setting	Setting	Default	Applicable	When	Classi-	Refer	
No.	Size	N	ame		Range	Unit	Setting	Motors	Enabled	fication	ence	
	2	Input Signa 4	al Selectio	ns	0000h to FFFFh	-	8888h	-	After restart	Setup	_	
			/ZCLAM	P (Ze	ero Clamping I	Applicable Motors	Refere	ence				
		0 Active when CN1-40 input signal is ON (closed).										
			1	Act	ive when CN1-	41 input s	signal is ON	l (closed).				
			2	Act	ive when CN1-	42 input s	signal is ON	l (closed).				
			3	Act	ive when CN1-	43 input s	signal is ON	l (closed).				
			4	Act	ive when CN1-	44 input s	signal is ON	l (closed).				
			5	Act	ive when CN1-	45 input s	signal is ON	l (closed).				
			6	Act	ive when CN1-	46 input s	signal is ON	l (closed).				
		n.□□□X	7	The	signal is alwa	ys active.			All	page 6	3.26	
			8	The	signal is alwa	ys inactive).		All	page	3-20	
			9	Act	ive when CN1-	40 input s	signal is OF	F (open).				
			А	Acti	ive when CN1-	41 input s	signal is OF	F (open).				
			В	Acti	ive when CN1-	42 input s	signal is OF	F (open).				
Pn50D			С	Act	ive when CN1-	43 input s	signal is OF	F (open).				
				D	Acti	ive when CN1-	44 input s	signal is OF	F (open).			
			Е	Acti	ive when CN1-	45 input s	signal is OF	F (open).				
			F	Acti	ive when CN1-	46 input s	signal is OF	F (open).				
		- DDVD	/INHIBIT	(Ref	erence Pulse	Inhibit Inp	out) Signal	Allocation	Applicable Motors	Refere	ence	
		n.□□X□	0 to F		allocations are o Clamping In				All	page 6	6-39	
			/G-SEL (Gain	Selection Inp	ut) Signal	Allocation	ı	Applicable Motors	Refere	ence	
		n.□X□□	0 to F		allocations are o Clamping In				All	page 8	3-67	
		n.X□□□	/P-DET (Pola	rity Detection	Input) Sig	nal Alloca	tion	Applicable Motors	Refere	ence	
		п.хиии	0 to F		allocations are ro Clamping In				Linear	page 5	5-29	

Continued from previous page.

Parameter No.	Size	N	ame	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence
	2	Output Sig tions 1	nal Selec-	0000h to 6666h	-	3211h	All	After restart	Setup	-
			/COIN (Pos	tioning Comple	tion Outp	ut) Signal	Allocation		Refere	ence
				sabled (the abo			· · · · · · · · · · · · · · · · · · ·			
				utput the signal			· · · · · · · · · · · · · · · · · · ·			
		n.□□□X		utput the signal						
				utput the signal				ut terminal.	page	5-37
				utput the signal utput the signal			•			
				utput the signal						
Pn50E										
		n.□□X□	<u> </u>	eed Coincidend		•	, 0		Refere	ence
		П.ШЦХЦ		ne allocations ar on) signal allocat		e as the /C	OIN (Position	ing Comple-	page (6-27
			/TGON (Rot	ation Detection	Output) S	Signal Allo	cation		Refere	ence
		n.□X□□		ne allocations ar on) signal allocat		e as the /C	OIN (Position	ing Comple-	page (6-11
			/S-RDY (Se	rvo Ready) Sigr	nal Allocat	ion			Refere	ence
		n.X□□□		ne allocations ar		e as the /C	OIN (Position	ing Comple-	page (6-12
									·	
	2	Output Sig tions 2	nal Selec-	0000h to 6666h	-	0000h	All	After restart	Setup	-
			/CLT (Torque Limit Detection Output) Signal Allocation						Refere	ence
				sabled (the abo		<u> </u>				
				utput the signal						
		n.□□□X		utput the signal						2 70
				utput the signal utput the signal			· · · · · · · · · · · · · · · · · · ·	ut terminai.	page (5-73
				utput the signal			•			
Pn50F				utput the signal			•			
			/VLT (Speed	Limit Detectio	n) Signal /	Allocation			Refere	ence
		n.□□X□		ne allocations ar utput) signal allo		e as the /C	CLT (Torque Li	mit Detection	page (6-45
			/BK (Brake	Output) Signal	Allocation				Refere	ence
		n.□X□□		ne allocations ar utput) signal allo		e as the /C	CLT (Torque Li	mit Detection	page :	5-37
			/WARN (Wa	rning Output) S	ignal Allo	cation			Refere	ence
		n.X□□□	O to 6 Th	ne allocations ar utput) signal allo	e the same		CLT (Torque Li	mit Detection		
					_					

Continued from previous page.

Pn510 Pn510 Alter content Cont	Parameter No.	Size	N	lame	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence		
Pn510 Pn510 Disabled (the above signal output is not used). 1 Output the signal from the CN1-25 or CN1-26 output terminal. 2 Output the signal from the CN1-27 or CN1-28 output terminal. 3 Output the signal from the CN1-29 or CN1-30 output terminal. 4 Output the signal from the CN1-37 output terminal. 5 Output the signal from the CN1-38 output terminal. 6 Output the signal from the CN1-38 output terminal. 7 Output the signal from the CN1-38 output terminal. 8 Output the signal from the CN1-39 output terminal. 7 Output terminal. 8 Output terminal. 8 Output terminal. 8 Output terminal. 8 Output Multiplication Switching Output) Signal Reference Pulse Input Multiplication Switching Output) Signal Incession for CN1-28 are the same as the /NEAR (Near) signal allocations are the same as the /		2	Output Sig tions 3	ınal Selec-		_	0000h	All		Setup	-		
Pn510 Pn510 Disabled (the above signal output is not used). 1 Output the signal from the CN1-25 or CN1-26 output terminal. 2 Output the signal from the CN1-27 or CN1-28 output terminal. 3 Output the signal from the CN1-29 or CN1-30 output terminal. 4 Output the signal from the CN1-37 output terminal. 5 Output the signal from the CN1-38 output terminal. 6 Output the signal from the CN1-38 output terminal. 7 Output the signal from the CN1-38 output terminal. 8 Output the signal from the CN1-39 output terminal. 7 Output terminal. 8 Output terminal. 8 Output terminal. 8 Output terminal. 8 Output Multiplication Switching Output) Signal Reference Pulse Input Multiplication Switching Output) Signal Incession for CN1-28 are the same as the /NEAR (Near) signal allocations are the same as the /													
Pn510 Pn510 1				/NEAR (Near	Output) Signa	l Allocatio	n			Refere	ence		
Pn510 Pn510 2													
Pn510 A													
Pn510 4 Output the signal from the CN1-37 output terminal. 5 Output the signal from the CN1-38 output terminal. 6 Output the signal from the CN1-39 output terminal. n.□□X□ Reserved parameter (Do not change.) Posta (Reference Pulse Input Multiplication Switching Output) Signal Allocation. O to 6 The allocations are the same as the /NEAR (Near) signal allocations. Description of the signal inverse Double to the same as the /NEAR (Near) signal allocations. Description of the signal inverse Double to the sign			n.□□□X							nage (3-38		
Pn510 S									at torrilliar.	page	, 00		
Pn512 Reserved parameter (Do not change.) /PSELA (Reference Pulse Input Multiplication Switching Output) Signal Reference Allocation 0 to 6 The allocations are the same as the /NEAR (Near) signal allocapage 6-34 Dutput Signal Inverse 0000h to 0000h to 0000h All After restart Setup Page 6-8	Pn510							•					
Pn512 PSELA (Reference Pulse Input Multiplication Switching Output) Signal Reference Allocation D to 6 The allocations are the same as the /NEAR (Near) signal alloca- page 6-34 page 6-34				6 Out	put the signal	from the C	N1-39 ou	tput terminal.					
Pn512 Allocation			n.□□X□	Reserved par	rameter (Do no	ot change	.)						
Pn512 Pn512 Reserved parameter (Do not change.) Description Reserved parameter (Do not change.)					erence Pulse II	nput Multi	plication S	Switching Out	put) Signal	Refere	ence		
Pn512 2 Output Signal Inverse			n.UXUU	1 (11(n) n) 1		e the sam	e as the /N	IEAR (Near) si	gnal alloca-	page 6	3-34		
Pn512 Output Signal Inversion for CN1-25 and CN1-26 Terminals n.□□□X O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-27 and CN1-28 Terminals n.□□X□ O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-29 and CN1-30 Terminals n.□X□□ O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-37 Terminal n.X□□□ O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-37 Terminal n.X□□□ O The signal is inverted. 2 Output Signal Inverse O000h to O011h O The signal is inverted. Output Signal Inverse O000h to O011h O The signal is not inverted.			n.X□□□	Reserved par	rameter (Do no	ot change	.)						
Pn512 Output Signal Inversion for CN1-25 and CN1-26 Terminals n.□□□X O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-27 and CN1-28 Terminals n.□□X□ O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-29 and CN1-30 Terminals n.□X□□ O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-37 Terminal n.X□□□ O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-37 Terminal n.X□□□ O The signal is inverted. 2 Output Signal Inverse O000h to O011h O The signal is inverted. Output Signal Inverse O000h to O011h O The signal is not inverted.													
Pn512 Output Signal Inversion for CN1-25 and CN1-26 Terminals 0 The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-27 and CN1-28 Terminals 0 The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-29 and CN1-30 Terminals n.□X□□ OTHe signal is inverted. 1 The signal is inverted. 1 The signal is inverted. Output Signal Inversion for CN1-37 Terminal n.X□□□ OTHe signal is not inverted. 1 The signal is inverted. 2 Output Signal Inverse O000h to O11h O1000h All After restart Setup page 6-8 Output Signal Inversion for CN1-38 Terminal O The signal is not inverted.		2		ınal Inverse	0000h to	_	0000h	All		Setup	page 6-8		
Pn512 Pn512 Output Signal Inversion for CN1-27 and CN1-28 Terminals O The signal is not inverted. Output Signal Inversion for CN1-27 and CN1-28 Terminals O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-29 and CN1-30 Terminals O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-37 Terminal O The signal is not inverted. 1 The signal is inverted. 2 Output Signal Inverse Output Signal inversed. Output Signal Inversion for CN1-38 Terminal O The signal is not inverted. Output Signal Inversion for CN1-38 Terminal O The signal is not inverted.													
Pn512 Pn512 Output Signal Inversion for CN1-27 and CN1-28 Terminals O The signal is not inverted. Output Signal Inversion for CN1-27 and CN1-28 Terminals O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-29 and CN1-30 Terminals O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-37 Terminal O The signal is not inverted. 1 The signal is inverted. 2 Output Signal Inverse Output Signal inversed. Output Signal Inversion for CN1-38 Terminal O The signal is not inverted. Output Signal Inversion for CN1-38 Terminal O The signal is not inverted.				Output Signa	I Inversion for	CN1-25 a	and CN1-2	26 Terminals					
Pn512 Output Signal Inversion for CN1-27 and CN1-28 Terminals O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-29 and CN1-30 Terminals O The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-37 Terminal n.X□□□ O The signal is not inverted. 1 The signal is inverted. 2 Output Signal Inverse O000h to O011h O The signal is inverted. Output Signal Inverse O001h OUTPUT Signal Inverse O001h OUTPUT Signal Inverse O001h OUTPUT Signal Inversion for CN1-38 Terminal O The signal is not inverted.			n.□□□X								_		
Pn512 Description of the signal is not inverted.				1 The	signal is inver	ted.							
Pn512 1 The signal is inverted. Output Signal Inversion for CN1-29 and CN1-30 Terminals 0 The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-37 Terminal 0 The signal is not inverted. 1 The signal is inverted. 2 Output Signal Inverse 0000h to 0011h - 0000h All After restart Setup page 6-8 Output Signal Inversion for CN1-38 Terminal 0 The signal is not inverted.				Output Signa									
Output Signal Inversion for CN1-29 and CN1-30 Terminals 0 The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-37 Terminal 0 The signal is not inverted. 1 The signal is not inverted. 1 The signal is inverted. 2 Output Signal Inverse O000h to O011h - O000h All After restart Setup page 6-8 Output Signal Inversion for CN1-38 Terminal 0 The signal is not inverted.			n.□□X□	0 The	signal is not in	nverted.							
n.□X□□ 0 The signal is not inverted. 1 The signal is inverted. Output Signal Inversion for CN1-37 Terminal 0 The signal is not inverted. 1 The signal is not inverted. 1 The signal is inverted. 2 Output Signal Inverse 0000h to 0011h - 0000h All After restart Setup page 6-8 Output Signal Inversion for CN1-38 Terminal n.□□□X 0 The signal is not inverted.	Pn512			1 The	signal is inver	ted.							
1 The signal is inverted. Output Signal Inversion for CN1-37 Terminal 0 The signal is not inverted. 1 The signal is inverted. 2 Output Signal Inverse O000h to O011h - O000h All After restart Setup page 6-8 Output Signal Inversion for CN1-38 Terminal n.□□□X 0 The signal is not inverted.				Output Signa	I Inversion for	CN1-29	and CN1-3	30 Terminals					
Output Signal Inversion for CN1-37 Terminal O The signal is not inverted. 1 The signal is inverted. 2 Output Signal Inverse Settings 2 Output Signal Inversion for CN1-38 Terminal O The signal is not inverted.			n.□X□□		9								
n.X□□□ 0 The signal is not inverted. 1 The signal is inverted. 2 Output Signal Inverse 0000h to 0011h - 0000h All After restart Setup page 6-8 Output Signal Inversion for CN1-38 Terminal 0 The signal is not inverted.				1 The	signal is inver	ted.							
1 The signal is inverted. 2 Output Signal Inverse				Output Signa	I Inversion for	CN1-37	Terminal						
2 Output Signal Inverse 0000h to 0011h - 0000h All After restart Setup page 6-8 Output Signal Inversion for CN1-38 Terminal 0 The signal is not inverted.			n.X□□□										
Output Signal Inversion for CN1-38 Terminal Output Signal is not inverted.				1 The	signal is inver	ted.							
Output Signal Inversion for CN1-38 Terminal Output Signal is not inverted.			Outrot Oir		00001-1-		T		۸ ۲۰ - ۰۰	I			
n.□□□X 0 The signal is not inverted.		2	Settings 2	jnai inverse		_	0000h	All		Setup	6-8		
n.□□□X 0 The signal is not inverted.													
				Output Signa	I Inversion for	CN1-38	Terminal						
1 The signal is inverted			n.□□□X										
The signal is inverted.				1 The signal is inverted.									
Pn513 Output Signal Inversion for CN1-39 Terminal	Pn513			Output Signa	I Inversion for	CN1-39	Terminal						
n.□□X□ 0 The signal is not inverted.			n.□□X□										
1 The signal is inverted.				1 The	signal is inver	ted.							
n.□X□□ Reserved parameter (Do not change.)			n.□X□□	Reserved par	rameter (Do no	ot change	.)						
n.X□□□ Reserved parameter (Do not change.)			n.X□□□	Reserved par	rameter (Do no	ot change	.)						
											_		

Continued from previous page.

Parameter No.	Size	N	ame	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence	
	2	Output Sig tions 4	nal Selec-	0000h to 0666h	-	0000h	All	After restart	Setup	_	
		n.000X	Reserved pa	arameter (Do no	ot change.)					
		n.00X0	Reserved pa	arameter (Do no	ot change)					
			/PM (Preventative Maintenance Output) Signal Allocation Referen								
		n.□X□□	0 Di	Disabled (the above signal output is not used).							
Pn514			1 Ou	Output the signal from the CN1-25 or CN1-26 output terminal.							
			2 Ot	Output the signal from the CN1-27 or CN1-28 output terminal.							
			3 Ot	Output the signal from the CN1-29 or CN1-30 output terminal.						9-17	
			4 Ot	4 Output the signal from the CN1-37 output terminal.							
			5 Ot	tput the signal	from the C	N1-38 out	tput terminal.				
			6 Ot	tput the signal	from the C	N1-39 out	tput terminal.				
	I	n.X000	Reserved pa	arameter (Do no	ot change.	.)					

Continued from previous page.

Parameter No.	Size	1	Name		Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer			
	2	Input Sigr 6	nal Selecti	ons	0000h to FFFFh	_	8888h	All	After restart	Setup	-			
			SEN (Ab	solute	Data Reques	t Input) Si	gnal Alloc	ation		Refere	nce			
			0	Activ	e when CN1-4	10 input si	gnal is ON	(closed).						
			1	Activ	e when CN1-4	1 input si	gnal is ON	(closed).						
			2		e when CN1-4			· · · · · · · · · · · · · · · · · · ·						
			3		e when CN1-4	<u> </u>		, ,						
			4		e when CN1-4			,						
			5		e when CN1-4					_				
			6		e when CN1-4	<u> </u>	gnal is ON	(closed).		_				
	n	n.□□□X	7		signal is always					page 6				
			8		le when 5 V is					page 6	-90			
			9		e when CN1-4									
			A		e when CN1-4	' '		() /		_				
			В		e when CN1-4		_							
			С		e when CN1-4	' '		() /						
			D		e when CN1-4	<u> </u>		,						
			E		e when CN1-4					-				
	-		F	ACTIV	e when CN1-4	16 input si	gnai is Off	(open).						
Pn515			/PSEL (F	leferei	nce Pulse Inpi	ut Multipli	cation Swi	tching Input)	Signal Allo-	Refere	nce			
			0	Activ	e when CN1-4	10 input siç	gnal is ON	(closed).						
			1	Activ	e when CN1-4	l1 input si	gnal is ON	(closed).						
			2	Activ	e when CN1-4	l2 input si	gnal is ON	(closed).						
			3		e when CN1-4		-	•						
			4		e when CN1-4									
			5		e when CN1-4	• •		· ,						
	n	.00x0	6		e when CN1-4	<u> </u>		(closed).						
	''		7		signal is always					page 6	-34			
			8		signal is always					1 1 3 1				
			9	Activ	e when CN1-4	10 input si	gnal is OFF	(open).						
					Α		e when CN1-4							
			В	Activ	e when CN1-4									
							and in OFF			7				
			С		e when CN1-4	<u> </u>		,						
				Activ	e when CN1-4	4 input si	gnal is OFF	(open).						
			C D E	Activ	e when CN1-4 e when CN1-4	14 input siç 15 input siç	gnal is OFF gnal is OFF	(open).						
			C D	Activ	e when CN1-4	14 input siç 15 input siç	gnal is OFF gnal is OFF	(open).						
	n	.0X00	C D E F	Activ Activ	e when CN1-4 e when CN1-4	14 input siç 15 input siç 16 input siç	gnal is OFF gnal is OFF	(open).						

14.1.2 List of Parameters

Continued from previous page.

Parameter No.	Size	N	lame	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence			
	2	Input Sign	al Selections	0000h to FFFFh	_	8888h	All	After restart	Setup	_			
					II.	I.							
			FSTP (Force	d Stop Input) Si	gnal Alloc	ation			Refere	ence			
			0 E	nable drive wher	n CN1-40	input signa	al is ON (close	ed).					
			1 Enable drive when CN1-41 input signal is ON (closed).										
			2 E	Enable drive when CN1-42 input signal is ON (closed).									
				nable drive wher		. 0	,						
				nable drive wher		· ·	•						
				nable drive where		· ·	•						
				nable drive where the signal to a			•	,	_	page 6-107			
Pn516	1	n.□□□X	' st	op).					page 6				
				et the signal to a otor to stop).	always ena	able drive (always disable	e forcing the					
				nable drive wher			` '	<u> </u>					
				nable drive wher									
				nable drive wher									
				nable drive wher				-					
				nable drive whernable drive wher				-					
				nable drive where									
		~ DDVD					and 011 (open						
	n.□□X□ Reserved parameter (Do not change.) n.□X□□ Reserved parameter (Do not change.)												
	n.□X□□ Reserved para			rameter (Do no	change.)								
	_	n.X000	Reserved pa	rameter (Do not	t change.)								
					1	I	I I						
	2	Output Sig	gnal Selec-	0000h to 0666h	_	0654h	All	After restart	Setup	page 6-8			
										I			
			ALO1 (Alarm Code Output) Signal Allocation										
			0 Di	sabled (the abov	ve signal c	output is no	ot used).						
			1 Ou	utput the signal	from the C	N1-25 or	CN1-26 outpu	ut terminal.					
		n.□□□X	2 Output the signal from the CN1-27 or CN1-28 output terminal.										
			3 Output the signal from the CN1-29 or CN1-30 output terminal.										
				 Output the signal from the CN1-37 output terminal. Output the signal from the CN1-38 output terminal. 									
Pn517				·			•						
		n.□□X□		n Code Output)			0.1 (1)						
			1 U IO D	e allocations are ns.	e the same	e as the Al	-O1 (Alarm Co	ode Output) s	signal allo	ca- 			
			ALO3 (Alarn	n Code Output)	Signal All	location							
		n.□X□□	Th	e allocations are			O1 (Alarm Co	ode Output) :	sianal allo	ca-			
			1 U IO D 1 .	ns.									
		n.X□□□	Reserved pa	arameter (Do no	ot change	.)							
						,							
Pn518*2 - Safety Module-Related All -						_	_	_					
1 113 10		Parameter	S				/ WI						
		Motor-Los	d Position	2 .	1 refer-								
Pn51B	4	Deviation	Overflow	0 to 1,073,741,824	ence	1000	Rotary	Immedi- ately	Setup	page 10-8			
		Detection	Level	,,,,	unit								

page 7-20

page 7-20

14

Continued from previous page.

Parameter No.	Size	Name	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence
Pn51E	2	Position Deviation Over- flow Warning Level	10 to 100	1%	100	All	Immedi- ately	Setup	page 8-9
Pn520	4	Position Deviation Over- flow Alarm Level	1 to 1,073,741,823	1 refer- ence unit	524288 0	All	Immedi- ately	Setup	page 8-8, page 8-85
Pn522	4	Positioning Completed Width	0 to 1,073,741,824	1 refer- ence unit	7	All	Immedi- ately	Setup	page 6-37
Pn524	4	Near Signal Width	1 to 1,073,741,824	1 refer- ence unit	107374 1824	All	Immedi- ately	Setup	page 6-38
Pn526	4	Position Deviation Over- flow Alarm Level at Servo ON	1 to 1,073,741,823	1 refer- ence unit	524288 0	All	Immedi- ately	Setup	page 8-10
Pn528	2	Position Deviation Over- flow Warning Level at Servo ON	10 to 100	1%	100	All	Immedi- ately	Setup	page 8-10
Pn529	2	Speed Limit Level at Servo ON	0 to 10,000	1 min ⁻¹	10000	Rotary	Immedi- ately	Setup	page 8-10
Pn52A	2	Multiplier per Fully- closed Rotation	0 to 100	1%	20	Rotary	Immedi- ately	Tuning	page 10-8
Pn52B	2	Overload Warning Level	1 to 100	1%	20	All	Immedi- ately	Setup	page 5-44
Pn52C	2	Base Current Derating at Motor Overload Detection	10 to 100	1%	100	All	After restart	Setup	page 5-45
Pn52F	2	Monitor Display at Startup	0000h to 0FFFh	_	OFFFh	All	Immedi- ately	Setup	page 13-4
	2	Program Jogging- Related Selections	0000h to 0005h	_	0000h	All	Immedi- ately	Setup	page 7-20

		5	
		Program 0	n Jogging Operation Pattern (Waiting time in Pn535 → Forward by travel distance in Pn531) × Number of movements in Pn536
		1	(Waiting time in Pn535 → Reverse by travel distance in Pn531) × Number of movements in Pn536
Pn530		2	(Waiting time in Pn535 → Forward by travel distance in Pn531) × Number of movements in Pn536 (Waiting time in Pn535 → Reverse by travel distance in Pn531) × Number of movements in Pn536
	n.□□□X	3	(Waiting time in Pn535 → Reverse by travel distance in Pn531) × Number of movements in Pn536 (Waiting time in Pn535 → Forward by travel distance in Pn531) × Number of movements in Pn536
		4	(Waiting time in Pn535 → Forward by travel distance in Pn531 → Waiting time in Pn535 → Reverse by travel distance in Pn531) × Number of movements in Pn536
		5	(Waiting time in Pn535 → Reverse by travel distance in Pn531 → Waiting time in Pn535 → Forward by travel distance in Pn531) × Number of movements in Pn536
	n.□□X□	Reserve	d parameter (Do not change.)
	n.□X□□	Reserve	d parameter (Do not change.)
	n.X□□□	Reserve	d parameter (Do not change.)

1 reference unit

Rotary: 1 min⁻¹ Direct Drive:

0.1 min⁻¹

32768

500

ΑII

Rotary

1 to 1,073,741,824

1 to 10,000

Program Jogging Travel Distance

Program Jogging Movement Speed

Pn531

Pn533

4

2

Continued on next page.

Setup

Setup

Immediately

Immediately

14.1.2 List of Parameters

Continued from previous page.

D	r (t) Cotting Cotting		0.11.	D . (- 11		itinued fron	· .		
Parameter No.	Size	Name	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence
Pn534	2	Program Jogging Acceleration/Deceleration Time	2 to 10,000	1 ms	100	All	Immedi- ately	Setup	page 7-20
Pn535	2	Program Jogging Wait- ing Time	0 to 10,000	1 ms	100	All	Immedi- ately	Setup	page 7-20
Pn536	2	Program Jogging Number of Movements	0 to 1,000	1 time	1	All	Immedi- ately	Setup	page 7-20
Pn550	2	Analog Monitor 1 Offset Voltage	-10,000 to 10,000	0.1 V	0	All	Immedi- ately	Setup	page 9-12
Pn551	2	Analog Monitor 2 Offset Voltage	-10,000 to 10,000	0.1 V	0	All	Immedi- ately	Setup	page 9-12
Pn552	2	Analog Monitor 1 Mag- nification	-10,000 to 10,000	× 0.01	100	All	Immedi- ately	Setup	page 9-12
Pn553	2	Analog Monitor 2 Mag- nification	-10,000 to 10,000	× 0.01	100	All	Immedi- ately	Setup	page 9-12
Pn55A	2	Power Consumption Monitor Unit Time	1 to 1,440	1 min	1	All	Immedi- ately	Setup	_
Pn560	2	Residual Vibration Detection Width	1 to 3,000	0.1%	400	All	Immedi- ately	Setup	page 8-56
Pn561	2	Overshoot Detection Level	0 to 100	1%	100	All	Immedi- ately	Setup	page 8-32, page 8-40
Pn580	2	Zero Clamping Level	0 to 10,000	1 mm/s	10	Linear	Immedi- ately	Setup	page 6-25
Pn581	2	Zero Speed Level	1 to 10,000	1 mm/s	20	Linear	Immedi- ately	Setup	page 6-11
Pn582	2	Speed Coincidence Detection Signal Output Width	0 to 100	1 mm/s	10	Linear	Immedi- ately	Setup	page 6-27
Pn583	2	Brake Reference Output Speed Level	0 to 10,000	1 mm/s	10	Linear	Immedi- ately	Setup	page 5-36
Pn584	2	Speed Limit Level at Servo ON	0 to 10,000	1 mm/s	10000	Linear	Immedi- ately	Setup	page 8-10
Pn585	2	Program Jogging Movement Speed	1 to 10,000	1 mm/s	50	Linear	Immedi- ately	Setup	page 7-20
Pn586	2	Motor Running Cooling Ratio	0 to 100	1%/ Max. speed	0	Linear	Immedi- ately	Setup	-
Pn600	2	Regenerative Resistor Capacity*3	Depends on model.*4	10 W	0	All	Immedi- ately	Setup	page 5-58
Pn601	2	Dynamic Brake Resistor Allowable Energy Consumption	0 to 65,535	10 J	0	All	After restart	Setup	*5
Pn603	2	Regenerative Resistance	0 to 65,535	10 mΩ	0	All	Immedi- ately	Setup	page 5-58
Pn604	2	Dynamic Brake Resistance	0 to 65,535	10 mΩ	0	All	After restart	Setup	*5
	2	Overheat Protection Selections	0000h to 0003h	-	0000h	All	After restart	Setup	page 6-110

Pn	61	Δ	

n.□□□X	Overheat	: Protection Selection
	0	Disable overheat protection.
	1	Use overheat protection in the Yaskawa Linear Servomotor.*6
	2	Monitor a negative voltage input from a sensor attached to the machine and use overheat protection.
	3	Monitor a positive voltage input from a sensor attached to the machine and use overheat protection.

n.□□X□	Reserved parameter (Do not change.)
n. 🗆 X 🗆 🗆	Reserved parameter (Do not change.)
11.0700	neserved parameter (Do not change.)
n.X□□□	Reserved parameter (Do not change.)

Continued from previous page.

-		a a vital a manufacture de a de							
Parameter No.	Size	Name	Setting Range	Setting Unit	Default Setting	Applicable Motors	When Enabled	Classi- fication	Refer- ence
Pn61B *7	2	Overheat Alarm Level	0 to 500	0.01 V	250	All	Immedi- ately	Setup	page 6-112
Pn61C *7	2	Overheat Warning Level	0 to 100	1%	100	All	Immedi- ately	Setup	page 6-112
Pn61D *7	2	Overheat Alarm Filter Time	0 to 65,535	1 s	0	All	Immedi- ately	Setup	page 6-112
Pn621 to Pn628*2	-	Safety Module-Related Parameters	-	-	-	All	-	-	-

- *1. Set a percentage of the motor rated torque.
- *2. These parameters are for SERVOPACKs with a Safety Module. Refer to the following manual for details.

 Σ-V-Series/Σ-V-Series for Large-Capacity Models/Σ-7-Series User's Manual Safety Module (Manual No.: SIEP C720829 06)
- *3. Normally set this parameter to 0. If you use an External Regenerative Resistor, set the capacity (W) of the External Regenerative Resistor.
- *4. The upper limit is the maximum output capacity (W) of the SERVOPACK.
- *5. These parameters are for SERVOPACKs with the dynamic brake option. Refer to the following manual for details.

 Σ-7-Series AC Servo Drive Σ-7S/Σ-7W SERVOPACK with Dynamic Brake Hardware Option Specifications Product Manual (Manual No.: SIEP S800001 73)
- *6. The SGLFW2 is the only Yaskawa Linear Servomotor that supports this function.
- *7. Enabled only when Pn61A is set to n.□□□2 or n.□□□3.

14.2 Parameter Recording Table

Use the following table to record the settings of the parameters.

Parameter No.	Default Setting	Name	When Enabled
Pn000	0000h	Basic Function Selections 0	After restart
Pn001	0000h	Application Function Selections 1	After restart
Pn002	0000h	Application Function Selections 2	After restart
Pn006	0002h	Application Function Selections 6	Immediately
Pn007	0000h	Application Function Selections 7	Immediately
Pn008	0000h	Application Function Selections 8	After restart
Pn009	0010h	Application Function Selections 9	After restart
Pn00A	0001h	Application Function Selections A	After restart
Pn00B	0000h	Application Function Selections B	After restart
Pn00C	0000h	Application Function Selections C	After restart
Pn00D	0000h	Application Function Selections D	Immediately
Pn00F	0000h	Application Function Selections F	After restart
Pn010	0001h	Axis Address Selection for UART/USB Communications	After restart
Pn021	0000h	Reserved parameter	_
Pn022	0000h	Reserved parameter	_
Pn040	0000h	Σ-V Compatible Function Switch	After restart
Pn080	0000h	Application Function Selections 80	After restart
Pn081	0000h	Application Function Selections 81	After restart
Pn100	400	Speed Loop Gain	Immediately
Pn101	2000	Speed Loop Integral Time Constant	Immediately
Pn102	400	Position Loop Gain	Immediately
Pn103	100	Moment of Inertia Ratio	Immediately
Pn104	400	Second Speed Loop Gain	Immediately
Pn105	2000	Second Speed Loop Integral Time Constant	Immediately
Pn106	400	Second Position Loop Gain	Immediately
Pn109	0	Feedforward	Immediately
Pn10A	0	Feedforward Filter Time Constant	Immediately
Pn10B	0000h	Gain Application Selections	*
Pn10C	200	Mode Switching Level for Torque Reference	Immediately
Pn10D	0	Mode Switching Level for Speed Reference	Immediately on next page.

Continued from previous page.

Danses		Continued from p	
Parameter No.	Default Setting	Name	When Enabled
Pn10E	0	Mode Switching Level for Acceleration	Immediately
Pn10F	0	Mode Switching Level for Position Deviation	Immediately
Pn11F	0	Position Integral Time Constant	Immediately
Pn121	100	Friction Compensation Gain	Immediately
Pn122	100	Second Friction Compensation Gain	Immediately
Pn123	0	Friction Compensation Coefficient	Immediately
Pn124	0	Friction Compensation Frequency Correction	Immediately
Pn125	100	Friction Compensation Gain Correction	Immediately
Pn131	0	Gain Switching Time 1	Immediately
Pn132	0	Gain Switching Time 2	Immediately
Pn135	0	Gain Switching Waiting Time 1	Immediately
Pn136	0	Gain Switching Waiting Time 2	Immediately
Pn139	0000h	Automatic Gain Switching Selections 1	Immediately
Pn13D	2000	Current Gain Level	Immediately
Pn140	0100h	Model Following Control- Related Selections	Immediately
Pn141	500	Model Following Control Gain	Immediately
Pn142	1000	Model Following Control Gain Correction	Immediately
Pn143	1000	Model Following Control Bias in the Forward Direction	Immediately
Pn144	1000	Model Following Control Bias in the Reverse Direc- tion	Immediately
Pn145	500	Vibration Suppression 1 Frequency A	Immediately
Pn146	700	Vibration Suppression 1 Frequency B	Immediately
Pn147	1000	Model Following Control Speed Feedforward Com- pensation	Immediately
Pn148	500	Second Model Following Control Gain	Immediately
Pn149	1000	Second Model Following Control Gain Correction	Immediately
Pn14A	800	Vibration Suppression 2 Frequency	Immediately
Pn14B	100	Vibration Suppression 2 Correction	Immediately
Pn14F	0021h	Control-Related Selections	After restart
Pn160	0010h	Anti-Resonance Control- Related Selections	Immediately
Pn161	1000	Anti-Resonance Frequency	Immediately

Continued from previous page.

No. Default Setting Name Enable			Continued from p	
Pn163		Default Setting	Name	When Enabled
Pn164	Pn162	100		Immediately
Pn165	Pn163	0		Immediately
Pn166 0 Constant 2 Correction Immedian Pn170 1401h Anti-Resonance Damping Gain 2 Immedian Pn170 1401h Tuning-less Function-Related Selections * Pn181 0 Mode Switching Level for Speed Reference Immediance Pn182 0 Mode Switching Level for Acceleration Immediance Pn200 0000h Position Control Reference Form Selections After respectively Pn201 65535 Multiturn Limit After respectively Pn202 0000h Position Control Function Selections After respectively Pn203 32768 Number of External Encoder Scale Pitches After respectively Pn204 4 Electronic Gear Ratio (Numerator) After respectively Pn205 64 Electronic Gear Ratio (Numerator) After respectively Pn210 1 Electronic Gear Ratio (Numerator) After respectively Pn212 2048 Position Reference Acceleration Time Constant After respectively Pn215 0 Average Position Reference Movement Time After respectively	Pn164	0	Constant 1 Correction	Immediately
Pn170 1401h Tuning-less Function-Related Selections # Tuning-less Function-Related Selections # Tuning-less Function-Related Selections # Tuning-less Function-Related Selections # Mode Switching Level for Speed Reference # Mode Switching Level for Acceleration Control Reference # Pn205 # Mode Switching Level for Acceleration Control Reference # Mode Switching Level for Acceleration Selections # Mode Switching Level for Acceleration Control Selections # Mode Switching Level for Acceleration Control Reference Acceleration Time Control Reference Movement Time # Mode Switching Level for Acceleration Control Reference Movement Time # Mode Switching Level for Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Selections # Mode Switching Level for Spieck For Acceleration Switching Level for Spieck For Acceleration Switching Level for Spieck	Pn165	0		Immediately
Pn181 0	Pn166	0		Immediately
Pn182 0 Mode Switching Level for Acceleration Pn200 0000h Position Control Reference Form Selections After reform Selections A	Pn170	1401h		*
Pn200 0000h Position Control Reference Form Selections After reform Selection Selections After reform	Pn181	0		Immediately
Pn205 65535 Multiturn Limit After respections Pn207 0000h Position Control Function Selections After respectively Pn208 32768 Number of External Encoder Scale Pitches After respectively Pn209 64 Electronic Gear Ratio (Numerator) After respectively Pn210 1 Electronic Gear Ratio (Denominator) After respectively Pn212 2048 Number of Encoder Output Pulses After respectively Pn214 0 Position Reference Acceleration Time Constant Immediatory Pn215 0 Average Position Reference Movement Time Immediatory Pn217 0 Average Position Reference Movement Time After respectively Pn218 1 Reference Pulse Input Multiplier Immediatory Pn219 1 Reference Pulse Input Multiplier After respectively Pn220 0 Encoder Output Resolution After respectively Pn281 20 Encoder Output Resolution After respectively Pn282 0 Linear Encoder Scale Pitch After respectively	Pn182	0		Immediately
Pn207 0000h Position Control Function Selections After respectively. After respectivel	Pn200	0000h		After restart
Pn20A 32768	Pn205	65535	Multiturn Limit	After restart
Pn20E 64 Electronic Gear Ratio (Numerator) After re Electronic Gear Ratio (Denominator) After re Pn210 1 Electronic Gear Ratio (Denominator) After re Pn212 2048 Pn214 Pulses Position Reference Acceleration/Deceleration Time Constant Pn217 0 Average Position Reference Movement Time After re Pn218 1 Reference Pulse Input Multiplier Pn22A 0000h Pn281 20 Encoder Output Resolution After re Pn282 0 Encoder Output Resolution After re Pn300 600 Speed Reference Input Gain Internal Set Speed 1 Immed Gain Pn301 100 Internal Set Speed 3 Immed Pn304 500 Jogging Speed Immed Pn304 Soft Start Acceleration Immed Immed Pn304 Immed Pn304 Immed Pn305 Soft Start Acceleration Immed Pn306 Immed Pn307 Immed Immed Pn307 Immed Immed Pn308 Immed Immed Pn309 Immed Immed Immed Immed Pn309 Immed Immed Immed Immed Pn309 Immed Imm	Pn207	0000h	Selections	After restart
Pn210 1 1 Electronic Gear Ratio (Denominator) After respond to the property of	Pn20A	32768		After restart
Pn212 2048 Number of Encoder Output Pulses Pn216 O	Pn20E	64		After restart
Pn216 0 Pulses Position Reference Acceleration/Deceleration Time after motors Average Position Reference Acceleration Time Constant Average Position Reference Movement Time after motors Pn217 0 Reference Pulse Input Multiplier Pn218 1 Reference Pulse Input Multiplier Pn22A 0000h Fully-closed Control Selections Pn281 20 Encoder Output Resolution After reference Pn282 0 Linear Encoder Scale Pitch After reference Reference Input Gain Pn300 600 Speed Reference Input Gain Internal Set Speed 1 Immed Pn302 200 Internal Set Speed 2 Immed Pn303 300 Internal Set Speed 3 Immed Pn304 500 Jogging Speed Immed Immed Soft Start Acceleration Immed Pn305 Soft Start Acceleration Immed Immed Soft Start Acceleration Immed Immed Soft Start Acceleration Immed Immed Soft Start Acceleration Immed Soft Start Acceleration Immed Immed Soft Start Acceleration Immed Soft Start Acceleration Immed Immed Soft Start Acceleration Immed Soft Soft Soft Soft Soft Soft Soft Soft	Pn210	1		After restart
Pn216 0 ation/Deceleration Time Constant after motor state after m	Pn212	2048		After restart
Pn217 0 Average Position Reterence Movement Time after motor state after after motor state after after motor state after	Pn216	0	ation/Deceleration Time	Immediately after the motor stops
Pn22A 0000h Fully-closed Control Selections Pn281 20 Encoder Output Resolution After respond to the pn282 of	Pn217	0		Immediately after the motor stops
Pn281 20 Encoder Output Resolution After re Pn282 0 Linear Encoder Scale Pitch After re Pn300 600 Speed Reference Input Gain Immed Pn301 100 Internal Set Speed 1 Immed Pn302 200 Internal Set Speed 2 Immed Pn303 300 Internal Set Speed 3 Immed Pn304 500 Jogging Speed Immed Pn305 Soft Start Acceleration Immed	Pn218	1		Immediately
Pn2820Linear Encoder Scale PitchAfter respondence Input GainPn300600Speed Reference Input GainImmedPn301100Internal Set Speed 1ImmedPn302200Internal Set Speed 2ImmedPn303300Internal Set Speed 3ImmedPn304500Jogging SpeedImmedPn3050Soft Start AccelerationImmed	Pn22A	0000h		After restart
Pn300600Speed Reference Input GainImmedPn301100Internal Set Speed 1ImmedPn302200Internal Set Speed 2ImmedPn303300Internal Set Speed 3ImmedPn304500Jogging SpeedImmedPn3050Soft Start AccelerationImmed	Pn281	20	Encoder Output Resolution	After restart
Pn301 100 Internal Set Speed 1 Immed Pn302 200 Internal Set Speed 2 Immed Pn303 300 Internal Set Speed 3 Immed Pn304 500 Jogging Speed Immed Pn305 Soft Start Acceleration Immed	Pn282	0	Linear Encoder Scale Pitch	After restart
Pn302200Internal Set Speed 2ImmedPn303300Internal Set Speed 3ImmedPn304500Jogging SpeedImmedPn3050Soft Start AccelerationImmed	Pn300	600		Immediately
Pn303300Internal Set Speed 3ImmedPn304500Jogging SpeedImmedPn3050Soft Start AccelerationImmed	Pn301	100	Internal Set Speed 1	Immediately
Pn304 500 Jogging Speed Immed Soft Start Acceleration Immed	Pn302	200	Internal Set Speed 2	Immediately
Soft Start Acceleration Immed	Pn303	300	Internal Set Speed 3	Immediately
Soft Start Acceleration Immed	Pn304	500	Jogging Speed	Immediately
Time	Pn305	0	Soft Start Acceleration Time	Immediately
Pn306 0 Soft Start Deceleration Time Immed	Pn306	0		Immediately
Pn307 40 Speed Reference Filter Time Constant Immed	Pn307	40		Immediately
Pn308 0 Speed Feedback Filter Time Constant Immed	Pn308	0		Immediately

Continued from previous page.

Parameter	Default Setting	Name	When
No.	Delauit Setting		Enabled
Pn30A	0	Deceleration Time for Servo OFF and Forced Stops	Immediately
Pn30C	0	Speed Feedforward Average Movement Time	Immediately
Pn310	0000h	Vibration Detection Selections	Immediately
Pn311	100	Vibration Detection Sensitivity	Immediately
Pn312	50	Vibration Detection Level	Immediately
Pn316	10000	Maximum Motor Speed	After restart
Pn324	300	Moment of Inertia Calculation Starting Level	Immediately
Pn380	10	Internal Set Speed 1	Immediately
Pn381	20	Internal Set Speed 2	Immediately
Pn382	30	Internal Set Speed 3	Immediately
Pn383	50	Jogging Speed	Immediately
Pn384	10	Vibration Detection Level	Immediately
Pn385	50	Maximum Motor Speed	After restart
Pn400	30	Torque Reference Input Gain	Immediately
Pn401	100	First Stage First Torque Reference Filter Time Constant	Immediately
Pn402	800	Forward Torque Limit	Immediately
Pn403	800	Reverse Torque Limit	Immediately
Pn404	100	Forward External Torque Limit	Immediately
Pn405	100	Reverse External Torque Limit	Immediately
Pn406	800	Emergency Stop Torque	Immediately
Pn407	10000	Speed Limit during Torque Control	Immediately
Pn408	0000h	Torque-Related Function Selections	*
Pn409	5000	First Stage Notch Filter Frequency	Immediately
Pn40A	70	First Stage Notch Filter Q Value	Immediately
Pn40B	0	First Stage Notch Filter Depth	Immediately
Pn40C	5000	Second Stage Notch Filter Frequency	Immediately
Pn40D	70	Second Stage Notch Filter Q Value	Immediately
Pn40E	0	Second Stage Notch Filter Depth	Immediately
Pn40F	5000	Second Stage Second Torque Reference Filter Frequency	Immediately
Pn410	50	Second Stage Second Torque Reference Filter Q Value	Immediately
Pn412	100	First Stage Second Torque Reference Filter Time Constant	Immediately

Continued from previous page.

	Continued from previous page			
Parameter No.	Default Setting	Name	When Enabled	
Pn415	0	T-REF Filter Time Constant	Immediately	
Pn416	0000h	Torque-Related Function Selections 2	Immediately	
Pn417	5000	Third Stage Notch Filter Frequency	Immediately	
Pn418	70	Third Stage Notch Filter Q Value	Immediately	
Pn419	0	Third Stage Notch Filter Depth	Immediately	
Pn41A	5000	Fourth Stage Notch Filter Frequency	Immediately	
Pn41B	70	Fourth Stage Notch Filter Q Value	Immediately	
Pn41C	0	Fourth Stage Notch Filter Depth	Immediately	
Pn41D	5000	Fifth Stage Notch Filter Frequency	Immediately	
Pn41E	70	Fifth Stage Notch Filter Q Value	Immediately	
Pn41F	0	Fifth Stage Notch Filter Depth	Immediately	
Pn423	0000h	Speed Ripple Compensation Selections	*	
Pn424	50	Torque Limit at Main Circuit Voltage Drop	Immediately	
Pn425	100	Release Time for Torque Limit at Main Circuit Voltage Drop	Immediately	
Pn426	0	Torque Feedforward Average Movement Time	Immediately	
Pn427	0	Speed Ripple Compensa- tion Enable Speed	Immediately	
Pn456	15	Sweep Torque Reference Amplitude	Immediately	
Pn460	0101h	Notch Filter Adjustment Selections 1	Immediately	
Pn475	0000h	Gravity Compensation- Related Selections	After restart	
Pn476	0	Gravity Compensation Torque	Immediately	
Pn480	10000	Speed Limit during Force Control	Immediately	
Pn481	400	Polarity Detection Speed Loop Gain	Immediately	
Pn482	3000	Polarity Detection Speed Loop Integral Time Constant	Immediately	
Pn483	30	Forward Force Limit	Immediately	
Pn484	30	Reverse Force Limit	Immediately	
Pn485	20	Polarity Detection Reference Speed	Immediately	
Pn486	25	Polarity Detection Reference Acceleration/Deceleration Time	Immediately	
Pn487	0	Polarity Detection Constant Speed Time	Immediately	

Continued from previous page.

D		Continued from p	
Parameter No.	Default Setting	Name	When Enabled
Pn488	100	Polarity Detection Reference Waiting Time	Immediately
Pn48E	10	Polarity Detection Range	Immediately
Pn490	100	Polarity Detection Load Level	Immediately
Pn495	100	Polarity Detection Confirmation Force Reference	Immediately
Pn498	10	Polarity Detection Allowable Error Range	Immediately
Pn49F	0	Speed Ripple Compensation Enable Speed	Immediately
Pn501	10	Zero Clamping Level	Immediately
Pn502	20	Rotation Detection Level	Immediately
Pn503	10	Speed Coincidence Detection Signal Output Width	Immediately
Pn506	0	Brake Reference-Servo OFF Delay Time	Immediately
Pn507	100	Brake Reference Output Speed Level	Immediately
Pn508	50	Servo OFF-Brake Com- mand Waiting Time	Immediately
Pn509	20	Momentary Power Interruption Hold Time	Immediately
Pn50A	2100h	Input Signal Selections 1	After restart
Pn50B	6543h	Input Signal Selections 2	After restart
Pn50C	8888h	Input Signal Selections 3	After restart
Pn50D	8888h	Input Signal Selections 4	After restart
Pn50E	3211h	Output Signal Selections 1	After restart
Pn50F	0000h	Output Signal Selections 2	After restart
Pn510	0000h	Output Signal Selections 3	After restart
Pn512	0000h	Output Signal Inverse Settings	After restart
Pn513	0000h	Output Signal Inverse Settings 2	After restart
Pn514	0000h	Output Signal Selections 4	After restart
Pn515	8888h	Input Signal Selections 6	After restart
Pn516	8888h	Input Signal Selections 7	After restart
Pn517	0654h	Output Signal Selections 5	After restart
Pn51B	1000	Motor-Load Position Deviation Overflow Detection Level	Immediately
Pn51E	100	Position Deviation Over- flow Warning Level	Immediately
Pn520	5242880	Position Deviation Over- flow Alarm Level	Immediately
Pn522	7	Positioning Completed Width	Immediately
Pn524	1073741824	Near Signal Width	Immediately
Pn526	5242880	Position Deviation Over- flow Alarm Level at Servo ON	Immediately
Pn528	100	Position Deviation Over- flow Warning Level at Servo ON	Immediately

Continued from previous page.

		Continued from p	previous page.
Parameter No.	Default Setting	Name	When Enabled
Pn529	10000	Speed Limit Level at Servo ON	Immediately
Pn52A	20	Multiplier per Fully-closed Rotation	Immediately
Pn52B	20	Overload Warning Level	Immediately
Pn52C	100	Base Current Derating at Motor Overload Detection	After restart
Pn52F	0FFFh	Monitor Display at Startup	Immediately
Pn530	0000h	Program Jogging-Related Selections	Immediately
Pn531	32768	Program Jogging Travel Distance	Immediately
Pn533	500	Program Jogging Movement Speed	Immediately
Pn534	100	Program Jogging Acceleration/Deceleration Time	Immediately
Pn535	100	Program Jogging Waiting Time	Immediately
Pn536	1	Program Jogging Number of Movements	Immediately
Pn550	0	Analog Monitor 1 Offset Voltage	Immediately
Pn551	0	Analog Monitor 2 Offset Voltage	Immediately
Pn552	100	Analog Monitor 1 Magnification	Immediately
Pn553	100	Analog Monitor 2 Magnification	Immediately
Pn55A	1	Power Consumption Monitor Unit Time	Immediately
Pn560	400	Residual Vibration Detection Width	Immediately
Pn561	100	Overshoot Detection Level	Immediately
Pn580	10	Zero Clamping Level	Immediately
Pn581	20	Zero Speed Level	Immediately
Pn582	10	Speed Coincidence Detection Signal Output Width	Immediately
Pn583	10	Brake Reference Output Speed Level	Immediately
Pn584	10000	Speed Limit Level at Servo ON	Immediately
Pn585	50	Program Jogging Movement Speed	Immediately
Pn586	0	Motor Running Cooling Ratio	Immediately
Pn600	0	Regenerative Resistor Capacity	Immediately
Pn601	0	Dynamic Brake Resistor Allowable Energy Con- sumption	After restart
Pn603	0	Regenerative Resistance	Immediately
Pn604	0	Dynamic Brake Resistance	After restart
Pn61A	0000h	Overheat Protection Selections	After restart
Pn61B	250	Overheat Alarm Level	Immediately

4 4

Continued from previous page.

Parameter No.	Default Setting			Name	When Enabled
Pn61C	100			Overheat Warning Level	Immediately
Pn61D	0			Overheat Alarm Filter Time	Immediately

^{*} The enable timing depends on the digit that is changed. Refer to the following section for details.

**The enable timing depends on the digit that is changed. Refer to the following section for details.

**The enable timing depends on the digit that is changed. Refer to the following section for details.

Appendices

The appendix provides host controller connection examples, and tables of corresponding SERVOPACK and SigmaWin+ function names.


15.1	Examp	oles of Connections to Host Controllers15-2
	15.1.1	Example of Connections to MP2000/ MP3000-Series SVA-01 Motion Module 15-2
	15.1.2	Example of Connections to Yokogawa Electric's F3YP2□-0P Positioning Module
	15.1.3	for Position Control
		for Position Control
	15.1.4	Example of Connections to an OMRON Position Control Unit
	15.1.5	
		Positioning Module for Position Control 15-6
15.2	Corresp	onding SERVOPACK and SigmaWin+ Function Names 15-7
	15.2.1	Corresponding SERVOPACK Utility Function
	15.2.2	Names
		Function Names

15.1.1 Example of Connections to MP2000/MP3000-Series SVA-01 Motion Module

15.1 Examples of Connections to Host Controllers

This section provides examples of connections to host controllers.

15.1.1 Example of Connections to MP2000/MP3000-Series SVA-01 Motion Module

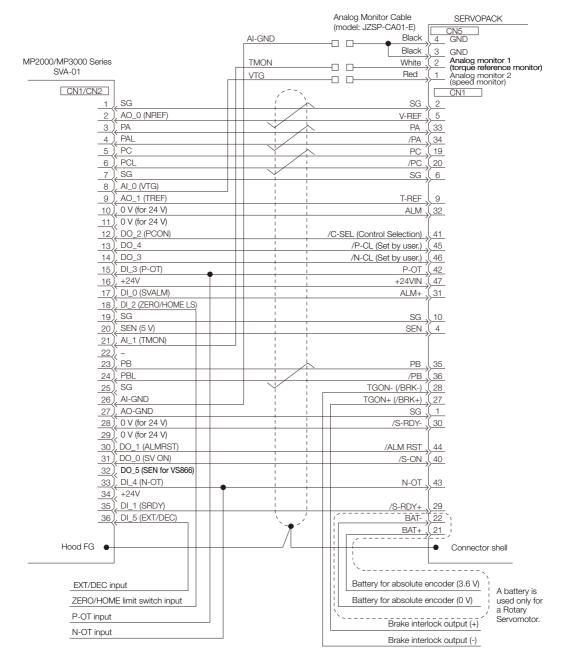


Note: 1. Cables to connect the SERVOPACK to the MP2000/MP3000 are available from Yaskawa. For details, refer to the manual for the Machine Controller.

- 2. Only signals that are applicable to the MP2000/MP3000-Series SVA-01 Motion Module and the SERVO-PACK are shown in the diagram.
- 3. The main circuit power supply for the SERVOPACK in this connection example is three-phase 200 VAC.
- 4. Incorrect wiring may damage the Machine Controller or SERVOPACK. Wire all connections carefully.
- 5. Do not wire any unused signal lines (i.e., leave them open).
- 6. The above wiring diagram shows the connections for only one axis. If you will use other axes, make connections to the SERVOPACK in the same way.
- 7. All normally closed input terminals that are not used at the Machine Controller's I/O connector section must be connected at the connector.
- 8. Set the parameters so that the servo can be turned ON and OFF with the /S-ON (Servo ON) signal.


- 9. The SERVOPACK provides safety functions to protect people from the hazardous operation of the moving parts of the machine. In order to use the safety functions, the required circuits must be configured for CN8. If the safety functions will not be used, leave the enclosed Safety Jumper Connector connected to the SERVOPACK (CN8). Refer to the following chapter for details.
 - Chapter 11 Safety Functions

15.1.2 Example of Connections to Yokogawa Electric's F3YP2□-0P Positioning Module for Position Control

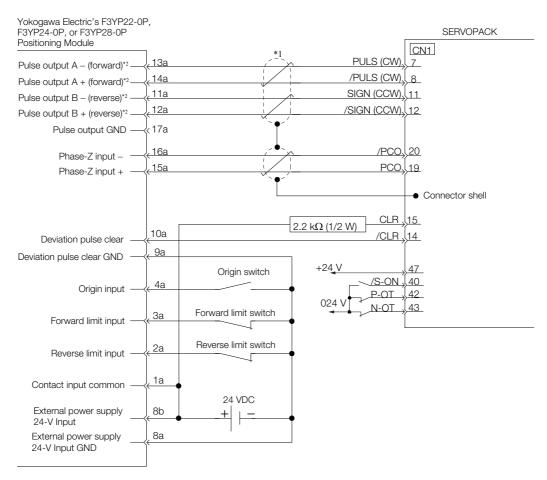


- *1. Indicates shielded twisted-pair cable.
- *2. The pulse output from Yokogawa Electric's F3YP2□-0P Positioning Module uses negative logic, so the positive and negative connections are reversed.
- Note: 1. Only signals that are applicable to the SERVOPACK and Yokogawa Electric's F3YP2□-0P Positioning Module are shown in the diagram.
 - 2. Incorrect wiring may damage the Positioning Module or SERVOPACK. Wire all connections carefully.
 - 3. Do not wire any unused signal lines (i.e., leave them open).
 - 4. The above wiring diagram shows the connections for only one axis. If you will use other axes, performing wiring to the SERVOPACK in the same way.

15.1.3 Example of Connections to Yokogawa Electric's F3NC3□-0N Positioning Module for Position Control

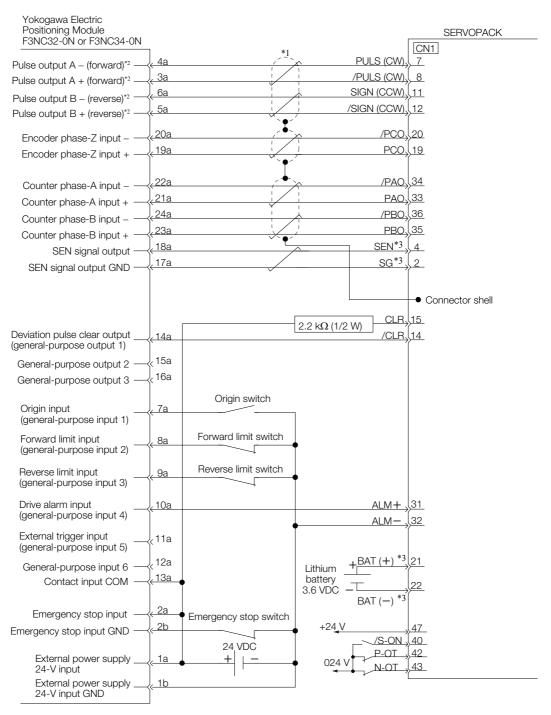


- *1. Indicates shielded twisted-pair cable.
- *2. The pulse output from Yokogawa Electric's F3NC3□-0N Positioning Module uses negative logic, so the positive and negative connections are reversed.
- *3. Connect these when using an absolute encoder.
- Note: 1. Only signals that are applicable to the SERVOPACK and Yokogawa Electric's F3NC3□-0N Positioning Module are shown in the diagram.
 - 2. Incorrect wiring may damage the Positioning Module or SERVOPACK. Wire all connections carefully.
 - 3. Do not wire any unused signal lines (i.e., leave them open).
 - 4. The above wiring diagram shows the connections for only one axis. If you will use other axes, performing wiring to the SERVOPACK in the same way.

15.1.4 Example of Connections to an OMRON Position Control Unit

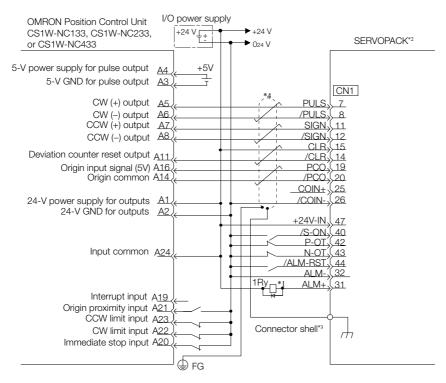

- *1. The ALM (Servo Alarm) signal is output for approximately five seconds when the power supply is turned ON. Take this into consideration when designing the power ON sequence. Also, use the ALM signal to actuate the alarm detection relay (1Ry) to stop the main circuit power supply to the SERVOPACK.
- *2. Set Pn200 to n. □□□1 (CW and CCW pulse trains with positive logic).
- *3. Connect the shielded wire to the connector shell.
- *4. represents a shielded twisted-pair cable.
- Note: 1. Only the signals that are applicable to the SERVOPACK and the OMRON Position Control Unit are shown in the diagram.
 - 2. The main circuit power supply for the SERVOPACK in this connection example is three-phase 200 VAC.
 - 3. Incorrect wiring may damage the Position Control Unit or SERVOPACK. Wire all connections carefully.
 - 4. Do not wire any unused signal lines (i.e., leave them open).
 - 5. The above wiring diagram shows the connections for only the X axis. If you will use other axes, make connections to the SERVOPACK in the same way.
 - All normally closed input terminals that are not used at the Position Control Unit's I/O connector section must be connected at the connector.
 - 7. Set the parameters so that the servo can be turned ON and OFF with the /S-ON (Servo ON) signal.
 - 8. The SERVOPACK provides safety functions to protect people from the hazardous operation of the moving parts of the machine. In order to use the safety functions, the required circuits must be configured for CN8. If the safety functions will not be used, leave the enclosed Safety Jumper Connector connected to the SERVOPACK (CN8). Refer to the following chapter for details.
 - Chapter 11 Safety Functions

15.1.5 Example of Connection to Mitsubishi's QD75D□ Positioning Module for Position Control

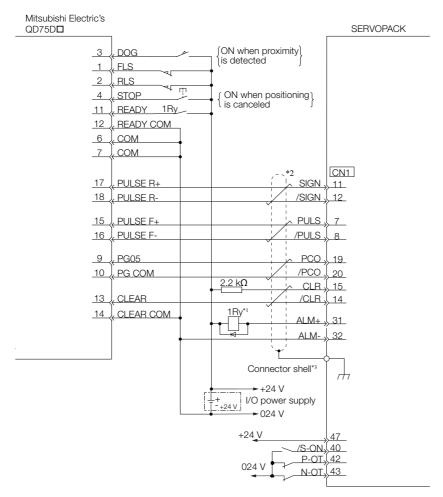

- *1. The ALM (Servo Alarm) signal is output for up to five seconds when the power supply is turned ON. Take this into consideration when designing the power ON sequence. Also, use the ALM signal to actuate the alarm detection relay (1Ry) to stop the main circuit power supply to the SERVOPACK.
- *2. represents a shielded twisted-pair cable.
- *3. Connect the shielded wire to the connector shell.
- Note: 1. Only the signals that are applicable to the SERVOPACK and Mitsubishi Electric's QD75D□ Positioning Module are shown in the diagram.
 - 2. The main circuit power supply for the SERVOPACK in this connection example is three-phase 200 VAC.
 - 3. Incorrect wiring may damage the Positioning Module or SERVOPACK. Wire all connections carefully.
 - 4. Do not wire any unused signal lines (i.e., leave them open).
 - 5. The above wiring diagram shows the connections for only one axis. If you will use other axes, make connections to the SERVOPACK in the same way.
 - All normally closed input terminals that are not used at the Positioning Module's I/O connector section must be connected at the connector.
 - 7. Set the parameters so that the servo can be turned ON and OFF with the /S-ON (Servo ON) signal.
 - 8. The SERVOPACK provides safety functions to protect people from the hazardous operation of the moving parts of the machine. In order to use the safety functions, the required circuits must be configured for CN8. If the safety functions will not be used, leave the enclosed Safety Jumper Connector connected to the SERVOPACK (CN8). Refer to the following chapter for details.
 - Chapter 11 Safety Functions

15.2

Corresponding SERVOPACK and SigmaWin+ Function Names

This section gives the names and numbers of the utility functions and monitor display functions used by the SERVOPACKs and the names used by the SigmaWin+.

15.2.1 Corresponding SERVOPACK Utility Function Names

Button in Menu Dialog Box Function Name Fn No.		SigmaWin+		SERVOPACK		
Software Reset Setup Wizard - -	Menu	Function Name	Fn No.	Function Name		
Basic Functions Setup Wizard - - Functions Feature Functions Feature Functions Fn011 Display Servomotor Model Functions Froduct Information Fn012 Display Servomotor Model Fn016 Display SERVOPACK and Servomotor IDs Fn016 Fn017 Display Servomotor ID from Feedback Option Module Fn028 Reset Absolute Encoder Multiturn Limit Setting after Multiturn Limit Disagreement Alarm Multi-turn Limit Setup Fn030 Origin Search Search Origin Fn030 Origin Search Zero Point Position Setting Fn020 Set Absolute Linear Encoder Origin Polarity Detection Fn080 Polarity Detection Motor Parameter Scale Write - - Fn000 Display Alarm History Fn014 Reset Option Module Configuration Error Alarm Trace - - Reset Motor Type Alarm Fn021 Reset Motor Type Alarm Monitor Fn004 Jog Program Trace -		Initialize	Fn005	Initializing Parameters		
Basic Functions I/O Signal Allocation - - Functions Fn011 Display Servomotor Model Fn012 Display Software Version Fn01E Display SERVOPACK and Servomotor IDs Fn01F Display Servomotor ID from Feedback Option Module Fn01F Display Servomotor ID from Feedback Option Module Reset Absolute Encoder Fn008 Reset Absolute Encoder Multi-turn Limit Setup Fn013 Multiturn Limit Setting after Multiturn Limit Disagreement Alarm Search Origin Fn003 Origin Search Zero Point Position Setting Fn020 Set Absolute Linear Encoder Origin Polarity Detection Fn080 Polarity Detection Motor Parameter Scale Write - Fn000 Display Alarm History Fn006 Clear Alarm History Fn014 Reset Option Module Configuration Error Alarm Trace - Reset Motor Type Alarm Fn021 Reset Motor Type Alarm Operation Fn002 Jog Program JOG Operation Fn004 Jog Program Monitor - - Monitor - -		Software Reset	Fn030	Software Reset		
Find to the product Information Find the pr		Setup Wizard	_	_		
Functions Product Information Product Information Fn011 Display Servomotor Model Fn012 Display Software Version Fn01E Display SERVOPACK and Servomotor IDs Fn01F Display Servomotor ID from Feedback Option Module Fn008 Reset Absolute Encoder Multi-turn Limit Setup Fn013 Multiturn Limit Setting after Multiturn Limit Disagreement Alarm Search Origin Fn003 Origin Search Zero Point Position Setting Polarity Detection Motor Parameter Scale Write Fn000 Display Alarm History Fn006 Clear Alarm History Fn014 Reset Option Module Configuration Error Alarm Trace Reset Motor Type Alarm Fn021 Reset Motor Type Alarm Jog Program JOG Operation Fn004 Jog Program Fn005 Polarity Detection Fn006 Polarity Detection Fn006 Clear Alarm History Fn017 Reset Motor Type Alarm Fn018 Polarity Polarity Fn019 Polarity Detection Fn019 Polarity Detection Fn010 Display Alarm History Fn011 Reset Motor Type Alarm Fn011 Reset Motor Type Alarm Fn011 Polarity Polarity Fn012 Polarity Fn013 Polarity Detection Fn014 Polarity Detection Fn015 Polarity Detection Fn016 Clear Alarm History Fn017 Reset Motor Type Alarm Fn018 Polarity Polarity Fn019 Polarity Detection Fn019 Polarity Detection Fn010 Display Alarm History Fn010 Display Alarm History Fn011 Polarity Detection Fn011 Polarity Detection Fn011 Polarity Detection Fn012 Polarity Detection Fn013 Polarity Detection Fn013 Polarity Detection Fn014 Polarity Detection Fn014 Polarity Detection Fn011 Polarity Detection Fn011 Polarity Detection Fn012 Polarity Detection Fn012 Polarity Detection	Racio	I/O Signal Allocation	_	_		
Product Information Fn01E Display SERVOPACK and Servomotor IDs Fn01F Display Servomotor ID from Feedback Option Module Reset Absolute Encoder Multi-turn Limit Setup Search Origin Zero Point Position Setting Polarity Detection Motor Parameter Scale Write Trouble-shooting Display Alarm Display Alarm Display Alarm Fn000 Display Alarm History Fn004 Clear Alarm History Fn014 Reset Option Module Configuration Error Alarm Trace Reset Motor Type Alarm Fn002 Jog Program JOG Operation Fn004 Jog Program Monitor Fn015 Display SERVOPACK and Servomotor IDs Display Search Option Foodate Multi-turn Limit Display Alarm Multiturn Limit Display Search Seat Absolute Linear Encoder Origin Fn000 Display Alarm History Fn006 Clear Alarm History Fn014 Reset Option Module Configuration Error Alarm Trace Pn021 Reset Motor Type Alarm Jog Program JOG Operation Fn004 Jog Program Trace Real Time Trace Pn006 Program Alarm Trace Pn007 Display Alarm Fn008 Polarity Detection Josepha Alarm History Fn009 Display Alarm History Fn009 Display Alarm History Fn009 Display Alarm History Fn009 Display Alarm History Fn000 Display Alarm History Fn000 Display Alarm History Fn0014 Reset Option Module Configuration Error Alarm Trace Pn001 Reset Motor Type Alarm Jog Program JOG Operation Fn001 Jog Program Trace Pn002 Jog Program Jog Operation Fn004 Jog Program			Fn011	Display Servomotor Model		
Proof Proo			Fn012	Display Software Version		
Reset Absolute Encoder		Product Information	Fn01E	Display SERVOPACK and Servomotor IDs		
Hencoder Setting Encoder Setting Search Origin Search Origin Fn003 Fn003 Fn003 Origin Search Zero Point Position Setting Polarity Detection Motor Parameter Scale Write Fn000 Fn000 Display Alarm History Fn001 Fn006 Clear Alarm History Fn0014 Reset Option Module Configuration Error Alarm Trace Reset Motor Type Alarm Fn002 Program JOG Operation Fn004 Jog Program Fn005 Fn006 Fn006 Fn007 Fn008			Fn01F			
Encoder Setting Search Origin Search Origin Search Origin Fn003 Set Absolute Linear Encoder Origin Polarity Detection Motor Parameter Scale Write Fn000 Fn000 Display Alarm Fn000 Display Alarm History Fn006 Clear Alarm History Fn014 Reset Option Module Configuration Error Alarm Trace Reset Motor Type Alarm Fn002 Program JOG Operation Fn004 Jog Program Fn004 Jog Program Fn005 Fn006 Fn006 Fn007 Fn008 Fn009	Reset Absolute Encoder	Fn008	Reset Absolute Encoder			
Setting Search Origin Fn003 Origin Search Zero Point Position Setting Fn020 Set Absolute Linear Encoder Origin Polarity Detection Fn080 Polarity Detection Motor Parameter Scale Write – – Fn000 Display Alarm History Fn014 Reset Option Module Configuration Error Alarm Trace – – Reset Motor Type Alarm Fn021 Reset Motor Type Alarm Operation Fn002 Jog Program JOG Operation Fn004 Jog Program Monitor – – Monitor – –		Multi-turn Limit Setup	Fn013			
Zero Point Position Setting Fn020 Set Absolute Linear Encoder Origin		Search Origin	Fn003	Origin Search		
Motor Parameter Scale Write - - Trouble-shooting Shooting Display Alarm Fn000 Display Alarm History Fn006 Clear Alarm History Fn014 Reset Option Module Configuration Error Alarm Trace - - Reset Motor Type Alarm Fn021 Reset Motor Type Alarm Operation Fn002 Jog Program JOG Operation Fn004 Jog Program Monitor - Monitor -	Setting	Zero Point Position Setting	Fn020	Set Absolute Linear Encoder Origin		
Trouble-shooting Display Alarm Display Alarm Display Alarm Fn000 Clear Alarm History Fn014 Reset Option Module Configuration Error Alarm Trace Reset Motor Type Alarm Fn021 Reset Motor Type Alarm Fn002 Display Alarm History Fn014 Reset Option Module Configuration Error Fn021 Reset Motor Type Alarm Fn002 Jog Program JOG Operation Fn004 Jog Program Trace Real Time Trace Monitor - Monitor - - - - - - - - - - - - -		Polarity Detection	Fn080	Polarity Detection		
Trouble-shooting Display Alarm Fn006 Clear Alarm History Fn014 Reset Option Module Configuration Error Alarm Trace Reset Motor Type Alarm Fn021 Reset Motor Type Alarm Jog Fn002 Jog Program JOG Operation Fn004 Jog Program Trace Real Time Trace Monitor Monitor		Motor Parameter Scale Write	_	_		
Trouble-shooting Fn014 Reset Option Module Configuration Error Alarm Trace - - Reset Motor Type Alarm Fn021 Reset Motor Type Alarm Operation Jog Fn002 Jog Program JOG Operation Fn004 Jog Program Trace - - Real Time Trace - - Monitor - -			Fn000	Display Alarm History		
Shooting	T	Display Alarm	Fn006	Clear Alarm History		
Alarm Trace			Fn014	Reset Option Module Configuration Error		
Operation Jog Program JOG Operation Fn002 Fn004 Fn0	oncomig	Alarm Trace	_	-		
Operation Program JOG Operation Fn004 Jog Program Monitor Trace - - Monitor - -		Reset Motor Type Alarm	Fn021	Reset Motor Type Alarm		
Program JOG Operation	Operation	Jog	Fn002	Jog		
Monitor Real Time Trace - - Monitor - -	Operation	Program JOG Operation	Fn004	Jog Program		
Monitor — —		Trace	_	_		
Monitor – –	Monitor	Real Time Trace	_	_		
Life Monitor – –	IVIOLIITOI	Monitor	_	_		
		Life Monitor	_	_		

15.2.1 Corresponding SERVOPACK Utility Function Names

Continued from previous page.

	SigmaWin+	SERVOPACK		
Button in Menu Dialog Box	Function Name	Fn No.	Function Name	
	Tuning - Autotuning without Host Reference	Fn201	Advanced Autotuning without Reference	
	Tuning - Autotuning with Host Reference	Fn202	Advanced Autotuning with Reference	
	Tuning - Custom Tuning	Fn203	One-Parameter Tuning	
Tuning	Tuning - Custom Tuning - Adjust Anti-resonance Control	Fn204	Adjust Anti-resonance Control	
	Tuning - Custom Tuning - Vibration Suppression	Fn205	Vibration Suppression	
	System Tuning	_	-	
	Response Level Setting	Fn200	Tuning-less Level Setting	
	Edit Online Parameters	_	-	
-	Mechanical Analysis	_	-	
Diognostio	Easy FFT	Fn206	Easy FFT	
Diagnostic	Ripple Compensation	_	-	
	Online Vibration Monitor	_	-	
	Adjust the Speed and Torque Reference Offset	Fn009	Autotune Analog (Speed/ Torque) Reference Offset	
		Fn00A	Manually Adjust Speed Reference Offset	
		Fn00B	Manually Adjust Torque Reference Offset	
	Adjust the Analog Monitor Output	Fn00C	Adjust Analog Monitor Output Offset	
	Adjust the Analog Monitor Output	Fn00D	Adjust Analog Monitor Output Gain	
	Adjust the Motor Current Detec-	Fn00E	Autotune Motor Current Detection Signal Offset	
Others	tion Offsets	Fn00F	Manually Adjust Motor Current Detection Signal Offset	
	Initialize Vibration Detection Level	Fn01B	Initialize Vibration Detection Level	
	Parameter Converter	_	-	
	SERVOPACK Axis Name Setting	_	-	
	Write Prohibited Setting	Fn010	Write Prohibition Setting	
	Motor Parameter SERVOPACK Write	_	-	

15.2.2 Corresponding SERVOPACK Monitor Display Function Names

SigmaWin+		SERVOPACK		
Button in Menu Dialog Box	Name [Unit]	Un No.	Name [Unit]	
	Motor Speed [min ⁻¹]	Un000	Motor Speed [min ⁻¹]	
	Speed Reference [min ⁻¹]	Un001	Speed Reference [min ⁻¹]	
	Torque Reference [%]	Un002	Torque Reference [%] (percentage of rated torque)	
	 Rotary Servomotors: Rotational Angle 1 [encoder pulses] (number of encoder pulses from origin within one encoder rotation) Linear Servomotors: Electrical Angle 1 [linear encoder pulses] (linear encoder pulses from the polarity origin) 	Un003	Rotary Servomotors: Rotational Angle 1 [encoder pulses] (number of encoder pulses from origin within one encoder rotation displayed in decimal) Linear Servomotors: Electrical Angle 1 [linear encoder pulses] (linear encoder pulses from the polarity origin displayed in decimal)	
	Rotary Servomotors: Rotational Angle 2 [deg] (electrical angle from origin within one encoder rotation) Linear Servomotors: Electrical Angle 2 [deg] (electrical angle from polarity origin)	Un004	 Rotary Servomotors: Rotational Angle 2 [deg] (electrical angle from polarity origin) Linear Servomotors: Electrical Angle 2 [deg] (electrical angle from polarity origin) 	
	Input Reference Pulse Speed [min ⁻¹]	Un007	Input Reference Pulse Speed [min ⁻¹] (displayed only during position control)	
Motion	Position Deviation [reference units]	Un008	Position Error Amount [reference units] (displayed only during position control)	
Motion Monitor	Accumulated Load Ratio [%]	Un009	Accumulated Load Ratio [%] (percentage of rated torque: effective torque in cycles of 10 seconds)	
	Regenerative Load Ratio [%]	Un00A	Regenerative Load Ratio [%] (percentage of processable regenerative power: regenerative power consumption in cycles of 10 seconds)	
	Dynamic Brake Resistor Power Consumption [%]	Un00B	Power Consumed by DB Resistance [%] (percentage of processable power at DB activation: displayed in cycles of 10 seconds)	
	Input Reference Pulse Counter [reference units]	Un00C	Input Reference Pulse Counter [reference units]	
	Feedback Pulse Counter [encoder pulses]	Un00D	Feedback Pulse Counter [encoder pulses]	
	Fully-closed Loop Feedback Pulse Counter [external encoder resolu- tion]	Un00E	Fully-closed Loop Feedback Pulse Counter [external encoder resolution]	
	Upper Limit Setting of Motor Maximum Speed/Upper Limit Setting of Encoder Output Resolution	Un010*1	Upper Limit Setting of Motor Maximum Speed/ Upper Limit Setting of Encoder Output Resolu- tion	
	Total Operation Time [100 ms]	Un012	Total Operation Time [100 ms]	
	Feedback Pulse Counter [reference units]	Un013	Feedback Pulse Counter [reference units]	
	Overheat Protection Input [0.01 V]	Un02F	Overheat Protection Input [0.01 V]	
	Power Consumption [W]	Un032	Power Consumption [W]	
	Consumed Power [0.001 Wh]	Un033	Consumed Power [0.001 Wh] Continued on next page.	

15.2.2 Corresponding SERVOPACK Monitor Display Function Names

Continued from previous page.

Button in Menu Name [Unit] Un No. Name [Unit] Un No. Name [Unit]		SigmaWin+		SERVOPACK
Motion Monitor	Menu	Name [Unit]	Un No.	Name [Unit]
Motion Monitor Position within One Rotation of Absolute Encoder [encoder pulses] Lower Bits of Absolute Encoder Position [encoder pulses] Un042 Lower Bits of Absolute Encoder Position [encoder pulses] Un043 Un044 Lower Bits of Absolute Encoder Position [encoder pulses] Un043 Upper Bits of Absolute Encoder Position [encoder pulses] Un043 Upper Bits of Absolute Encoder Position [encoder pulses] Un043 Upper Bits of Absolute Encoder Position [encoder pulses] Un044 Un045 Upper Bits of Absolute Encoder Position [encoder pulses] Un045 Upper Bits of Absolute Encoder Position [encoder pulses] Un046 Upper Bits of Absolute Encoder Position [encoder pulses] Un047 Upper Bits of Absolute Encoder Position [encoder pulses] Un046 Upper Bits of Absolute Encoder Position [encoder pulses] Un047 Upper Bits of Absolute Encoder Position [encoder pulses] Un047 Upper Bits of Absolute Encoder Position [encoder pulses] Un048 Upper Bits of Absolute Encoder Position [encoder pulses] Un048 Upper Bits of Absolute Encoder Position [encoder pulses] Un048 Upper Bits of Absolute Encoder Position [encoder pulses] Un048 Upper Bits of Absolute Encoder Position [encoder pulses] Un048 Upper Bits of Absolute Encoder Position [encoder pulses] Un048 Upper Bits of Absolute Encoder Position [encoder pulses] Un048 Upper Bits of Absolute Encoder Position [encoder Position [encoder Position [encoder pulses] Upper Bits of Absolute Encoder Position [encoder			Un034	Cumulative Power Consumption [Wh]
Absolute Encoder [encoder pulses] Un041 Encoder [encoder pulses] Lower Bits of Absolute Encoder Position [encoder pulses] Un042 Lower Bits of Absolute Encoder Position [encoder pulses] Un043 Un045 Un046 Un046 Un047 Un047 Un047 Un047 Un048 Un0		Absolute Encoder Multiturn Data	Un040	Absolute Encoder Multiturn Data
Lower Bits of Absolute Encoder Position [encoder pulses] Upper Bits of Absolute Encoder Position [encoder pulses] Upper Bits of Absolute Encoder Position [encoder pulses] Upper Bits of Absolute Encoder Position [encoder pulses] Polarity Sensor Signal Monitor Un011 Polarity Sensor Signal Monitor Effective Gain Monitor (gain settings 1 = 1, gain settings 2 = 2) Safety I/O Signal Monitor Un015 Safety I/O Signal Monitor Input Signal Monitor Un005 Input Signal Monitor Un005 Input Signal Monitor Output Signal Monitor Un006 Output Signal Monitor Un006 Output Signal Monitor Installation Environment Monitor — SERVOPACK Installation Environment Monitor — Servomotor*2 Service Life Prediction Monitor Un026 Servomotor Installation Environment Monitor — Service Life Prediction Monitor — Un027 Un027 Built-in Fan Remaining Life Ratio [%] Service Life Prediction Monitor — Service Life Predicti			Un041	
Position [encoder pulses] On043 [encoder pulses]			Un042	
Status Monitor Active Gain Monitor Battus Monitor Active Gain Monitor Safety I/O Signal Monitor Input Signal Monitor Output Signal Monitor SERVOPACK Installation Environment Monitor [%] Service Life Prediction Monitor – Un026 Service Life Prediction Monitor – Un027 Service Life Prediction Monitor – Un028 Capacitor Remaining Life Ratio [%] Service Life Prediction Monitor – Un029 Surge Prevention Circuit Remaining Life Ratio [%] Product Information Motor – Resolution Motor – Resolution Un084 Un085 Un085 Un086 [pm]) Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) Un084 \ 10 ^{Un085} [pm]) Un085 Capacitor Service Life Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm])			Un043	
Monitor Safety I/O Signal Monitor Un015 Safety I/O Signal Monitor		Polarity Sensor Signal Monitor	Un011	
Input Signal Monitor		Active Gain Monitor	Un014	
Input Signal Monitor		Safety I/O Signal Monitor	Un015	Safety I/O Signal Monitor
Signal Monitor Un006 Output Signal Monitor Un006 Output Signal Monitor	Signal	Input Signal Monitor	Un005	Input Signal Monitor
SERVOPACK Un025 [%]	Signal	Output Signal Monitor	Un006	Output Signal Monitor
Service Life Monitor Service Life Prediction Monitor – Built-in Fan Service Life Prediction Monitor – Built-in Fan Service Life Prediction Monitor – Capacitor Service Life Prediction Monitor – Capacitor Service Life Prediction Monitor – Surge Prevention Circuit Service Life Prediction Monitor – Dynamic Brake Circuit Product Information Motor – Resolution Motor – Resolution Linear Encoder Pitch (Scale pitch = Un084 × 10 ^{Un085} [pm]) Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm])			Un025	
Built-in Fan Service Life Monitor Service Life Prediction Monitor Uno28 Capacitor Remaining Life Ratio [%]			Un026	
tor Service Life Prediction Monitor – Capacitor Service Life Prediction Monitor – Surge Prevention Circuit Remaining Life Ratio [%] Service Life Prediction Monitor – Surge Prevention Circuit Remaining Life Ratio [%] Service Life Prediction Monitor – Dynamic Brake Circuit Product Information Motor – Resolution Un024 Dynamic Brake Circuit Remaining Life Ratio [%] Un025 Linear Encoder Pitch (Scale pitch = Un084 × 10 ^{Un085} [pm]) Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) Un026 Rated Motor Speed [min ⁻¹]			Un027	Built-in Fan Remaining Life Ratio [%]
Surge Prevention Circuit Service Life Prediction Monitor – Dynamic Brake Circuit Product Information Motor – Resolution Un084 Un085 Un085 Un086 [%] Un02A Dynamic Brake Circuit Remaining Life Ratio [%] Linear Encoder Pitch (Scale pitch = Un084 × 10 ^{Un085} [pm]) Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) Un085 Un086 Rated Motor Speed [min ⁻¹]			Un028	Capacitor Remaining Life Ratio [%]
Product Information Motor – Resolution Un084 Un084 Linear Encoder Pitch (Scale pitch = Un084 × 10 ^{Un085} [pm]) Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) Un085 Un086 Un087 Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) Un087 Un088 Un088 Un089 Un089 Product Information Un089 Un080 Un080 Rated Motor Speed [min ⁻¹]			Un029	
Product Information Motor – Resolution Un084 10 ^{Un085} [pm]) Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) – Un020 Rated Motor Speed [min ⁻¹]			Un02A	Dynamic Brake Circuit Remaining Life Ratio [%]
tion Un085 Linear Encoder Pitch Exponent (Scale pitch = Un084 × 10 ^{Un085} [pm]) Un020 Rated Motor Speed [min ⁻¹]		Motor Resolution	Un084	Linear Encoder Pitch (Scale pitch = $\overline{\text{Un084}} \times 10^{\text{Un085}}$ [pm])
-		INOTOL - DESOLUTION	Un085	
- Un021 Maximum Motor Speed [min ⁻¹]		_	Un020	Rated Motor Speed [min ⁻¹]
		_	Un021	Maximum Motor Speed [min ⁻¹]

^{*1.} You can use Un010 to monitor the upper limit setting for the maximum motor speed or the upper limit setting for the encoder output resolution.

Output Pulses).

You can monitor the upper limit of the encoder output resolution setting (Pn281) for the current maximum motor speed setting (Pn385), or you can monitor the upper limit of the maximum motor speed setting for the current encoder output resolution setting.

Select which signal to monitor with Pn080 = n.XDDD (Calculation Method for Maximum Speed or Encoder Output Pulper)

<sup>If Pn080 = n.0□□□, the encoder output resolution (Pn281) that can be set is displayed.
If Pn080 = n.1□□□, the maximum motor speed (Pn385) that can be set is displayed in mm/s.</sup>

^{*2.} This applies to the following motors. The display will show 0 for all other models. SGM7M, SGM7J, SGM7A, SGM7P, SGM7G, SGMMV, SGM7E, SGM7F, and SGMCV



wiring - - - - - - - - 4-24 additional adjustment functions -----8-66 alarm code output - - - - - - - - - - - - 12-5 **Symbols** alarm reset possibility - - - - - - - - - - - - 12-5 /ALM-RST - - - -- - - - - - 12-41 alarm tracing - - - - - - - - 9-18 /ALM-RST (Alarm Reset Input) signal - - - - - - 12-41 ALM - - - - - - - - - 6-9 /BK-----5-37 ALM (Servo Alarm) signal - - - - - - - - - - - - 6-9 /BK (Brake) signal - - - - - - - - - - - - - - - - 5-37 ALO1 ------6-10 ALO2 -----6-10 /COIN (Positioning Completion) signal - - - - - - - - 6-37 ALO3 -----6-10 /C-SEL------6-61 analog input circuits - - - - - - - - - - - 4-45 Analog Monitor Connector - - - - - - - - - - - 4-52 /G-SEL ------8-67 analog monitor factors -----9-12 anti-resonance control -----8-51 automatic detection of connected motor - - - - - - 5-16 automatic gain switching - - - - - - - - - - 8-67 automatic notch filters-----8-32 /N-CL (Reverse External Torque Limit) signal - - - - - - 6-65 autotuning with a host reference - - - - - - - - - 8-35 autotuning without a host reference - - - - - - - - 8-24 /NEAR (Near) signal ------6-38 /P-CL -------6-65 В /P-CL (Forward External Torque Limit) signal - - - - - - 6-65 base block (BB) - - - - - -battery replacement - - - - - - - - 12-3 /P-CON (Proportional Control) signal - - - - - - - - - - - - - - - - - 8-75 block diagram -----2-12 brake operation delay time - - - - - - - - - 5-36 brake release delay time -----5-36 /S-ON (Servo ON) signal- - - - - - - - - - - - - - 5-17 C /SPD-A ------6-55 CCW -----5-18 /SPD-B -------6-55 clearing alarm history - - - - - - - 12-43 CLR - - - - - - 6-33 /S-RDY -------6-12 CLR (Position Deviation Clear) signal ------6-33 /S-RDY (Servo Ready) signal - - - - - - - - - - - - 6-12 CN1 - - - - - - 4-35 /TGON------6-11 CN2 - - - - - - 4-25 CN3 - - - - - - - - 4-52 CN5 - - - - - - 4-52 /V-CMP (Speed Coincidence Detection) signal - - - - - -6-27 CN7 - - - - - - - - 4-52 NLT ------6-46 CN8 - - - - - - - - 4-50 /VLT (Speed Limit Detection) signal -----6-46 coasting-----5-41 /WARN ------6-10 coasting to a stop - - - - - - - - - - - - 5-41 /WARN (Warning) signal - - - - - - - - - - - - - - - - - - 6-10 coefficient of speed fluctuation - - - - - - - - 2-11 compatible adjustment functions- - - - - - - - - 8-87 Computer Connector - - - - - - - - - - 4-52 Α connecting a safety function device - - - - - - - 11-13 A.CC0 - - - - - - - - - -- - - - - - - - - - - - - 6-85 control method selection - - - - - - - - - 5-13 absolute encoder - - - - - - - - - - - - - - - - - - 6-74 resetting-----5-52 countermeasures against noise ------4-5 current control mode selection - - - - - - - - - 8-73 wiring -------4-26 AC power supply input current gain level setting ------8-73

- - - - - - - - - - - - - - - - - - 5-14

setting - - - -

AC Reactor

custom tuning ------8-42 CW -----5-18


| D | Н |
|---|---|
| DATA/SHIFT Key 13-3 | hard wire base block (HWBB) 11-4 |
| DC power supply input 4-12 | HWBB input signal specifications 11-6 |
| setting 5-14 | hard wire base block (HWBB) state11-5 |
| DC Reactor | detecting errors in HWBB signal 11-6 |
| terminals4-11 | resetting 11-5 |
| wiring 4-24 | holding brake 5-36 |
| decelerating to a stop 5-41 | HWBB 11-4, 11-5 |
| detection timing for Overload Alarms (A.720) 5-45 | detecting errors in HWBB signal 11-6 |
| detection timing for Overload Warnings (A.910) 5-44 | HWBB input signal specifications11-6 |
| deviation counter 6-33 | HWBB state |
| diagnostic output circuits 4-51 | resetting11-5 |
| diagnostic tools 8-93 | 1 |
| displaying alarm history12-42 | I/O signals |
| DOWN Key 13-3 | allocations6-5 |
| dynamic brake applied 5-41 | functions4-35 |
| dynamic brake stopping 5-41 | monitoring 9-4, 9-6 |
| F | names |
| E | wiring example 4-39 |
| EasyFFT 8-95 | initializing the vibration detection level 6-99 |
| EDM1 11-9 | input signals |
| EDM1 (External Device Monitor) signal 11-9 | allocations6-5 |
| electronic gear 5-46 | internal set speed6-57 |
| encoder divided pulse output 6-48, 10-7 | internal set speed control 6-55, 6-59 |
| setting 6-53 | internal torque limits 6-64 |
| signals 6-48 | I-P control 8-83 |
| encoder resolution 5-48, 6-53 | |
| estimating the moment of inertia 8-16 | J |
| examples of connections to host controllers 15-2 | jogging7-7 |
| External Regenerative Resistor 5-58 | 1 |
| external torque limits 6-65 | limiting torque6-64 |
| F | limiting torque with an analog reference 6-68 |
| feedforward 8-33, 8-87 | limiting torque with an external torque limit and an 6-70 |
| feedforward compensation 8-87 | Linear Encoder |
| FG 4-37 | wiring example 4-26 |
| forcing the motor to stop6-107 | linear encoder |
| forward direction 10-6 | feedback resolution 5-49 |
| forward rotation 5-18 | scale pitch setting 5-19 |
| friction compensation 8-33, 8-70 | Linear Servomotor x |
| fully-closed system 10-2 | line-driver output circuits4-49 |
| Tully-closed system 10-2 | list of alarms12-5 |
| G | list of parameters 14-2 |
| gain switching 8-66 | list of warnings 12-48 |
| gravity compensation 8-71 | |
| grounding 4-8 | M |
| group 1 alarms 5-42 | Main Circuit Cable x |
| group 2 alarms 5-42 | manual gain switching 8-67 |
| 0.12 | mechanical analysis8-93 |
| | mode switching |
| | (changing between proportional and PI control) 8-89 |
| | MODE/SET Key13-3 |
| | Mamantary Power Interruption Hold Time 6-19 |

| monitor display (UnDDD) operations 13-8 | position integral | 8-92 |
|---|--|------------|
| monitor factors 9-12 | position loop gain | 8-77 |
| motor current detection signal | position reference input circuits | 4-45 |
| automatic adjustment 6-103 | positioning completed width | |
| manual adjustment 6-105 | P-OT | 5-31, 5-32 |
| offset6-103 | P-OT (Forward Drive Prohibit) signal | 5-32 |
| motor direction setting 5-18 | program jogging | |
| motor maximum speed | operation pattern | |
| motor overload detection level 5-44 | PULS | |
| multiturn limit | Pulse Reference Input | 4-36 |
| Multiturn Limit Disagreement 6-85 | | |
| N. | R | |
| N Noise Filter 4-6 | reactors | 4.04 |
| | AC reactor wiring DC reactor connection terminal | |
| Noise Filter connection precautions 4-7 N-OT5-31, 5-32 | DC reactor connection terminal | |
| • | reference pulse form | |
| N-OT (Reverse Drive Prohibit) signal 5-32 | | |
| notch filters 8-79, 8-81 | reference pulse inhibition function | |
| 0 | reference pulse input multiplication switching | |
| offset6-19 | reference pulse input multiplier | |
| open-collector output circuits 4-48 | reference unit | 5-40 |
| operation for momentary power interruptions 6-13 | connection | 1-22 |
| origin search7-25 | regenerative resistor | |
| output phase form 6-49 | regenerative resistor capacity | |
| overheat protection6-110 | resetting alarms | |
| Overheat Protection Input | resetting alarms detected in Option Modules | |
| overload warnings 5-44 | reverse direction | |
| overtravel 5-31 | risk assessment | |
| warnings 5-34 | Rotary Servomotor | |
| · · | Hotaly Golvomotol | ^ |
| Р | S | |
| Panel Operator | Safety Function Signals | |
| key names and functions 13-3 | safety functions | |
| status display | application examples | |
| PAO6-48, 10-7 | monitoring | |
| parameter settings recording table 14-34 | precautions | |
| parameters | verification test | |
| classification 5-4 initializing parameter settings 5-11 | safety input circuits | |
| notation (numeric settings) Xii, 5-5 | scale pitch | |
| notation (selecting functions) Xii, 5-5 | selecting combined control methods | 6-59 |
| setting methods 5-6 | selecting the phase sequence for a Linear Servomotor | 5.2/ |
| write prohibition setting 5-8 | selecting torque limits | |
| PBO6-48, 10-7 | SEMI F47 function | |
| PCO | | |
| photocoupler input circuits 4-47 | Serial Communications Connector | |
| photocoupler output circuits | Servo Drive | |
| Pl control 8-83 | servo gains | |
| PLUS6-31 | | |
| polarity detection 5-27 | servo lock | |
| polarity sensor 5-26 | servo ON | |
| position control | | |
| , | Servo System | X |

| Servomotor | Xi | T | |
|---|----------|--|----------|
| Servomotor stopping method for alarms | 5-42 | test without a motor | |
| SERVOPACK | xi | TH | 4-35 |
| inspections and part replacement | 12-2 | three-phase AC power supply input | |
| part names | | setting | 5-15 |
| ratings | 2-2 | three-phase, 200-VAC power supply input | 4-11 |
| specifications | 2-7 | torque control | 6-40 |
| status display | | automatic offset adjustment | 6-41 |
| status displays | 13-4 | manual offset adjustment | 6-43 |
| setting the origin | 5-55 | torque feedforward | 8-87 |
| setting the position deviation overflow alarm level - | 8-8 | torque reference | |
| setting the position deviation overflow alarm level | | input filter | |
| at servo ON | | torque reference filter | 8-79 |
| setting the vibration detection level | 8-10 | Torque Reference Input | 4-36 |
| setting the warning code output | | Torque Reference Input Gain | 6-41 |
| setup parameters | 5-4 | T-REF4-36, 6-4 | 40, 6-68 |
| SG | 6-10 | T-REF (Torque Reference Input) signal | 6-40 |
| SigmaWin+ | xi | trial operation | |
| SIGN 4- | 36, 6-31 | position control | 7-15 |
| Sign of Reference Input | 4-36 | position control from the host controller with the | |
| signal allocations | | SERVOPACK used for speed control | |
| single-phase AC power supply input | | speed control | |
| setting | 5-15 | troubleshooting alarms | |
| single-phase, 200-VAC power supply input | | troubleshooting warnings | |
| wiring example | | tuning parameters | 5-5 |
| sink circuits | 4-47 | tuning-less | |
| smoothing | 6-35 | load level | |
| soft start | 6-24 | rigidity level | |
| software reset | 6-97 | tuning-less function | 8-12 |
| source circuits | 4-47 | 11 | |
| speed control | 6-17 | U UP Key | 12.5 |
| speed detection method selection | 8-74 | utility function (FnDDD) operations | |
| speed feedforward | | utility function (FNDDD) operations | 13-0 |
| speed limit during torque control | | V | |
| speed loop gain | | vibration suppression | 8-56 |
| speed loop integral time constant | | V-REF | |
| speed reference | | V-REF (Speed Reference Input) signal | |
| automatic offset adjustment | 6-20 | VIII. (Operative input) eights. | 0 |
| filter | | W | |
| manual offset adjustment | 6-22 | warning code output | - 12-48 |
| Speed Reference Input Gain | 6-19 | writing parameters | 5-20 |
| Spring Opener | 4-14 | | |
| stopping by applying the dynamic brake | 5-41 | Z | |
| stopping method for servo OFF | | zero clamping 5-4 | |
| storage humidity | | zero clamping level | 6-26 |
| storage temperature | | zero-speed stopping | 5-41 |
| surrounding air humidity | | | |
| surrounding air temperature | | | |
| switching condition A | | | |
| oo.mig ooriginori7. | 0 01 | | |

Revision History

The date of publication, revision number, and web revision number are given at the bottom right of the back cover. Refer to the following example.

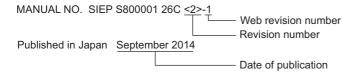

| Date of
Publication | Rev.
No. | Web
Rev.
No. | Section | Revised Contents |
|------------------------|-------------|--------------------|---|--|
| September 2023 | <22> | 0 | 2.1.1, 4.2, 4.4.3,
4.5.4, 6.12.1,
6.12.4, 6.13.4,
12.2.2 | Partly revised. |
| | | | Back cover | Revision: Address |
| February 2023 | <21> | 0 | Preface, 1.2, 3.7, 6.18.1, 12.2.2 | Partly revised. |
| September 2022 | <20> | 0 | 6.1.7, 6.12.6,
8.12.1, 10.3.2,
12.2.1, 12.2.2,
14.1.2 | Partly revised. |
| | | | Back cover | Revision: Address |
| February 2022 | <19> | 0 | Preface,5.16.1,
5.18.1, 6.12.9,
7.4.4, 12.2.2 | Partly revised. |
| | | | Back cover | Revision: Address |
| July 2021 | <18> | 0 | All chapters | Partly revised. |
| August 2020 | <17> | 2 | 5.16.1, 6.8.2,
10.3.4 | Partly revised. |
| February 2020 | | 1 | 4.4.3, 5.16.1,
5.18.1 | Addition: Information on Linear Encoder from Canon Precision Inc. |
| | | | Back cover | Revision: Address |
| October 2019 | | 0 | All chapters | Partly revised. |
| January 2019 | <16> | 0 | 5.1.4, 7.6.3 | Revision: Information in table of restrictions |
| | | | 9.2.2, 9.2.3,
12.2.6, 12.2.7,
15.1.4, 15.2.1 | Partly revised. |
| | | | 12.2.3 | Addition: Reset procedure with the SigmaWin+ |
| December 2018 | <15> | 0 | Back cover | Revision: Address |
| September 2018 | <14> | 0 | Preface | Partly revised. |
| | | | 2.1.1 | Revision: Information on built-in regenerative resistor power loss [W] for SGD7S-120A, -180A, -200A of three-phase, 200 VAC input Revision: Information on built-in regenerative resistor power loss [W] for SGD7S-120A of single-phase, 200 VAC input |
| | | | 4.4.3, 5.16.1 | Addition: Absolute linear encoder from Fagor Automation S. Coop. |
| | | | 12.2.1, 12.2.2 | Deletion: A.F50 |
| | | | Back cover | Revision: Address |
| December 2017 | <13> | 0 | Preface | Partly revised. |
| | | | Preface, 1.4.2,
1.5.1, 5.13.1,
5.16.1, 13.4.16 | Addition: Information on Rotary Servomotors (SGM7M) |
| | | | 1.2 | Revision: Information on nameplate |
| | | | 1.5.3 | Addition: Information on SGLFW2-90A200A□L, SGLFW2-90A560A, and SGLFW2-1DA560A |
| July 2017 | <12> | 0 | Back cover | Revision: Address |

| Date of
Publication | Rev.
No. | Web
Rev.
No. | Section | Revised Contents |
|------------------------|-------------|--------------------|---|--|
| March 2017 | <11> | 0 | Preface, 6.1.2, 12.4 | Partly revised. |
| | | | 4.4.3, 5.16.1 | Addition: Information on SQ47 and SQ57 Linear Encoders from Magnescale Co., Ltd. |
| | | | 5.16.1 | Addition: Information on LIC2100-Series and LC415 Linear Encoders from Heidenhain Corporation. |
| | | | 5.16.1, 5.18.1 | Addition: Information on RESOLUTE Linear Encoders from Renishaw PLC. |
| | | | 12.2.2, 14.1.2 | Revisions: Reference information |
| December 2016 | <10> | 0 | Preface | Partly revised. |
| | | | 1.4.2, 4.4.2,
4.4.3, 5.16.1,
5.17, 6.12 | Addition: Information on Rotary Servomotors with 24-bit batteryless absolute encoders. |
| | | | Back cover | Revision: Address |
| November 2016 | <9> | 0 | Preface | Partly revised. |
| | | | 1.5.2 | Addition: Information on Direct Drive Servomotors (SGM7F-DDA, -DDM, -DDN) |
| | | | 4.4.3, 5.16.1,
5.18.1 | Addition: Information on Renishaw PLC EVOLUTE linear scales |
| September 2016 | <8> | 0 | All chapters | Addition: Information on Direct Drive Servomotors (SGM7E) |
| | | | Preface | Partly revised. |
| | | | 2.1.3, 4.2, 4.5 | Revision: "Linear Servomotor overheat protection signal input" changed to "overheat protection input." |
| | | | 3.7 | Addition: EMC installations for single-phase 200-VAC and single-phase 100-VAC models |
| | | | 6.18, 8.12.3 | Newly added. |
| | | | Chapter 12 | Addition: A.862 and A.93B |
| | | | Chapter 14 | Addition: Pn022, Pn475, Pn476, Pn61A, Pn61B, Pn61C, and Pn61D |
| | | | 15.2.2 | Addition: Un02F |
| April 2016 | <7> | 0 | All chapters | Addition: Information on SGM7F Direct Drive Servomotors Deletion: Information on SGLC Linear Servomotors |
| | | | Preface, 9.1, 9.2 | Partly revised. |
| | | | 2.1.1. | Addition: Information on input current of control power supply |
| | | | Chapter 14 | Deletion: Pn52D |
| November 2015 | <6> | 0 | All chapters | Addition: Information on SERVOPACKs with single-phase, 100-VAC power supply inputs |
| | | | Preface | Revision: Information on certification for standards |
| | | | 4.4.3, 5.16.1,
6.8.1 | Addition: Information on SQ10 Linear Encoder from Magnescale Co., Ltd. |
| October 2015 | <5> | 0 | All chapters | Revision: Information on SigmaWin+ procedures |
| | | | Preface,
Chapter 1 | Addition: Information on SGMMV Rotary Servomotors |
| | | | Preface, 9.4.1 | Partly revised. |
| | | | 1.5.2 | Addition: Information on Direct Drive Servomotors (SGMCV-16D and -35D) |
| | | | 9.5 | Newly added. |
| | | | Chapter 12 | Addition: A.bF5, A.bF6, A.bF7, A.bF8, and FL-6 |
| | | | Back cover | Revision: Address |
| April 2015 | <4> | 0 | All chapters | Addition: Information on dynamic brake option |
| | | | Preface, 7.6.3,
8.3.3, 8.3.5,
12.3.2 | Partly revised. |
| | | | 12.2.2, 12.4,
14.1.2 | Revision: Reference information |
| | | | 14.1.2 | Revision: Information on Pn601 and Pn604 |
| | | | Front cover, back cover, spine | Revision: Format |

| Date of
Publication | Rev.
No. | Web
Rev.
No. | Section | Revised Contents |
|------------------------|-------------|--------------------|--|--|
| March 2015 <3> | <3> | 0 | All chapters | Addition: Information on SERVOPACKs with single-phase, 200-VAC power supply input Addition: Information on BTO specification Addition: Information on Safety Modules Partly revised. |
| | | | Preface | Addition: Information on dynamic brake
Revision: Information on certification for standards |
| | | | 2.1.1 | Revision: Power loss |
| | | | 2.3.2 | Addition: Information on duct-ventilated SERVOPACKs Revision: External dimensions of the following three-phase, 200-VAC SERVO-PACKs: SGD7S-470A, -550A, -590A, and -780A |
| | | 4.3.5 | Revision: Illustration of SGD7S-470A, -550A, -590A, and -780A SERVOPACKs | |
| | | | 4.2, 4.4.3, 4.5.3,
6.12.1 | Addition: Information on Battery for absolute encoder |
| | | | 5.16.1, 5.18.1 | Addition: Information on Linear Encoders (ST1381 and ST1382) from Mitutoyo Corporation |
| | | | 8.12.3, 14.1.2 | Revision: Information on Current Control Mode Selection |
| | | | Back cover | Revision: Address |
| September 2014 | <2> | 1 | 12.4 | Partly revised. |
| July 2014 | | 0 | _ | Based on Japanese user's manual, SIJP S800001 26C<2> printed in July 2014. |
| | | | All chapters | Addition: Information on SGD7S-330A, -470A, -550A, -590A, and -780A |
| | | | | Addition: Information on supplementary document (Manual No.: SIEP S800001 50) |
| May 2014 <1 | <1> | 0 | Preface | Revision: Safety Parameters |
| | | | 3.7 | Newly added. |
| | | | Chapter 12 | Addition: A.EC8 and A.EC9 |
| April 2014 | _ | _ | _ | First edition |

Σ-7-Series AC Servo Drive Σ -7S SERVOPACK with Analog Voltage/Pulse Train References **Product Manual**

IRUMA BUSINESS CENTER (SOLUTION CENTER) 480, Kamifujisawa, Iruma, Saitama, 358-8555, Japan Phone: +81-4-2962-5151 Fax: +81-4-2962-6138 www.vaskawa.co.ip

YASKAWA AMERICA, INC.

2121, Norman Drive South, Waukegan, IL 60085, U.S.A. Phone: +1-800-YASKAWA (927-5292) or +1-847-887-7000 Fax: +1-847-887-7310 www.yaskawa.com

YASKAWA ELÉTRICO DO BRASIL LTDA.
777, Avenida Piraporinha, Diadema, São Paulo, 09950-000, Brasil Phone: +55-11-3585-1100 Fax: +55-11-3585-1187 www.yaskawa.com.br

YASKAWA EUROPE GmbH

Philipp-Reis-Str. 6, 65795 Hattersheim am Main, Germany Phone: +49-6196-569-300 Fax: +49-6196-569-398 www.yaskawa.eu.com E-mail: info@yaskawa.eu.com

YASKAWA ELECTRIC KOREA CORPORATION

6F, 112, LS-ro, Dongan-gu, Anyang-si, Gyeonggi-do, Korea Phone: +82-31-8015-4224 Fax: +82-31-8015-5034 www.yaskawa.co.kr

YASKAWA ASIA PACIFIC PTE, LTD.

30A, Kallang Place, #06-01, 339213, Singapore Phone: +65-6282-3003 Fax: +65-6289-3003 www.yaskawa.com.sg

YASKAWA ELECTRIC (THAILAND) CO., LTD.
59, 1F-5F, Flourish Building, Soi Ratchadapisek 18, Ratchadapisek Road, Huaykwang, Bangkok, 10310, Thailand Phone: +66-2-017-0099 Fax: +66-2-017-0799 www.yaskawa.co.th

YASKAWA ELECTRIC (CHINA) CO., LTD.

22F, Link Square 1, No.222, Hubin Road, Shanghai, 200021, China Phone: +86-21-5385-2200 Fax: +86-21-5385-3299 www.vaskawa.com.cn

YASKAWA ELECTRIC (CHINA) CO., LTD. BEIJING OFFICE

Room 1011, Tower W3 Oriental Plaza, No.1, East Chang An Avenue, Dong Cheng District, Beijing, 100738, China Phone: +86-10-8518-4086 Fax: +86-10-8518-4082

YASKAWA ELECTRIC TAIWAN CORPORATION
12F, No. 207, Section 3, Beishin Road, Shindian District, New Taipei City 23143, Taiwan Phone: +886-2-8913-1333 Fax: +886-2-8913-1513 or +886-2-8913-1519 www.yaskawa.com.tw

YASKAWA

YASKAWA ELECTRIC CORPORATION

In the event that the end user of this product is to be the military and said product is to be employed in any weapons systems or the manufacture thereof, the export will fall under the relevant regulations as stipulated in the Foreign Exchange and Foreign Trade Regulations. Therefore, be sure to follow all procedures and submit all relevant documentation according to any and all rules, regulations and laws that may apply. Specifications are subject to change without notice for ongoing product modifications and improvements.

© 2014 YASKAWA ELECTRIC CORPORATION